


Attachment C

**Pit Worx, Inc.
Pearson Pit
Site Inspection Photographic Log**

Autaugaville, Autauga County, Alabama

April 17, 2024

Overview Map

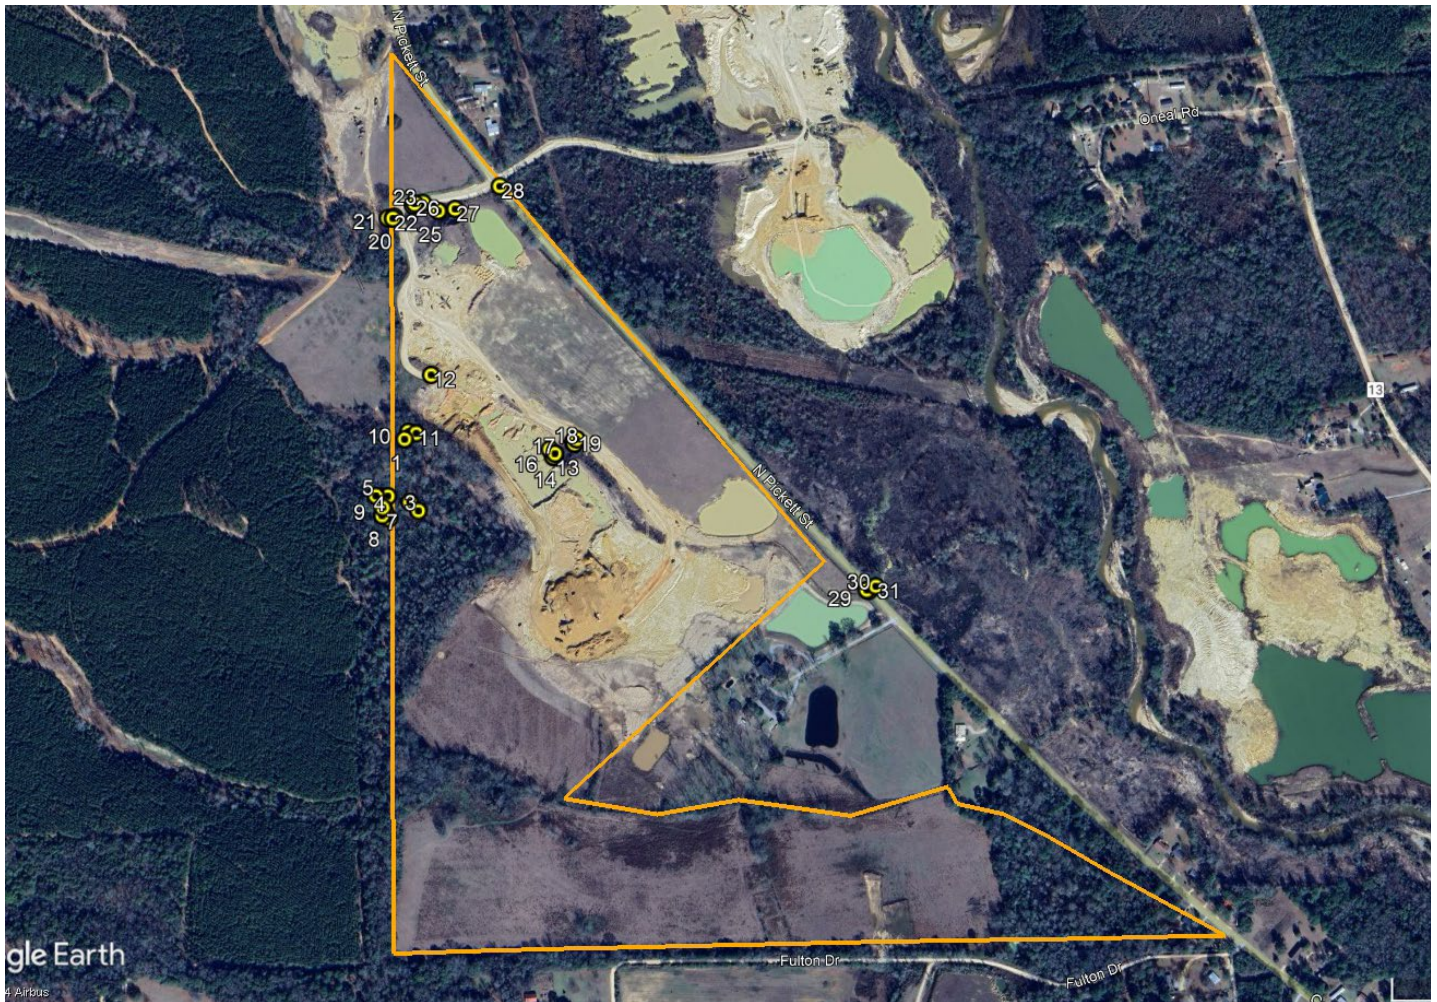


**Satellite imagery sourced from Google Earth, dated 1/30/2024
Topographic map layer sourced from Earth Point**



**Photos 32 and 33 are not displayed in Overview Map*




Title	Photo 1
Comment	Taken by Rachel Earwood
Description	Striking toward remaining trees where potentially jurisdictional wetlands are located. Additional clearing has potentially occurred since the aerial imagery was taken. *Camera clock was set to Eastern Standard Time.

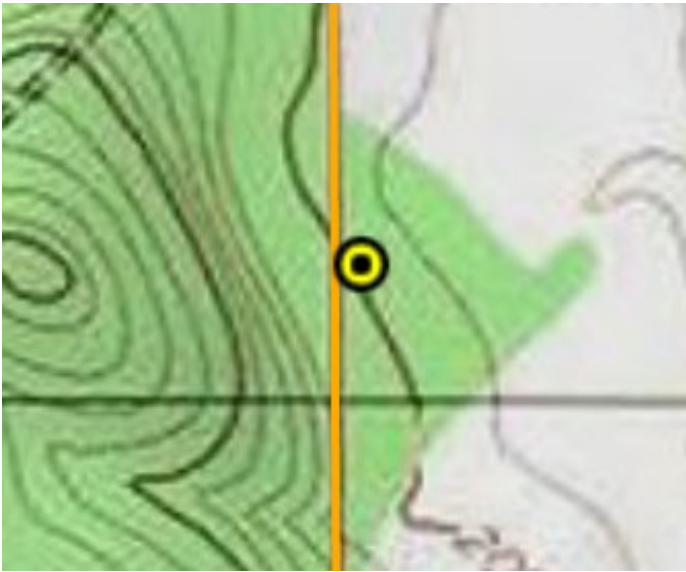

Title	Photo 2
Comment	Taken by Rachel Earwood
Description	Soil profile, S1. Location where BioResources documented wetland conditions (November 2023 WOTUS report).

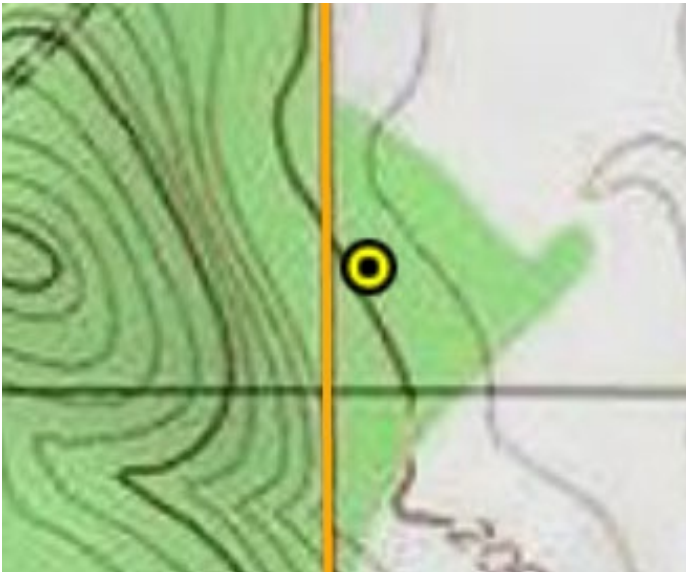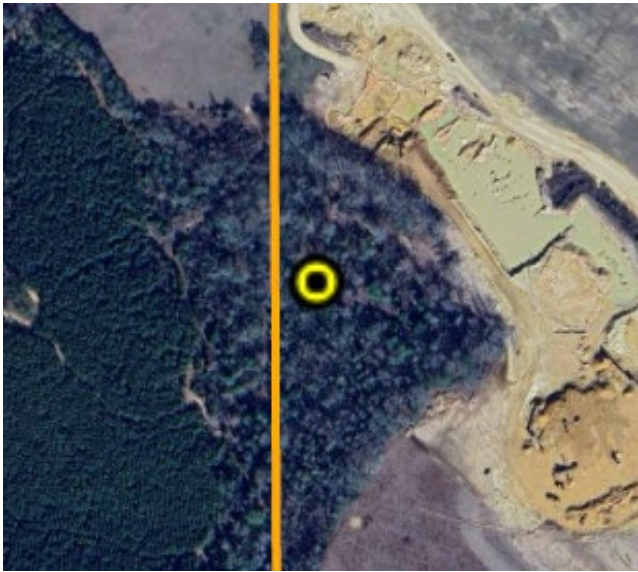


Title	Photo 3
Comment	Taken by Rachel Earwood
Description	Location of soil profile, S1. Notice water within 12 inches from the soil surface.

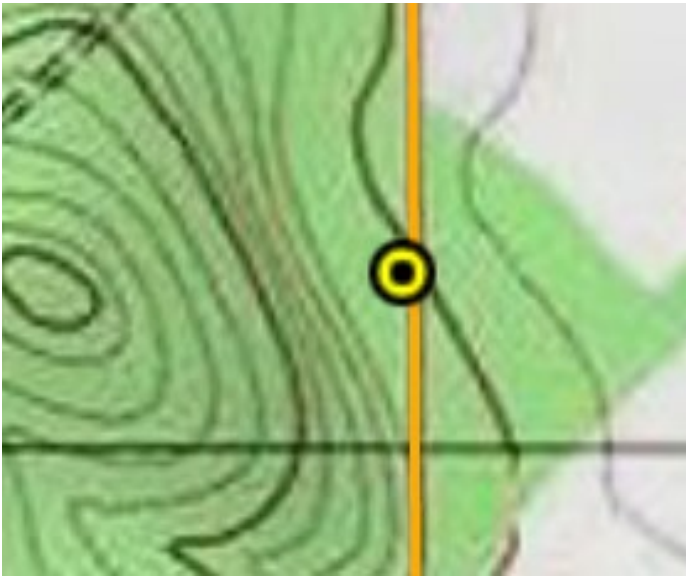


Title	Photo 4
Comment	Taken by Rachel Earwood
Description	Soil profile, S2.



Title	Photo 5
Comment	Taken by Rachel Earwood
Description	Additional angle of S2.

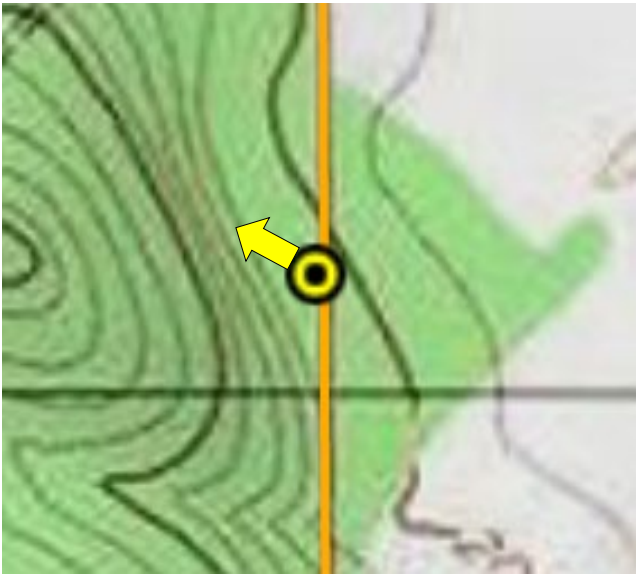


Title	Photo 6
Comment	Taken by Rachel Earwood
Description	Landscape, taken approximately 10 feet from S2.

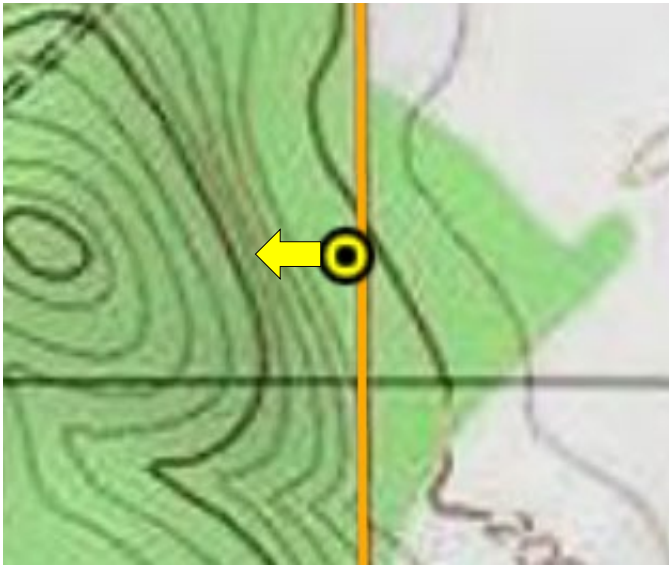

Title	Photo 7
Comment	Taken by Rachel Earwood
Description	Landscape, taken approximately 3 feet from S2.



Title	Photo 8
Comment	Taken by Rachel Earwood
Description	Location of soil profile S3. Notice water within 12 inches from the soil surface.

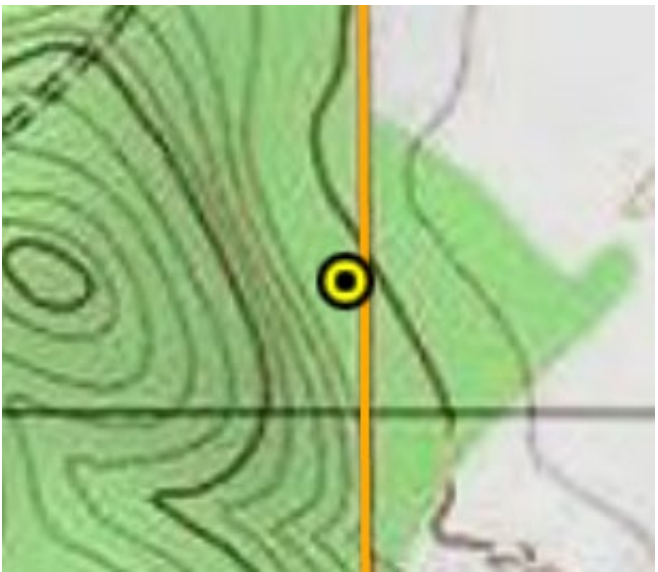

Title	Photo 9
Comment	Taken by Rachel Earwood
Description	Soil profile, S4.




Title	Photo 10
Comment	Taken by Rachel Earwood
Description	Coming out of the forested area, notice evidence of mechanized earth-moving equipment.



Title	Photo 11
Comment	Taken by Rachel Earwood
Description	Striking toward sand/gravel dredging and sorting operations.



Title	Photo 12
Comment	Taken by Rachel Earwood
Description	Same description as Photo 11, different view.

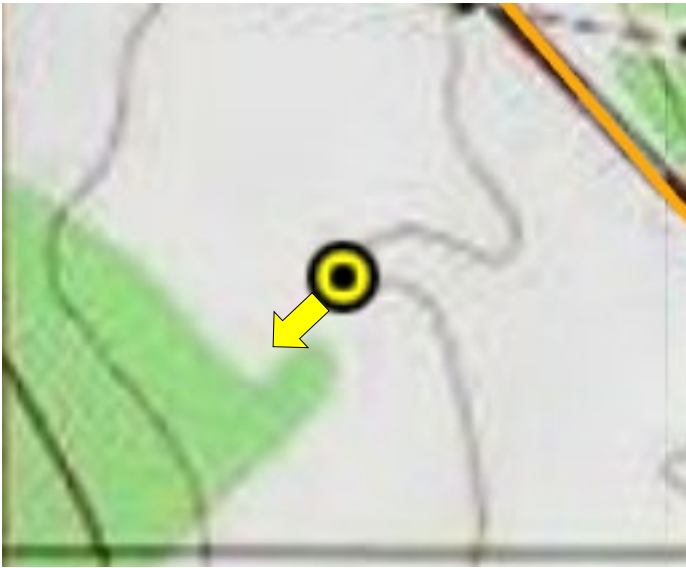

Title	Photo 13
Comment	Taken by Rachel Earwood
Description	Overlooking a past vegetated oxbow feature that has since been excavated circa late 2023/early 2024, per operator. Approximately 600 feet northwest from Stream 1, delineated by BioResources in their 2023 WOTUS report.



Title	Photo 14
Comment	Taken by Rachel Earwood
Description	Standing in the vegetated channel, striking in the opposite direction in relation to Photo 13. Observed <i>Juncus effusus</i> , <i>Panicum hemitomon</i> , <i>Salix caroliniana</i> .



Title	Photo 15
Comment	Taken by Rachel Earwood
Description	Soil profile, S5; where Photos 13/14 were taken.



Title	Photo 16
Comment	Taken by Rachel Earwood
Description	Surface of S5.



Title	Photo 17
Comment	Taken by Rachel Earwood
Description	Soil profile, S6.



Title	Photo 18
Comment	Taken by Rachel Earwood
Description	Standing over location of S6.



Title	Photo 19
Comment	Taken by Rachel Earwood
Description	Opposite direction in relation to Photo 18.



Title	Photo 20
Comment	Taken by Rachel Earwood
Description	Striking upstream of flow coming from adjacent property to the west of the orange Pit Worx property lines. Red arrow in top photo indicates the direction of flow.



Title	Photo 21
Comment	Taken by Rachel Earwood
Description	Striking from the opposite side of the road, following the flow downstream. Red arrow in top photo indicates the direction of flow.



Title	Photo 22
Comment	Taken by Rachel Earwood
Description	More direct shot of the culvert that can be partially seen in Photo 21. Notice excessive sediment load inhibiting flow. Red arrow in top photo indicates the direction of flow.



Title	Photo 23
Comment	Taken by Rachel Earwood
Description	Continuing to follow the flow/ponding created by the blocked culvert to the west. Notice iron flocculation in water. Red arrow in top photo indicates the direction of flow.



Title	Photo 24
Comment	Taken by Rachel Earwood
Description	Continuing to follow the flow/ponding created by the blocked culvert to the west.



Title	Photo 25
Comment	Taken by Rachel Earwood
Description	Continuing to follow the flow/ponding created by the blocked culvert to the west. Notice the formation of seeps in the foreground and midground.



Title	Photo 26
Comment	Taken by Rachel Earwood
Description	Continuing to follow the flow/ponding created by the blocked culvert to the west. Red arrow in top photo points out new high water marks on trees in the vicinity.



Title	Photo 27
Comment	Taken by Rachel Earwood
Description	Continuing to follow the flow/ponding created by the blocked culvert to the west.



Title	Photo 28
Comment	Taken by Rachel Earwood
Description	Flow after it has traveled under County Road 19 North, toward Pit Worx property to the east.




Title	Photo 29
Comment	Taken by Rachel Earwood
Description	Striking toward Pickett Pond, with flow from the vegetated channel meeting a culvert that conveys it across County Road 19 North. Red arrow in top photo indicates the direction of flow.



Title	Photo 30
Comment	Taken by Rachel Earwood
Description	The landscape/channel northwest of Pickett Pond. Red arrow in top photo indicates the direction of flow.



Title	Photo 31
Comment	Taken by Rachel Earwood
Description	Flow from vegetated channel across the road from the Site; Swift Creek lies to the east. Red arrow in top photo indicates the direction of flow.

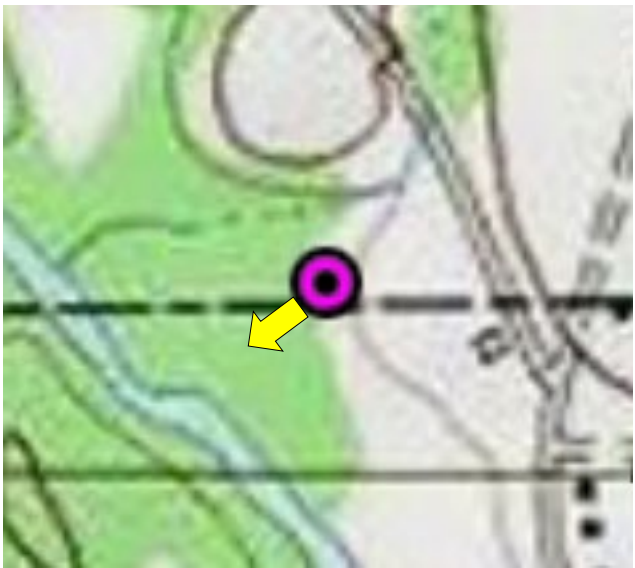

Title	Photo 32
Comment	Taken by Rachel Earwood
Description	Unnamed tributary at the Meeks' property and its new flowpath post-impact. *EPA inspection team visited this current enforcement action due to its proximity to the Site (i.e., east of County Road 19 North).



Title	Photo 33
Comment	Taken by Rachel Earwood
Description	The unnamed tributary as it pools as part of its new flowpath, looking toward its confluence with Swift Creek. *EPA inspection team visited this current enforcement action due to its proximity to the Site.

PAGE INTENTIONALLY LEFT BLANK