

A NATIONAL SAFETY COUNCIL
TECHNICAL SERVICE

June 1963
6/10/63

DUSTS, FUMES, AND MISTS IN INDUSTRY

LESC
RE
1-10-1
C-1

Copies of this data sheet will be available for purchase within 30 days. Subscribers to the Council's data sheet maintenance service will receive a copy in the next quarterly mailing.

MICH01143

Introduction

1. Industrial dusts, mists, and fumes, their hazards and their control, are discussed in this data sheet.* The general principles presented can be applied to evaluate most industrial situations involving these air contaminants and to determine the need for controls. This data sheet is intended to guide employers, plant safety engineers, personnel managers, and supervisors.

2. A plant manager who believes that he has a toxic or irritating dust problem should consult a competent industrial hygienist. Such help may be obtained from his own company, insurance carrier, private consultants, or state health or labor agency.

3. To protect the health of employees who work where a dust, fume, or mist created by a manufacturing process is released into the atmosphere, a control program may be required. In such a case, three steps must be taken:

a. The properties of the specific dust, fume, or mist and its possible physiological effects on employees must be ascertained.

*This data sheet covers toxic and irritating air contaminants encountered in industry. It does not include a discussion of the explosive properties of such airborne particulate matter.

This data sheet is one of a series published by the National Safety Council, reflecting experience from many sources. Not every acceptable safety procedure in this field is necessarily included. This data sheet should not be confused with American Safety Standards, federal laws, insurance requirements, state laws, rules, regulations or municipal ordinances.

- b. The particular exposure must be evaluated by dust counts or by chemical analyses of air samples, and a step-by-step analysis of the operations must be made to find the areas where employees are exposed to hazardous amounts of the material. The operational analysis also should determine how the dust, fume, or mist is dispersed.
- c. Appropriate methods of control must be provided where indicated. The type and extent of controls will depend upon the physical, chemical, and toxic properties of the dust, fume, or mist, the evaluation made of the exposure, and the operation that disperses the contaminant. The extensive controls needed for lead oxide dust, for example, would not be needed for limestone dust, since much greater quantities of limestone dust can be tolerated.

4. Except for the skin diseases, most occupational diseases are acquired by inhalation of material. Lung tissue is by far the most efficient medium the body possesses for absorbing materials. In addition, the surface area of this lung tissue averages 55 square meters or about 590 square feet.

5. Certain dusts that reach the lungs can pass directly into the blood stream and be absorbed over a long period of time. Others may stay in the lungs and set up local irritant or damaging action.

6. Toxic and irritant dusts can also be ingested in amounts that may cause trouble. If toxic dust swallowed with food or saliva is not soluble in body fluids, it is eliminated directly through the intestinal tract. Toxic materials that are readily soluble in body fluids can be absorbed in the digestive system and picked up by the blood.

7. A third way in which toxic and irritant substances may enter the system is skin absorption. Many organic compounds, such as TNT, cyanides, and most aromatic amines, amides, and phenols, can produce systemic poisoning by direct contact with the skin. Contact of toxic and irritant dusts with the skin also may result in skin irritation.

8. As compared to inhalation,

however, both ingestion and skin contact are of relatively minor importance in industrial poisoning insofar as dusts, fumes, and mists are concerned.

Origin and Properties of Particulate Matter

9. The dust normally present in the atmosphere has a beneficial effect in screening out some of the harmful rays of the sun. Inhalation of this dust may not be harmful because either the dust may be nontoxic or body mechanisms capture, remove and eliminate or isolate the small amounts of dust trapped in the lungs. Air pollution, radioactive fallout, pollens, and similar conditions may have an adverse effect on some individuals. Also, when the air breathed contains excessive amounts of dust, the body has difficulty in handling the load and dust may remain in the lungs.

Sources

10. The term *dust* as used in industry is generally applied to air-borne solid particles that range in size from 0.1 micron to 25 microns (one micron = $1/10,000$ centimeter = $1/25,000$ inch). Process dusts below 0.5 micron in size are rare. Dusts above 5 microns in size usually will not stay air-borne long enough to present an inhalation problem.

11. Dust may enter the air from various sources. It may be dispersed when a dusty material is handled, such as when lead oxide is dumped into a mixer or a product is dusted

with talc. Dust may be formed and dispersed when solid materials are reduced to small sizes in processes such as grinding, crushing, blasting, shaking, and drilling. In these processes, the mechanical action of the grinding or shaking device supplies a source of energy to disperse the dust formed (Figure 1).

12. When a solid such as a metal is heated to a temperature high enough to volatilize it, the volatilized matter later condenses in cooler air to form a *fume* (Figure 2). The solid particles that make up a fume are extremely fine, usually less than 0.5 micron in size. In some cases, the hot material reacts with the air to form an oxide. Examples are lead oxide fume from smelting and iron oxide fume from arc welding. Also, a fume can be formed when a material such as magnesium metal is burned or when welding or gas cutting is done on galvanized metal.

13. A *mist* is formed when a finely divided liquid is suspended in air. An example is the oil mist produced during cutting and grinding operations.

14. *Smoke* may be formed by the incomplete combustion of organic materials. Smoke generally contains droplets as well as dry particles. Tobacco, for instance, produces a wet smoke composed of minute tarry droplets. The size of the particles contained in tobacco smoke is about 0.25 micron.

15. Radioactive dust may be dispersed in the same ways as other industrial dusts. Radium, thorium, and other radioactive elements are present in extremely minute amounts in the atmosphere.

Magnitude of particles

16. When a solid is broken into finely divided particles, its surface area is increased many times. For example, 1 cubic centimeter (0.061 cubic inch) of quartz in the form of a cube when crushed into 1-micron cubes will give 10^{12} (1,000,000,000,000 or one trillion) particles with a total surface area of 6 square meters (9,300 square inches), as compared with 6 square centimeters (0.930 square inch) for the original cube.

17. When a solid is broken into finely divided particles, the volume occupied by the mass is also increased because of the voids between the particles. A dust concentration of

50 million particles per cubic foot of air (mppcf), resulting from 1 cubic centimeter of material reduced to particles 1 cubic micron in size, will occupy an air space of 20,000 cubic feet.

18. Even smaller amounts of toxic dusts, fumes, and mists, will make a workroom atmosphere hazardous. For example, the threshold limit value for lead, as adopted by the American Conference of Governmental Industrial Hygienists, is 0.2 milligram per cubic meter of air (mg/cu m), which is 0.0000002 ounce per cubic foot. Therefore, the dispersion of only 0.002 ounce of lead will be enough to give the threshold limit value of 0.2 mg/cu m of dust or fume in an air space of 10,000 cubic feet (280 cubic meters). The concentrations that may be present in the workroom without harm to health are different for different substances.

19. A person with normal eyesight can detect dust particles as small as 50 microns in diameter. Smaller air-borne particles can be detected individually by the naked eye only when strong light is reflected from them. Dust of respirable size (below 10 microns) cannot be seen without the aid of a microscope.

20. Most industrial dusts consist of particles that vary widely in size, with the small particles greatly outnumbering the large ones. Consequently, with few exceptions, when dust is noticeable in the air around an operation, probably more invisible dust particles than visible ones are present.

Separation in air-borne dust

21. Dust in the air may or may not have the same composition as its parent material. The determining factors are the particle size and density of each component in the original mixture, and the hardness of the materials (hard materials will resist the pulverizing action of a mechanical device.)

22. For example, foundry molding sand contains a large percentage of free silica (quartz) with a lower percentage of clays. Most of the clays consist of fine particles that can be air-borne, but most of the quartz particles are too large to be air-borne. The air-borne dust, therefore, as compared with the original mixture, may contain a much higher percentage of clays and a much

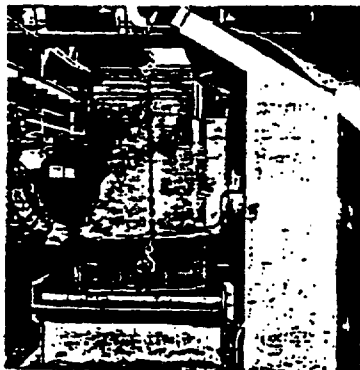


Figure 1. Dust from foundry sand is generated during the shake-out of castings. The mechanical action of the shake-out machine disperses the dust. Path taken by the dust particles as they are drawn into the hood shows the efficiency of the local exhaust system. (Courtesy American Foundrymen's Society)

lower percentage of free silica.

23. Dust particles are, of course, attracted by gravity. Their settling rate through still air will vary with their size, density, and shape. Microscopically small particles settle out more slowly than larger particles because of their relatively minor density and because of their being influenced by Brownian movement. Mineral particles larger than 10 microns will settle out relatively fast. The estimated settling rates for silica dusts in still air are given in Table I.

TABLE I. SETTLING RATES
FOR SILICA DUSTS

Size in Microns	Time to Fall 1 Foot (minutes)
0.25	590.0
0.50	187.0
1.00	54.0
2.00	14.5
5.00	2.5

24. Most of the particles in airborne industrial dusts are small. Because of air currents, the fine particles in dust clouds at an operation will remain suspended in the workroom air for relatively long periods of time. The smaller dust particles, moreover, will travel farther away from their point of origin than will the larger particles so that the farther dust is from its source, the greater the percentage of small particles it contains.

Inhalation of Dusts, Fumes, and Mists

25. With the exception of such fibrous materials as asbestos, dust particles must usually be smaller than 5 microns in order to enter the alveoli or inner recesses of the lungs. Although a few particles up to 10 microns in size may enter the lungs occasionally, nearly all the larger particles are trapped in the nasal passages, throat, larynx, trachea, and bronchi, from which they are expectorated or swallowed into the digestive tract.

26. When larger particles of certain toxic dusts are trapped in the upper respiratory passages, they can be absorbed by the body fluids in the nasal passages and in the

digestive tract before they are eliminated. Hence the final toxic effects of larger dust particles may be delayed. The larger particles of irritant dusts can cause immediate effects in the upper respiratory system.

27. Ragweed pollen, which varies from 18 to 25 microns in diameter can cause hay fever from its action in the upper respiratory system. This type of dust and other allergenic types, as well as bacterial and irritant dusts, can cause difficulty even in the larger air-borne sizes.

28. When dust-laden air is inhaled, some of the larger particles are trapped by the hairs in the nose. Other dust particles are removed from the air as it passes over the moist mucous membranes of the nose, throat, and other portions of the upper respiratory system.

29. The bronchi and other respiratory passages are covered with a large number of tiny, hairlike cilia or microscopic whiplashes, which aid in the removal of dust trapped on these moist surfaces. The cilia, all bending in one direction, make a fast stroke toward the mouth and a slower return stroke. This action tends to push mucous and deposited dust upward to the mouth so that the particles can be expectorated or swallowed.

Retention of dust

30. Many studies have been made in an effort to determine the amount of dust that is retained in the lungs, but there is no simple answer to this question. It has been shown that the size of the dust particles, the rate of respiration, the density of the dust in the air, the efficiency of the dust-catching mechanism, and probably many other factors are involved.

Sizes of particles inhaled

31. Although an occasional dust particle of larger size will enter the lungs, particles less than 3 microns in diameter are the most likely to do so and thus have the greatest opportunity to cause a physiological reaction. In silicotic lungs, for example, dust particles under 3 microns greatly outnumber larger ones, and many particles are less than 1 micron.

32. In the case of very fine fibrous asbestos dust, an exception occurs in the size of particles inhaled. Many fibers up to 100 microns long have been found in the lungs



Figure 2. Metal volatilized by the heat of welding later condenses to form a fume. On this bench-welding installation, fumes are removed at their point of origin by a properly located local exhaust installation. (Courtesy American Foundrymen's Society)

of asbestos workers at autopsy. A typical fibrosis caused by asbestos is produced by fibers ranging from 20 to 50 microns in length, but only a few microns wide.

Physiological effects

33. The physiological reactions caused by the inhalation of airborne particulate matter will vary with different types of dusts, fumes, and mists. The reactions include:

- a. The cardiopulmonary reaction which consists of the pneumoconioses, such as *silicosis* and *asbestosis*. In certain cases, specific types of lung pathology result, and the heart may be affected (cor pulmonale) when the fibrosis is advanced. In other cases, there is mainly just an accumulation of a relatively inert dust in the lungs.
- b. The systemic reactions which are caused by toxic dusts of such elements as lead, manganese, cadmium, and mercury, by their compounds, and by certain organic compounds.
- c. Metal fume fever which results from the inhalation of finely divided and freshly generated fume of zinc or possibly of magnesium or of their oxides. This is a transient condition.
- d. Allergic and sensitization reactions which may be caused by inhalation of, or skin contact with, such materials as organic dusts from flour, grains, and some woods and dusts of a few organic and inorganic chemicals.
- e. Bacterial and fungus infections which occur from inhalation of dusts containing active organisms, such as wool or fur dust contain-

TABLE II. SELECTED INDUSTRIAL MINERAL DUSTS

Substance	Description and Uses	Threshold Limit in Million Particles per Cubic Foot of Air*
CRYSTALLINE FREE SILICA (SiO ₂ , including microcrystalline forms)		
Chalcedony	A heat-resistant, chemically inert form of microcrystalline quartz. A decorative material. Rare in industry.	Calculate from formula:** $\frac{250}{\% \text{ SiO}_2 + 5}$
Chert	A microcrystalline form of silica. An impure form of flint used in abrasives.	
Cristobalite	A crystalline form of free silica, extremely hard and inert chemically; very resistant to heat. Quartz in refractory bricks and amorphous silica in diatomaceous earth are altered to cristobalite when exposed to high temperatures (calcined). Cristobalite is extensively used in precision casting by the hot wax process, dental laboratory work, and certain specialty ceramics.	
Flint	A microcrystalline form of native quartz, more opaque and granular than chalcedony. Used as an abrasive and in ceramics.	
Jasper	A microcrystalline impure form of silica similar to chert. Used for decorative purposes. Rare in industry.	
Quartz	Vitreous, hard chemically resistant free silica, the most common form in nature. The main constituent in sandstone, igneous rocks, and common sands.	
Tridymite	Vitreous, colorless form of free silica. Formed when quartz is heated to 870 C (1,598 F).	
Tripoli (Rottenstone)	A porous, siliceous rock, resulting from the decomposition of chert or siliceous limestone. Used as a base in soap and scouring powders, in metal polishing, as a filtering agent, and in wood and paint fillers. A cryptocrystalline form of free silica.	
AMORPHOUS FREE SILICA (Noncrystalline)		
Diatomaceous earth	A soft, gritty amorphous silica composed of minute siliceous skeletons of small aquatic plants. Used in filtration and decolorization of liquids, insulation, filler in dynamite, wax, textiles, plastics, paint, and rubber. Calcined and flux-calcined diatomaceous earth contains appreciable amounts of cristobalite, and dust levels should be the same as for cristobalite.	Amorphous = 20 mppcf Calcined = use formula: $\frac{250}{\% \text{ SiO}_2 + 5}$
Silica gel	A regenerative absorbent consisting of the amorphous silica manufactured by the action of HCl on sodium silicate. Hard, glassy, quartz-like in appearance. Used in dehydrating and in drying and as a catalyst carrier.	20 mppcf
SILICATES (Compounds made up of silicon, oxygen, and one or more metals with or without hydrogen. These dusts cause nonspecific dust reactions, but generally do not interfere with pulmonary function or result in disability.)		
Asbestos	A hydrated magnesium silicate in fibrous form. The fibers are believed to be the more hazardous component of asbestos dust.	5 mppcf†
Clays	A great variety of aluminum-silicate bearing rocks, plastic when wet, hard when dry. Used in pottery, stoneware, tile, bricks, cements, fillers, and abrasives. Kaolin is one type of clay. Some clay deposits may include appreciable quartz. Commercial grades of clays may contain up to 20 per cent quartz.	50 mppcf†
Feldspar	Most abundant group of materials, composed of silicates of aluminum with sodium, potassium, calcium, and rarely barium. Most economically important mineral. Used for ceramics, glass, abrasive wheels, cements, insulation, and fertilizer.	50 mppcf†

*These threshold limit values were adopted by the American Conference of Governmental Industrial Hygienists in 1962.

**Threshold limit values obtained from formula apply to all the substances in "Crystalline Free Silica" group.

†Threshold limits given for substances in "Silicates" group are for compounds containing less than 1 per cent crystalline silica. For compounds containing more than 1 per cent silica, calculate threshold limit from formula:

$$\frac{250}{\% \text{ SiO}_2 + 5}$$

TABLE II. SELECTED INDUSTRIAL MINERAL DUSTS (Continued)

SILICATES		
(Compounds made up of silicon, oxygen, and one or more metals with or without hydrogen. These dusts cause nonspecific dust reactions, but generally do not interfere with pulmonary function or result in disability.)		
Fuller's earth	A hydrated silica-alumina compound, associated with ferric oxide. Used as a filter medium and as a catalyst and catalyst carrier and in cosmetics and insecticides.	50 mppcft
Kaolin	A type of clay composed of mixed silicates and used for refractories, ceramics, tile, and stoneware.	50 mppcft
Mica	A large group of silicates of varying composition, but similar in physical properties. All have excellent cleavage and can be split into very thin sheets. Used in electrical insulation.	20 mppcft
Portland cement	Fine powder containing compounds of lime, alumina, silica, and iron oxide. Used as construction material.	50 mppcft
Silicon carbide (Carborundum)	Bluish-black, very hard crystals. Used as abrasive and refractory material.	50 mppcft
Talc	A hydrous magnesium silicate used in ceramics, cosmetics, paint, and pharmaceuticals, and as a filler in soap, putty, and plaster.	20 mppcft
Vermiculite	An expanded mica (hydrated magnesium-aluminum-iron silicate). Used in lightweight aggregates, insulation, fertilizer, and soil conditioners, as a filler in rubber and paints, and as a catalyst carrier.	50 mppcft

*Threshold limits given for substances in "Silicates" group are for compounds containing less than 1 per cent crystalline silica. For compounds containing more than 1 per cent silica, calculate threshold limit from formula:

$$\frac{250}{\% \text{ SiO}_2 + 5}$$

ing anthrax spores or wood bark or grain dust containing parasitic fungi.

- f. Irritation of the nose and throat, which is caused by acid, alkali, or other irritating dusts or mists. Some dusts such as soluble chromate dusts may cause ulceration of the nasal passages or even lung cancer.
- g. Damage to internal tissues, which may result from inhaled radioactive materials such as radium and its daughter products and from other radioisotopes that emit highly ionizing radiation.

Pneumoconioses

34. *Pneumoconiosis* comes from three Greek words that mean "lung," "dust," and "abnormal condition." The present generally accepted meaning of the word is merely "dusty lung." The kind of dust inhaled determines the type of condition or injury. A number of organic dusts are capable of producing lung diseases, but not all these diseases are classified as pneumoconioses because they are not all a "dusty condition" of the lung.

35. In very rare cases, enough dust had been inhaled to cause mechanical blockage of the air spaces. Flour dust has been known to cause this condition. Some dusts

may be essentially inert and remain in the lungs indefinitely with no recognizable irritation, and a few like limestone dust may be gradually dissolved and eliminated without harm.

Silicosis

36. The most important lung disease caused by the inhalation of mineral dust is *silicosis*—well-known in industries where crystalline free silica dust is present, such as foundries, glass manufacturing, granite cutting, mining, and tunneling in quartz rock. It is found throughout the world, and in the past it has had many names, such as miner's asthma, grinder's consumption, miner's phthisis, potter's rot, and stone-mason's disease. The same occupational disease, however, is meant by all these names, and it is caused by dust from crystalline free silica, usually quartz (see Table II).

37. Although considerable progress has been made in dust control in industry, men still develop silicosis in plants and on jobs where dust control is not adequate. Engineering control is still the basic means of preventing this disease, and dust control equipment and procedures must be carefully maintained.

38. *Definition.* Silicosis has been defined as "a disease due to breathing air containing silica (SiO_2) characterized *anatomically* by generalized fibrotic changes and the development of miliary nodulation in both lungs, and *clinically* by shortness of breath, decreased chest expansion, lessened capacity for work, absence of fever, increased susceptibility to tuberculosis (some or all of which symptoms may be present), and by characteristic X-ray findings."

39. *Factors of influence.* Silicosis has been known to manifest itself after widely differing periods of exposure to silica dust. Apparently, development of the disease depends upon:

- a. The amount and kind of dust inhaled.
- b. The percentage of free silica contained in the dust.
- c. The form of the silica.
- d. The size of the particles inhaled.
- e. The duration of the exposure.

—Continued on page 95

*Report (Joint) of the Committee on Pneumoconiosis and the Committee on Standard Practices in Compensation of Occupational Diseases. "Year Book, 1933, American Public Health Association, 1790 Broadway, New York 19, p 100.



How one of the world's most important insurance companies chose this symbol...and why

Sure, Wausau has landmarks more impressive than this depot. And as for trademarks, Employers Mutuals' handsome office in Wausau would be a far better reflection of our coast to coast operations and our \$325 million assets.

But there's another dimension to Employers Mutuals of Wausau. And when we set out to define it and describe it, we find the depot does it best.

Back in 1874, the first train puffed its way through the Wisconsin timberlands, summoned north to Wausau by the thriving lumber industry. From then on, the depot stood as proof that this community was no longer the "faraway place," as the early Chippewas had de-

scribed it in giving Wausau its name.

This Wisconsin community is an integral part of the operating philosophy of Employers Mutuals of Wausau, just as it has been throughout the 52 years since this mutual insurance company was founded. Call this neighborly concern or "Main Street" friendliness and co-operation. It's a way of doing business our policyholders seem to like and we don't want to lose.

Employers Mutuals of Wausau is a large company now, but the Wausau Way is evident in our relationship with policyholders everywhere. We do business in all the principal cities of the nation through 145 offices. We are one of the largest and most experienced underwriters

in the field of workmen's compensation. We write group health and accident, fidelity bonds, and all forms of fire and casualty insurance, including automobile. We write only nonassessable policies. We're proud of our unbroken record of dividend-savings. And, as a mutual company, we're dedicated to the prevention of loss.

"Good people to do business with"

**Employers
Mutuals
of Wausau**

CIRCLE 48 ON READER CARD

f. The powers of resistance of the individual concerned.

g. The presence or absence of a complicating process such as infection.

40. Many theories have been advanced over the years to explain why crystalline free silica acts as it does in the lungs. Theories have been based on the hardness of the material and the effect of sharp edges, solubility phenomena, electrochemical action of the crystals, and immunological reactions.

41. It is believed now that the fibrosis produced is caused not by the hardness or sharpness of the particles, but by a combination of slight solubility with a physiochemical effect and an immunological effect—but no one is certain of the exact mechanism of the disease. Experimental work on the reasons for the development of silicosis is still going on in various parts of the world. If the precise mechanism of silicosis could be determined, better medical preventive measures might be developed and possibly a cure could be found.

42. *Three stages.* Silicosis is generally classified in three separate stages by medical authorities. More sophisticated classifications are some times used for the various X-ray stages and complications of the disease, but for a basic understanding the three stages give a good breakdown.

43. The first stage of the disease produces no disability. The affected man can carry on his work as well as ever. Frequently, the individual is not aware that anything is wrong, and the disease is revealed only by opaque nodular shadows on a chest X-ray coupled with a known exposure to crystalline free silica.

44. In the second stage, respiration may be affected in some persons but not in all by any means. Labored breathing on heavy exertion usually is noted first, and a dry cough also may be present.

45. The third stage can develop after the second stage even though the individual has been removed from exposure to silica dust. However, the progress of the disease will be slower without continued dust exposure. Breathing may become severely labored. The worker is far below normal physically and is susceptible to

respiratory diseases. Chest X-rays may show an enlarged heart as a result of the body's attempts to overcome the resistance of restricted blood vessels in the lungs. Pulmonary tuberculosis is a frequent complication and occasionally results in death.

46. *Detection and development.* Silicosis may be detected by chest X-rays in each of the three stages. However, X-rays alone are not sufficient for a positive diagnosis, for the shadows may be due to a variety of other conditions, including infection or another type of pneumoconiosis. The individual must have had a definite exposure to free silica, because only it can cause silicosis. The complete occupational and medical history of the employee must therefore be evaluated before a conclusion can be reached. The correlation of chest X-ray findings and physical disability may be poor in many cases.

47. From most industrial experience, silicosis seldom develops in less than five years and in many cases may take 20 years or longer to become disabling.

48. The development of silicosis in its earliest stage is not perceived by the individual. The disease cannot be cured by any means yet known. Tuberculosis is more prevalent in persons with silicosis, but the incidence is decreasing, as it is in the general population.

49. Men with early signs of silicosis are able to perform their duties and are not a menace to other employees, for it is not a contagious disease. A perceptible X-ray change is not grounds for assuming disability because most people show chest changes with advance in age even without exposure to dust. Where there is a known exposure to silica dust, however, men with early signs of silicosis should be seen periodically by a physician.

50. *Action of silica on the lungs.* At the points in the lung where silica dust is deposited and accumulated, a fibrous tissue develops and grows around the particles. This fibrous tissue is tough like scar tissue. It is not as elastic as normal lung tissue, does not permit the ready passage of oxygen and carbon dioxide, and as it proliferates, cuts down the amount of normal lung tissue. As

a result, the available functional volume of the lung is reduced.

51. In some advanced cases, the fibrous tissue will slow down or even prevent the diffusion of oxygen from the lung to the blood in the capillaries, and the blood in the area will not be completely oxygenated. The fibrous tissue can also affect the blood vessels by obliterating them or cutting down the flow of blood. All these effects tend to limit the rate at which oxygen is supplied to the body tissues. *Emphysema* is the most obvious symptom.

52. As the inhalation of silica continues over the years, the amount of fibrous tissue will, of course, increase, with the ultimate result that the lungs will not readily oxygenate sufficient blood for the body's needs. Then when the oxygen demand of the body is increased by exertion, the individual will feel distress with shortness of breath.

53. *Amorphous free silica* differs from crystalline free silica in physical structure and in physiological effects. In the amorphous state, molecules of silica exist in random orientation, which may be caused by natural forces to form opal and diatomaceous earth (kieselguhr). Amorphous silica may be converted by artificial processes into such forms as silica gel, silica fume, and fused silica or quartz.

54. If amorphous silica is heated to a high temperature, as in calcining, forms of crystalline free silica called cristobalite and tridymite result. These intermediate forms of amorphous silica are known as cryptocrystalline (ultra-microcrystalline.) Inhalation of these crystalline forms can readily cause diatomite pneumoconiosis.

55. When diatomaceous earth is calcined, particularly in the presence of a trace of alkaline flux, appreciable quantities are converted to cristobalite. As a result of studies made by the U. S. Public Health Service, it has been recommended that the threshold limit value for crude or amorphous diatomite be placed at 20 mppcf (see Table II), but that the atmospheric concentration for dust containing cristobalite be kept under 5 mppcf.

56. Various commercial products containing particles of silica under 1 micron in size are available. The

physiological effects of these products have not been well defined. Until more experience with human beings is available, it is believed these products should be handled with care.

57. *Free silica and silicates.* Free silica is uncombined silicon dioxide (SiO_2). Silicates contain silicon and oxygen combined with other elements in a more complex molecule. Analyses of minerals, particularly in geological reports, are sometimes reported as percentages of oxides, which may include SiO_2 , Al_2O_3 , K_2O , Fe_2O_3 . The SiO_2 reported in such chemical analyses is the total of the silicon dioxide present, both the free silica (if present), and the silica combined in the mineral. Such analyses are not reliable indications of the silicosis potential of the material.

58. It is uncombined or free silica that is most important in industrial dust exposure. So that an exposure can be properly evaluated, the percentage of uncombined silica must be determined by petrographic analysis using a polarizing microscope or, preferably, by X-ray diffraction analyses and special analytical chemical procedures.

59. There has been some experimental evidence that some dusts may tend to inhibit the action of silica on the body, but this inhibiting action is so slight and uncertain that it must be discounted in practice. In fact, there also is evidence that the nonsiliceous components of a dust mixture containing free silica may provoke a disabling condition more severe than that caused by the silica acting alone.

60. With the exception of asbestos and some talcs, the silicate dusts do not ordinarily cause a serious disabling lung condition such as is produced by free silica. Much higher levels of silicate dusts than of free silica dust can be tolerated.

61. In many industries, men have worked with silicate dusts that contained no free silica without development of disability or of nodulation in the lungs. The X-ray may show shadows indicating dust deposits in the lungs, but the pneumoconiosis is essentially harmless. However, partially disabling pneumoconioses have been reported where men have worked for long periods of time in

very high concentrations of certain silicate dusts.

62. Disabling pneumoconioses from exposure to abnormally high concentrations of mica, tremolite talc, and kaolin dusts have been described in the literature. The clinical signs are not the same for these silicate dusts as for free silica, but the symptoms can be marked.

63. The body does not have adequate defense against indiscriminate amounts of dust of any kind. Therefore, although specific symptoms have not been described for many mineral dusts, the general experience would indicate that dust levels should be kept within threshold limit values or below (Table II).

Asbestosis

64. Asbestos is a general term applied to several minerals having a fibrous character. These asbestos minerals are hydrated silicates of magnesium with variable amounts of iron, calcium, sodium, potassium, and aluminum present as impurities.

65. Asbestos when inhaled produces fibrous tissue in the lungs of both men and animals. It has been shown that fibers of asbestos must be present for the production of asbestosis. Other silicate minerals of the same chemical composition but nonfibrous in form produce no reaction or a relatively mild reaction, but not the severe reaction of fibrous asbestos dust.

66. These facts lead to the conclusion that asbestosis is mainly the result of physical irritation of the lung tissue and not of a chemical action, which is thought to be one of the causes of silicosis. It is suspected that lung cancer may be induced by asbestos. However, there is no impressive amount of evidence to support this assumption.

67. The fine air-borne fibers of asbestos can pass through the upper respiratory tract to the lower parts of the lungs to cause irritation and to form "asbestos bodies" where the fibers are encapsulated. This diffuse fibrosis probably begins as a "collar" about the terminal bronchioles. There is evidence that other minerals having a fibrous character can produce a reaction similar to that of asbestos. Fiber glass, however, does not produce such a reaction.

68. Following a study by the U. S. Public Health Service of the

asbestos textile industry,* it was recommended that the dust concentration be kept at less than 5 mppcf to prevent asbestosis. Evaluation of an exposure to asbestos dust is based on the total amount of dust because it has proved out in practice that if the fine dust is kept below the suggested threshold limit, the concentration of injurious fibers will also be kept within safe limits.

Talcosis

69. As used in industry, "talc" is a very general term. To the geologist, talc is a hydrous magnesium silicate, which may be a relatively pure mineral or may be mixed with tremolite or with dolomite depending upon where it is mined. The term "talc" is applied commercially to carbonate mixtures that have the same general feel and physical properties; it also is applied to pyrophyllite, a hydrous aluminum silicate, which frequently is mixed with a high percentage of quartz. The free silica generally found with pyrophyllite can cause silicosis. It is therefore essential to know which talc is being used in order to evaluate a specific dust exposure.

70. *Talcosis* is usually associated with tremolite talc. This disease produces changes in the lungs and symptoms similar to those of asbestosis.

Anthracosilicosis

71. *Anthracosilicosis*, a complex form of pneumoconiosis, is a chronic disease caused by breathing air containing dust that has free silica as one of its components and that is generated in the various processes involved in mining and preparing anthracite (hard coal)** and, to a lesser degree, bituminous coal.

72. The disease is characterized anatomically by generalized fibrotic changes throughout both lungs and by the presence of excessive amounts

*Dreesen, W. C., Dalla Valle, J. M., Edwards, T. L., Miller, J. W., and Sayers, R. R., *A Study of Asbestosis in the Asbestos Textile Industry*, U. S. Public Health Bulletin No. 241, U. S. Public Health Service, Washington 25, D. C. 1938.

***Anthracosilicosis among Hard-Coal Miners*, U. S. Public Health Bulletin No. 221, U. S. Public Health Service, Washington 25, D. C. 1935.

of carbonaceous and siliceous material. Such lungs on autopsy are coal black.

73. Symptoms found in early stages of the disease are shortness of breath, cough with a coal-black sputum, pain in the chest, and in some cases physical weakness. In the advanced stages, there are loss of weight and decreased capacity for work, partly caused by pulmonary infection (frequently bronchitis), and in some cases there may be heart failure.

74. Experiments with animals showed that mixtures of coal and quartz produced more fibrosis than did quartz alone. The harmful effects of coal dust do not come only from the silica in the dust. Coal dust alone in very heavy concentrations over a period of many years can cause breathlessness and ventilatory impairment.

Miscellaneous pneumoconioses

75. Even though a dust is classified as harmless, excessive amounts of it can lead to trouble by causing a pneumoconiosis or simply by mechanically irritating the walls of the respiratory system. Moreover, even though there is no chemical or physical irritation, mechanical plugging of the lungs and interference with their ordinary processes can result. Mica dust and kaolin dust are two good examples of dusts that ordinarily are considered benign but in excessive amounts can cause a troublesome pneumoconiosis.

76. Mica pneumoconiosis has been observed in grinding operations where mica dust, but no free silica was present. There were marked changes in the X-ray pictures of the lungs and some disability. The cases occurred where the dust exposures were massive over many years.

77. *Kaolinosis* has been described as a condition induced by inhalation of dust released in the grinding and handling of kaolin (china clay). Where the cases occurred, dust levels of several hundred million particles per cubic foot of air were common.

78. Aluminum dust is not considered to be harmful except where exposures are massive. Without adverse effects, aluminum dust inhalation has been used as part of an endeavor to prevent silicosis. Also without adverse effects, extensive exposures to aluminum dust have oc-

curred in the grinding of aluminum parts and castings. It can therefore be concluded that reasonably good control will prevent harm from aluminum dust.

79. Bauxite pneumoconiosis (Shaver's disease) has been found only in workers exposed to fumes containing aluminum oxide and minute or ultramicroscopic silica particles arising from smelting bauxite in the manufacture of corundum, an impure form of aluminum oxide. It is essentially a diffuse interstitial fibrosis and marked associated emphysema, with a complete absence of any nodular fibrosis. It definitely does not occur from the use of corundum grinding wheels or from other forms of aluminum oxide.

80. Some pneumoconioses may show marked shadows on an X-ray film; these shadows, without the necessary information on the exposure of the individual, may be alarming in a general X-ray screening program. On clinical examination of individuals showing the X-ray markings, however, often no disability or symptom can be found.

81. These shadows are frequently encountered when the dusts contain atoms of relatively high molecular weight because the heavier atoms are fairly opaque to X-rays. Insoluble barium dusts and tin oxide dusts, for example, can show very marked shadows on X-ray films without producing signs of significant pathology (barium dust that is soluble in the body fluids can give a toxic reaction).

82. Iron oxide, particularly excessive fume from welding operations, may produce *siderosis* with a pigmentation of the lungs (black in welders and red in iron ore miners) without disability. The X-ray shadows produced by the iron oxide in the lungs are somewhat similar to the shadows from silicosis. Because of this similarity, differential diagnosis is often difficult, and heavy exposures to iron oxide dust and fume may lead to medicolegal problems. It is therefore important to control iron oxide exposures even though siderosis is not disabling.

83. Limestone, marble, lime, gypsum, and portland cement dusts apparently have no serious effect even after long exposures. Also, many silicates and other minerals have not caused impairment in individuals inhaling the dusts, and the resulting

pneumoconioses are generally classed as benign.

Toxic Dusts and Fumes

84. Systemic reactions are caused by toxic dusts and fumes of various elements and their compounds and by certain organic compounds. All metallic fumes are irritating, especially when freshly generated. Industrially important metals and their compounds that can have a toxic effect when the dust or fume is inhaled include arsenic, antimony, cadmium, chromium, lead, manganese, mercury, selenium, tellurium, thallium, uranium, and a few others.*

85. The effect of some metals, such as magnesium and zinc, appears to be transient. Only limited data are available on the exotic and rare earth metals.

86. Although the dusts and fumes from metals with low toxicity do not need as much attention as the dusts and fumes from highly toxic metals, they should not be neglected or disregarded. The metals with low toxicity are controlled more readily because greater amounts can be tolerated, but their dusts and fumes should be kept at reasonable levels since excessive amounts of any of them can be harmful (Table III).

Lead poisoning

87. Although extremely severe cases of lead poisoning are rare in industry today, lead exposures must be controlled to prevent even the moderate symptoms, which can be troublesome. Inhalation of the dust of lead compounds is the most common mode of entry of lead into the system. Ingestion of lead compounds can add to the problem if personal hygiene is poor. Workers should therefore be encouraged to wash thoroughly before eating, and lunchrooms should be segregated from work areas.

88. It should be recognized that lead is a normal constituent of plants and animals. People ingest and excrete lead daily even though they are not exposed to lead in their daily work. The body can handle

*See the following National Safety Council Data Sheets: *Antimony and Its Compounds*, 408; *Arsenic and Its Inorganic Compounds*, 499; *Cadmium*, 312; *Lead*, 443; *Magnesium*, 426; *Manganese*, 306; *Mercury*, 203; *Titanium*, 485; *Zinc and Zinc Oxide*, 267; *Zirconium Powder*, 382.

and eliminate small amounts without harm. When intake rates exceed the normal excretion level, build-up occurs in the body. There is a safe level of absorption, and if the concentration of lead dust in the air of work areas is kept below the threshold limit, there should be no difficulty.

89. The importance of maintaining the concentration of air-borne lead at a very low value stems from lead's high toxicity and its tendency, in small amounts, to accumulate in the human system. When lead absorption in the body reaches a sufficient degree, symptoms of poisoning or intoxication appear.

Beryllium intoxication

90. Beryllium intoxication is a severe systemic disease that can result from the inhalation of massive doses of dust of metallic beryllium, beryllium oxide, and some soluble beryllium compounds. There are two forms of the disease. One is an acute form of chemical pneumonitis with cough, pain, difficulty in breathing, cyanosis, and loss of weight. In the chronic type, known as berylliosis, there may be loss of appetite and weight, weakness, cough, extreme difficulty in breathing, cyanosis, and cardiac failure. Mortality is high in chronic beryllium intoxication, and many who survive suffer from pulmonary distress.

91. Individual susceptibility apparently is an important factor in the development of the disease. In many instances, one employee has developed the severe symptoms while other employees doing the same work have shown no signs of disability.

92. Beryllium intoxication has never been demonstrated in individuals mining or handling ore only. There is no evidence of intoxication from the ingestion of beryllium oxide, beryllium metal, or any of the beryllium alloys. Only the inhalation of beryllium dust produces systemic disease.

93. Because of the severe nature of the disease and because there is no way of predicting who will develop it, extreme care must be taken to control the dust and fume that arise in the handling of beryllium, its alloys, and its compounds. Beryllium is toxic in such small quantity as to be considered the most toxic of all elements yet investigated.

TABLE III. SELECTED TOXIC DUSTS AND FUMES

Substance	Description and Effects	Threshold Limit in Milligrams per Cubic Meter of Air*
Antimony	Gray metal often associated with lead and arsenic. Hazardous from inhalation and ingestion. Soluble salts may cause dermatitis.	0.5
Arsenic	Silvery brittle crystalline metal. Hazardous from inhalation and ingestion. Usually encountered as arsenic trioxide.	0.5
Barium (soluble compounds)	Soluble barium chloride and sulfide are toxic when taken by mouth.	0.5
Beryllium	Light weight, gray metal. The metal, low-fired oxides, soluble salts, and some alloys are toxic by inhalation.	0.002
Chronic acid and Chromates	Red, brown, or black crystals. Caustic action on mucous membranes or skin.	0.1
Cyanide (as CN)	Nonvolatile cyanides are ingestion hazards. Cyanides inhibit tissue oxidation upon inhalation and cause death.	5.0 (skin**)
Dinitrobenzene	Yellowish crystal. Hazardous from skin absorption, inhalation, and ingestion.	1.0 (skin**)
Fluorides	Inorganic fluorides are highly irritant and toxic.	2.5
Hydroquinone	Colorless hexagonal crystals. Contact with the skin may cause sensitization and irritation. Excessive exposure to dust may cause corneal injury.	2.0
Iron oxide fume	Major sources are cutting and welding.	15.0
Lead	Lead fumes and lead compounds cause poisoning after prolonged exposure. Most important means of entry into body is inhalation. Skin absorption is of significance only from such organic compounds as lead tetraethyl.	0.2
Lead arsenate	White crystals—highly toxic.	0.15
Magnesium oxide fume	White powder. Inhalation of freshly generated fume may cause metal fume fever.	15.0

*These threshold limit values were adopted by the American Conference of Governmental Industrial Hygienists in 1962.

94. When the soluble salts of beryllium, especially beryllium fluoride, come in contact with cuts or abrasions on the skin, deep ulcers may be formed that heal very slowly. Complete surgical excision of the ulcer is sometimes required in order to effect healing.

Metal fume fever

95. Metal fume fever is an acute condition of short duration caused

by a brief high exposure to the freshly generated fumes of metals such as zinc or magnesium or their oxides. Symptoms appear from four to twelve hours after exposure and consist of fever and shaking chills. There is complete recovery usually within one day, and ordinarily the employee can return to the same job without recurrence. However, after a period in which there has been no contact with the fume, for example,

TABLE III. SELECTED TOXIC DUSTS AND FUMES (Continued)

Substance	Description and Effects	Threshold Limit in Milligrams per Cubic Meter of Air*
Manganese	Silvery gray metal. Hazardous from inhalation of fumes or dust.	5.0
Pentachlorophenol	Dark-colored flakes. Harmful dust. Emits toxic fumes when heated.	0.5 (skin**)
Phosphorus (yellow)	Poisonous mainly by inhalation. Severe burn hazard from skin contact.	0.1
Picric acid	Yellow crystals or liquid. Explosive—particularly metallic salts. Emits toxic fumes on decomposition.	0.1 (skin**)
Selenium compounds	Toxicity varies somewhat according to the solubility of the specific compound. Often causes contact dermatitis.	0.1
Sodium hydroxide	White, deliquescent pieces or lumps. Has severe action upon all body tissue.	2.0
Tellurium	Similar to selenium chemically and in physiological effects.	0.1
Titanium dioxide	White to black powder. Considered in the nuisance category.	15.0
Trinitrotoluene	Colorless to yellow monoclinic crystals. Emits toxic fumes of oxides of nitrogen when heated to decomposition. Highly poisonous explosive.	1.5 (skin**)
Uranium	Highly toxic and a radiation hazard that requires special consideration.	0.05 (soluble compounds) 0.25 (insoluble compounds)
Vanadium pentoxide	Yellow to red crystals. Acts chiefly as an irritant to the conjunctiva and respiratory tract.	0.5 (dust) 0.1 (fume)
Zinc oxide fume	Amorphous white or yellow powder. The powder is essentially nontoxic, but freshly generated fume may cause metal fume fever.	5.0
Zirconium compounds	Most compounds are insoluble and have low toxicity.	5.0

*These threshold limit values were adopted by the American Conference of Governmental Industrial Hygienists in 1962.

**The word "skin" in this table indicates that the substance can penetrate the skin to contribute to the exposure.

after a layoff, resumption of exposure is likely to bring on an attack.

96. To cause metal fume fever, heavy concentrations of fumes are required. Zinc oxide fume is the most common source, but cases caused by the inhalation of fumes from magnesium oxide, copper oxide, and other metallic oxides have also been reported. The condition does not occur from the handling of these oxides in powder form. Apparently,

it results only from the inhalation of extremely fine particles freshly formed as fume (nascent fume).

97. Nickel, mercury, and other metals may also produce a fever followed by the toxic effects of the element.

Allergic Reactions

98. When in the form of dust, a large number of materials may cause various allergic reactions in suscep-

tible individuals. Examples of such agents are certain animal products, foods, drugs, and chemicals. The bodily systems usually involved in allergic reactions, which may be quite severe, are the skin, respiratory system, and gastrointestinal system. Occasionally, two or more systems are involved. Some of the allergic reactions are dermatitis, hay fever, asthma, and hives.

99. Usually, the victim is subjected to a series of exposures without any reactions during which sensitization is built up. These exposures may occur continuously for years. Then, at the end of the "incubation period," which varies according to the individual, a reaction is produced.

100. For a true allergic reaction two factors are required:

- A history of prior exposure to the material involved (sometimes not known by affected employees).
- A "challenge dose" of the material, which provokes the allergic reaction.

101. Continuous exposures may act as "desensitizing doses," and under these conditions an allergic individual may work without incident for long periods of time only to find that re-exposure after removal from the sensitizing material (such as after a vacation) causes an allergic response to recur.

102. Medical and engineering recommendations to prevent allergic reactions are based on prevention of exposure by means of personal protective equipment, ventilation methods, or removal of sensitized individuals from the exposure.

Infections

Infection and pneumoconiosis

103. The presence of pulmonary disease that significantly interferes with the natural defenses against foreign particles may increase susceptibility to pneumoconiosis. Conversely, a pneumoconiotic lung is more prone to infection. For example, tuberculosis occurs more frequently among silicotics than among normal persons. Severe disability or death of a silicotic, when caused by pulmonary conditions, usually results from complicating tuberculosis either alone or combined with other infections.

Bacteria and fungi

104. The possibility of lung in-

fections from the inhalation of bacteria and fungi exists in several industries. Pulmonary anthrax from the inhalation of dust containing anthrax spores has occurred among employees engaged in the handling of wool and the crushing of bones from infected animals.

105. Fungi (molds) growing on grain has been found in the sputum of workmen shoveling the grain and are believed to be the cause of outbreaks of respiratory disorders. Fungi found in sugar cane residues (bagasse) are believed to be part of the cause of *bagassosis*. Fungal spores formed under the bark of some trees have been blamed for respiratory difficulties among employees who debark dry logs.

106. Although the incidence of occupationally related bacterial and fungal infections is found to be relatively low, the respiratory effects can be troublesome and, in the case of pulmonary anthrax, even fatal. The basic methods of control are the same as those for the pneumoconiosis producing dusts, but sterilization and disinfection must be added.

Radioactive Dusts*

107. A radioactive contaminant may offer a chemical toxicity hazard in addition to an ionizing radiation exposure, and it may be present as a gas, dust, fume, or mist.

108. Radioactive contaminants taken into the body may be deposited in various organs where they constitute sources of internal radiation. The chemical characteristics of the radioactive contaminant or isotope determine the organ in which it will be deposited. The excretion rate is also dependent upon the chemical nature of the isotope, because the radioactive isotopes of an element follow the same metabolic process as do the stable isotopes of that element.

109. If a radioisotope has been deposited in the body, the internal exposure is regarded as continuous until the isotope is lost by radiological or biological decay. In some cases, exposures may last a lifetime.

*For a detailed discussion of radioactivity and an extensive bibliography, see the chapter entitled "Ionizing Radiation" in the *Accident Prevention Manual for Industrial Operations*, published by the National Safety Council.

110. Since radioisotopes are selectively taken up in individual organs, they may cause only localized irradiation. The radiosensitivity of the organ dictates the extent of the hazard of a particular radioactive substance. Solubility and particle size determine how much of the active material will gain access to and remain in the blood stream and various organs.

111. If radioactive air-borne contamination is known to be present, control measures are mandatory. If the presence of contamination is unknown but suspected, sampling must be done to determine whether or not air-borne concentrations of the radioisotope are below the threshold limit value.

112. Good personal hygiene and good operating techniques are much more important in the handling of radioactive materials than in the handling of most other materials used in industry.

113. Engineering controls for radioactive dusts are similar to those for other dusts and depend primarily upon capture at the point of generation. The difference lies in the fact that controls for radioactive dusts must be extremely efficient. Threshold limit values for radioactive particulate matter are very low, and in some cases 100 per cent efficiency in capture and retention is required.

Permissible Dustiness

114. Threshold limit values of mineral dusts and toxic dusts—that is, time-weighted average concentrations considered permissible for exposures of eight hours per day, five days per week—have been published by the American Conference of Governmental Industrial Hygienists. These values have been obtained from the experience of many groups in industry and from laboratory studies on animals. They are reviewed annually and changed as necessary on the basis of experience.

115. These values are set only as guides for the best practice and are not to be considered absolute values. There is reasonable assurance that occupational disease will not occur if exposures are kept below these levels. On the other hand, occupational disease is likely to develop in some people if the recommended levels are exceeded consistently.

116. The currently recommended threshold limits of particular dusts can be found in the most recently published ACGIH list, or the ACGIH can be consulted directly. Information on threshold limits also can be obtained from the National Safety Council, state occupational health agencies, the American Industrial Hygiene Association, and compensation insurance carriers.

117. No one knows the exact concentration at which men will start to develop silicosis, asbestosis, or lead poisoning. With some toxic dusts, however, experience has been wide enough to establish the present threshold limits as fairly reliable.

118. For example, if the level of lead in a workroom is kept below 0.2 mg/cu m, experience has shown that cases of lead intoxication will not occur. Experience also has shown that many men can tolerate lead levels well above 0.2 mg/cu m without signs of trouble.

Mineral dusts

119. In the United States, the threshold limits for mineral dusts are expressed in millions of particles per cubic foot of air (mppcf). The concentration of a mineral dust is determined by counting dust particles that are less than 10 microns in size in an aliquot sample after sampling a known volume of air in a known volume of liquid. In some European countries, mineral dusts are weighed, and permissible levels are expressed as milligrams of dust per cubic meter of air (mg/cu m). In England and some other areas, the number of particles per cubic centimeter is the current basis of measurement.

120. In comparing United States and foreign dust counts, it is helpful to keep in mind that 100 particles per cubic centimeter is equivalent to approximately 3 million particles per cubic foot.

121. It is difficult to compare dust counts with results obtained on the basis of weight. However, with either type of measurement, a threshold limit can be set as an objective. Experience has shown that maintaining dust levels below the recommended threshold limits has resulted in a great decrease in the incidence of occupational diseases.

122. Threshold limits are based on the percentage of free silica where this substance is the impor-

tant constituent of the dust. If silicosis is to be prevented, these limits must not be exceeded. Concentrations of dusts containing less than 5 per cent free silica should not exceed 50 million particles per cubic foot (mppcf). Concentrations of dusts containing from 5 per cent to 50 per cent free silica should not exceed 20 mppcf. Dusts containing more than 50 per cent free silica should be kept at concentrations below 5 mppcf.

123. As more experience accumulates, original threshold limits sometimes can be modified. In some cases, it has been necessary to lower the limits, for the objective is to protect the more susceptible individuals. In a few cases, experience has shown that the limits were too stringent, and it has been possible to raise the limits to allow for more reasonable controls.

Toxic dusts

124. In all countries, threshold limits for toxic dusts are expressed in milligrams per cubic meter of air. With toxic dusts, the average levels must be kept below the suggested threshold limits. In fact, it is advisable to keep the levels of toxic dusts as low as practical in the specific circumstances. Little in the way of experience or data will be developed if the levels are kept unusually low, but few if any cases of occupational disease will occur from these dusts.

Nuisance dusts

125. Even though a dust may be considered generally innocuous and not be recognized as the direct cause of a serious pathological condition, its level should be kept as low as is practical. Dust levels well below the suggested threshold limits are desirable.

126. A concentration of 50 mppcf is suggested as the threshold limit for a number of nuisance dusts. With good engineering practice, there is no need for this level to be exceeded. Any reduction below this level will increase the comfort of employees and improve plant housekeeping.

Methods of Control

127. Various methods of controlling dusts, mists, and fumes are available. Basic engineering dictates where possible an operation should

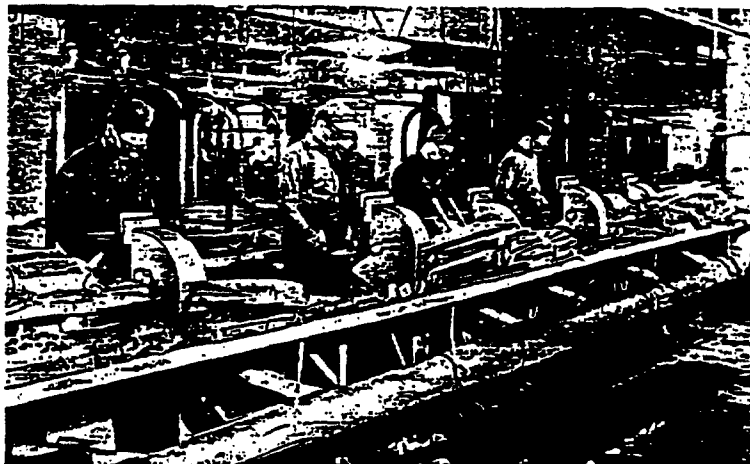


Figure 3. Each of these grinding wheels is partially enclosed by an exhaust hood. Efficient local exhaust is achieved by drawing the dust into the hoods, through branch ducts, and into a control duct which leads to the collection point. (Courtesy American Foundrymen's Society)

be made dustless through control at the source. This method is always the most effective, for it either completely prevents the contaminant from entering the workroom atmosphere or limits to safe levels the amounts that do escape. In addition, this method is generally the least expensive.

128. When control at the source is not possible, other methods may have to be considered. Any one or a combination of the following types of dust control may be needed to limit the exposure.

- a. The dusty operation may be enclosed, with or without a local exhaust system. An enclosed operation generating large quantities of dust usually needs to be exhausted, or the dust will leak into the surrounding atmosphere. Examples are sandblast cabinets or sandblast rooms and the dry boxes used to handle radioactive materials.
- b. The dusty work may be performed in a separate building or may be isolated by partitions to reduce the number of employees exposed to the dust. The employees who are still being exposed should be protected by respiratory protective equipment.
- c. A less hazardous material may be substituted. For instance, steel shot may be used instead of silica sand in abrasive cleaning.
- d. Keeping the materials moist may be a practical means of control. Examples are the careful and proper wetting down of aisles in a foundry and the use of water in drilling.
- e. Local exhaust systems may be installed with virtually full or partial enclosure. Examples are an exhaust hood on a grinding wheel (Figure 3) and an exhaust hood at a bagging or filling operation.
- f. General room ventilation can be used to dilute the dust by adding large quantities of air and thus preventing build-up of dust concentrations. Examples of this method are roof fans and roof monitor windows. But it generally is inefficient and expensive to attempt to control contaminants by dilution.
- g. The dusty work may be performed at night or on week-ends to reduce the number of employees exposed. Cleaning dust accumulations from overhead beams, for instance, is preferably done during a weekend. The employees who are exposed should wear appropriate type of respiratory protective equipment.
- h. The number of working hours at the particular exposure can be reduced. However, other methods of control are preferable.
- i. Use of respiratory protective equipment approved for the exposure by the U.S. Bureau of Mines can give excellent protection against all types of dust, but in most cases should be considered as a temporary control measure. In a sandblast room, however, air-supplied helmets usually are required continuously during operations. Respiratory protective equipment.

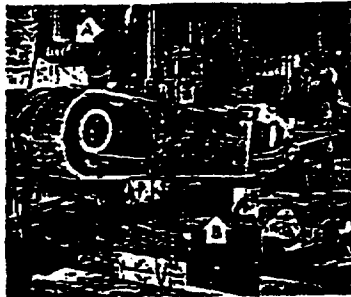


Figure 4. Since this spring-frame grinder is used in a variety of positions, the local exhaust system must be adjustable. The flexible duct (A) permits movement of the exhaust hood (B) as needed. (Courtesy American Foundrymen's Society)

nevertheless, should not be considered as a universal substitute for adequate local exhaust removal, elimination of the contaminant, or containment.

129. Many states and municipalities have dust control codes or ordinances with which employers must comply. In a few states, for instance, written approval of plans must be obtained before a local exhaust system is installed. Each employer should therefore know his state and municipal dust control requirements.

130. Each type of exposure must be considered separately. For example, a local exhaust system suitable for welding or cutting of steel might not be satisfactory for welding or cutting steel coated with red lead.

Local exhaust systems

131. A local exhaust system for the control of an industrial dust or fume traps the air contaminant near its source so that an operator standing at the process is not exposed to harmful concentrations. The system should be designed to enclose the process as completely as possible. This method usually is preferred to general ventilation, but should be used only when the contaminant cannot be controlled by isolation, process revision, or substitution of less harmful materials. Even though a process has been isolated, it may still require a local exhaust system.

132. A local exhaust system consists of four principal parts:

- a. Hoods or other inlets, into which the air-borne contaminant is drawn.

- b. Ducts, to carry the contaminated air to a central point.
- c. Dust and fume collectors, to clean the air before it is discharged.
- d. A fan and motor to keep the air moving through the system.

133. While each of these parts should be designed and installed to perform its required function with respect to the system as a whole, design of the exhaust hood demands the greatest care. The degree of control of dust at the point of generation or dispersion is determined by the shape of the hood or degree of enclosure, the location of the hood and its distance from the dust source, and the rate of flow of air into the hood. A poorly designed hood can make an exhaust system ineffective.

134. There is no standard hood. In every case, the hood must be designed to fit the specific operation and to make the exhaust effective without interfering with the operation (Figure 4). Among the factors to be considered are the natural air currents in the room and other exhausts or windows in the area.

135. The hood should be shaped to conform to the shape of the area of dust production so as to secure reasonably uniform air velocity over this area. A hood which does not enclose the process should be placed with its opening as close as possible to the point of generation of the dust or fume (Figure 5) because the velocity of the air in the zone of the hood influence is inversely proportional to the square of the distance from the face of the hood.

136. The hood opening, or part of it, should be located so as to receive directly dust that is thrown off along a well-designated path (Figure 6). The directional energy of the material can thus be used for its own capture. Air movement must always be past the employee, then over the dust source, and directly into the face of the hood.

137. The fan should be of sufficient capacity to maintain the required air capture velocity at the point of generation of the dust. Internal baffles should be installed to guide the air flow where it is most needed. Flanges should be provided wherever possible to reduce the air flow from areas where no dust is produced; that is, air-flow contours should be controlled.

138. Enough air must be supplied to the room from the outside to replace the air that is removed by the exhaust system. Otherwise, there will be interference with other exhaust systems in the area or with gas or oil flames in nearby furnaces. Great difficulty has occurred where an exhaust system caused a slightly negative pressure in a room containing a gas furnace. As a result air came down the furnace flue, and the area became contaminated with carbon monoxide from the furnace.

139. With small exhaust systems, air that is removed usually can be replaced by infiltration flow, but larger exhausts may need a positive air supply (Figure 7). An adequate supply of make-up air, tempered when necessary, is one of the most frequently overlooked fundamentals of ventilation. Air always should be supplied in quantities equal to or slightly in excess of the amounts exhausted.

140. The size of the ducts, the type and size of the dust collectors, and the type and size of the fan and motor (explosion-proof where necessary) are among the other factors which must be considered in the design of an exhaust system. Preventing ignition of a combustible

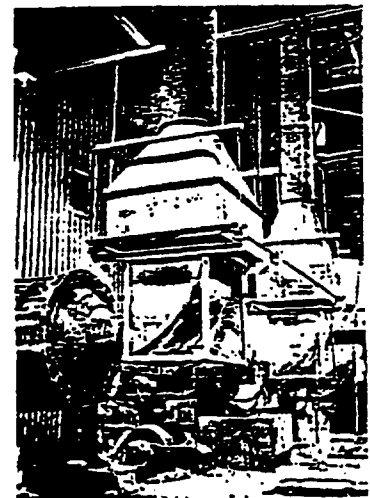


Figure 5. To achieve the proper exhaust air velocity, the hoods for these barrel furnaces can be positioned as close to the furnace spouts as practical. Such positioning is made possible by mounting the hoods on a trolley suspended from an overhead track. (Courtesy American Brake Shoe Co.)

contaminant is a prime safety consideration. Since discussion of the subject of exhaust system design is beyond the scope of this data sheet, an experienced ventilation engineer should be consulted.

141. Also, information can be secured from several excellent publications, one of which is the current edition of *Industrial Ventilation—A Manual of Recommended Practice*, published by the American Conference of Governmental Industrial Hygienists. Another is the chapter entitled "Local Exhaust Systems and Ventilation" in the *Accident Prevention Manual for Industrial Operations*, published by the National Safety Council.

General ventilation

142. Where it is impossible, impractical, or too expensive to control dust entirely by local exhaust systems, general ventilation must be used as a supplement or a substitute. It should be noted, however, that where local exhaust systems can be used, they will always do a better job than general ventilation.

143. General ventilation requires the introduction of enough clean air from the outside to dilute the contaminated atmosphere to a safe level. This method requires larger volumes of air than local exhaust systems to accomplish the same control, and will not be effective uniformly over a large room. It should be considered only when local exhaust systems require such assistance. This is usually where the sources of dust are widely dispersed and each is small.

144. General room exhaust and supply fans must be carefully installed. Eddy currents, which will interfere with local exhaust systems, must be avoided. Employees must not be exposed to excessive concentrations of dust as the dust-laden air moves away from the point of generation, and sufficient makeup air from the outside must be supplied to the room to replace the air that is exhausted. The location and design of the source of supply are important. It is becoming common practice to supply clean, tempered air to the work zone for controlled dilution.

Wet methods

145. Wet dust is not dispersed

as readily as dry dust—advantage of this fact should be taken whenever possible. Carloads of dry minerals in some cases may be wetted down before they are unloaded. Aisles in foundries should be wetted down to prevent dispersal of the dust by traffic. Water sprays can be used at some operations. Wet drilling methods can be used for rock drilling to wet the dust as it is formed.

Personal protective equipment

146. Respirators of various designs are available which will give protection against toxic and pneumoconiosis-producing dusts by filtering out the contaminant from the air. The U. S. Bureau of Mines has set up performance standards for dust respirators and gives approval to respirators that meet these standards. It is important that a respirator be used *only* for the particular dust exposure for which it has been approved.

147. Although approved respirators will give excellent protection when properly fitted, they should be used only as supplements to other methods of control or for short or occasional exposures and not as primary controls.

148. Proper fitting of a mechanical filter respirator to the face of the individual is most important because a small space between the facepiece and the face will permit dustladen air to bypass the filter.

149. Respirators must be inspected and cleaned daily. Filters should be replaced before they become so plugged with dust as to seriously increase resistance to breathing. Proper filters for replacement should be available.

Medical program

150. An effective medical control program will help prevent cases of occupational disease. Such a program can also serve as a check on the engineering controls because symptoms of exposure in a group of workers will indicate a failure that must be corrected. The extent of the medical program will depend upon the seriousness of the exposures.

151. An industrial hygiene program should parallel the medical program. Both are essential to protect the health of employees.

152. The physical examination for new employees should include

a thorough pre-employment history with the occupational background given in detail. Chest X-rays should be made of all new employees who will be working in dust exposures that could produce disabling pneumoconiosis. The examining physician should decide on placement of those who have pneumoconiosis, active or significant past tuberculosis, abnormally low timed vital capacity, or serious pulmonary diseases.

153. Periodic physical examinations, including chest X-rays, should be made of employees exposed to toxic dusts, fumes, and mists. Such checks can help find incipient cases of poisoning in which symptoms are slight, and the X-rays can pick up early symptoms of lung conditions. Suitable preventive measures can then be taken.

154. Routine, periodic clinical examinations, stipple cell counts, porphyrin determinations, and properly evaluated blood and urine lead level measurements, are practical methods for checking employees exposed to lead. If unsafe exposures are found, further environmental control is mandatory. Affected employees should, of course, be given proper medical treatment.

155. Medical controls for employees who work with radioactive dusts must be more stringent than the medical controls for most dusts. An extensive bioassay sampling program is nearly always required.

Other control measures

156. Although the most effective method of control is to prevent contamination of workroom air and thus prevent inhalation of harmful

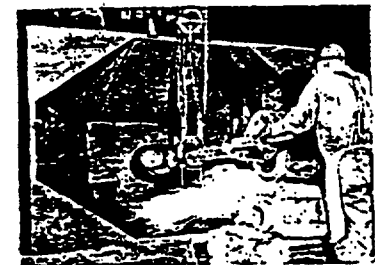


Figure 6. The centrifugal force created by this grinding wheel causes the generated dust to travel in a well-defined path. To prevent dispersion of the dust, the exhaust hood is placed directly in the dust stream, close to its source. (Courtesy American Foundrymen's Society)

dusts, the importance of personal hygiene should not be overlooked. The periodic medical examinations provide a good opportunity for instruction of employees in various personal hygiene measures.

157. Good washing facilities, clean lunchrooms, and clean work clothes can help prevent additional, even though minor, exposure to toxic materials. Also, contaminated work clothes should not be taken home where a toxic dust could contaminate the home or expose other members of the family. These recommendations become mandatory where such materials as beryllium and radioisotopes are handled.

ACKNOWLEDGMENT

The text of this data sheet, which replaces Health Practices Pamphlet No. 4, was prepared by the Health Committee of the Chemical Section, National Safety Council. The content has been extensively reviewed by members of the National Safety Council, representatives of chapters of the American Society of Safety Engineers, medical authorities, and industrial hygienists. The data sheet has been approved for publication by the Publications Committee of the Industrial Conference, National Safety Council.

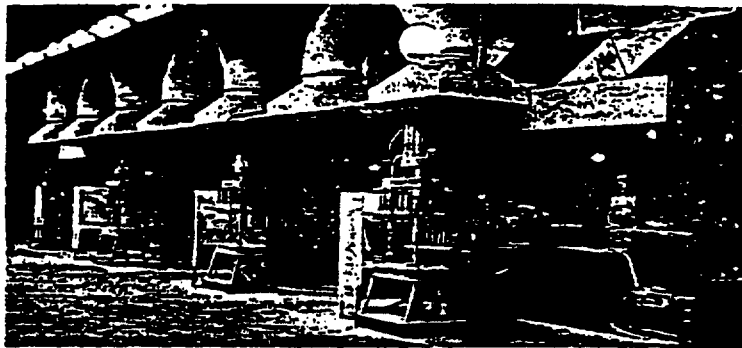


Figure 7. In this foundry, local exhaust hoods are installed over each station having a shell-molding machine and glue press. Adequate make-up air is supplied from ventilating duct situated between molding machines and presses. (Courtesy American Foundrymen's Society)

BIBLIOGRAPHY

Accident Prevention Manual for Industrial Operations, National Safety Council, 425 N. Michigan Ave., Chicago 11.

Anthraco-silicosis Among Hard-Coal Miners, U. S. Public Health Bulletin No. 221, U. S. Public Health Service, Washington 25, D. C. 1935.

Brandt, A. D., *Industrial Health Engineering*. John Wiley and Sons, Inc., 440 4th Ave., New York 21, 1948.

Data Sheets, National Safety Council:

No. 408, *Antimony and Its Compounds*

No. 499, *Arsenic and Its Inorganic Compounds*

Beryllium (in preparation)

No. 312, *Cadmium*

No. 443, *Lead*

No. 426, *Magnesium*

No. 306, *Manganese*

No. 203, *Mercury*

No. 485, *Titanium*

No. 267, *Zinc and Zinc Oxide*

No. 382, *Zirconium Powder*

Dreesen, W. C., Dalla Valle, J. M.,

Edwards, T. I., Miller, J. W., and Sayers, R. R., *A Study of Asbestosis in the Asbestos Textile Industry*, U. S.

Public Health Bulletin No. 241, U. S.

KOOLPADS cut the price you pay for sweat.

Sweat is one of the most expensive luxuries in modern industry. Production slows as workers stop frequently to wipe glasses, mop brows and gain relief from sweat.

Cellulose sponge StaSafe KOOLPADS soak up that sweat (up to six times their own weight, in fact). Some workers even dampen KOOLPADS in water for refreshing coolness.

KOOLPADS pay for themselves in keeping men on the job.

KOOLPADS pay for themselves in safety. (Help solve the problem of blurred glasses and sweat-stung eyes.)

KOOLPADS pay for themselves in worker comfort, which contributes to increased production.

KOOLPADS pay for themselves in re-use. (Rinse in seconds and use again and again.)

Write today for a free sample KOOLPAD

STANDARD SAFETY EQUIPMENT COMPANY

431 NORTH QUENTIN ROAD • PALATINE, ILLINOIS

13 HECKEL ST.
BELLEVILLE 7, N. J.

12921 W. WASHINGTON BLVD.
LOS ANGELES 64, CALIF.

855 EAST 152nd STREET
CLEVELAND 10, OHIO

MICH01158



CIRCLE 70 ON READER CARD

Public Health Service, Washington 25, D. C. 1938.

Drinker, Philip, and Hatch, T. F., *Industrial Dust*, 2nd Edition. McGraw-Hill Book Co., Inc., 330 W. 42nd St., New York 36. 1954.

Elkins, H. B., *Chemistry of Industrial Toxicology*, 2nd Edition. John Wiley and Sons, Inc., 440 4th Ave., New York 21. 1959.

Hunter, Donald, *The Diseases of Occupations*, 2nd Edition. Little Brown and Company, 34 Beacon St., Boston. 1957.

Hygienic Guide Series. American Industrial Hygiene Association, 14125 Prevost, Detroit 27.

Industrial Ventilation—A Manual of Recommended Practice, 7th Edition. American Conference of Governmental Industrial Hygienists, Committee on Industrial Ventilation, Box 453, Lansing, Michigan. 1962.

Johnston, R. T., and Miller, S. E., *Occupational Diseases and Industrial Medicine*. W. B. Saunders Company, Philadelphia. 1960.

Lanza, A. J., *Silicosis and Asbestosis*. Oxford University Press, New York. 1938.

Patty, F. A., editor, *Industrial Hygiene and Toxicology*, Volume I, 2nd Edition, 1958, and Volume II, 2nd edition (in preparation). Interscience Publishers, 250 Fifth Ave., New York 3.

"Report (Joint) of the Committee on Pneumoconiosis and the Committee on Standard Practices in Compensation of Occupational Diseases," *Year Book*. American Public Health Association, 1790 Broadway, New York 19. 1933.

Review of Literature on Dust, U. S. Department of the Interior, Bureau of Mines, Bulletin 478. U. S. Government Printing Office Office, Washington 25, D. C., 1950.

CIRCLE 45 ON READER CARD

APEX Safety Hats & Caps

Feathered center with built-in clearance

Three-point vertical and angular adjustment for better fit



Eight-point suspension for better impact distribution

Supersoft headband for day-long comfort

With Exclusive NEW Suspension Design

Guarantees Maximum Safety/Comfort/Economy

Apex safety hats and caps meet or exceed government specifications for impact and penetration. They're accepted as a standard by every industry. Compare these advantages . . . and you'll choose Apex!

- Better fit — greater comfort
- Lighter weight
- Better impact distribution
- Quick size adjustment — 6½ to 8
- Easier to clean for hygienic protection
- High resistance to abrasion
- Permanent, molded-in colors
- Lower replacement and inventory costs—one suspension fits any APEX hat or cap

Select an APEX safety hat or cap in the style and color you need for any application . . .



ALUMINUM



ELECTRICAL



FIBRE-GLASS



WINTER LINERS

Literature gives full specifications. Write for free copy today.



apex
SAFETY PRODUCTS

Division of WHITE Sewing Machine Corporation


WASHINGTON & ELM STREETS • CLEVELAND 13, OHIO

BERT



NEW SAFETY EQUIPMENT


Information on new safety equipment is based on literature from the manufacturer, and the National Safety Council does not accept responsibility for statements or claims made herein. Nor does the listing of a product in this section imply endorsement by the National Safety Council.

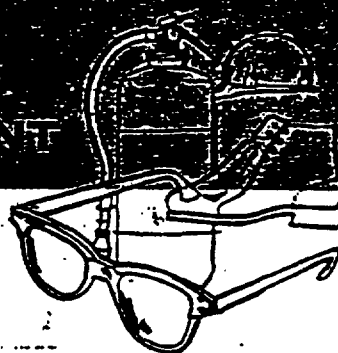

Sweeper

The Damp Sweep Tool has a double steel swivel joining the brush and handle giving easy maneuverability. The tool sweeps under chairs, desks, and tables, and changes direction without lifting from the floor. A 36-inch cleaning cloth with reinforced center hole fits over the handle, and tucks under the brush. The cloth is dampened with water or a liquid dust remover. The device is available in 3 models, with oval, triangular, and rectangular brushes. Available from WALTER G. LEOGE CO., INC., New York.

CIRCLE 80 ON READER CARD

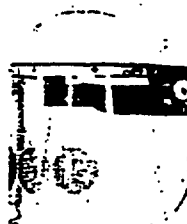

Vented
Face
Shield

Full facial protection against impact without heat problems is the purpose of the air-vented face shield introduced by CHICAGO EYE SHIELD CO.

The shield has hundreds of holes (.070-inch diameter) in a 2 1/4-inch by 8-inch area at the mouth level. The resulting effect is a shield with the ventilation of wire screen and a mar-

gin of safety of a laminated multiply window .045 inches thick.

The window is held in place by studs and spring clips and the face shield has a deeply molded fiber glass crown. The nylon headgear with a broadbearing cross strap has seven height adjustments. There is a ratchet friction adjustment for a full range of head sizes.

CIRCLE 81 ON READER CARD

Penetrating Primer

A rapid-drying, penetrating primer called Myco Primatex, is designed to seal oil-soaked wood and concrete flooring.

Manufactured by MASURY-YOUNG CO., Boston, the primer is said to prevent oil, moisture, and most chemicals from bleeding to the surface. Traffic sealers and coatings may be applied within one hour after it is put down.

A blend of modified resins and cellulose derivatives dissolved in a combination of alcohols and esters, the product covers 800 to 1200 square feet per gallon.


CIRCLE 82 ON READER CARD

Welder's Filter Plate

The Weld-Cool filter plate, manufactured by AMERICAN OPTICAL COMPANY'S Safety Products Div., Southbridge, Mass., is used in inert-gas-shielded arc welding processes where excessive infrared radiation is present. It provides visible light transmission in the blue region of the spectrum and absorbs the yellow flare associated with certain welding processes. The plate is available in shades 10 and 12 and is 2 by 4 1/4 inches.

CIRCLE 83 ON READER CARD

Portable Radar Alarm Unit

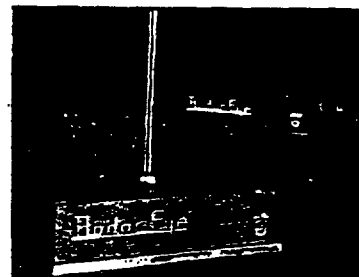

The Radar-Eye Minuteman, which provides protection through a radar field, is available from PINKERTON ELECTRO-SECURITY CORP., Webster, Mass., a subsidiary of Pinkerton's National Detective Agency.

Designed for the small business or homeowner, the device weighs 14 pounds and operates off 110-120 volt house current. The turn of a key switches it on and off. Its circuitry sounds an alarm in the event of power or tube failure, tampering, or wire-cutting.

CIRCLE 84 ON READER CARD

MICH01160

Dry Box Gloves

Dura-Sol dry box gloves are available from CHARLESTON RUBBER CO., Charleston, S.C., in the standard Neo-Sol, Buta-Sol, and Rad-Bar types. Combining a film of synthetic elastomers with butyl rubber for example, is said to produce a glove with retaining low permeability characteristics.

The Dura-Sol gloves incorporate a feature that makes detection of damage by visual inspection possible: The outer polymer film is compounded in