

Thread Connections

Threads used for fittings are the same American Standard taper pipe threads as those used for pipe, and unless otherwise ordered, right-hand threads are used. To facilitate drainage, some elbows have the thread tapped at an angle to provide a pitch of the connecting pipe of $\frac{1}{4}$ in. to the foot. These elbows are known to the trade as pitched elbows and are commercially available. Malleable iron fittings, like brass fittings, are cast with a round instead of a flat band or bead, or with no bead at all. Fittings are designated as male or female, depending on whether the threads are on the outside or inside, respectively.

Flanged fittings are generally used in the best practice for connecting all piping above 4 in. in diameter. While screwed fittings may be used for the larger sizes and are satisfactory under the proper working conditions, it will be found difficult either to make or to break the joints in these large sizes.

A number of different flange facings in common use are plain face, raised face, tongue and groove, and male and female. Cast-iron fittings for 125 lb pressure and below are normally furnished with a plain face, while the 250 lb cast-iron fittings are supplied with a $\frac{1}{16}$ -in. raised face. The standard facing for steel flanged fittings for 150 and 300 lb is a $\frac{1}{16}$ -in. raised face although these fittings are obtainable with a variety of facings. The gasket surface of the raised face may be finished smooth or may be machined with concentric or spiral grooves often referred to as serrated face or phonograph finish, respectively.

The dimensions of elbows, tees and crosses for 125 lb cast-iron screwed fittings are given in Table 7, whereas the dimensions for 125 lb cast-iron flanged fittings are given in Tables 8 and 9.

For low temperature service not to exceed about 220 F, a number of paper or vegetable fiber gasket materials will prove satisfactory; for plain raised face flanges, rubber or rubber inserted gaskets are commonly employed. Asbestos composition gaskets are probably the most widely used, particularly where the temperature exceeds 250 F. Jacketed asbestos and metallic gaskets may be used for any pressure and temperature conditions, but preferably only with a relatively narrow recessed facing.

WELDING


Erection of piping in heating and ventilating installations by means of fusion welding has been commonly accepted in the past few years as a competitive method to the screwed and flanged joint. Since the question of economy of welding as against the use of screwed and flanged fittings is dependent on the individual job, the use of welding is generally recommended on the basis of a greatly reduced cost of maintenance and repair, of less weight resulting from the use of a lighter-weight pipe, and of increased economy in pipe insulation, hangers, and supports rather than on the basis of any economy that might be effected in actual erection by welding on low to medium pressure heating jobs.

Fusion welding, commonly used in erection of piping, is defined as the process of joining metal parts in the molten, or molten and vapor states, without the application of mechanical pressure or blows. Fusion welding

embraces gas welding and electric arc welding, both of which are commonly used to produce acceptable welds.

Welding application requires the same basic knowledge of design as do the other types of assembly, but in addition, requires a generous knowledge of the sciences involved, particularly as to welding qualities of metal, their reaction to extremely high temperatures, and the ability to

TABLE 7. TENTATIVE AMERICAN STANDARD DIMENSIONS OF ELBOWS, 45-DEG ELBOWS, TEES, AND CROSSES (STRAIGHT SIZES) FOR 125-LB CAST-IRON SCREWED FITTINGS

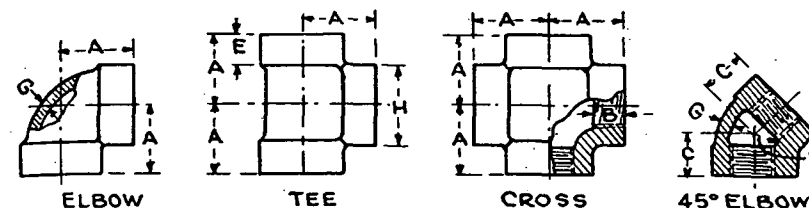

NOMINAL PIPE SIZE	A CENTER TO END, ELBOWS, TEES AND CROSSES	C CENTER TO END, 45 DEG ELBOWS	B LENGTH OF THREAD MIN.	E WIDTH OF BAND, MIN.	F INSIDE DIAMETER OF FITTING		G METAL THICKNESS, MIN.	H OUTSIDE DIAMETER OF BAND, MIN.
					Min.	Max.		
$\frac{1}{4}$	0.81	0.73	0.32	0.38	0.540	0.584	0.110	0.93
$\frac{3}{8}$	0.95	0.80	0.36	0.44	0.675	0.719	0.120	1.12
$\frac{1}{2}$	1.12	0.88	0.43	0.50	0.840	0.897	0.130	1.34
$\frac{3}{4}$	1.31	0.98	0.50	0.56	1.050	1.107	0.155	1.63
1	1.50	1.12	0.58	0.62	1.315	1.385	0.170	1.95
$1\frac{1}{4}$	1.75	1.29	0.67	0.69	1.660	1.730	0.185	2.39
$1\frac{1}{2}$	1.94	1.43	0.70	0.75	1.900	1.970	0.200	2.68
2	2.25	1.68	0.75	0.84	2.375	2.445	0.220	3.28
$2\frac{1}{2}$	2.70	1.95	0.92	0.94	2.875	2.975	0.240	3.86
3	3.08	2.17	0.98	1.00	3.500	3.600	0.260	4.62
$3\frac{1}{2}$	3.42	2.39	1.03	1.06	4.000	4.100	0.280	5.20
4	3.79	2.61	1.08	1.12	4.500	4.600	0.310	5.79
5	4.50	3.05	1.18	1.18	5.563	5.663	0.380	7.05
6	5.13	3.46	1.28	1.28	6.625	6.725	0.430	8.28
8	6.56	4.28	1.47	1.47	8.625	8.725	0.550	10.63
10	8.08	5.16	1.68	1.68	10.750	10.850	0.690	13.12
12	9.50	5.97	1.88	1.88	12.750	12.850	0.800	15.47
14 O.D.	10.40		2.00	2.00	14.000	14.100	0.880	16.94
16 O.D.	11.82		2.20	2.20	16.000	16.100	1.000	19.30

All dimensions given in inches.

determine and use only the best quality welding rods. This requirement applies equally to employer and employee with the employer accepting all of the responsibility. Thus the employer should select his welding mechanics with good judgment, provide them with first-class equipment and tools, arrange for their training and use of acceptable workmanship standards, and at regular intervals subject their work to prescribed tests. Industry will not accept the employment of mechanics of undetermined ability nor on the basis of past experience. Neither does industry accept