


FILE NAME: National Safety Council (NSC)

DATE: 1948 Feb

DOC#: NSC018

DOCUMENT DESCRIPTION: NSC - National Safety News - Fume and Dust Exposure

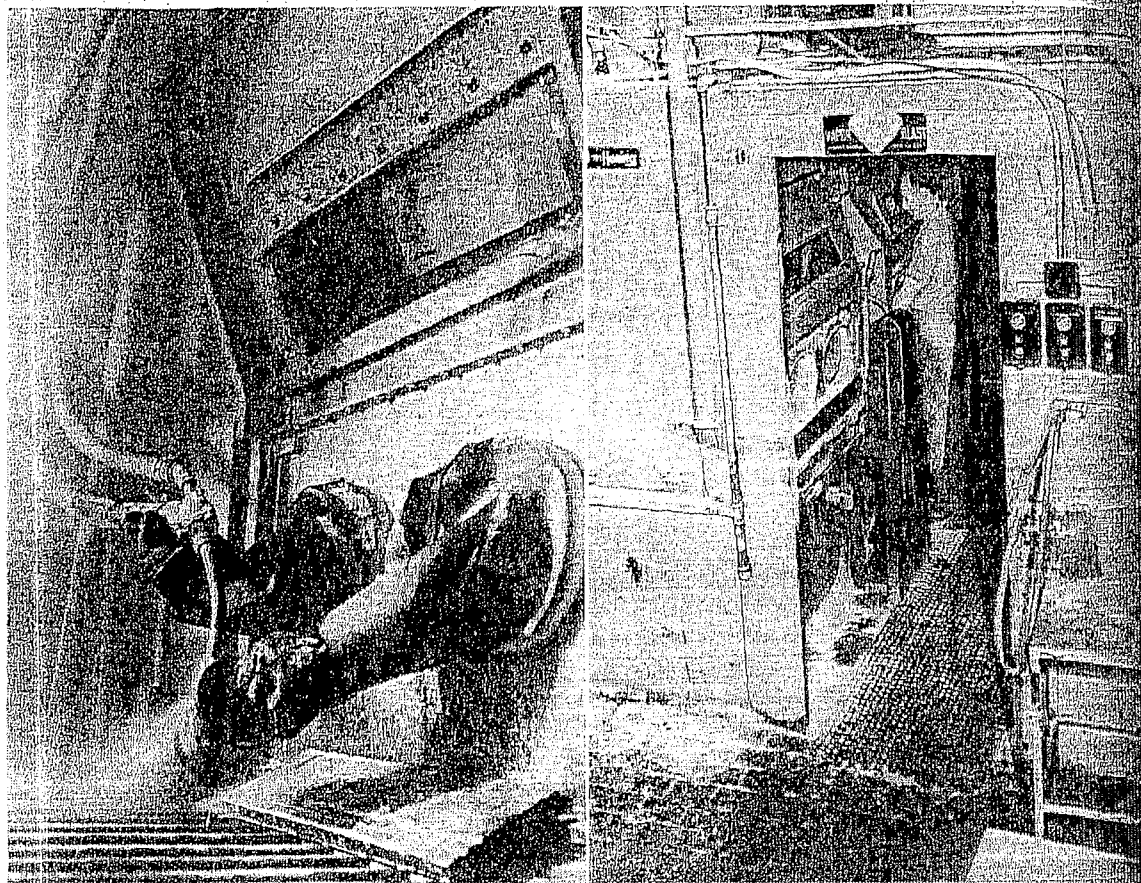

Recognition and Control of

Fume and Dust Exposure

By V. J. CASTROP

RESPONSIBILITY for employee health is delegated by management to the medical director, while the safety director is charged with accident prevention activities. For the smooth functioning of either department, it is necessary that these individuals work in harmony.

The safety engineer spends much of his time in the plant and usually is well informed about working conditions. The doctor, on the other hand, must spend most of his time tending to the medical needs of the employee

and to the administrative work of his department. As a result, he has insufficient time for plant surveys. This is particularly true in plants where the doctor is employed on a part-time basis.

A safety engineer who is capable of recognizing conditions which may be detrimental to health is an excellent team mate for the doctor in a health maintenance program. The safety engineer need not be capable of actually sampling air in the environment or designing a ventilation system for the control of toxic materials. He should, however, have knowledge of the materials which have been proved harmful, and should have some understanding of basic control measures.

The safety engineer, as well as the

doctor, should be informed as to where he can obtain the technical personnel to do the sampling and a detailed study of the environment. Engineering personnel to render assistance in the control of exposure. Such assistance may be obtained from the industrial hygiene divisions, either the health or labor department of many states. Some city governments likewise have industrial hygiene bureaus.

In addition to these government agencies, many insurance carriers have on their staffs men who are capable of sampling and rendering engineering assistance. Private consultants are also available, or one may find that an industrial hygienist is employed by your own organization.

V. J. CASTROP is Assistant Head, Industrial Hygiene Department, Research Laboratories Division, General Motors Corp., Detroit, Mich. This article has been condensed from a paper presented at the Automotive and Machine Shop Section, 35th National Safety Congress.

← Inside and outside views of vapor blasting equipment. Fine silica and water under pressure are used. Cabinets must be maintained so that leakage of mist does not occur.

→ Local exhaust ventilation of soldering operations.



This discussion will be limited to basic principles of industrial hygiene as they relate to fume and dust exposures, to indicate what control measures are available or used to protect the employee's health, and to call attention to operations and materials which are commonly used in industry, at the same time indicating generally accepted opinion as to their effect on health.

Many conditions are improved for reasons other than their effect upon health. Better products, better employee relationship, reduction in maintenance of equipment may be cited as justification for management's decisions for such correction.

Definitions

Laymen frequently designate as "fume" any vapor, fog, gas, etc., they may encounter. In industry, the plating mist over a chrome tank, the vapor or gases, at a metal-cleaning operation or the exhaust gases from a truck are frequently referred to as "fumes." To the industrial hygienist, the term has a more definite mean-

ing. For this discussion, fume may be considered to be particulate matter formed by the condensation of a vapor. A molten bath of lead at a high temperature causes the metal to volatilize and form a vapor. Upon contact with the cooler surrounding atmosphere condensation occurs and the physical state changes from vapor to a solid metallic particle.

While dust is also a solid particle, it is formed by the disintegration of solid materials by grinding, crushing, abrasion, or similar action.

Fume particles are generally small in diameter, with the size dependent upon the type of fume, the extent of flocculation, and other factors. Dust particles of hygienic significance are those between one and ten microns


in size. (25,400 microns are equivalent to one inch).

Generally speaking, there are two means of entrance of toxic compounds into the human body—by ingestion or via the respiratory tract through inhalation of fumes, dusts, mists or gases. Ingestion is of importance if toxic materials which have a systemic effect are used and adequate washing facilities are not provided, or, where the employees are slovenly in personal habits.

Inhalation is considered the most important portal of entry of fumes or dusts and the particle size, therefore, becomes significant in evaluating exposure. The particles which cause the physiological changes are those which are small enough to remain suspended in the air and not those which immediately fall to the floor. Flying particles, which may cause eye injuries are not of hygienic significance since they are not of respirable size. To judge the seriousness of an exposure by the quantity of detritus adjacent to an operation is often misleading. This is especially true where mechanical ventilation removes the fine material but is inadequate to trap or convey the larger particles.

In evaluating an exposure it is necessary to consider the toxicity of the material, the duration of the exposure, the average concentration of the contaminant with special attention being paid to those operations which produce high concentrations at some phase of an operating cycle, and the measures which have been provided

—To page 52

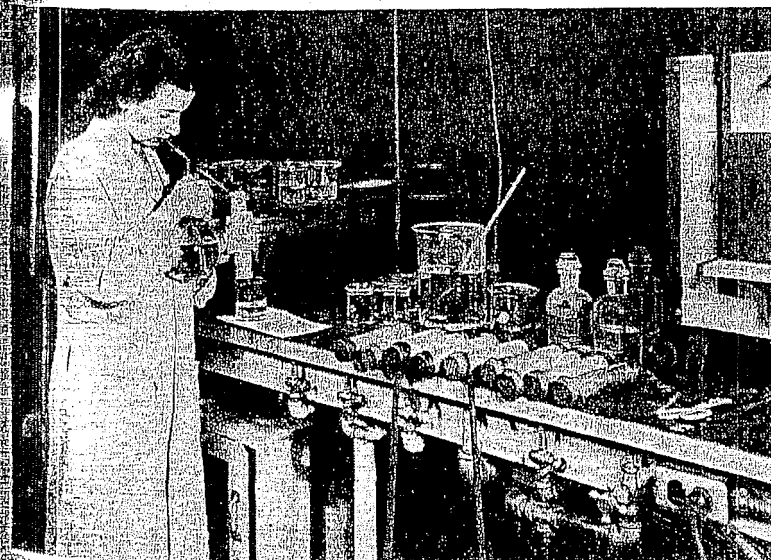

ned as
hical per
g and of
ment an
render as
exposure
ained from
visions of
partment
y govern
istrial hy
ernmenta
carrier
who an
nderm
con
or you
hygienic
organiza

Fume and Dust Exposure

—From page 21

to control the exposure. Medical records of the individuals subjected to the exposure may be of value if the examinations are thorough and frequent and not of a cursory type. It must be remembered that occupational diseases are slow in development and in some instances lasting in effect. Slow changes may not be detected, and the mere fact that cases have not occurred does not mean that exposures to known toxic materials may be ignored.

Determination of the concentration of the toxic material in the air is important in evaluating the exposure. Tests of this type are indicative not only of the degree of contamination but also, in some instances, which operation is the major offender.

The apparatus used in collecting the contaminant and the method used in estimating the amount present in the atmosphere vary with the type of material. Tests of this type are specialized in nature and are beset with many pitfalls which can lead to erroneous conclusions if done by inexperienced personnel.

Permissible Limits

In a discussion pertaining to toxic materials it is generally necessary to quote permissible concentrations, or as it is sometimes expressed—maximum allowable concentrations—permissible limits, or threshold limits. These terms are used extensively by industrial hygienists to indicate concentrations of a substance in the air which are considered compatible with good health. The limit usually applies to exposures of eight hours duration for a prolonged period.

The limits are, for the most part, advisory standards or bench marks which are practical to meet. In general, these limits are derived from three types of evidence all of which have value and limitations.

1. Animals have been exposed at different concentrations and the effects noted.
2. A few experiments have been made on human subjects for short periods of time.
3. Safe limits have been arrived at by measuring the concentrations of substance in the workroom air and correlating this information with results of medical examinations of workmen.

The mere fact that these limits are exceeded does not necessarily mean that someone will become definitely ill. But there is a good probability that someone will suffer ill effects if the limit is greatly exceeded for a considerable period. There remains much to be learned regarding the toxicity of many substances used in industry.

So much for the general picture. Now let's look at some specific operations.

Welding

Welding processes most commonly used can be divided into three types, arc, gas, and resistance. The safety measures pertaining to clothing, goggles, and helmets are of common knowledge and will not be considered here.

Arc welding when performed on uncoated steel does not produce a condition considered harmful to the welder, provided it is done in a comparatively large open area. The fumes which result from welding consist essentially of the oxides of iron and oxides of metals which may comprise the steel or coating of the welding rod. Some investigators have found characteristic markings on chest x-rays of men who have welded under severe conditions for long periods of time. These markings are presumably due to the deposition of iron fumes within the lungs, but it has not been demonstrated that such fumes have caused physical impairment.

A frequently suggested limit for welding fume is 15 milligrams of iron oxide per cubic meter of air. Concentrations of this magnitude existing in the workroom would materially reduce visibility and thereby become a nuisance or an unsafe condition requiring correction.

Welding within confined areas such as tanks, inside machinery or equipment, or in small rooms presents a condition which can be of concern. The concentration of fume is materially higher under these conditions as there is little opportunity for dilution by natural air currents normally present in a large shop. Nitrogen oxides formed by the electric arc when inhaled in sufficient quantities causes fluids to form in the lung—edema—

with resultant failure of the respiratory system. While welding in open areas these toxic gases are normally not present in sufficient quantities to cause harmful effects. However, when welding is done in confined areas, the nitrogen oxides reach a concentration which is harmful.

Gas welding generally is not productive of harmful fumes. There is, however, in brazing two potentially harmful exposures. While borates or borates generally are used in brazing fluxes, some metals require containing significant quantities of fluoride compounds and fumes from these fluxes have been known to produce significant nasal irritation. Fluorides in general are looked upon with suspicion since they may produce harmful effects upon the structure. A limit of 2.5 mg per cubic meter has been suggested for fluorides, but no standard has been agreed upon. Most industrial hygienists attempt to keep them as low as practicable.

Silver solder is one of the common alloys used in brazing. Fumes of this type vary in composition and may in some instances contain cadmium which, if volatilized in sufficient quantities, is considered harmful. At present the suggested limit for cadmium fume in air is 1 mg per 10 cubic meters of air.

Resistance, spot, or butt welds on plain steel is of no concern from a physiological standpoint. The fumes arising from such operations are generally caused by the volatilization of which has come upon the metal during previous operations and has been placed upon the metal as a preventive.

The preceding discussion of welding operations has been based on the assumption that the metals welded are of plain steel. The performance of welding operations on other arc, gas, or resistance metals which have been coated with such toxic materials as lead, cadmium, or mercury may cause harmful exposures. The heat of the flame of the arc causes volatilization of these metals. Welding or cutting onterne plate or other metals containing significant quantities of lead can result in the volatilization of lead which if inhaled for a sufficient period of time, may result in lead poisoning.

—To page

Burlington Mills Corp.

Bristol Weaving Co., Bristol, Tenn.
January 19, 1940, to date; 360 employees; 6,218,430 man-hours as of December 17, 1947. A plaque and flag are awarded for each million man-hours without a disabling injury (Rayon weaving).

The Firestone Tire and Rubber Co.

Akron Mechanical Shop—November 12, 1946, to date; 2,000,000 man-hours as of December 22, 1947.

New Orleans Public Service Inc.

New Orleans, La.,—Mechanical Operation Section, Power Division, Electric Department—May 17, 1944, to date; 51 employees; 500,000 man-hours as of December 31, 1947.

Fume and Dust

—From page 52

...and ultimate poisoning. The cutting or welding of surfaces which have been coated with paint containing lead has caused lead poisoning. Welding of cadmium plated material was attributed as the cause of illness and even death to a number of individuals during the war. The reported cases indicated that death occurred in a comparatively short time after the exposure.

Welding of galvanized metal causes volatilization of the zinc coating. Temporary discomfort associated with metal fume fever may result from such exposure.

Where warranted, control of welding fumes is generally accomplished by providing a mechanical ventilation system. The type of ventilation used is dependent upon the nature of the welding. When the object to be welded is positioned in a fixture or jig it is possible to obtain effective control of the fumes by the use of a grill, hood, or flexible duct near the source of fume. If the parts are large and it is necessary to weld more than a foot from a fixed point, it is difficult to obtain good control of the fume with reasonable air volumes through a system using flexible ducts.

Since the effective range of most flexible ducts is approximately eight inches from the dust opening, it is necessary for the welder to move the duct whenever the arc is outside this range. The practical result is that


ELIMINATE THIS

ACCIDENT REPORT

Joe Smith, Lathe Dept., slipped on oil splash, tore knee ligaments—Compensation claimed.
Mary Rocco, scrub woman, fell on wet floor, dislocated hip—Compensation claimed.
Pat Ryan, Receiving Dept., slipped on wet platform, broke wrist—Compensation claimed.

By
Using

SKIDMASTER

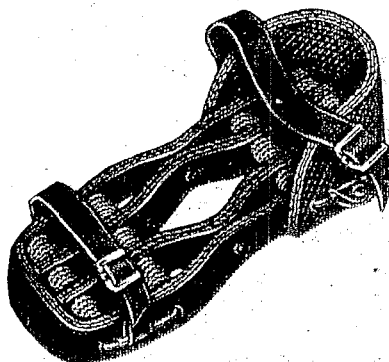

Whenever there's a slipping hazard there's a possible time lost accident, a possible compensation claim and a need for sure, easy-to-wear SkidMASTERS.

StaSafE SKIDMASTERS assure safe footing on oil-slick floors or other slippery surfaces. Indoors or out, SKIDMASTERS offer economical protection against slipping hazards.

Write for Bulletin No. 104

STANDARD SAFETY EQUIPMENT COMPANY

232 West Ontario Street, Chicago 10, Illinois

NEWARK

CLEVELAND

LOS ANGELES

KEEP IT CLEAN

Specialists in Powdered Hand Cleaners

- SOPAC—beaded soaps and vegetable scrubber
- STEROPAC—ph 7.0
- LANOPAC—contains lanolin
- BOROPAC—borax scrubber

"A Wee Bit Goes a Long Way"

WE INVITE AN OPPORTUNITY TO SERVE YOU

SKOTCH PRODUCTS CORPORATION
2710-12 Detroit Ave. Cleveland 13, Ohio

most ducts are normally not moved and the ventilation system does not remove the fumes. According to reports, this type of system has been effectively used in shipyards for the control of welding fumes in confined areas. In view of this experience it should therefore be a satisfactory means of control for welding fumes in tanks. However, supervision and education are necessary to make such systems effective.

Where the room volume per welder is large, natural ventilation within the plant is usually sufficient to prevent accumulation of excessive concentration of fumes from plain steel

welding. Circulating fans directed from the side help to dilute the fume which may be concentrated in the breathing zone of the welder.

Another means of control is the use of personal respiratory equipment. Air line respirators and fume respirators have been developed which will provide adequate protection. Some manufacturers have on the market welders' helmets with facilities for providing fresh air to the wearer. Use of this type of equipment has been limited. Since the welder is already burdened with helmet, goggles, and protective clothing he probably will not be receptive to

a respirator. It is sufficient in welding for the employee to arrange ordinary helmet and to arrange position of the work so as to prevent the concentrated fume from blowing under the helmet.

Dry Grinding

Dust resulting from the grinding of nontoxic metals which are fine sand is generally considered a nuisance and is not harmful. Despite this fact some state laws require grinding operations to be ventilated. This requirement has probably been a holdover from the time when sandstone wheels were prevalent and also to prevent the creation of a nuisance condition. Grinding wheels in use in industry have facial abrasives, such as aluminum oxide or silicon carbide. Emery, a natural product composed essentially of aluminum and magnetic oxides of iron, may also be used. A permissible limit of 50 million particles per cubic foot of air for aluminum oxide, silicon carbide was recently accepted by the members of the American Conference of Governmental Industrial Hygienists. Such a limit for general and concentrations of such magnitude are normally not encountered.

When lead, silica, or some similar toxic material comes in contact with the grinding wheel the exposure to the abrasive matter may be high and the exposure evaluated on the basis of the toxic material. If the latter material is controlled, the nuisance will also be eliminated.

Ventilation systems for grinding wheels have been fairly well standardized and generally are satisfactory to prevent a nuisance. Hoods should enclose the wheel as completely as practicable. Air volumes should be sufficient to draw air from the hood when using the smallest wheel. This is especially true when toxic materials are involved.

Wet Grinding

Baffles, hoods, and guards are generally located near wet grinding wheels to prevent dispersion of liquid used as a coolant. These devices are usually sufficient to control the dust if it is nontoxic in nature. If the dust liberated is toxic, mechanical exhaust ventilation may be required.

Buffing and Polishing

Buffing compounds applied

Only in Safe-Hi

LADDER SHOES

**DO YOU GET THESE
EXCLUSIVE FEATURES
BECAUSE...**



SAFE-HI has straight ridges of mixed cord and rubber in the Tread

For smooth, dry surfaces, you must have rubber . . . because rubber holds firmly on DRY surfaces, but would slip on wet surfaces.

For wet, slippery surfaces, you must have cord . . . because cord holds securely on wet surfaces.

For greasy, soapy surfaces, you must have straight ridges . . . because ridges cut thru and scrape off grease, suds, and grime.

For snowy, icy surfaces, you must have a spike — and a sharp one . . . because dull spikes are a hazard. The SAFE-HI spike is self-sharpening . . . always sharp.

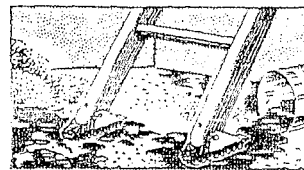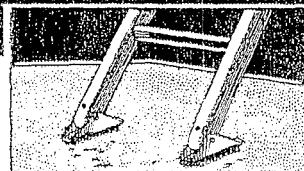

Ask your safety dealer
or write us

ROSE MANUFACTURING CO.
1731 Arapahoe St. Denver 2, Colo.

cient in
to we
range
as to p
from f

the gun
ich are fr
sidered
rmful pe
state law
ons to be
ent has
from the
ls were
nt the crea
tion. Gun
stry have
s aluminum
Emery, an
d essential
etic oxide
A permi
ticles per
um oxide
cently acc
the Amer
mental in
mit
such
ot encount
or some sm
in contact
exposure
ay being
aluated
aterial. The
rolled, the
minated
for gen
rly well
are satisf
Hoods sh
completely
mes should
ward flow in
g the small
ully true wh
olved.

guards are
wet gr
person or
tant. These
cient to con
oxic in nat
toxic
usion may
g
s applied

February

wheels used for buffing and polishing vary in composition. Waxes and various types of abrasives are the major components. These materials, plus lint and fibers from the wheel, are the essential ingredients of the airborne dust. The toxicity is dependent upon the type of abrasive. Generally ventilation is provided to improve housekeeping and reduce the number of complaints and not because of the hazard to health.

Machining

Smoke from oily parts is the prevailing source of air contamination in machining operations. Illness has been attributed to this type of exposure. As is the case with most mists and dusts of the nuisance variety, little is known as to what effect these materials have on existing physical abnormalities.

Machining operations on steel produce large chips or turnings; consequently, dust is not a problem. Operations involving the machining of lead alloys have been studied, and significant quantities of airborne dust have not been demonstrated.

Graphite which becomes airborne during the machining of cast iron is considered physiologically significant and therefore, is classified as a nuisance dust. Frequently management considers it advisable to provide ventilation for the machines which are productive of the most dust. Graphite on the clothing and upon and surrounding machinery is conducive to many complaints.

Grinding Cleaning

Since silica is recognized as the most harmful of mineral dusts, an adequate ventilation system is normally provided at the time of installation of commercially built sand blast equipment. Continuous usage and lack of maintenance result in a breakdown of adequate control. Visible escape of dust is the best evidence that this has occurred and it is advisable to correct such a condition without undue delay.

Employees who are stationed in blast rooms are dependent upon personal respiratory equipment. Devices of this type are of the supplied-air variety, and it is necessary that the equipment be free of harmful contaminants. Air compressors should be located in an area free of contamination, otherwise the contaminant will be transmitted to the helmet.

16,500 Killed in Industry

Help reduce this figure with Precision Hearing Testing



The 16,500 occupational death toll reported in 1946 by the National Safety Council is industry's challenge to provide greater safety for its employees. Working hand in hand with science, industry can reduce this staggering figure.

New scientific techniques for checking physical fitness of employees now include periodic hearing tests with a pure tone audiometer.

Avoid accidents caused by faulty hearing in your plant. Check your employees hearing regularly with a precision ADC Audiometer.

Hearing tests with a precision ADC Audiometer will furnish you with valuable data for permanent records. Give pre-employment hearing tests to determine applicant fitness for specific jobs; and periodic tests to detect need for occupation re-adjustments.

EQUIP your doctor, nurse or clinic with the latest development in scientific hearing testing —an ADC Audiometer. Operation is easy with factory-provided instructions.

WRITE TODAY for informative Bulletin D-100.



"Audio Develops the Finest"
Audio Development Co.

2833-13th Avenue So., Minneapolis, Minn.

FIRE HOSE DRYING



MADE EASY WITH **CIRCUL-AIR**
The Air Conditioning Hose Dryer

Saves time — saves space — eliminates man hours — keeps all hose in service — hose dries in a few hours. Makes good hose last longer — prevents mildew and rot.

USED BY MOST OF AMERICA'S LARGEST INDUSTRIES



THE **CIRCUL-AIR** CORPORATION
575 East Milwaukee Ave. Detroit 8, Michigan

Normally, ventilation within the room is provided so as to improve visibility and to help prevent the escape of dust to the surrounding areas, not to reduce the concentration of silica dust to a safe level.

Tumblast or rotating table type of sand blast units should be provided with sufficient ventilation to prevent the escape of silica dust. Leakage due to excessive wear should be remedied.

Small sandblast cabinets, where the operator controls the blast nozzles from outside the cabinet, frequently have faulty seals around the doors or the rubber gauntlets are loose or torn. The dust which escapes from the cabinet through these openings is in close proximity to the breathing zone of the employee and in many instances exceeds the permissible limit for silica. This leakage should be corrected and the men should not be required to use respirators.

If the articles being blasted are free of silica or other toxic material, the dust resulting from grit or shot blasting is classified in the nuisance category. It follows that the maintenance of ventilating systems for grit blasting, although desirable, is not always so necessary as for sand blasting.

The use of steel grit or shot in blasting rooms produces excessively high concentrations of dust within the enclosure. It is therefore, necessary to protect the worker within the room. The remarks concerning sandblasting rooms are therefore, pertinent when considering rooms in which steel grit or shot are used as the abrasive.


Vapor blasting, a variation sand blasting, is a comparatively recent development. This procedure involves the use of fine silica and under pressure. The silica used in vapor blast units varies in size may even be as small as 1250 (approximately 10 microns) and is generally believed that airborne particles below 5 microns are significant in causing silicosis. It then follows that operations involving the use of silica abrasive whose particle size approaches the order of magnitude are more hazardous, and, require continual vigilance in maintaining good control. It is therefore, essential that the blast cabinets be maintained so that leakage of mist does not occur.

Good housekeeping is also essential as spillage of the sand and sludge upon the floor will create a source for dust dissemination when the water evaporates. Likewise, containers of the dried sludge should be allowed to stand in the area where they can be influenced by currents of high velocity.

Practically all industrial operations which involve the use of lead base bearing metal



Abrasive dusts irritate workmen and slow production. Eliminate them with **TORIT DUST COLLECTORS**

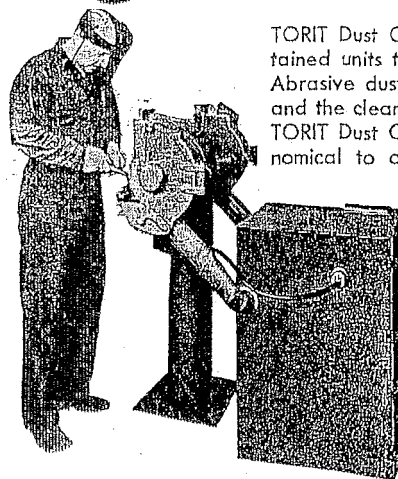

TORIT Dust Collectors are completely self-contained units that are attached at the machine. Abrasive dusts pass through spark-proof filters and the cleaned air is recirculated. TORIT Dust Collectors are easy to install, economical to operate, and may be moved as production layouts are changed. Sizes ranging from 1/3 HP to 3 HP, and fitting all standard grinding, cut-off and polishing wheels are available for immediate delivery. For details and latest TORIT catalog write:

TORIT
MANUFACTURING CO.
291 WALNUT ST. • ST. PAUL 2, MINN.

STANDARD
Directional
SIGNS

WRITE FOR LATEST CATALOG SHOWING
SAFETY SIGNS FOR ALL PURPOSES
STANDARD SIGNS, INC.
3190 E. 65th ST. CLEVELAND 4, OHIO

variation
atively
reduce
ica and
ilica, use
in size
is 1250
rons)
irborne
ons are
silicosis
ons invol
re whose
roaches
more har
ual vigil
ontrol
the av
ined so
occur
s also
id and
will crea
nation
kewise
e should
the fac
nced
trial
ive
is met

RD
1
SOLID
SUPER
THERM

VISITORS
PARKING

INC.
2-510

older. Babbitt bearing metal contain-
ing approximately 75 per cent lead
have been encountered. The composi-
tion of solder metal is variable and
dependent upon the purpose for
which it is used, with ordinary soft
solder containing a comparatively
high percentage of lead.

Assuming that the babbitt or solder
contains a significant amount of lead,
the question then arises as to whether
or not employees working with this
material will become ill. The answer
could be given by a qualified indus-
trial hygienist after he had seen the
operation and considered such factors
as the temperature to which the metal
is heated, the method of removing ex-
cess solder, the length of exposure,
and the effectiveness of the control
measures provided.

It is a well known fact that lead
causes illness if absorbed in excessive
amounts, and therefore operations
where lead is used have received con-
siderable study. Out of this experi-
ence certain practices are known to
produce excessive exposure whereas
other practices have been proved not
to be harmful. It is generally con-
sidered that excessive concentrations
do not result from operations where
solder is applied by means of an elec-
tric soldering iron. This is probably
due to the small amounts of solder
used and the comparatively low heat
of the metal.

When the iron is heated in a small
refined furnace, the exposure may
be of greater consequence. Solder
which remains on the iron coming
into contact with the flame or heat is
vulnerable for volatilization. Small
amounts of solder drop from the iron
onto the hot floor of the furnace
where it is readily volatilized or ox-
idized. The oxidized material may be-
come airborne due to disturbances
created by the flame or by removing
or placing the soldering iron in the
furnace.

Frequently industrial hygienists
recommend that ventilation be pro-
vided for heating units of this type,
thereby removing lead fumes and
heat from the environment. This is
particularly true in small rooms or
where many units are in use.

Atmospheric contamination occa-
sioned by the use of either gas or
electrically heated pots containing
solder is dependent on a number of
factors. With higher temperatures
more volatilization will occur and the
greater will be the exposure. With the

higher temperature the metal is more
readily oxidized to produce a dross
consisting of a high percentage of
lead oxide. The dross may provide a
protective coating to reduce the vola-
tilization of the lead; however, dis-
turbance of this coating will create
an exposure.


As a safeguard against excessive
contamination, pots containing solder
or babbitt are usually ventilated.
Wherever possible, it is advisable to
enclose the pot as completely as pos-
sible and provide sufficient air vol-
ume to overcome the thermal effects

of the molten metal. Attempts have
been made to use natural draft ven-
tilation systems to control these fumes
and in those instances where the ducts
were not of sufficient diameter the
system was inadequate. A preferable
method is the use of mechanical sys-
tems.

The removal of excess solder with
power-driven tools, such as grinding
wheels, discs, or wire wheels, creates
airborne dust which may contamin-
ate large areas if the operation is ex-
tensive. Diligent use of abrasive cloth
will also result in excessive concen-

WHEN DANGER TIPS THE SCALE

WORKERS ARE SAFER IN STASAFE PROTECTIVE GARMENTS

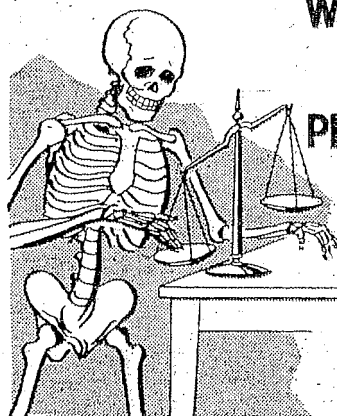

Dermatitis, burns and injuries threaten workers not properly protected from the materials they use. StaSafe Protective Garments are designed to give the worker maximum protection.

Oils and Grease
Acids and Caustics
Tars and Creosote
Paints and Lacquers
Naphtha and Solvents
Flame.

Each of these represents a potential lost time accident. Protect your workers against these hazards by standardizing on StaSafe Protective Garments.

Stock models solve many problems; Standard's free design service will develop a new model or modify an existing one to solve your special safety problem.

Write for Bulletin No. 106

StaSafe Products
are manufactured by



STANDARD SAFETY EQUIPMENT COMPANY

232 West Ontario Street, Chicago 10, Illinois

NEWARK

CLEVELAND

LOS ANGELES

trations of lead dust. Filing, however, is not productive of small particles and is preferred over the use of power-driven tools.

If filing is not practicable, it will be necessary to provide some type of mechanical ventilation system for the solder removal operations involving the use of power tools. Since the permissible limit generally accepted for lead is 1.5 milligrams per 10 cubic meters of air (353 cubic feet) it will be necessary to have an effective system to provide adequate control. Engineers experienced in designing ven-

tilation systems to control toxic materials should be consulted, otherwise a costly system might be erected and later found entirely ineffective.

Frequently solder removal operations require the use of portable tools on large objects and a local exhaust system would not be effective, as is the case in the fabrication of automobile bodies. General contamination of the factory with lead dust has been eliminated by enclosing the entire operation in a large booth and exhausting a sufficient quantity of air from the enclosure to insure a constant in-


ward flow of air from the factory into the booth. Under these circumstances no practical amount of air could be removed from the booth to reduce the lead concentration to a safe level and therefore it is necessary that men working therein be provided with adequate personal protective devices.

Heat Treating

High temperatures are a frequent source of complaint from employees in heat treat departments but conditions and their control are within the subject under discussion.

Fumes from cyanide pots are associated with cyanides used as fumigants or as the lethal agent in death chambers, and supervisors as well as the employee become apprehensive. Fumes from such a source are irritating and because of this property should be adequately ventilated. The irritant nature of the fume is caused by alkali formed in the decomposition of the cyanide.


Molten lead is sometimes used as a hardening medium for metals. Frequently charcoal or some similar material is placed on the surface of metal to conserve heat and pro-

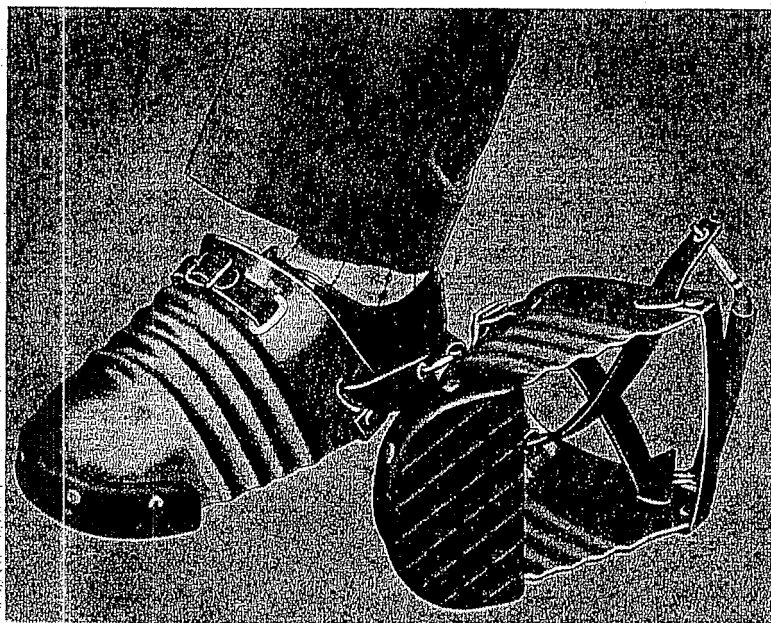

THIS IS THE NEW ANTI-SKID TOE CLIP

"SANKEY" Foot Guards are now available with a rubber anti-skid toe clip $\frac{3}{4}$ -inch longer than formerly used. "SANKEY" FOOT GUARDS consist essentially of a metal shield to be worn over the shoe whenever the foot is in danger of being either crushed or cut. The metal shield is designed to furnish a maximum amount of protection to the entire front of the foot—not merely the toes alone, but also to the instep against hazards from falling, rolling or flying objects, or from accidental tool blows. Write for literature or a trial pair.

ELLWOOD SAFETY APPLIANCE COMPANY
219 SIXTH STREET ELLWOOD CITY, PENNA.

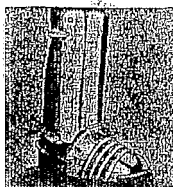


Combination
Foot-Shin Guard



New Anti-Skid
Full Sole



Fibre Shin Guard

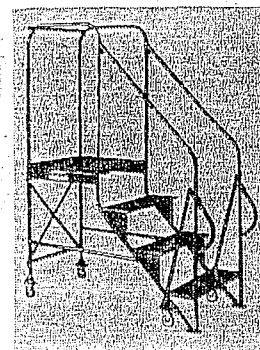

Handy-Jack STAIR STAND

is the answer to climbing problems. speeds up work, reduces costs, and work is more efficient with no fear of falling or strain. Stand is ideal for cleaning, servicing, reaching, and handling stock in and out of bins and shelving.

Features include strength, light weight, ample platform space, waist high guard rail, stability, plus HANDY JACKS for a rigid stand. Built of steel tubing and selected wood painted with two coats machine enamel, with neoprene wheels, available in various models. Write for further information.

*Patents applied for

R. W. FIERON CO., INC.
3401 S. Hoyne Ave., Chicago 8, Illinois

factory in-
stance
could be
to reduce
a safe level
ry that
provide
ective d

a frequen
employe
s but such
rol are
discussion
ts are on
used
d agent
ervision
comes
ch a source
se of the
ately ven
ure of the
rmed upon
ide.
es used
etals
similar ma
of the
to preven

STAND
problems
osts, and
o fear of
ideal for
ng, and
bins and
ht weight
ist high
HANDY
Built of
d wood
achinery
it is
for

), INC.
B, Illinois

oxidation. A covering of this type reduces the volatilization of lead while the bath is quiescent, but has no effect while the bath is in use. Adequate ventilation should therefore be provided for baths of this type. As complete an enclosure as is practical for the operation being performed is advisable with air quantities dependent upon the open areas in the hood. To prevent contamination resulting from volatilization of lead accumulating in the combustion chambers the products of combustion from gas fired lead pots should be vented to the outdoors and not be allowed to dissipate into the workroom.

Asbestos

Asbestos used in the formulation of brake lining is a potentially harmful compound. This material is the offending agent in the production of the lung ailment known as asbestosis. The harmful effect is comparable to that of silica and a permissible limit of 5,000,000 particles of asbestos dust per cubic foot of air is generally recognized.

Dust exposures to asbestos and other ingredients of the brake lining exist when the dry materials are handled and emptied into the mixers and in the subsequent operations of blitting, grinding, or surfacing. Compounds of lead are sometimes used in brake linings, and contamination from this source should not be ignored. Local exhaust systems with properly designed hoods or enclosures are used to remove the dust from these operations.

Iron Foundries

The principal ingredients of foundry dusts are silica, sea coal, clays, and parting compounds. The predominant material will be dependent upon which phase of the foundry operation is being studied and what operation is being performed. The control of dust is the major problem, whereas fume is of secondary importance.

A discussion of all the aspects of the industrial hygiene problems in such plants would require a separate treatise. For the present discussion it should be sufficient to state that all obvious sources of dust dispersion should be reduced to a minimum by adequate localized exhaust systems. In a mechanized foundry such places would be sand conditioning and mixing equipment, tumbling mills, shakeouts, core removal and knockout sta-

tions, transfer points of dry sand, abrasive blasting operations, and all grinding operations performed on castings containing appreciable quantities of sand.

Maintenance of ventilation equipment is a major item in foundries because of the abrasive action of the dust. It is imperative that a good program be maintained so as to keep the equipment functioning at maximum efficiency.

Because of the heat associated with large scale foundry activities it is a common sight to see pedestal fans or

air cooling ducts directed in such a manner as to create cross drafts which interfere with the efficient removal of dust. Better placement of these fans or ducts will go far in reducing dust concentrations in the areas where they are used.

Respiratory Protective Devices

After the obvious has been corrected, it is advisable that a survey of the foundry be made by an industrial hygienist so that an accurate evaluation of the exposure may be obtained.


As has been stated, the atmospheric

Safe-T-vis: the goggles that workers will wear

No purse?



No drawer?



No back pocket?



because they're

Light!

No, the glamor gal's all and the upper right cache may be full with accumulation of year pocket may bulge—but you won't find lightweight Safe-T-vis there. Not during working hours you won't!

The weight of two Safe-T-vis lenses, made from a new allyl casting resin, is approximately the same as that of one case hardened glass lens of the same size.

8-HOUR Comfort

Workers find Safe-T-vis lightweight, attractive and comfortable. What a change from old type goggles whose weight causes workers to remove them chancing exposure to hazard!


8-HOUR Protection

Real protection comes only when goggles are worn *throughout* the period of exposure. And complete protection is the *only* function of any safety goggle.

And they are SAFE

Standard drop-ball tests prove Safe-T-vis' superiority over ordinary eye protection. Safe-T-vis offers greater resistance to abrasion than do other plastic lenses. It resists the stresses of high velocity impact, corrosion and other causes of industrial eye injury to the most exacting specifications.

Write for booklet giving complete details.

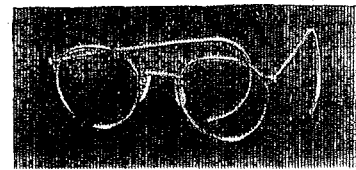

Safe-T-vis

Lightweight protective spectacles

A product of THE UNIVIS LENS COMPANY, Dayton 1, Ohio

WHERE
TO GET THE PROTECTIVE AP-
PAREL DESIGNED TO FIT THE
MAN-AS-WELL AS THE NEED

WHEN
YOU WANT IT—
WHEELER
PROTECTIVE APPAREL

Write or 'phone:

BALTIMORE
CAREY MCHY. & SUPPLY CO.
BIRMINGHAM
SAFETY ENG. & SUPPLY CO.
BUFFALO
THE ELWOOD COMPANY
CAMBRIDGE, MASS.
CUTTER, WOOD & SANDERSON CO.
CHARLESTON, W. VA.
SAFETY FIRST SUPPLY CO.
CHICAGO
PROTECTIVE EQUIPMENT INC.
CINCINNATI
THE E. A. KINSEY CO.
CLEVELAND
SAFETY FIRST SUPPLY COMPANY
COLUMBUS, O.
THE E. A. KINSEY CO.
DAYTON
THE E. A. KINSEY CO.
DENVER
E. D. BULLARD COMPANY
HOUSTON
ALLIED SAFETY EQUIPMENT CO.
INDIANAPOLIS
THE E. A. KINSEY CO.
LOS ANGELES
E. D. BULLARD COMPANY
MILWAUKEE
PROTECTIVE EQUIPMENT INC.
NEW YORK CITY
W. S. WILSON CORP.
PHILADELPHIA
INDUSTRIAL PRODUCTS COMPANY
PITTSBURGH
SAFETY FIRST SUPPLY COMPANY
ROCHESTER
THE ELWOOD COMPANY
ST. LOUIS
SAFETY INCORPORATED
SALT LAKE CITY
UNIVERSAL SAFETY APPLIANCE CO.
SAN FRANCISCO
E. D. BULLARD COMPANY
SEATTLE
E. D. BULLARD COMPANY
SYRACUSE
SYRACUSE SUPPLY COMPANY
WHEELING
SAFETY FIRST SUPPLY COMPANY

**WHEELER PROTECTIVE
APPAREL, Inc.**

Formerly known as F. H. Wheeler Mfg. Co.
224 W. Huron St. Chicago 10, Ill.



concentration of dust and fume and other materials may be reduced to a safe level by adequate exhaust ventilation. In some cases it is possible to correct the condition by substituting a less toxic material. If these measures are not practical, respiratory protective devices may be used. They may also prove valuable in giving protection during an emergency or to provide protection for intermittent exposures or to supplement other methods of control. They should, however, not be considered as the desirable means of controlling a health hazard.

Ceramic Plant

—From page 37

Handling materials is recognized as a prolific source of accidents in industry; consequently it is a fundamental that handling should be kept at a minimum to avoid accidents as well as to keep down operating costs.

3. Nearly every ceramic plant must store large quantities of finely ground material. Many storage systems are of the deep bin type. Some of the materials do not flow freely, and because of forces developed in deep granular material, arching takes place. Often devices are not provided to keep material moving to the bottom of the bin. As a result, a worker must enter the bin from the top to get the material moving. This is a dangerous operation but when necessary, safety harness and life lines should be used and attendants stationed where they can help in an emergency.

4. Silicates and silica or quartz are primary materials in nearly all of the ceramic industries. Also, these materials are generally used in a finely ground state. As a result there are many dust problems. When the free silica in these dusts is finely divided, workers exposed to them are potential victims of silicosis. Either workers must wear respirators or dust must be removed from the work place by exhaust ventilation with a system of dust collectors.

Control of dust should be a major consideration in the ceramic plant. Not only is dust injurious to workers, but it is also harmful to machinery, complicates housekeeping, and produces generally unsatisfactory working conditions.

5. Operation of kilns, tanks and furnaces presents other hazards. Often there is the possibility of explosions and refractory failures. All

such equipment must be designed and constructed for safety as well for processing requirements. Protective equipment should be provided for use in case of power failure or faulty combustion conditions.

6. It is hardly necessary to say that moving parts of machinery should be guarded. Wherever practicable, such guards should be in to the machinery.

7. In general, building structure and equipment used in the ceramic industry are subjected to rigorous use. Fumes, heat, dust and loads create problems; consequently a relatively high factor of safety factor of uncertainty should be incorporated in the design.

The solution of many of the problems will require the cooperation of the safety, production and engineering departments. Compromises required, should be those necessary for process reasons, since it is well known that the process is the prime reason for the plant.

Planning the original design layout and selecting equipment with the safety angle in mind will guard the investment as well as reduce the accident risks.

IT'S TOO LATE WHEN

**DERMATITIS
NEEDS
MEDICAL
CARE!**

Strike at the
Cause with
SPUN-DERMA-C
Hand Cleanser



Spun-Derma-C gets into those tiny cuts and abrasions to thoroughly cleanse . . . removes dirt, oil, grease, paint, tar, ink, and grit of all kinds without hurting the most delicate hands. It's a chap-free cleanser carefully blended of 7 elements with a specific function: scrubbing without skin, combating dermatitis, restoring oils, "fluffing" to last up to 1/32 inch. Federal and State requirements for hand soap. Passes every test in over 100 industrial plants. Available in 100, 300, 500 cartons of twenty-four 5-lb. boxes. Information.

"Guarding the Hands of Industry"

Spun-Derma-C
L. E. HICKS & SON
CHEMISTS

509 S. GROVE AVE.

OAK

National Safety News, February