FRICTION MATERIALS STANDARDS INSTITUTE
588 MONROE TURNPIKE, MONROE, CT 06468

AUTOMOTIVE DATA BOOK BULLETIN #1-991
September 23, 1999

This is the first Automotive Data Book Bulletin since printing the 1999 Automotive Data Book.

	FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
ACURA			
1999, RL	7656-D787**	D/D	7418-D536**
AUDI			
1999, A4	7434-D555**	D/D	7309-D228**
1999, A4 Avant	7434-D555**	D/D	7309-D228**
BMW			
1988-87, M6		/D	7683-D809** (Notes #8 & #16)
CHEVROLET TRUCK			
Tracker 1999	7680-D807** (Notes #5 & #14)	D/N	1511-S743* (Notes #10 & #19)
CHRYSLER (See Comments & Corrections)			
1999, Concorde	7678-D730** (Note #3)	D/	
1999, LHS	7678-D730**	D/	
1999, 300M	7678-D730**	D/	
DODGE			
1999, Viper	7471-D592**	D/D	7472-D491**
DODGE TRUCK (See Comments & Corrections)			
B2500 1999-98	7677-D655** (Note #2)	D/	
B3500 1999-98	7677-D655**	D/	
B1500 1999		/BH	2182T-S734* (Note #11)
B2500 1999		/BH	2182T-S734*
FORD			
1999, Escort OR		/D	7682-D663* (Note #7)

SEE DISCLAIMER AT END OF BULLETIN
FMSI® and FMS® are registered trademarks of the Friction Materials Standards Institute, Inc.
Copyright© by Friction Materials Standards Institute, Inc.

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
LINCOLN (See Corrections)				
2000, LS		7676-D805** (Notes #1 & #12)	D/D	7679-D806** (Notes #4 & #13)
1999, Continental		7633-D765**	D/	
MERCEDES				
1999, CLK 320		7609-D740**	D/D	7526-D603**
1999, CLK 430		7609-D740**	D/D	7526-D603**
1999, ML 320		7628-D760**	D/D	7629-D761**
1999, ML 430		7628-D760**	D/D	7629-D761**
1999, S 320		7564-D689**	D/D	7526-D603**
1999, S 420		7564-D689**	D/D	7484-D603**
MERCURY				
1999, Cougar			/N	1510-S742* (Notes #9 & #18)
	OR		/N	1504-S736*
MITSUBISHI				
1999, Diamante		7412-D530**	D/D	7591-D724**
1999, Galant		7365-D484**	D/N	1445-S658*
	OR	7412-D530**	D/D	7272-D383**
1999, Mirage		7483-D602**	D/N	1415-S677*
	OR	7365-D484**	D/	
PLYMOUTH				
1999, Prowler		7597-D730**	D/D	7598-D730**
SAAB				
1999, 9-3		7605-D800**	D/D	7614-D709**
SUBARU				
1999, Impreza		7590-D722**	D/N	1462-S676*
	OR	7589-D721**	D/D	7351-D471**
VOLKSWAGEN				
1998, Eurovan			/D	7681-D808** (Notes #6 & #15)
1999, GTI		7578-D704**	D/D	7234-D340**
	OR	7434-D687**	D/	

EMERGENCY & PARKING BRAKE

CHEVROLET	DD	SIZE	PCS	SIZE LOCATION
1982-65, Corvette	6.50	1.25 X .156 X 6.75	4	1299 Internal (S741)

COMMENTS

Existing shoe with new lining:

Shoe	Assembly	Application
D655	7677-D655	1999-98 Dodge B2500/B3500 Front
D730	7678-D730	1999 Chrysler Concorde, LHS & 300M Front
S734	2182T-S734	1999 Dodge Truck B1500, B2500 Rear

CORRECTIONS

1999 Chrysler Concorde,LHS & 300M front application was originally listed as FMSI 7623-D730. The correct set number is FMSI 7678-D730.

1999-98 Dodge B2500/B3500 vans formerly listed as FMSI 7535-D655 for front applications. The correct FMSI number is 7677-D655.

1999 Dodge Truck B1500, B2500 Rear was originally listed as FMSI 2182TT-S734. The correct listing is FMSI 2182T-S734.

The 1999 Catalog lists - 1999 Lincoln Continental front as FMSI 7476-D598. The correct listing is FMSI 7633-D765.

DISC BRAKE LINING ASSIGNMENTS

Note #1	FMSI 7676		7676-D805		
7676	55.2	16.9	128.0	4	Integrally
	(2.17	.665	5.04)		Molded
(D805)					
Lincoln					
Note #2	FMSI 7677		7677-D655		
7677	43.2	17.9	185.9	4	Integrally
	(1.70	.705	7.32)		Molded
(D655)					
Dodge Truck					
Note #3	FMSI 7678		7678-D730		
7678	45.1	17.8	128.5	2	Integrally
	40.2	15.7	148.7	2	Molded
	(1.78	.701	5.06)		
	(1.58	.618	5.85)		
(D730)					
Chrysler					
Note #4	FMSI 7679		7679-D806		
7679	36.2	16.5	112.1	4	Integrally
	(1.43	.650	4.41)		Molded
(D806)					
Lincoln					

DISC BRAKE LINING ASSIGNMENTS (cont'd)

Note #5		FMSI 7680		7680-D807		
7680		38.6	14.9	114.6	4	Integrally
		(1.52	.587	4.51)		Molded
(D807)						
Chevrolet						
Note #6		FMSI 7681		7681-D808		
7681		41.1	16.0	90.2	4	Integrally
		(1.62	.630	3.55)		Molded
(D808)						
Volkswagen						
Note #7		FMSI 7682		7682-D663		
7682		30.2	11.5	88.9	4	Integrally
		(1.19	.453	3.50)		Molded
(D663)						
Ford						
Note #8		FMSI 7683		7683-D809		
7683		32.0	16.9	77.0	4	Integrally
		(1.26	.665	3.03)		Molded
(D809)						
BMW						

DRUM BRAKE LINING ASSIGNMENTS

Note#9		FMSI 1510		1510-S742		
1510	203.2	36.6	6.2	194.3	2	Bonded
	203.2	36.6	3.5	196.9	2	
	(8.00	1.44	.244	7.65)		
	(8.00	1.44	.138	7.75)		
(S742)						
Mercury						
Note #10		FMSI 1511		1511-S743		
1511	220.0	39.6	3.3	208.3	4	Bonded
	(8.66	1.56	.130	8.20)		
(S743)						
Chevrolet						
Note #11		FMSI 2182T		2182T-S734		
2182T	11.03	2.25	.200	10.70	2	Bonded
	11.03	2.25	.283	10.83	2	
(S734)						
Dodge Truck						

DISC BRAKE SHOE ASSIGNMENTS

Note #12 FMS D805

	163.2	Plate 6.0
SHOE D805	(6.43)	(.236)



7676

Clip-on anti-rattle clips

Lincoln

Clip-on metal composite shims 0.6 (.024) thick

Note #13 FMS D806

	114.3	Plate 5.8
SHOE D806	(4.50)	(.228)



7679

Lincoln

Metal composite insulator 1.0 (.039) thick

Retainer spring attached in cut-out with eyelet and washer

Note #14 FMS D807

	116.6	Plate 5.6
SHOE D807	(4.59)	(.220)



7680

Two shoes with lugs for sensors (LH,RH)

Chevrolet

Two shoes with no lugs

Metal composite insulators 0.6 (.024) thick on all

Note #15 FMS D808

	94.7	Plate 5.5
SHOE D808	(3.73)	(.217)

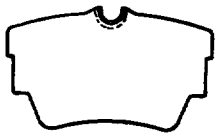

7681

Volkswagen

Retainer spring in cut-out with eyelet and washer

Metal composite insulator 0.9 (.035) thick on all

Note #16 FMS D809

	125.2	Plate 5.1
SHOE D809	(4.93)	(.201)



7683

BMW

Adhesive layer on back of all 0.2 (.008) thick

Two shoes have piston clip attached with pin 22.0 (.866) approx. free diameter

DRUM BRAKE SHOE ASSIGNMENTS



Note #17 FMS S741
6.50 x 1.25 Web .188 Corvette
SHOE S741
1299
DIH Parking Brake



Forward

Note #18 FMS S742 Forward Mercury
203.2 x 36.6 Web 3.4
SHOE S742 Fo (8.00 x 1.44) (.134)
1510

FMS S742 Reverse
203.2 x 36.6 Web 3.4
SHOE S742 Re (8.00 x 1.44) (.134)



Reverse

1510
Mercury
P/B lever riveted in top hole (LH,RH)

Note # 19 FMS S743
220 x 40 Web 4.2
SHOE S743 (8.66 x 1.57) (.165)



1511
Chevrolet

The data shown in this bulletin has been supplied by sources considered to be reliable. While we believe that such information is correct, the Institute cannot and does not accept any responsibility or liability for errors or omissions, or harm resulting therefrom.

The data shown in this bulletin indicates dimensions only and in no way refers to quality of any materials that may be embodied in the product or particular application involved, and moreover, SINCE FIELD CONDITIONS AND OTHER FACTS MAY NECESSARILY VARY FROM ONE APPLICATION TO ANOTHER, FRICTION MATERIALS SUPPLIERS AND INSTALLERS SHOULD RELY ULTIMATELY AND SOLELY UPON THEIR OWN EXPERTISE AND JUDGMENT AS TO QUALITY AND DIMENSIONAL SIZE. Under no circumstances should replacement items be used when they do not appear to fit, nor be "forced" to fit, nor be modified in the field instead of obtaining a proper sized item from a supplier. If such items are modified in the field to fit, the Institute specifically disclaims all liability and responsibility for any harm resulting therefrom.
If any error or omission is noted in this bulletin, it should be reported immediately to the Friction Materials Standards Institute Inc, 588 Monroe Turnpike, Monroe, Connecticut 06468.