



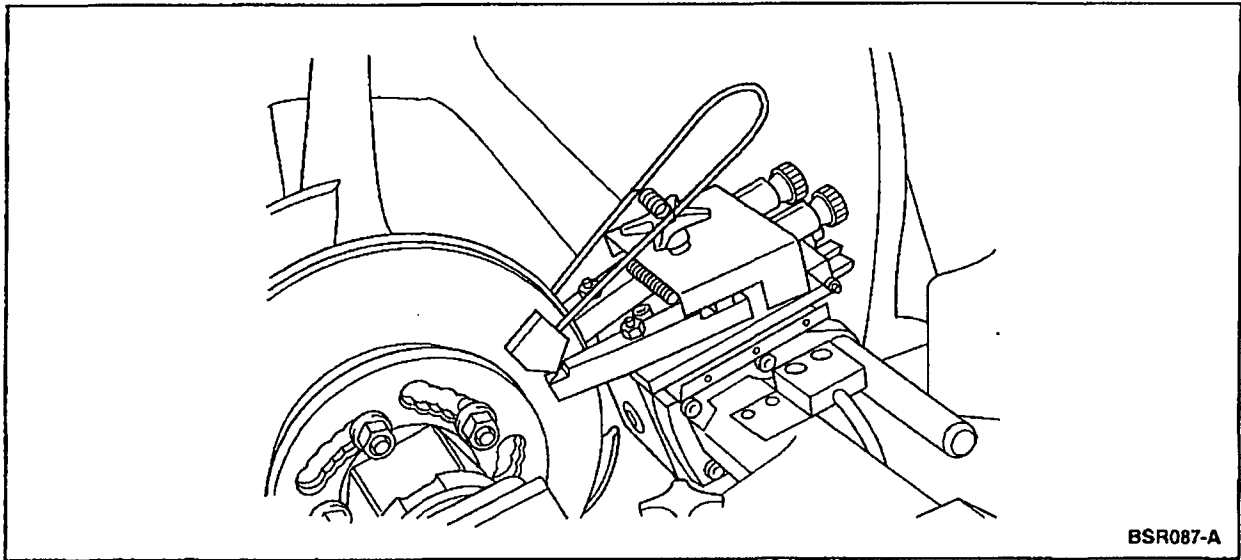

Lathe Chip Deflector / Silencer

27. Place the chip deflector/silencer over the bits.
28. Press the feed engage crank handle in to engage the automatic feed.
29. When the machine shuts off, measure rotor lateral runout to verify that rotor runout is within specifications.
30. Measure rotor thickness to make sure rotor is within minimum thickness.

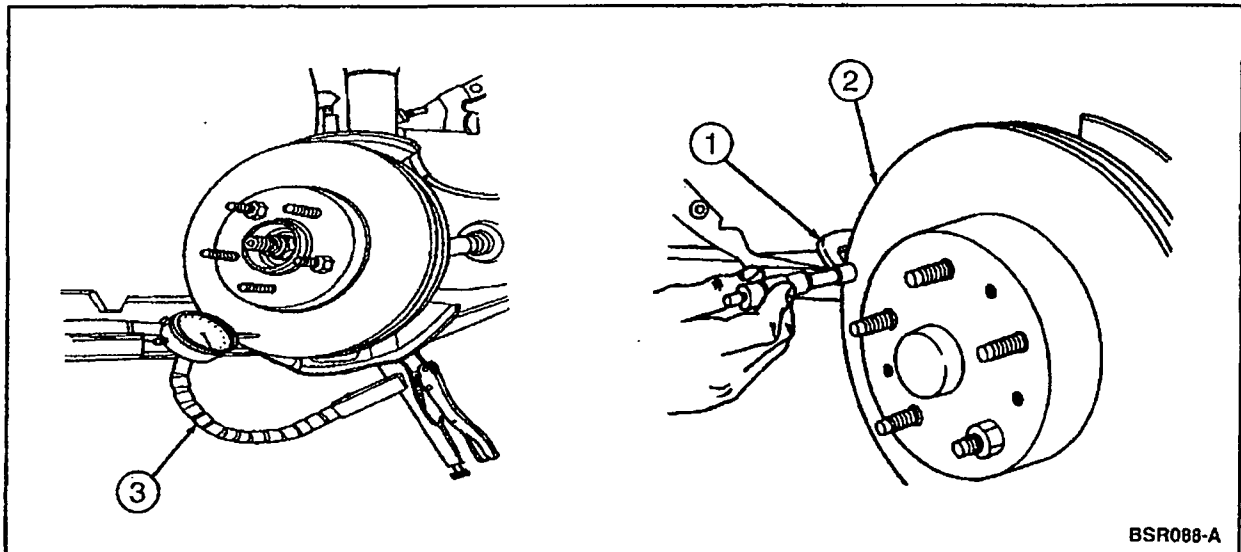

Recheck Rotor Thickness and Lateral Runout when Machining is Complete

Item	Description	Item	Description
1	Hand-Held Micrometer	3	Rotunda Disc Rotor and Ball Joint Gauge 134-R0199
2	Disc Brake Rotor		