


Fire Resistance Test Methods For Heat Transfer Fluids

0221934


Monsanto

TOWOLDMON0026559

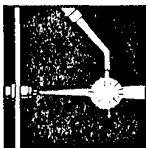

1

**High Temperature
High Pressure Spray Test**

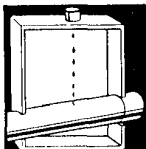


2

Hot Manifold Test




3

Low Pressure Spray Test

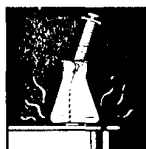

4

Autoignition Temperature (AIT)

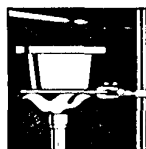

5

Flash and Fire Points

0221935

Know Your Heat Transfer Fluid's Fire Tests

Defining fire resistance in precise terms and numbers is extremely difficult and is best done in terms of *expected* fire hazards. Assessment of hazards should include consideration of all three components required for combustion—*fuel, oxidizer, and source of ignition*—as well as ways in which the three can combine into a fire. Simulative tests are considered most meaningful in assessing fire resistance. Since exposure conditions and sources of ignition vary widely, multiple tests are usually used in fire resistance evaluation. Test conditions should reflect two basic parameters of fire resistance—the ability to resist ignition and to prevent propagation of flame away from the source of ignition.

An ounce of prevention can be worth the cost of a plant or even the life of a worker. Hazardous plant operations can be isolated—fire walls can be built; sprinkler systems can be installed.

But the simplest and surest way to protect against heat transfer oil fires is to stop them before they start—with fire-resistant Therminol® FR fluids. Therminol FR will not support combustion.

When emergencies occur, Therminol FR minimizes the danger of local fires that can injure operators, spread to other locations, flash back to the break, or destroy equipment. By their very chemical nature, Therminol FR fluids are fire-resistant—from start-up through every hour of operation.


Know your system's fire hazards . . . know the tests and performance levels which are essential for assessing the fire resistance of any heat transfer fluid. The most widely accepted tests for measuring fire resistance are presented on the following pages.

1

High Temperature High Pressure Spray Test

Procedure: AMS 3150C. The fluid, at 1000 psi, is sprayed through a 0.0145 in. diameter orifice passing through the flame of an oxyacetylene torch with a No. 1 Purox tip held perpendicular to the fluid stream. Attempts are made to ignite the fluid stream at varying distances from the orifice.

Performance: This test simulates the hazard of a spray from a heat transfer fluid leak coming in contact with a high temperature flame ignition source. Performance is evaluated based on the ease of ignition, and the distance the flame is carried from the source of ignition, if ignition occurs.

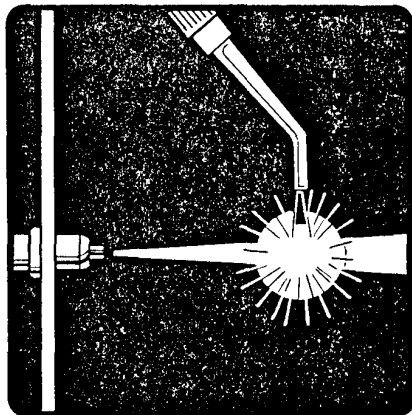


2


Hot Manifold Test

Procedure: AMS 3150C. Ten milliliters of fluid are dripped in 40 seconds onto a stainless steel simulated hot manifold held at 1300°F. (704°C.). Flashing or burning on contact with the tube, and carrying of flame to fluid collected in the bottom of the shield tube holder are observed.

Performance: This test simulates a fluid leak coming into contact with a hot surface. The heat transfer fluid should show only intermittent flashing or burning when dropped on the 1300°F. (704°C.) manifold and should not carry flame to the bottom of the shield.

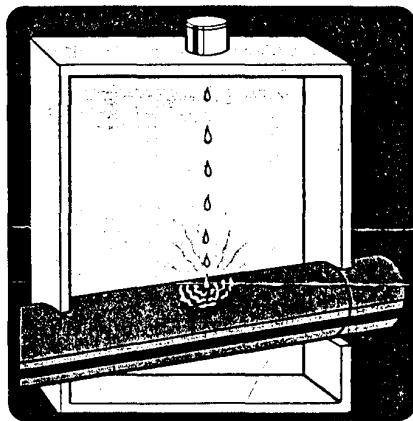

3

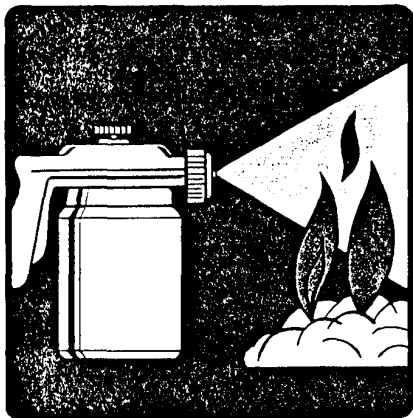


Low Pressure Spray Test

Procedure: AMS 3150C. The fluid is sprayed from a Binks Thor No. 7 paint spray gun (0.070 inch diameter orifice, 40 psi air) in bursts over the source of ignition, burning oil-soaked waste. Any increase or decrease in the flame caused by the fluid mist is observed.

Performance: This test is not commonly used, but is designed to simulate a line break spraying onto an open source of ignition. Criteria of performance is to observe for flame increase, no change, or decrease in intensity.

4

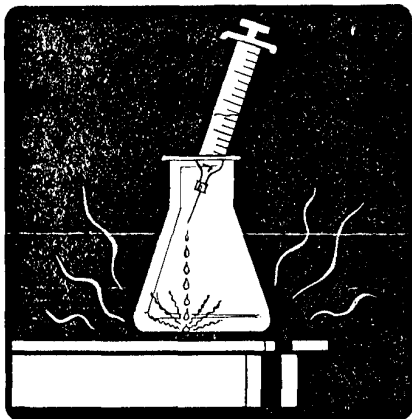

Autoignition Temperature (AIT)

Procedure: ASTM D 2155-66. A fluid sample is injected via hypodermic syringe into a heated glass flask. Autoignition is determined by appearance of visible flame.


Performance: This test measures autogenous ignition temperature in glass in air at one atmosphere pressure. Test conditions are critical and application of data to metal systems of irregular design is difficult.

5

Flash and Fire Points

Procedure: ASTM D 92-66. The fluid is heated in an open test cup at a constant rate. A small test flame is passed over the surface at specified temperature intervals. The lowest temperature at which the vapors above the surface ignite is the flash point. The fire point is the temperature at which the fluid ignites and burns for at least five seconds.

Performance: This test measures the ignitability of heated fluid. Flash and fire test results are sometimes misleading since they are so directly related to the chemical nature of the product being tested.

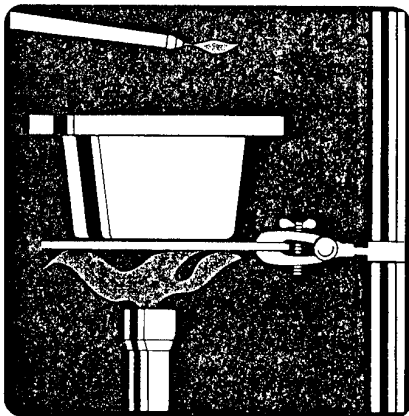

The Test Described Here...

show some of the rigorous methods used to determine fire resistance. Tests like these have established Therminol FR fluids as the only heat transfer fluids rated for fire resistance by Underwriters' Laboratory, Inc. and approved by Factory Mutual.

Therminol FR fluids are chemically synthesized from materials that resist burning. Other fluids, such as the glycols, petroleum oils and liquid/vapor phase fluids, *will* burn and support combustion.

If you'd like to find out more about Ther-

minol FR fluids, see the 16 mm full-color movie, "The House That Jack Built".

You can see for yourself—and demonstrate to others—

- Tests for fire resistance in Therminol FR fluids.
- Typical Therminol installations.
- A whole new concept in heat system design.

To receive a copy for showing, write or call the nearest Monsanto office on the following page.

DISTRICT SALES OFFICES ALL DIVISIONS

AKRON, OHIO 44313

260 Springside Drive
Montrose Development Park
Tel. (216) 666-4111

ATLANTA, GEORGIA 30326

Lenox Towers East
3400 Peachtree Rd. N. E., Suite 1711
Tel. (404) 577-2260

BOSTON, MASSACHUSETTS 02149

Everett Station
Tel. (617) 387-5010

CHICAGO, ILLINOIS

3158 Des Plaines Ave.
Des Plaines, Illinois 60018
Tel. (312) 296-6688

CINCINNATI, OHIO 45206

1501 Madison Road
Tel. (513) 751-6707

DETROIT, MICHIGAN 48235

500 Northland Towers East
Tel. (313) 357-0910

HONOLULU, HAWAII 96812

205 Pacific International Bldg.
677 Ala Moana Blvd., P. O. Box 3824
Tel. (808) 531-2744

HOUSTON, TEXAS 77027

1301 Post Oak Tower
5051 Westheimer Road
Tel. (713) 621-9550

LOS ANGELES, CALIFORNIA 90022

6670 E. Flotilla St.
Tel. (213) 723-2492

NEW ENGLAND AREA

Hydrocarbons & Polymers Div.
730 Worcester St., Indian Orchard, Mass. 01051
Tel. (413) 788-6911
Plastic Products & Resins Div.
P. O. Box 2130, Springfield, Mass. 01101
Tel. (413) 788-6911

NEW YORK, NEW YORK 10017

277 Park Avenue
Tel. (212) 922-4111

ST. LOUIS, MISSOURI 63166

800 N. Lindbergh Blvd.
Tel. (314) 694-1000

SAN FRANCISCO BAY AREA

2710 Lafayette, Santa Clara, Calif. 95052
Tel. (408) 243-0414

SEATTLE, WASHINGTON 98121

2112 Third Avenue
Tel. (206) 622-4203

WILMINGTON, DELAWARE 19803

2005 Concord Pike, Fairfax
Tel. (302) 658-6531

MONSANTO, 800 N. LINDBERGH BLVD., ST. LOUIS, MISSOURI 63166

*Additional District Offices
are maintained by:*

Agricultural Division

ALLENTOWN, PENNSYLVANIA 18104
Park Professional Building
2200 Hamilton Street
Tel. (215) 437-5471

DECATUR, ILLINOIS 62523

207 Decatur Professional Building
363 South Main Street
Tel. (217) 423-6031

DES MOINES, IOWA 50310

312 Merle Hay Tower
Tel. (515) 276-8503

FREMONT, NEBRASKA 68025

150 South Main Street
Tel. (402) 727-1230

INDIANAPOLIS, INDIANA 46205

Suite 218, 4000 Meadows Drive Building
Tel. (317) 547-9148

KANSAS CITY, MISSOURI 64133

701 Blue Ridge Tower
4240 Blue Ridge Boulevard
Tel. (816) 353-8060

LULING, LOUISIANA 70070

P. O. Box 174
Tel. (504) 784-6263

MANKATO, MINNESOTA 56001

111 Madison East
Tel. (507) 387-3406

MEMPHIS, TENNESSEE 38104

303 Union Plaza Building
1835 Union Avenue
Tel. (901) 278-7811

MUSCATINE, IOWA 52761

P. O. Box 473
Tel. (319) 263-1331

Hydrocarbons & Polymers Division-Lion Oil

EL DORADO, ARKANSAS 71730

Lion Oil Building
Tel. (501) 863-3111

JACKSON, MISSISSIPPI 39209

P. O. Box 10937, Westland Station
Tel. (601) 352-3648

N. LITTLE ROCK, ARKANSAS 72119

410 West 8th Street, P. O. Box 5821
Tel. (501) 376-2437

MEMPHIS, TENNESSEE 38113

1023 Riverside Drive, P. O. Box 13248
Tel. (901) 948-4451

Organic Division (Rubber Instruments)

AKRON, OHIO 44311
920 Brown Street, P. O. Box 2307
Tel. (216) 434-1962

Plastic Products & Resins Division

EUGENE, OREGON 97401

P. O. Box 1819
855 Seneca Road
Tel. (503) 342-7201

KENILWORTH, NEW JERSEY 07033

North Seventh St. & Monroe Ave.
Tel. (201) 276-2900

Textiles Division

ATLANTA, GEORGIA 30303

Atlanta Merchandise Mart
240 Peachtree St. N. W.
Tel. (404) 577-2260

CHARLOTTE, NORTH CAROLINA 28210

6230 Fairview Road, Suite 400
Tel. (704) 364-0110

GREENVILLE, SOUTH CAROLINA 29606

McAlister Plaza
P. O. Box 5564, Station B
Tel. (803) 239-9171

NEW YORK, NEW YORK 10001

350 Fifth Ave.
Tel. (212) 556-5100

0221940

TOWOLDMON0026565



"Nothing contained herein is to be construed as a recommendation to use any product in conflict with any patent. MONSANTO MAKES NO WARRANTIES AS TO THE FITNESS OR MERCHANTABILITY OF ANY PRODUCTS REFERRED TO, no guarantee of satisfactory results from reliance upon contained information or recommendations, and disclaims all liability for any resulting loss or damage."

0221941