

FRICION MATERIALS STANDARDS INSTITUTE, 588 MONROE TURNPIKE, MONROE, CT 06468
 A U T O M O T I V E D A T A B O O K B U L L E T I N #2-961
 December 10, 1996

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>ACURA</u>				
1997, CL		7382-D503**	D/	
1997, Integra		7493-D617**	D/D	7443-D564**
1997, TL		7382-D503**	D/D	7418-D537**
1997, SLX		7459-D579**	D/D	7460-D580**
<u>AUDI</u>				
1997, A4		7434-D555**	D/D	7309-D228**
1997, A6		7434-D555**	D/D	7309-D228**
1997, Cabriolet		7352-D419**	D/D	7309-D228**
<u>BUICK</u>				
1997, LeSabre		7384-D623**	D/N	1487-S636
1997, Park Avenue		7574-D699**	D/N	1487-S636
	OR		/D	7387-D508**
1997, Skylark		7554-D673**	D/BH	2164-553
1997, Riviera		7574-D699**	D/D	7387-D508**
<u>CADILLAC</u>				
1997, DeVille		7574-D699**	D/D	7387-D508**
1997, Eldorado		7574-D699**	D/D	7387-D508**
1997, Seville		7574-D699**	D/D	7387-D508**
<u>CHEVROLET (See Comments)</u>				
1997, Camaro		7384-D623**	D/BH	2117BTT-S651
	OR		/D	7301-D413**
1997, Cavalier		7554-D673**	D/BH	2164-S719
				(Note #17)
	OR		/N	1487-S636
1997, Lumina		7265-D376**	D/N	1394-S636
	OR		/D	7387-D508**
1997, Monte Carlo		7265-D376**	D/N	1394-S636
	OR		/D	7387-D508**
1997, Venture		7574-D699**	D/N	1394-S636
<u>CHEVROLET TRUCK (See Comments)</u>				
W7R042	1994	1418-S718	N/N	1418-S718
		(Note #16)		
<u>CHRYSLER</u>				
1997, Cirrus		7530A-D650	D/N	1481-S698*
	OR		/N	1481-S716*
	OR		/D	7438B-D641
1997, Concorde		7470A-D642	D/D	7438A-D658
1997, LHS		7470A-D642	D/D	7438A-D658

SEE DISCLAIMER AT END OF BULLETIN

FMSI® and FMS® are registered trademarks of the Friction Materials Standards Institute, Inc.

Copyright© by Friction Materials Standards Institute, Inc.

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>DODGE</u>				
1997, Intrepid		7470A-D642	D/N	1456-S657*
	OR		/D	7438A-D658
1997, Stratus		7530A-D650	D/N	1481-S698*
	OR		/N	1481-S716*
	OR		/D	7438B-D641
<u>DODGE TRUCK (See Comments)</u>				
Ram 1500	1997	7259-D369**	D/BH	2134BTT-S652
Ram 1500 4WD	1997	7259-D369**	D/BH	2134BTT-S652
Ram 2500	1997	7260-D370**	D/BH	2042BT-S655
Ram 2500 4WD	1997	7260-D370**	D/BH	2042BT-S655
	OR	7339-D459**	D/	
Ram 3500	1997	7339-D459**	D/BH	2157AT-S656
Ram 3500 4WD	1997	7339-D459**	D/BH	2157AT-S656
Dakota	1997	7410A-D593	D/BH	2176T-538
Dakota 4WD	1997	7410A-D593	D/BH	2089T-445*
<u>EAGLE</u>				
1997, Vision		7470A-D642	D/D	7438A-D658
<u>FORD TRUCK</u>				
1997, Expedition		7576-D702**	D/	
		(Notes #2 & #9)		
1997, F250		7576-D702**	D/	
<u>GEO</u>				
1997, Metro		7331-D451**	D/N	1489-608*
	OR		/N	1461-S630*
<u>GMC TRUCK (See Comments)</u>				
W7R042	1994	1418-S718	N/N	1418-S718
<u>ISUZU</u>				
1997, Oasis		7382-D503**	D/D	7418-D536**
1997, Rodeo		7459-D579**	D/N	1360-S619*
	OR		/D	7460-D580**
1997, Trooper		7459-D579**	D/D	7460-D580**
<u>ISUZU (Commercial) (See Comments)</u>				
FTR	1995-94	1418-S718	N/N	1418-S718
<u>LINCOLN (See Corrections)</u>				
1995, Town Car			/D	7424A-D544
1996, Town Car			/D	7565A-D690
1997, Mark VIII		7476-D598**	D/D	7477A-D599
1997, Town Car		7537-D678**	D/D	7565A-D690
<u>MAZDA</u>				
1997, Miata		7513-D635**	D/D	7514-D636**

	FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>NISSAN</u>			
1997, Altima	7407-D526**	D/N	1457-S671*
OR		/D	7421-D595**
1997, Pathfinder	7566-D691**	D/N	1433-S631*
1997, Quest	7456-D576**	D/N	1452-S665*
<u>OLDSMOBILE (See Comments)</u>			
1997, Achieva	7554-D673**	D/BH	2164-S719
1997, Cutlass	7265-D376**	D/D	7387-D508**
1997, Eighty Eight	7384-D623**	D/N	1487-S636
1997, Aurora	7574-D699**	D/D	7387-D508**
1997, Silhouette	7574-D699**	D/N	1394-S636
<u>PLYMOUTH</u>			
1997, Breeze	7530A-D650	D/N	1481-S698*
OR		/N	1481-S716*
OR		/D	7438B-D641
<u>PONTIAC (See Comments)</u>			
1997, Bonneville	7384-D623**	D/N	1394-S636
1997, Firebird	7384-D623**	D/BH	2117BTT-S651
OR		/D	7301-D413**
1997, Grand Am	7554-D673**	D/BH	2164-S719
1997, Sunfire	7554-D673**	D/BH	2164-S719
1997, Transport	7574-D699**	D/N	1394-S636
OR		/D	7387-D698**
<u>SUZUKI</u>			
1997, X90	7305-D418**	D/N	1491-S710
<u>TOYOTA</u>			
1997, Camry	7581-D707**	D/	
	(Notes #7 & #14)		
<u>UD (See Comments)</u>			
1400 1997-94	7575-D701**	D/	
	(Notes #1 & #8)		
1800 1997-95		/N	1464-S717
			(Note #15)
<u>VOLKSWAGEN</u>			
1997-96, Cabriolet	7578-D704**	D/	
	(Notes #4 & #11)		
1996, Eurovan	7577-D703**	D/D	7580-D706**
	(Notes #3 & #10)		(Notes #6 & #13)
1997, Eurovan	7579-D705**	D/D	7580-D706**
	(Notes #5 & #12)		
OR	7577-D703**	D/	
OR	7516-D638**	D/	

	FRONT	SYSTEM	REAR
	FMSI NO.	F/R	FMSI NO.
<u>VOLVO</u>			
1997, 850	7494-D618**	D/D	736-D31**
	OR	/D	7279-D391**
1997, 960	7512-D634**	D/D	7279-D391**
	OR	/D	7422-D541**

C O M M E N T S

1997 Dodge Dakota 2WD & 4WD uses FMSI 7410A-D593 with anti-rattle clip.
O.E. Set #4797400 listed for 2WD & 4WD models.

Existing lining used with new shoe:

<u>Lining</u>	<u>Assembly</u>	<u>Application</u>
1418	1418-S718	1994 Chevrolet Truck W7R042 F/R
		1994 GMC Truck W7R042 F/R
		1995-94 Isuzu Commerical FTR F/R
1464	1464-S717	1997-95 UD(Nissan Commercial) 1800
2164	2164-S719	1997 Chevrolet Cavalier Rear
		1997 Oldsmobile Achieva Rear
		1997 Pontiac Grand Am Rear
		1997 Pontiac Sunfire Rear

C O R R E C T I O N S

1995 Lincoln Town Car - the correct rear disc is FMSI 7424A-D544.
1996 Lincoln Town Car - the correct rear disc is FMSI 7565A-D690.
The FMSI 7542-D662 noted in Bulletin 1-961 is for Ford Police packages.

DISC BRAKE LINING ASSIGNMENTS

Note #1	<u>FMSI 7575</u>	7575-D701
	55.4 x 19.9 x 160.5	4 IM
	(2.18 x .782 x 6.32)	
Note #2	<u>FMSI 7576</u>	7576-D702
	43.2 x 16.5 x 153.2	4 IM
	(1.70 x .650 x 6.03)	
Note #3	<u>FMSI 7577</u>	7577-D703
	54.9 x 18.2 x 87.1	2 IM
	54.9 x 18.2 x 87.1	2
	(2.16 x .717 x 3.43)	
	(2.16 x .717 x 3.43)	
Note #4	<u>FMSI 7578</u>	7578-D704
	46.7 x 15.2 x 107.4	4 IM
	(1.84 x .598 x 4.23)	
Note #5	<u>FMSI 7579</u>	7579-D705
	54.6 x 19.2 x 116.6	2 IM
	54.6 x 19.2 x 116.6	2
	(2.15 x .756 x 4.59)	
	(2.15 x .756 x 4.59)	

DISC BRAKE LINING ASSIGNMENTS (con't)

Note #6 FMSI 7580 7580-D706
 41.1 x 16.8 x 90.0 4 IM
 (1.63 x .661 x 3.54)

Note #7 FMSI 7581 7581-D707
 53.3 x 17.0 x 88.1 4 IM
 (2.10 x .669 x 3.47)

DISC BRAKE SHOE ASSIGNMENTS


Note #8 FMS D701 7575-D701
 177.0 x 6.1 UD
 (6.97 x .240)




Note #9 FMS D702 7576-D702
 188.5 x 6.1 Ford Truck
 (7.42 x .240)




Note #10 FMS D703 7577-D703
 89.2 x 5.1 Volkswagen
 91.4 x 5.1
 (3.51 x .201)
 (3.60 x .201)

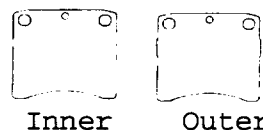

Note #11 FMS D704 7578-D704
 117.1 x 5.1 Volkswagen
 (4.61 x .201)



Note #12 FMS D705 7579-D705
 156.5 x 6.1 Volkswagen
 156.5 x 6.1
 (6.16 x .240)
 (6.16 x .240)

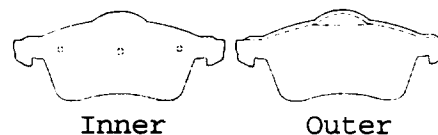

Note #13 FMS D706 7580-D706
 95.0 x 5.5 Volkswagen
 (3.74 x .217)



DISC BRAKE SHOE ASSIGNMENTS (con't)

Note #14 FMS D707 7581-D707
 116.8 x 6.1 Toyota
 (4.60 x .240)

DRUM BRAKE SHOE ASSIGNMENTS

Note #15 FMS S717 1464-S717
 320.0 x 135.0 UD
 (12.60 x 5.31)



Note #16 FMS S718 1418-S718
 410.0 x 140 Chevrolet Truck
 (16.14 x 5.51) GMC Truck
 Isuzu (Commercial)



Note #17 FMS S719 2164-S719
 200.0 x 45.0 Chevrolet
 (7.87 x 1.77) Oldsmobile
 Pontiac

The data shown in this bulletin has been supplied by sources considered to be reliable. While we believe that such information is correct, the Institute cannot and does not accept any responsibility or liability for errors or omissions, or harm resulting therefrom.

The data shown in this bulletin indicates dimensions only and in no way refers to quality of any materials that may be embodied in the product or particular application involved, and moreover, SINCE FIELD CONDITIONS AND OTHER FACTS MAY NECESSARILY VARY FROM ONE APPLICATION TO ANOTHER, FRICTION MATERIALS SUPPLIERS AND INSTALLERS SHOULD RELY ULTIMATELY AND SOLELY UPON THEIR OWN EXPERTISE AND JUDGMENT AS TO QUALITY AND DIMENSIONAL SIZE. Under no circumstances should replacement items be used when they do not appear to fit, nor be "forced" to fit, nor be modified in the field instead of obtaining a proper sized item from a supplier. If such items are modified in the field to fit, the Institute specifically disclaims all liability and responsibility for any harm resulting therefrom.

If any error or omission is noted in this bulletin, it should be reported immediately to the Friction Materials Standards Institute, Inc., 588 Monroe Turnpike, Monroe, Connecticut 06468.