FILE NAME: Allied Signal Bendix (ASB)

DATE: 1977 June 27

DOC#: ASB046


DOCUMENT DESCRIPTION: Air Quality Assessment Report - Ontario Ministry of Labor - Bendix Company, Windsor

Ontario

Ministry of
~~Health~~ LABOUR

I.S.B. File No.:
O.H.P.B. File No. 8E-24
A.Q.A. No: 457

OCCUPATIONAL HEALTH ~~PROTECTION~~ BRANCH

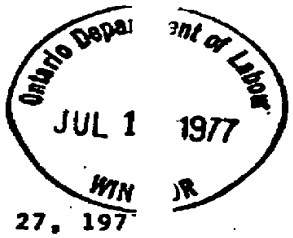

AIR QUALITY ASSESSMENT REPORT

Date: June 27, 197

From: C. Rhodes

Bendix Company	Requested by: I.H.S.B.
ss: 1473 Argyle Avenue Windsor, Ontario	Accompanied by: Mr. F. Gamble, I.S.O
	Date of Visit: June 9, 1977
cts: Mr. G. Detenbeck - Industrial Relations Administrator	Copies to: Dr. V. Tidey Mr. G. Rajhans Dr. J. Vingilis (2) Mr. H. Hendrickson Mr. J. Greenlaw (3) Mr. S. Morton (2) Mr. G. Detenbeck
d: Asbestos	

ct: Area and Personnel air samples were taken in the above plant, and the follo ng table lists their locations and results.

COPY PASSED TO MR DETENBEEK.

Bendix Company, Windsor

ample Number	Employees Name	Job Description	Personnel Samples	Sample Time in Minutes	Sample Volume Litres	Asbestos fibres greater than 5 micrometers in length per cc of Air
.	Ms. Mary Bennett	No. 4 Grinder operator (day shift)		32	64	0.3
				[illegible]	97	0.[illegible]
.	Mr. Reaume	No 4 Production Checker (afternoon shift)		36	72	0.9
.	Mr. G. Marra	No 3 Grinder operator, (afternoon shift)		37	74	0.9
.	Mr. B. Zakala	No 3 Production Checker (afternoon shift)		37	74	0.6
.	Mr. V. Yich	Changing Dust collector waste box		7*	14	1.5

ample Number	Location	Area Samples	Sample Time in Minutes	Sample Volume Litres	Asbestos fibres greater than 5 micrometers in length per cc of Air
.	On Pillar, between #2 and 3 Grinders (near end of day shift)		34	68	1.2
.	On Pillar, between #2 and 3 Grinders (over shift change into afternoon shift)		77	154	0.3

* This operation takes place over a duration of from 5 to 10 minutes, depending on the amount of spillage in the enclosure, and could occur twice a shift, dependant on the amount of production.