


FILE NAME: !ăōŜăúžă /ŜYŜyŭ tλLJŜ l·yŘ {KŜŜú ó! / t{ú

DATE: mφTT

DOC#: ! / t{moπ

5OCUMENT DESCRIPTION: wŜÖ2YYŜyŘŜŘ ² 2Nj tNjI·ŎúλŎŜă ƒ2Nj !π/ tλLJŜ π !π/
tλLJŜ tNj2ŘdzŎŜNă !ăă2Ŏφ

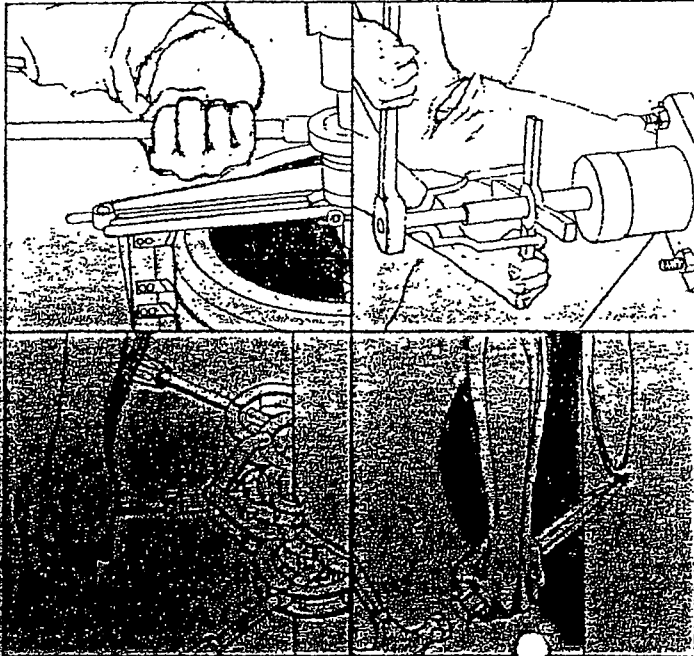

Recommended Work Practices for A/C Pipe



A/C Pipe Producers Association
1600 Wilshire Dr. Jr.

PENGAD 800-531-5985	EXHIBIT
	39
	44 11-9-08

Contents

Introduction.....	2
Asbestos and Health	3
Summary of OSHA Asbestos Standard	4
Products and Operations	5
Recommended Work Practices	
Shipping, Receiving, Handling and Assembly	6
Cutting A/C Pipe	
Carbide Blade Equipment	7
Snap Cutting Equipment	8
Machining A/C Pipe	
Field Lathe—Manual	9
Field Lathe—Power	10
Rasp—Manual	11
Cutting Holes in A/C Pipe	
Shell Cutters	12
Drill and Rasp	13
Chisel and Rasp	14
Tapping A/C Pipe	
Non-Pressure	15
Pressure	16
Coupling Removal	17
Housekeeping and Waste Disposal	18
Non-Recommended Work Practice	
Cutting	19
Abrasive Disc-Dry	19

Introduction

The Occupational Safety and Health Act in the United States and similar laws in Canada and other countries were enacted to ensure so far as possible, every worker a safe and healthy work place. This legislation is far-reaching. It covers millions of employees and nearly every employer, including those involved in utility duct and pipeline construction.

In keeping with the spirit and intent of these laws, the asbestos-cement pipe industry is cooperating with labor by disseminating information regarding the potential hazards of exposure to airborne asbestos and the means of reducing such potential hazards through good work practices.

Good work practices is what this booklet is about. The recommendations that appear on the following pages are the result of field testing and were developed through study.* They are intended as general guides to achieve safe and clean job site conditions when working with asbestos-cement (A/C) pipe products. Since field conditions will vary, adherence to these work practices will not necessarily guarantee compliance with national, state or local regulations. Questions relating to compliance should be directed to appropriate regulatory agencies.

The A/C Pipe Producers Association believes this booklet will be helpful to engineers, superintendents, contractors, foremen and laying crews in understanding and explaining established procedures for the safe handling of A/C pipe products.

Asbestos and Health

As you are aware, airborne asbestos fiber has been identified as a possible health hazard. Very few things to which we are exposed are "zero risks." But like the automobile, electricity and x-rays, there are non-harmful ways to use potentially harmful things.

Generally, asbestos-cement (A/C) pipe products contain less than 20% asbestos. The asbestos fibers are not free, but encapsulated or "locked-in" the cement binder like reinforcing rods in concrete. The distinction between "free" and "bound" asbestos is extremely important. First of all, it determines the probability of fiber release, which in turn, directly relates to the probability of risk. More importantly, it explains clearly and simply why A/C pipe is a non-harmful use of asbestos.

Experience has shown that minimizing exposure to airborne asbestos dust is the only effective method of preventing asbestos-related diseases. Recommended work practices are the best assurance of providing exposure safeguards for yourself and your employees.

*See "Asbestos Exposures During the Cutting and Machining of Asbestos-Cement Pipe," report prepared by Equitable Environmental Health Inc., March, 1977 and "News from PAC," reporting on a survey by the Occupational Hygiene Society.

Summary of OSHA Asbestos Standard

The Occupational Safety and Health Act was signed into law on December 29, 1970, and became effective on April 28, 1971. On December 7, 1971, the Secretary of Labor issued a temporary standard for exposure to asbestos dust. As required by the Act, a permanent standard for asbestos exposure was promulgated six months later.

Under the current standard, it is the employer's responsibility to assure that exposure of employees to airborne concentrations of asbestos fibers does not exceed the following "permissible exposure levels":

- a. Eight hour time weighted average: Two fibers, longer than 5 micrometers, per cubic centimeter.
- b. Ceiling concentrations: Ten fibers, longer than 5 micrometers, per cubic centimeter.

In October, 1975, OSHA proposed a revision to the current standard which would reduce the eight hour time weighted average exposure to 0.5 fibers per cubic centimeter of air and ceiling concentrations to 5.0 fibers per cubic centimeter. In their notice, OSHA stated that a separate "construction industry standard" would be issued to cover workers who handle asbestos-containing products. This work practice booklet will be revised as necessary to reflect any changes the construction industry standard may necessitate.

The work practices recommended in this booklet are based on data for "peak dust concentrations" representing short time periods of maximum exposure. Field cutting and machining operations involving A/C pipe are normally infrequent and of short duration. Using these recommended work practices, it is improbable that field personnel would be exposed in a typical working day to levels exceeding the eight hour time weighted average.

Products and Operations


Types of A/C Pipe Products covered by these work practices include:

"Class" Pressure Pipe
"Transmission" Pressure Pipe
Pressure Sewer Pipe
Gravity Sewer Pipe
Building Sewer Pipe
Storm Drain Pipe
Perforated Underdrain Pipe
Electrical Conduit
Telephone Duct
Air Duct

Operations to which these work practices apply include:

Shipping, Receiving and Handling
Cutting
Machining
Hole Cutting
Tapping
Coupling Removal
Housekeeping and Waste Disposal

Shipping, Receiving, Handling and Assembly*

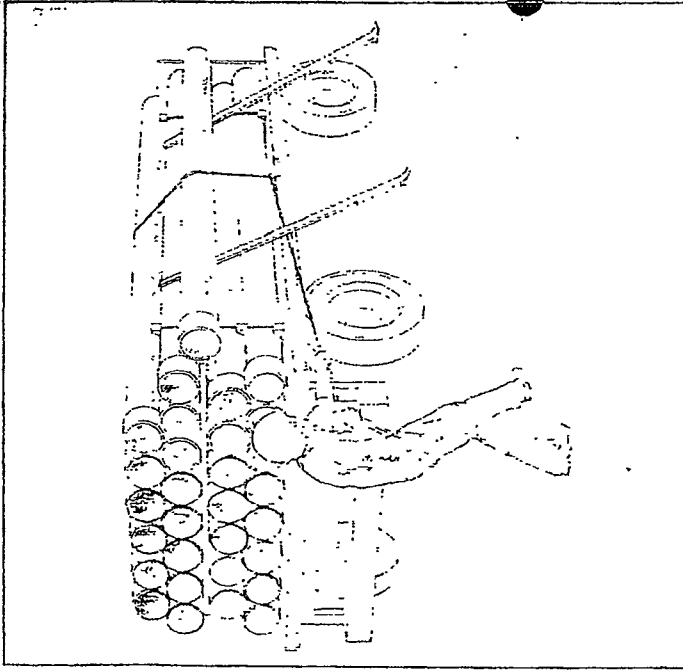


A/C pipe is shipped clean from the factory and carefully loaded using methods acceptable to the carrier. Loading, unloading, stringing out and assembling A/C pipe are essentially dust-free operations. Even in enclosed spaces, airborne asbestos fiber levels from pipe handling operations are far below existing and proposed occupational standards.

All hand and mechanical unloading operations should be carried out in accordance with the manufacturer's installation manuals.

A/C Pipe Products: All
Size Range: All


Cutting Carbide Blade Equipment

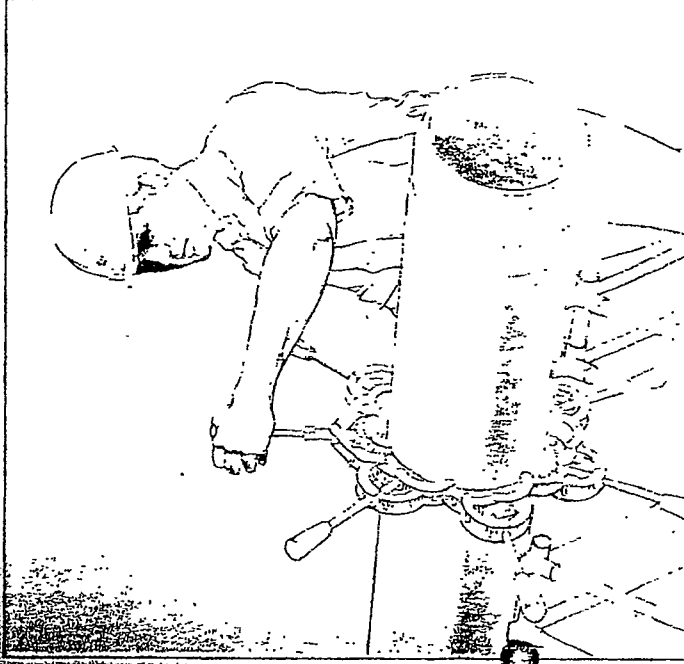

Blade cutters consist of a frame adjustable to the circumference of the pipe and a number of outboard, self-tracking rollers that align one or more carbide-tipped cutting blades. Blade cutters are typically hand-operated. Due to the relatively low mechanical input and clean cutting action, significant amounts of airborne asbestos dust are not produced.

A/C Pipe Products: All
Size Range: 3" through 24"

Cutting Snap Cutting Equipment

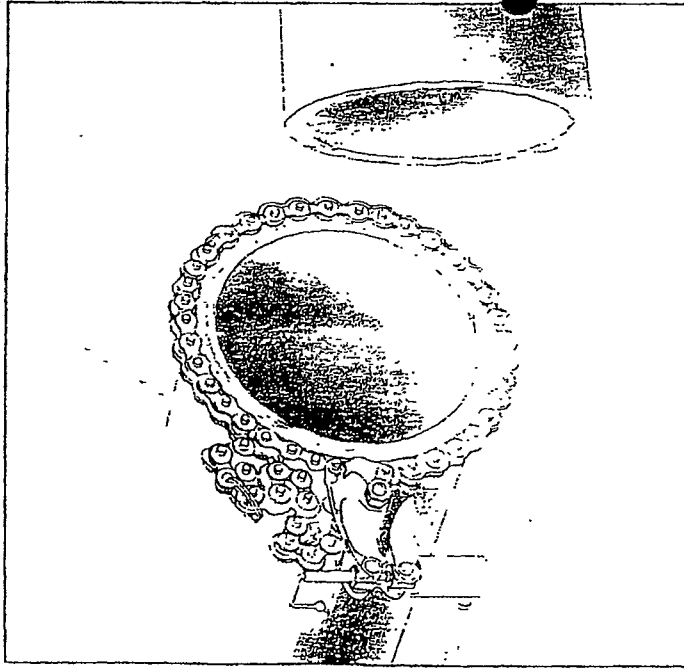

Snap cutters or "squeeze and pop" equipment operates by means of cutting wheels mounted in a chain wrapped around the pipe barrel. Hydraulic pressure, applied by means of a remote electric or manually-operated pump, simultaneously squeezes the cutting wheels into the pipe wall until the cut is made.


A/C Pipe Products: All

Size Range: Pressure Pipe—3" through 24"

Pressure, Gravity and Building Sewer; Storm Drain;

Air, Electrical and Telephone Duct—3" through 36"

Machining Field Lathe—Manual

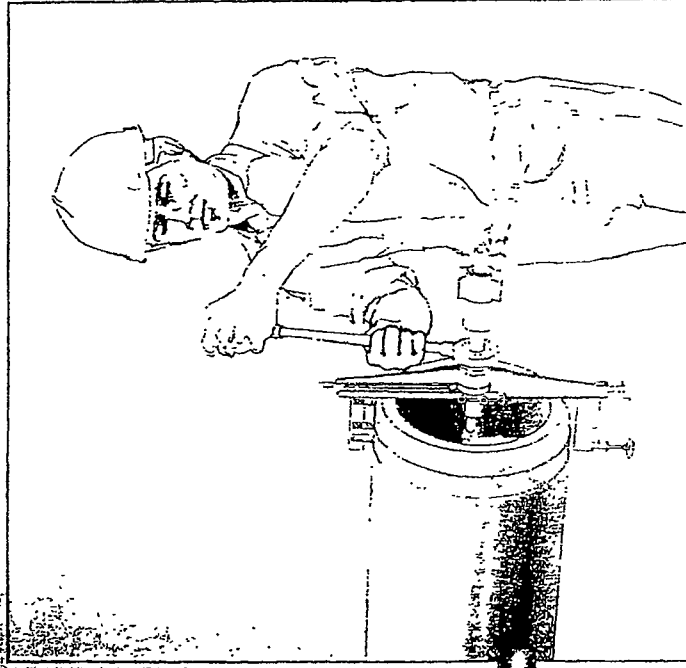


Manual field lathes are designed to end-trim and re-machine rough pipe barrels to factory-machined end profiles. The lathe consists of an adjustable, self-aligning arbor inserted into the pipe bore (which acts as a mandrel upon which the turning handle operates), a screw-fed turning frame, carbide machining blades and manual (hand or ratchet) turning handles.

A/C Pipe Products: All

Size Range: All


Machining Field Lathe-Power

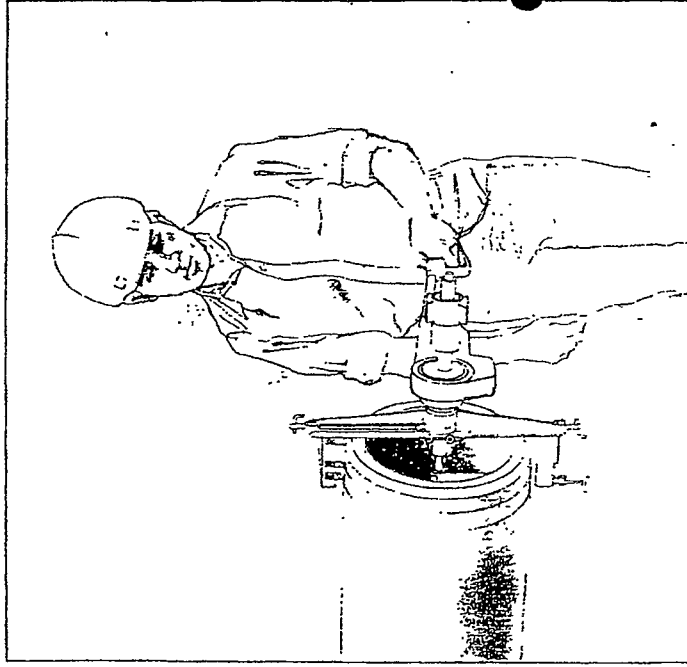

Power field lathes, like manual lathes, are designed to end trim and re-machine rough pipe barrels to factory-machined end profiles. The lathe consists of an adjustable, self-aligning arbor inserted into the pipe bore (which acts as a mandrel upon which the turning handle operates), a screw-fed turning frame, carbide machining blades and electric or pneumatic power drive.

A/C Pipe Products: All
Size Range: All


Machining Rasp-Manual*

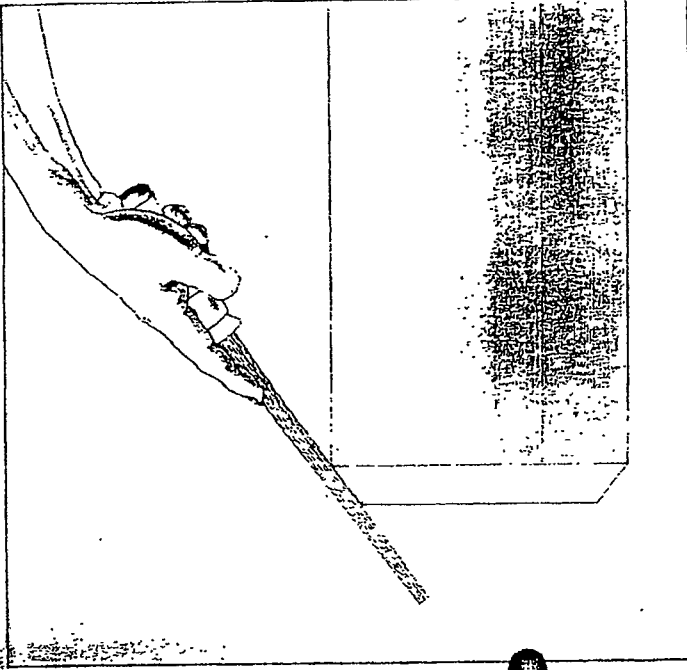

Short lengths of A/C pipe (MEE's & MOA's) can be cut for pipe closures, repairs and to locate fittings exactly. Field cut ends may be rebeveled with a coarse wood rasp to form a taper approximating the same profile as the factory-beveled end.

A/C Pipe Products: All
Size Range: All

Hole Cutting Shell Cutters

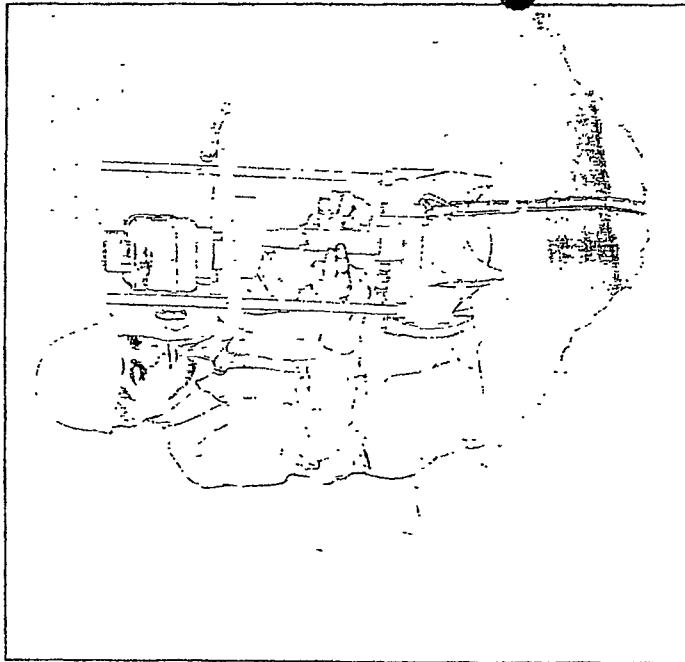


For field connections into A/C pipe, clean, even entry cuts may be accomplished by means of shell cutting equipment. Shell cutters consist of a hole cutter housing mounted on the pipe, a carbide or diamond-tipped hole cutter and a manual ratchet, pneumatic, electric or gasoline drive to power the cutting head.

When cutting holes in A/C pipe products, all dust and cuttings should be removed from the pipe or duct interior after the cutting operation. Removal may be accomplished by flushing with water, wet mopping or vacuuming prior to placing in service. DO NOT BLOW OUT WITH COMPRESSED AIR OR DRY SWEEP.

A/C Pipe Products: Pressure, Gravity and Building Sewer;
Air Duct

Size Range: All

Hole Cutting Drill and Rasp*

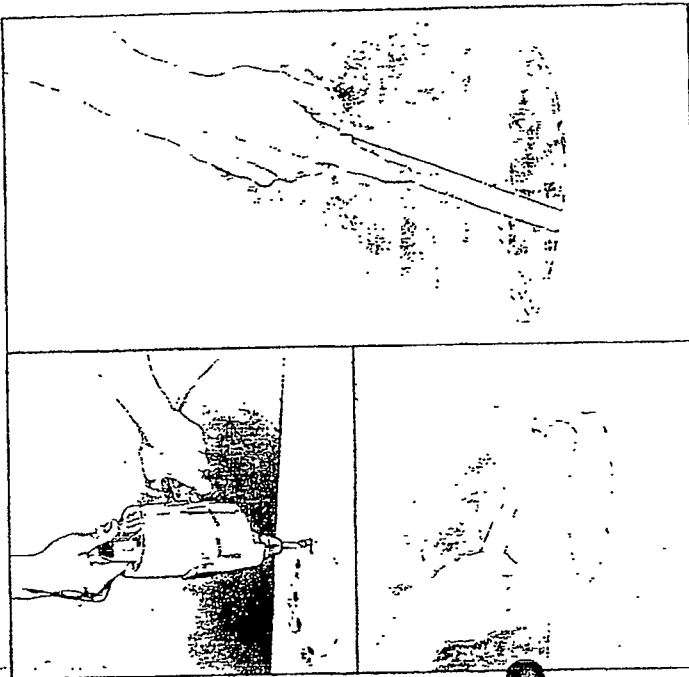


Field connections may be made with a heavy duty electric drill and rasp. Using a carbide-tipped drill, a series of closely-spaced holes are first drilled around the hole outline. The disc is knocked free with a hammer and the edges of the hole are dressed with a coarse wood rasp.

When cutting holes in A/C pipe products, all dust and cuttings should be removed from the pipe or duct interior after the cutting operation. Removal may be accomplished by flushing with water, wet mopping or vacuuming prior to placing in service. DO NOT BLOW OUT WITH COMPRESSED AIR OR DRY SWEEP.

A/C Pipe Products: Pressure, Gravity and Building Sewer;
Air Duct

Size Range: All

Hole Cutting Chisel and Rasp

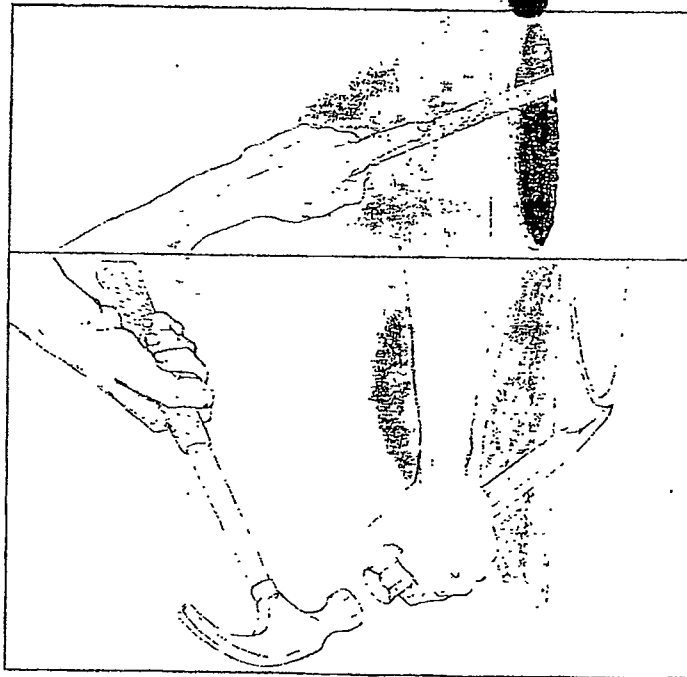


Holes may be cut into A/C pipe with a hammer and chisel. The edge of a plumber's wood chisel is used to cut completely around the hole outline, about a 1/4" from the prescribed line. The operation is repeated and the cut deepened until through. The edges of the hole are then dressed with a coarse wood rasp.

When cutting holes in A/C pipe products, all dust and cuttings should be removed from the pipe or duct interior after the cutting operation. Removal may be accomplished by flushing with water, wet mopping or vacuuming prior to placing in service. DO NOT BLOW OUT WITH COMPRESSED AIR OR DRY SWEEP.

A/C Pipe Products: Pressure, Gravity and Building Sewer;
Air Duct

Size Range: All

Tapping* Non-Pressure

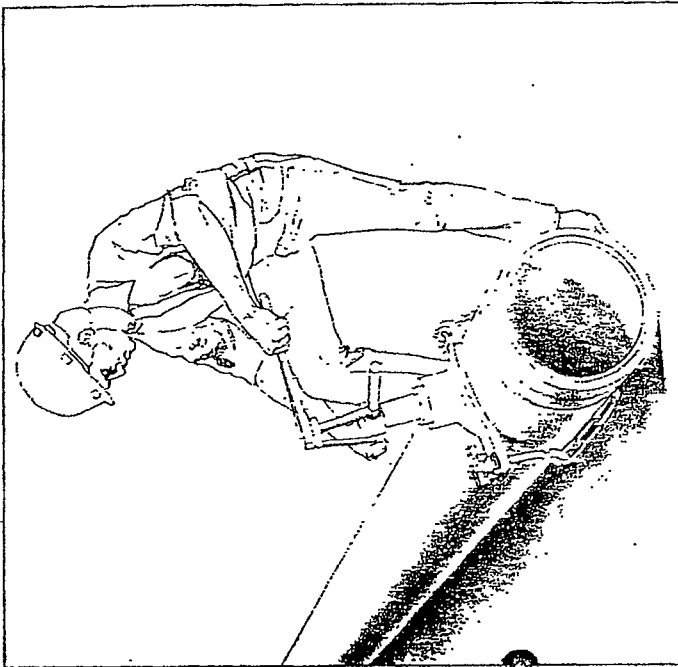


Non-pressure or "dry" tapping for service connections may be performed in or above the trench. The equipment is affixed to the pipe by means of a chain yoke. Separate drills and taps or a combination tool drills and taps the pipe wall. Corporation stops or other connections may then be affixed to the pipe.

To minimize (a) the fouling of valves, regulators, meters, etc. with chips and (b) unnecessary addition of asbestos to drinking water, all dust and cuttings should be removed from the pipe interior by flushing with water, wet mopping or vacuuming prior to placing in service. DO NOT BLOW OUT WITH COMPRESSED AIR OR DRY SWEEP.

A/C Pipe Products: Pressure Pipe
Size Range: All

*Asbestos data not currently available. Recommendation based on exposure data

Tapping Pressure*

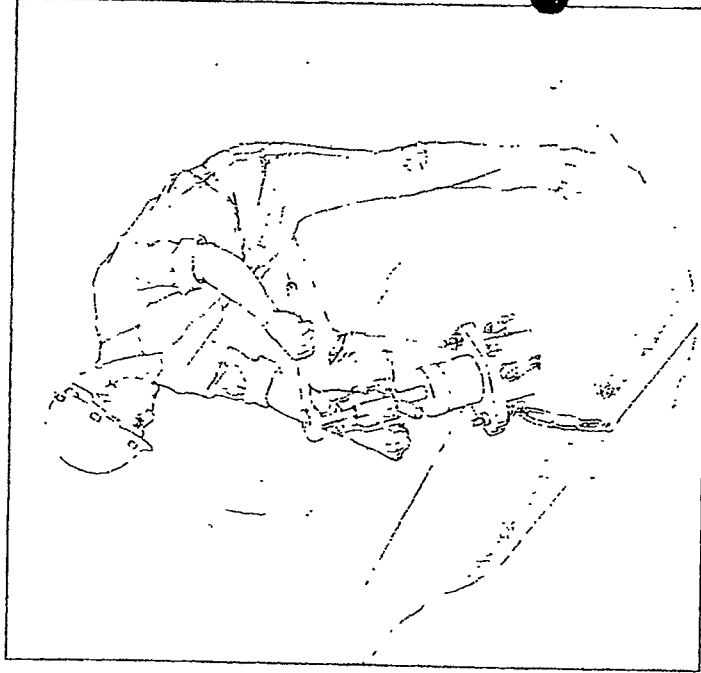


Pressure or "wet" tapping for service connections is performed in the trench while the pipe is under pressure. The equipment (manual or power driven) is affixed to the pipe by means of a chain yoke. A combination boring and inserting bar drills and taps the pipe wall and inserts a corporation stop or pipe plug. The pressure chamber, which protects against water leakage, also catches the asbestos-cement chips, so this is essentially a dust-free operation.

To minimize (a) the fouling of valves, regulators, meters, etc. with chips and (b) unnecessary addition of asbestos to drinking water, provisions should be made for downstream flushing or use of tapping equipment with positive purge or "blow-off" features.

A/C Pipe Products: Pressure Pipe
Size Range: All

Coupling Removal Hammer and Chisel*

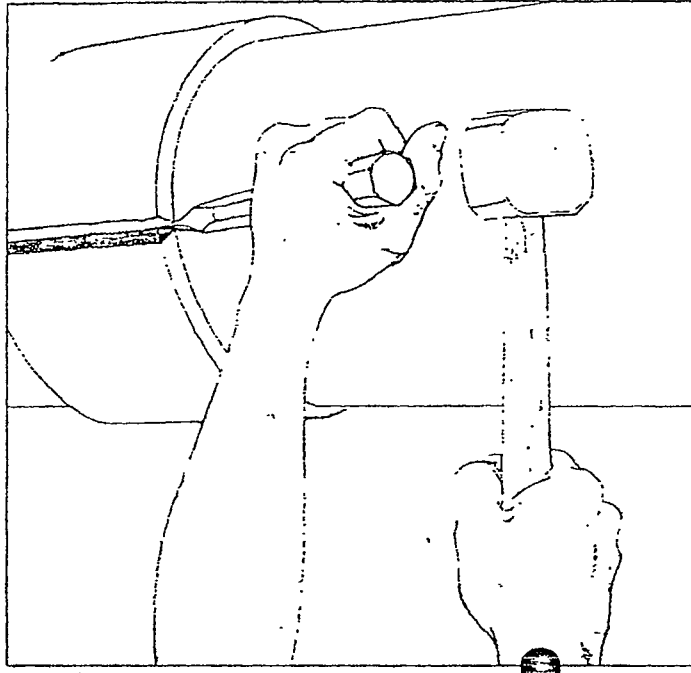

Replacement of damaged pipe necessitates excavation, exposure and removal. Coupling removal may be accomplished by gradually splitting the coupling lengthwise, using a chisel and ball-peen hammer. After the top of the coupling has been split, a crowbar or similar tool is used as a lever to split the bottom of the coupling.

A/C Pipe Products: All pipe with A/C couplings
Size Range: All

*Exposure data not currently available. Recommendation based on exposure data for asbestos-cement pipe.