FILE NAME: The Budd Company (BUD)

DATE: 0000


DOC#: BUD009

DOCUMENT DESCRIPTION: Industrial Hygiene Survey Published by Pullman, a Competitor

# INDUSTRIAL HYGIENE SURVEY

OF

# THE PULLMAN COMPANY

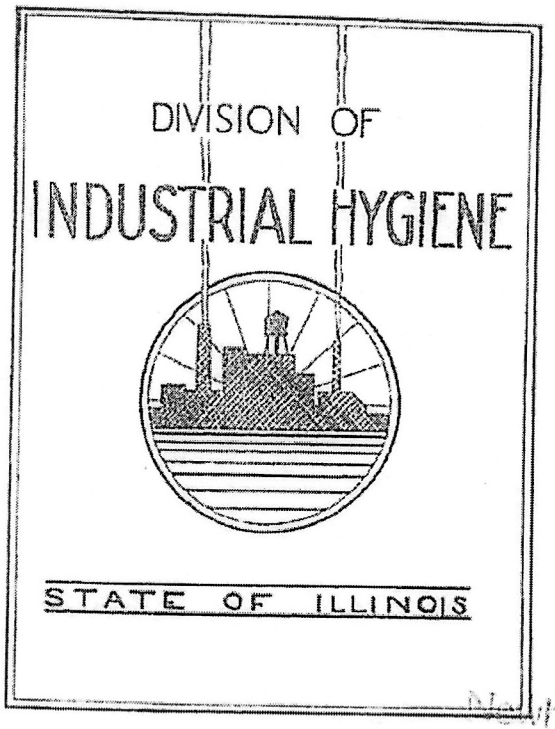


Newberry Library
For Study Use Only
Unauthorized Reproduction
Strictly Forbidden

STATE OF ILLINOIS
DEPARTMENT OF PUBLIC HEALTH
A. C. BAXTER, M. D., *Acting Director*

| | | | | | | |
|---|---|---|---|---|---|---|
| 12 | Stall Shop | 2-1-38 (A.M.) | In steam department, under car while men are stripping pipe covering | Inorganic<br>Silica<br>Asbestos | 27,012,500<br>4,750,000<br>8,000,000 | 42% |

Newberry Library
For Study Use Only
Unauthorized Reproduction
Strictly Forbidden

Stall Shop:

1. We found that the contamination of air in the stall shop is due to the stripping operation in the cars, the steel saw in the tin department, the duplex grinder in the tin department, and stripping of pipe covering in the steam department. Both of these stripping operations are the greatest sources of dust and present a serious dust hazard to the men doing this work, particularly since no protection is afforded. Fortunately, these operations are intermittent. If they were continuous, the entire stall shop would be seriously affected.

2. We found that in some of the various departments at Calumet and the Central Machine Shop, grinding wheels are in use.