

BASIC APPLICATION
LO-TEMP
EQUIPMENT & DUCTWORK

SECTION 3

Page 32

DUCT INSUL. (cont'd)

The lags shall be grooved to fit over the ribs or joints as shown in Figure 37A. The groove shall be partially filled with 30-45 sealing mastic, sufficient to eliminate any voids between joints and insulation. The lags shall be cemented to the duct insulation with 41-99 P.V.A. mastic.

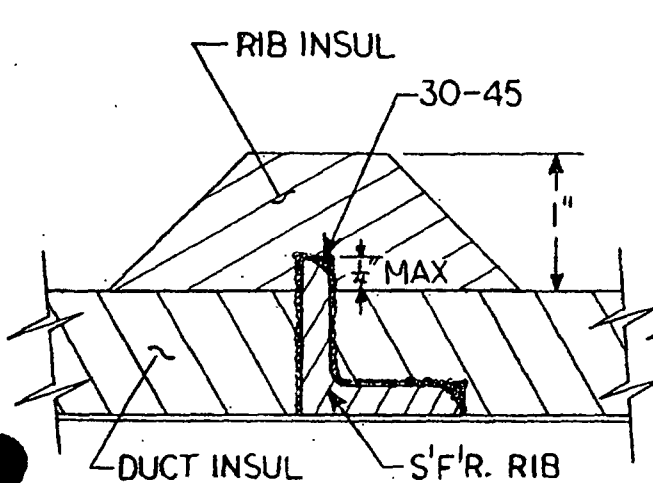


FIGURE 37 A
(CROSS SECTION)

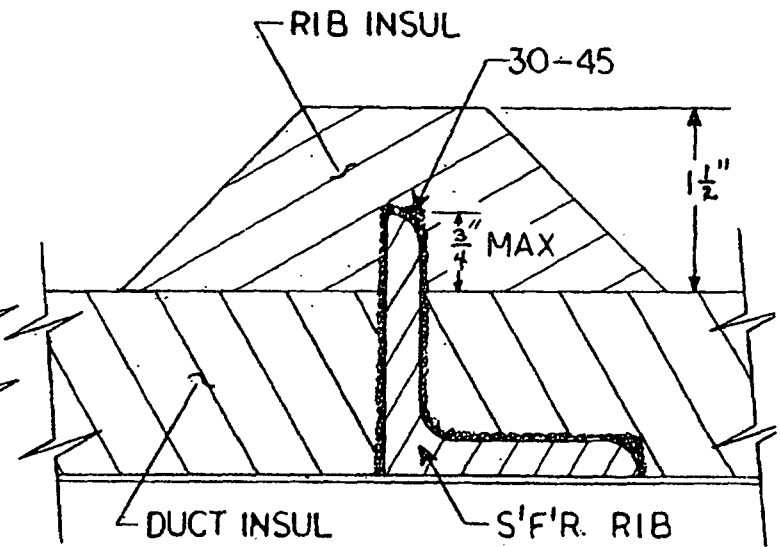


FIGURE 37 B
(CROSS SECTION)

6B7.2 When the joints or ribs extend more than $\frac{3}{4}$ " beyond the duct insulation, they shall be insulated as shown in Figure 39.

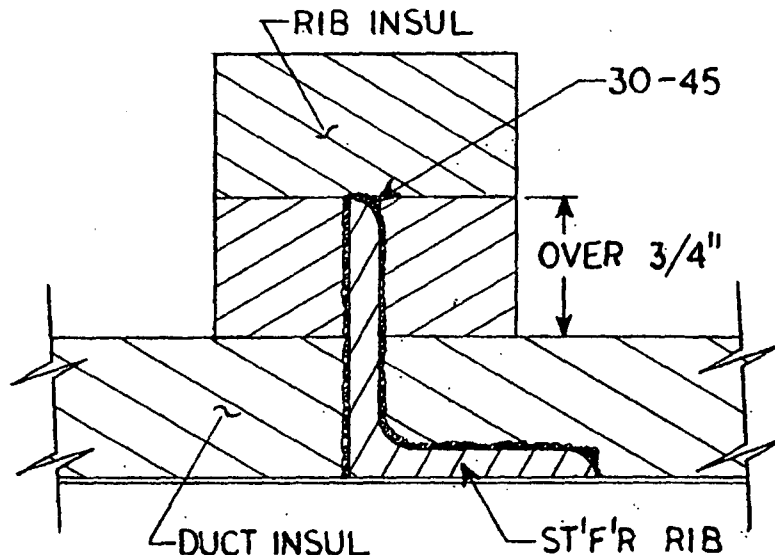


FIGURE 38.
(CROSS SECTION)