Table VIII
Guide to Rate of Dissolved Water Removal
By Filtering Askarel Through Paper Pads

Passes Through Filter Press	Water in Askarel (ppm)
0	115
1	35
2	22
3	18
4	12
5	10
6	10

B Contaminated Solid Wastes
The ANSI Guide states that "All solid wastes which have been saturated with askarel should be disposed of by the following procedure:
1 The saturated wastes should be placed into impervious containers and then shall be taken to a sanitary landfill site meeting State requirements. Alternatively, they can be disposed of by incineration in Solid Waste approved facilities.
2 Solid absorbents used for spills may be disposed of uncontained in the supervised dry sanitary site. The fuel to the site should be in closed containers. Alternatively, incineration can be used in accordance with par. B. (See Section 4 for restrictions)."

C. Solid Insulation Requiring Drying
If the solid insulation of the transformer requires drying, consult the transformer manufacturer or an approved service shop, as in such case oven drying is preferred.

D Earth Treatment for Maximum Improvement of Power Factor and Volume Resistivity
We question whether pumping and filtering the fluid solely to achieve a change in power factor or volume resistivity may be justified on technical grounds, but primarily regarding PCB's. We recommend that in these situations the original transformer manufacturer be contacted.
1 Procedure:
The piece of liquid should be relatively dry prior to the following earth filtration.

As a coating on the filter paper surfaces one should use Attapulgus clay or Fuller's earth mixed and stirred or rolled for 12 hours at 300-350 F into the clay or powder. The amount of earth used should be 0.1 to 0.2 [illegible] by weight on the weight of the askarel to be treated (a gallon weighs about 12.5 pounds per gallon).

To deposit the earth evenly around the pores of the paper, a small portion of clay is put in a small container. Pump the mixture [illegible] and allow it to flow back into the container. This procedure should be repeated [illegible] times. The earth should be dried [illegible] to remove any moisture. Then the earth is ready for use.

2 Effect of Equipment Material of Construction
Only [illegible] should be used. [illegible] the equipment [illegible] by the [illegible] of the [illegible] of the [illegible] of

T [illegible]

Power Factor (pf)		Minimum Resistance to Ground at 500 Volts	Minimum Insulation Resistance
[illegible]	[illegible]	[illegible]	[illegible]
1	0.01	1500	22 K Ω
0.5	0.1	500	25
0.3	0.3	100	15
0.2	2.0	50	10
0.1	-	25	10

XXI Cleaning And Transformers

If a unit has [illegible] cleaning of the core is necessary before [illegible] insulation and returning it to service. Follow this procedure

A Drain out all dark carbon contaminated askarel. Askarel is the only fluid that [illegible] Committee C107 report.)

B Carefully brush carbon deposits from internal parts and insulation using a soft bristle brush making sure that insulation is not damaged

C Flush thoroughly using new askarel – not an oil, not a cleaning solvent

D Flush a second time with fresh askarel, drain, then fill to the proper level with new askarel

E Energize transformer to warm the fluid for 24 to 48 hours then circulate the askarel through a filter returning it to the unit finished and ready for use

*This assumes that the cause of [illegible] When there is any doubt [illegible] result. This procedure can be required for [illegible]

XXII Sampling Askarel

Take a sample as close to the top of the liquid surface as [illegible] for askarel transformers have a built in sampling tube [illegible] for internal sampling. Then to make sure that your [illegible] represents your askarel insulation take another sample from bottom of tank and compare. Use conditions are [illegible] valves for other samples. Use the tubes of clean glass [illegible] glass jars or [illegible] types, and silicone or Viton for the [illegible] for these two types.

Use [illegible] containers for the askarel sample. [illegible] the [illegible] sample. Insert a [illegible] [illegible] [illegible]

[illegible] Make sure that the [illegible] at warm as the surrounding air. (Cold liquids can condense moisture from humid air.)

[illegible] When [illegible] from transformers, it is best to take the sample [illegible] unit is [illegible] at [illegible] or [illegible] for [illegible] a [illegible] voltage test. Sampling the warm [illegible] [illegible] during operation.

Experience [illegible] that [illegible] will [illegible] from a transformer's solid insulation [illegible] and vice versa, depending on [illegible] Therefore, when the transformer is hot, the moisture is most likely to be found in the liquid. This accounts largely for [illegible] breakdown voltage. For example, a [illegible] breakdown voltage may be found during winter months and a relatively low dielectric breakdown voltage during the summer months on samples taken from the same unit.

When testing has been completed, the remainder of the fluid sample should be destroyed by high temperature incineration described in Section VIII.

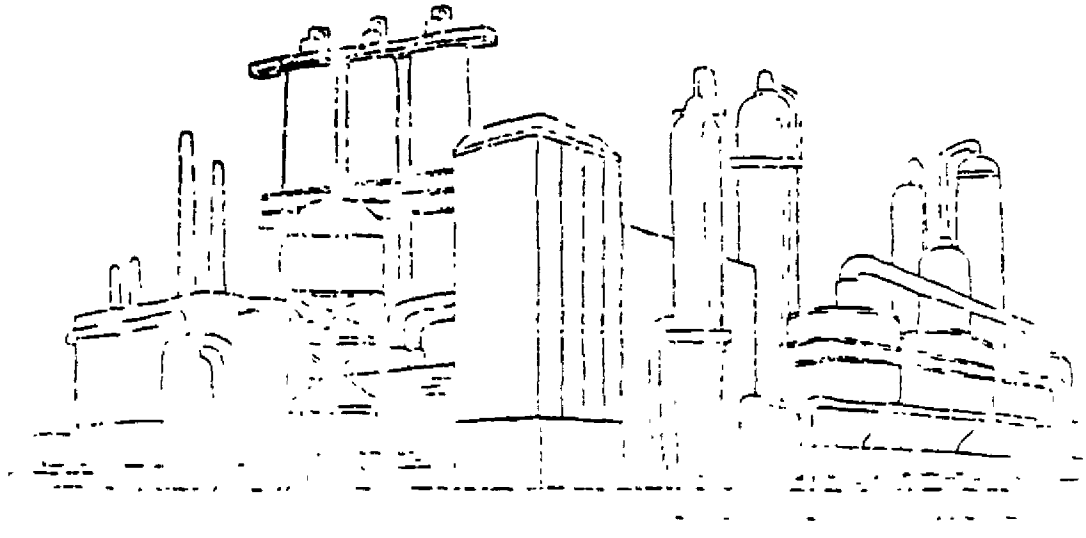

MONS 219776

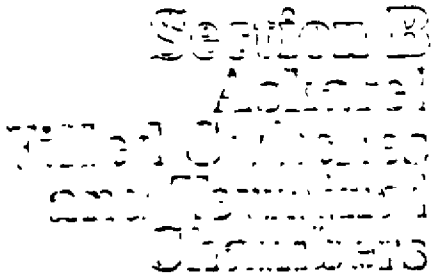

Section B
Askarel Filled Switches and Terminal Chambers

I. Introduction

[illegible] usually connected to askarel or mineral oil filled [illegible] through [illegible] chamber [illegible] chamber [illegible] high voltage leads [illegible] connected directly to the switch terminals. They may be [illegible] mineral oil [illegible] or drum type [illegible] with a [illegible] block and porcelain [illegible] for three phase service.

Askarel transformers with attached [illegible] have been in use for about 20 years. When they were first introduced, the availability of [illegible] and gasketing materials was rather limited and even the best [illegible] had no service history. As a result, [illegible] gasket materials such as cork, nitrile rubber, and nitrile rubber and cork particles were used. While satisfactory for a limited period of time, these materials cannot be depended upon for the expected long life of the equipment.

The terminal chamber is usually above or below the switch compartment and separated by a steel wall through which the bushings are inserted. When bushings are properly selected and correctly installed, there is no leakage from one compartment to the other. With poor bushing seals and the terminal chamber above the switch, potting compounds or cable oil can seep into the askarel. When the terminal chamber is below the switch, askarel can drain into the terminal chamber.

II. Sources of Contamination

There are three possible sources of contamination for askarel in switches and terminal chambers, they rank in this order of frequency: (1) water entering through door gaskets, (2) decomposition products from arcing when switch is used to break magnetizing current, (3) entrance of pothead or cable compounds through leaky bushing seals.

Unlike an askarel transformer where the amount of contamination is likely to be very small (probably only trace amounts) in relation to the volume of askarel fluid [illegible] switches or terminal chambers with faulty seals, the amount of contamination can be relatively large.

Experience has shown that, based on the number of [illegible] askarel switch units, the percentage of failures is extremely small [illegible] most failures [illegible] contamination [illegible] contamination of askarel [illegible] and [illegible] leaks [illegible] failures.

[illegible] terminal chambers [illegible] no great harm [illegible] and [illegible] askarel [illegible]

When the terminal chamber [illegible] switch chamber [illegible]

[illegible]

[illegible] Switches and Terminal Chambers

[illegible]

[illegible]

[illegible] Switches in Arduous Conditions

[illegible]

[illegible]

[illegible]

[illegible]

[illegible]

V Maintenance for Arterial Filled Switches

Switches [illegible] source has been switched off [illegible]

5 Switches [illegible] current will be subject to arcing [illegible] amount of decomposition will depend on both interrupting [illegible] operation. As a general rule, [illegible] 5 to 10 operations

1 On [illegible] switches after the breakers at 3, 6 and 12 months [illegible] Visual inspection to the guessing of causes and [illegible] probably indicate that less frequent [illegible]

2 Check [illegible]

a [illegible] (ASTM D877), it should [illegible] minimum [illegible] breakdown voltage is [illegible] contamination by water by Karl Fischer method (ASTM D 1533). Failure to remove moisture. Dielectric [illegible] 30 kV minimum.

b [illegible] carbon from arcing. Fluid should be [illegible] by [illegible] carbon, it will [illegible] and [illegible] marks, [illegible] these [illegible] [illegible] [illegible]

[illegible]

6 [illegible] repack with a Silas [illegible] gasket

VI. Askarel Under Excessive Temperature or Fault Condition.

The IEEE Guide also points out that:

"Chlorophenols used in transformer askarels begin to boil at temperatures of about 200 C, or [illegible] material is heated to such high temperature in a sealed system pressure develops. Pressure will [illegible] in the system if the askarel is [illegible] sufficiently to generate [illegible] hydrogen chloride gas.

"Therefore, it is recommended that wherever possible sealed askarel filled equipment be provided with pressure relief devices. These devices must be [illegible] enough to provide immediate [illegible] a definite pressure and to prevent further build up of pressure if decomposition continues. It must be remembered that the presence of devices of this sort does not necessarily preclude the rupturing of containing vessels, since pressure build up can be extremely rapid under violent arcing conditions."

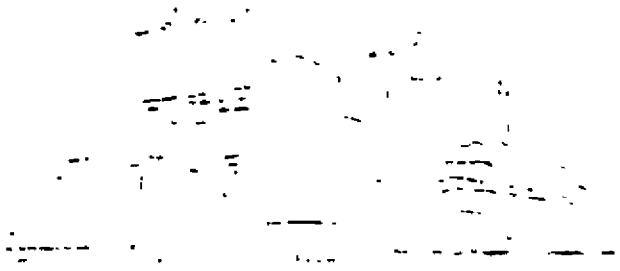

MONS 219779

[illegible] Analysis Services for Askarel Contaminated Electrical Equipment

[illegible] sample [illegible] fluid analysis [illegible] the [illegible] form for each sample. Simply contact [illegible] representative [illegible] what [illegible] test are wanted. You will be sent the proper size clean sample container with a [illegible] Then [illegible] process [illegible] your sample [illegible] using the [illegible] form [illegible] guide. Send the container [illegible] photocopy [illegible] sample container, check [illegible] and [illegible] laboratory costs.

Types of Analyses Available

(Analysis 1)
ROUTINE DIELECTRIC BREAKDOWN VOLTAGE CHECK — Total Charge $25.00

To determine the general condition of the fluid and find out whether further analysis is necessary. (one quart sample required)

Properties Tested	Dielectric Breakdown Voltage
Color and Condition	Moisture

You will be notified of the results of this test. If further testing is indicated, and you want a complete analysis, you will be sent a two-part sample container. This sample will be used for the following series of tests.

(Analysis 2)
COMPLETE ANALYSIS — Total Charge $50.00

(1) To determine the extent of fluid contamination, (2) earth treatment to determine the degree of restoration of electrical and chemical properties possible, (3) make test to see how the fluid responded to earth treatment.

a) Complete Analysis to determine the extent of contamination

Properties Tested	Free Chlorides
Color and Condition	Acidity
Specific Gravity	Dielectric Breakdown Voltage
Refractive Index	Power Factor, Dielectric Constant and Resistivity
Water	

b) Earth Refinement Response
Contact with [illegible] for 2.5 hours at 50-60°C with 0.1 to 0.2 percent by weight of properly conditioned Attapulgus clay and then [illegible] through dry filter paper.

c) Complete Analysis Laboratory Earth Treatment

Properties Tested	Acidity
Refractive Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant and Resistivity
Free Chlorides	

You will be notified of the results of this test series on your sample. These data, relating your entire transformer fluid [illegible] can check on [illegible] be required using the following analysis.

(Analysis 3)
ANALYSIS AFTER EARTH REFINEMENT — Total Charge $50.00
(This charge [illegible] analyses 1 and 2 are [illegible] both made.)

To determine what [illegible] the entire lot of the askarel [illegible] responded to [illegible] the [illegible] laboratory, [illegible] sample [illegible]

[illegible] Tested	Free Chlorides
[illegible] Condition	Acidity
[illegible] Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant and Resistivity

[illegible] determined above [illegible] the following [illegible]

[illegible]

[illegible]

[

APPENDIX A

[illegible] Arc Formed Gas [illegible] is one of the most inert chemicals [illegible] non-corrosive liquids known. It will not break down, oxidize or sludge when exposed to air and high temperatures [illegible] however, [illegible] the compound to liberate some hydrogen chloride [illegible] amounts of [illegible]

APPROXIMATE COMPOSITION
ARC FORMED GAS FROM TRANSFORMER ASKAREL BLENDS
ASTM TYPES D AND G
(INERTEEN 70 30 AND PYRANOL A1SSSB-S, RESPECTIVELY)

Gas	Amount
carbon monoxide	0.3%
carbon dioxide	0.3%
oxygen	0.6%
inert gases	1.5%
hydrogen chloride	97.3%
(note the absence of phosgene)	

This arc formed gas from ASTM Type D and Type F transformer askarels is non-flammable and non-combustible.

For all practical purposes, the amount of gas liberated from askarel under a given set of arcing conditions is about 100 cubic centimeters per kilowatt second.

APPENDIX B

SOLUBILITY OF GAS IN TRANSFORMER ASKARELS
ASTM TYPES D AND G

	Percent of Gas By Volume Corrected to			
	25°C 760 mm		0°C 760 mm	
	25°C	100°C	25°C	100°C
Carbon dioxide	71%	47.[illegible]	–	–
Air	5.7	4.9	5.8	5.0
Nitrogen	6.0	4.3	5.5	4.4
Hydrogen chloride[1]	37.8	50.9	–	–

[1] In absence of scavenger

APPENDIX C

EFFECT OF TEMPERATURE ON DIELECTRIC BREAKDOWN VOLTAGE OF ASKAREL

Temperature °C	Dielectric Breakdown Volts ASTM D 877
−60	67 KV
−40	60
−20	57
0	55
20	50
40	[illegible]
60	[illegible]
80	[illegible]

MONS 219781

APPENDIX D

COMPARISON OF THE APPROXIMATE VISCOSITY IN SAYBOLT UNIVERSAL SECONDS OF TRANSFORMER ASKARELS AND MINERAL OIL

Temp °C	Pyranol A10338-3	10-C Mineral Oil	Inerteen 70-30
−20	1,000	1,000	2,800
0	150	150	150
20	70	65	65
40	45	49	50
60	39	40	40
80	34	34	36
100	30	30	33

APPENDIX E

THE DENSITY OF INERTEEN 70-30 AND TRANSFORMER PYRANOL A10338-3

Approx. Density gm/cc.

Temp °C	Inerteen 70-30	Pyranol A10338-3
0	1.574	1.577
20	1.552	1.555
40	1.529	1.532
60	1.507	1.510
80	1.485	1.488

APPENDIX F

The thermal conductivity values of transformer Pyranol A10338-3 at 27°C and 58°C are 28.2 and 25.8 x 10^{-3} calories centimeter^{-1}, degrees centigrade^{-1}, second^{-1}, respectively. Or, approximately 0.03 BTU per (hr.) (sq. ft.) (°F.) per foot. This same approximation applies to Inerteen 70-30.

APPENDIX G

Heat Capacity

Over the temperature range of 25° to 125°C the specific heat of transformer askarel is close to 0.30 calories per gram per degree.

APPENDIX H

Coefficient of Expansion

The average coefficient of expansion of transformer askarel over the temperature range 20 to 100°C is 0.0007 cc/cc/°C. One gallon would increase to 1.05 gallons on heating from 20 to 100°C.

APPENDIX I

Gas Evolution

Askarels of various compositional types are used. Under arcing conditions the gases produced, while consisting of a major quantity of non-combustible hydrogen chloride gas, do have varying amounts of combustible gases depending upon the askarel type.

In laboratory systems simulating arcing askarels and cellulose or other gases or materials may be produced which in mixtures with air are moderately flammable. As a precaution any such gases should be removed from the askarel by bubbling dry nitrogen through the oil and the gases should be [illegible] only work to be performed on the askarel is

APPENDIX J

Supply Principles and Procurement

Dow Corning Corporation, Midland Michigan with Districts at Atlanta Boston, Chicago Cleveland, Dallas Los Angeles New York City Washington D C and Toronto has available Bulletin 09 019 August 1962 entitled "Silastic Design Data" This lists the gasket fabricators throughout the country from whom the "Silastic 50" gasketing can be purchased in sheet extrusions or molded shapes

Generally Silastic 50 sheet goods are stocked by local die cutters hence could be generally purchased locally Usually small quantities of gaskets are die cut If larger quantities are needed, tools are made of the same type used to cut other materials

Where the gasket is extruded for fitting into a machined groove or between gasket stops Dow Corning advises use of a butted joint The joint is then cemented using Dow Corning's Silastic 140 (clear) or their RTV 731 (white) materials which air cure

Dow Corning points out that the local "rubber" fabricators purchase the Silastic 50 in billet form This is worked on a roll mill in preparation for sheeting or extrusion Then to obtain the desired physical properties the fabricator must oven cure the Silastic 50 for 24 hours at 480 F

SPECIFICATIONS*

	Color	White
	Specific Gravity at 77°F	1 20 ± 0 02
ASTM D676	Hardness Shore A Scale	45 to 60
ASTM D412	Tensile Strength psi, min	800
ASTM D412	Elongation percent min	250
ASTM D395	Compression Set after 22 hrs at 300°F percent, max	30

*All physical properties measured on 0 075 inch thick samples molded 5 minutes at 240°F, and oven cured 24 hours at 480°F

APPENDIX K

Caution Label

The following or equivalent caution statements should be fixed on all containers of transformer askarels and the transformers themselves

This product contains Polychlorinated Biphenyls (PCBs). Care should be taken to prevent entry into the environment through spills, leakage use, vaporization or disposal of liquid or containers Avoid prolonged breathing of vapors or mists Avoid contact with eyes or prolonged contact with skin If skin contact occurs, remove by washing with soap and water Following eye contact, flush with water In case of spillage onto clothing, the clothing should be removed as soon a practical, skin washed, and clothing laundered

Monsanto

MONSANTO INDUSTRIAL CHEMICALS COMPANY
SPECIALTY PRODUCTS GROUP
[illegible] N LINDBERGH BLVD
ST LOUIS MISSOURI 63166

MONS 219783

CUSTOMER SERVICE CENTERS

AKRON, OHIO 44313
260 Springside Drive
Montrose Development Park
Tel. (216) 666-8111

ATLANTA, GEORGIA 30339
300 Interstate North Parkway
Suite 500
Tel (404) 432 7111

BOSTON, MASSACHUSETTS 02149
Everett Station
Tel (617) 387 5010

CHICAGO, ILLINOIS
3158 Des Plaines Ave
Des Plaines, Illinois 60018
Tel (312) 296-6699

CINCINNATI OHIO 45236
8041 Hosbrook Road
Tel (513) 984 1100

DETROIT, MICHIGAN
500 Northland Towers West
Southfield Michigan 48075
Tel (313) 357 0910

HOUSTON, TEXAS 77027
1301 Post Oak Tower
5051 Westheimer Road
Tel (713) 621 9550

LOS ANGELES, CALIFORNIA 90022
6670 E Flotilla St
Tel (213) 723 2492

NEW YORK, NEW YORK 10036
1114 Avenue of the Americas
Tel (212) 764 5000

ST LOUIS, MISSOURI 63166
800 N Lindbergh Blvd
Tel (314) 694 1000

SAN FRANCISCO BAY AREA
2710 Lafayette
Santa Clara, California 95052
Tel (408) 243-0414

SEATTLE, WASHINGTON 98121
2112 Third Avenue
Tel. (206) 622-4203

WILMINGTON, DELAWARE 19810
Suite 204 Barcroft Bldg
3411 Silverside Road
Tel. (302) 478 4600

Monsanto Industrial Chemicals Co.
A Unit of Monsanto Company
800 N Lindbergh Blvd., St. Louis, Mo. 63166

BULLETIN NO. C-FF-7R
(Revised March 197[illegible])

TRANSFORMER

Askarel

Inspection & Maintenance Guide

Monsanto

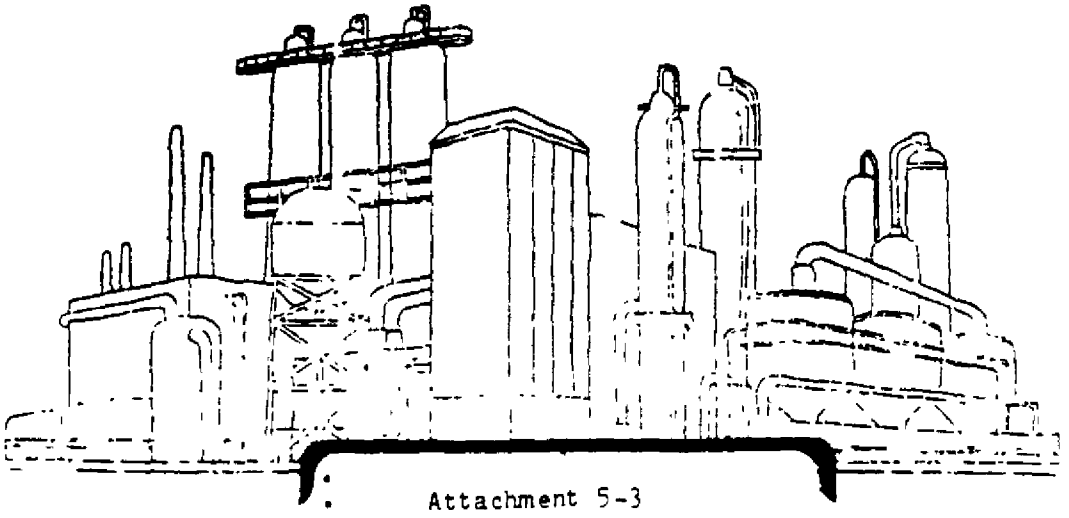

Attachment 5-3

MONS 219785

Table of Contents

SECTION A
TRANSFORMER ASKARELS 1
I. Introduction 1
II. History of Trade Name Types 1
Table I – The Composition of Transformer Askarels 2
III Interchangeability 2
IV. Table II – Official Transformer Askarel Shipping Specifications 3
V Ordering Instructions 2
VI. Stability 2
VII Precautions When Handling Drums, Tank Cars and When Opening Transformers 2
A Keep Dry During Handling 2
Table III – Handling and Pumping Temperatures 4
B Use Ordinary Personal Precautions 4
C Precautions on Opening an Askarel Transformer 5
VIII. Avoid Environmental Pollution 5
1 Labeling Askarel Transformers 6
2. Disposal of Liquid and Solid Wastes . . . 6
3 Conditioning of New or Recycled Askarel 6
4 Teardown of Transformers for Repair or Scrap 7
5 Transformer Disposal 7
IX. Expected Service Life 7
X. General Characteristics of Transformer Askarel Fluid 7
XI. Sampling Transformer Askarel Fluid 8
XII. Evaluation of Askarel Received in New Equipment 8
XIII Dielectric Breakdown Voltage – Moisture Relationship 9
Table IV – Relation of Dielectric Breakdown Voltage to Amount of Dissolved Water in Askarel and Mineral Oil 9
Table V – Approximate Solubility of Water in Transformer Askarel and Mineral Oil 10
XIV. Turbidity 10
XV. Check Points for Maintaining Askarel Insulation 10
A General Considerations 10
B Modern Sealing Procedures 11
C The Older Sealing Arrangements 12
XVI. Periodic Fluid Inspection and What Checkpoints Mean 12
A Visual Inspection 13
B Dielectric Breakdown Voltage 13
XVII Inspection Checklist 13
XVIII Contamination in Transformers 14
Table VI – Effect of Common Insulation Materials on Power Factor and Dielectric Strength 14
Table VII – Effect of Common Insulation Materials on Volume Resistivity of Askarel 14
XIX ASTM Method for Investigating the Compatibility of Transformer Insulation and Construction Materials in Askarels . . . 15
XX Reclaiming Askarel for Re Use 15
A Filtering Through Dry Blotter Paper to Remove Moisture and Extraneous Particles 15
Table VIII – Water Removal by Filtering Askarel Through a Paper Press 16
B. Disposal of Solid Wastes 16
C Solid Insulation Requiring Drying 16
D. Earth Treatment for Maximum Improvement of Power Factor and Volume Resistivity 16
Table IX – Effect of Power Factor and Volume Resistivity . . 17
XXI. Cleaning Arced Transformers 17
XXII. Sampling Askarel 17

SECTION B
ASKAREL FILLED SWITCHES AND TERMINAL CHAMBERS 19
I Introduction 19
II. Sources of Contamination 19
III. Sealing Switches and Terminal Chambers 20
IV. Askarel Used Under Mild Arcing Conditions 20
V. Maintenance for Askarel Filled Switches 20
VI Askarel Under Excessive Temperature or Fault Conditions 21

SECTION C
TOXICITY AND SAFE HANDLING 21
I. Inhalation 21
II. Skin Contact 21

SECTION D
ANALYTICAL SERVICES ON TRANSFORMER ASKAREL AVAILABLE FROM MONSANTO 22
Types of Analyses Available: 22
1) Routine Maintenance Check 22
2) Complete Analysis 22
3) Analysis After Earth Refinement 22

SECTION E
APPENDICES 23
Appendix A – Askarel Stability and Composition of Arc Formed Gas 23
Appendix B – Solubility of Gas in Transformer Askarels 23
Appendix C – Effect of Temperature on Dielectric Breakdown Voltage of Askarel . . 23
Appendix D – Comparison of the Approximate Viscosity in Saybolt Universal Seconds of Transformer Askarels and Mineral Oil 24
Appendix E – The Density of Inerteen 54201 KA 7336-9 and Transformer Pyranol A1393B-3 . . . 24
Appendix F – Thermal Conductivity Values of Transformer Pyranol A1383B 3 . . . 24
Appendix G – Heat Capacity . . . 24
Appendix H – Coefficient of Expansion . . 24
Appendix I – Fire Resistance 24
Appendix J – Seals, Properties and Procurement 25
Appendix K – Caution Label 25

NOTICE "Nothing contained herein is to be construed as a recommendation to use any product in conflict with any patent. MONSANTO MAKES NO WARRANTIES OF TO THE FITNESS FOR A PARTICULAR PURPOSE MERCHANTABILITY OF ANY PRODUCT REFERRED TO, no guarantee of satisfactory results from reliance on contained information or recommendations, and disclaims all liability for any resulting loss or damage."

Section A
Transformer Askarel

I. Introduction

The term "askarel" as defined by IEEE, ASTM and the National Electrical Code generally describes a broad class of fire-resistant* synthetic chlorinated hydrocarbon insulating liquids widely used in transformers, reactors and accessory equipment operated at power frequencies. Askarels of various compositional types are in use. (For the general properties and types see ASTM D-2283.) Under arcing conditions the gases produced, while consisting of predominantly non-combustible hydrogen chloride, can contain varying amounts of combustible gases depending upon the askarel type.

This manual describes the operating characteristics of transformer askarel liquid insulation as manufactured by Monsanto and how it differs from mineral oil. Appropriate handling and disposal procedures for both scrap askarel liquid and impregnated solid materials are given in accordance with the guidelines recommended by the American National Standards Institute.

The information is based on facts gathered by Monsanto over 40 years as a producer of askarel, plus knowledge gained from the experience of transformer manufacturers and users. This guide outlines the maintenance required for askarel fluid in "modern" transformers and offers suggestions for sealing and maintaining askarel in old units. By following this guide, we believe users will obtain maximum service from askarel insulation with a reasonable minimum of maintenance. If questions arise relating to the designing and building of transformers these should be referred to regular transformer suppliers.

Monsanto gratefully acknowledges the assistance, guidance and contributions of certain data by the following

Edward L. Baar – General Electric
Dr. T. K. Stost – Westinghouse Electric

II. History of Trade Name Types

"Askarel" is the generic name for the fire-resistant coolant and coolant first used by General Electric Company in 1932 for the Pyranol[1] brand name fire-resistant transformers. Westinghouse Electric Corporation uses their brand name, Inerteen.[2]

Whatever the trade name used, the askarel contains chlorinated biphenyl – one of the best liquid insulations developed by science. This inert material is chemically stable, fire resistant, heat stable, non corrosive and has high dielectric strength under the operating conditions encountered in transformers.

In addition to manufacturing Aroclor® (chlorinated biphenyl) Monsanto also mixes this dielectric fluid with an oxygen to produce the presently used Inerteen and Pyranol blends described in Table I.

* NOTE: Materials designated fire resistant generally are more difficult to ignite, or once ignited burn at a slower rate than combustible or conventional materials. This term does not mean that fire resistant materials will not burn. However, when properly used Monsanto's fire resistant ASKAREL FLUID is useful in helping customers meet fire safety requirements.

[1] Trademark of Monsanto Company
[2] Trademark of Westinghouse Electric Corporation

® Registered trademark of Monsanto Company

Table I
The Composition of Typical Transformer Askarels

	Method ASTM D2283		
	Type D	Type E	Type G
Trade Names	Inerteen 70-30	Inerteen 100-42	Pyranol A138383
Ingredients (% by wt.)			
Aroclor® 1254, chlorinated biphenyl (54% chlorine by weight)	70	–	60
Aroclor® 1242, chlorinated biphenyl (42% chlorine by weight)	–	100	–
Trichlorobenzene	30	–	40
Phenoxypropene oxide scavenger	0.18 to 0.22	0.18 to 0.22	–
Diepoxide scavenger	–	–	0.115 to 0.135

ASTM Method D-2283, titled *"Chlorinated Aromatic Hydrocarbons (Askarels) For Transformers"*, also lists the composition of all transformer askarels used at various times since 1932.

Monsanto manufactures similar transformer askarel fluids in England where the trade name Pyroclor is used.

III. Interchangeability

In general all transformer askarels are interchangeable. However, it is suggested that the transformer manufacturer be consulted prior to mixing in significant proportions of foreign askarels.

IV. Transformer Askarel Specifications

Specifications for the three major transformer askarel fluids are shown in Table II.

V. Ordering Instructions

Monsanto's current policy is to sell askarel transformer fluids only to transformer manufacturers. Users interested in these fluids should contact the manufacturers of askarel transformers and not Monsanto. The transformer name plate indicates the transformer maker and usually gives sufficient data to identify the specific askarel fluid used.

VI. Contamination

Askarel insulation must never be mixed with mineral oil. Over two percent of mineral oil by volume in askarel begins to lower its fire resistance.

In modern transformers, the principal "enemy" of askarel is contamination by water. Keeping askarel water free will insure long time service.

Askarel is heavier than water. If water gets into askarel insulation, only a tiny amount (approximately 120 ppm) dissolves – the rest floats on top. Askarel is very insoluble in water, only about 200 parts per billion of askarel dissolve in water at normal temperatures.

VII. Precautions When Handling Drums, Tank Cars, and When Opening Transformers

The following precautions

[illegible]

Transformer Askarel Specifications (New Fluid)

Specification Properties[1]	General Electric Co. Transformer Pyranol A13B3B-3 ASTM D2283 Type G	Westinghouse Transformer Inerteen 70-30* ASTM D2283 Type D	Westinghouse Transformer Inerteen 100 42* ASTM D2283 Type E
Color APHA	150 max	150 max	60 max
Clarity	Clear	Clear	Clear
Suspended matter ppm (ASTM D1533-60)	30 max.	30 max	35 max
Acidity mg KOH/g (ASTM D974-55)	0.013 max	0.014 max	0.01 max
Dielectric Strength 25 C, 0.1 in gap (ASTM D877-49)	35 KV, min	35 KV, min	35 KV, min.
Power Factor, 100 C, 60 Hz (ASTM D924-49)	4.2 to 4.6	4.2 to 4.5	4.7 to 4.9
Volume Resistivity 100 C, 500 volts DC 0.1 inch gap, 10^9 ohm cm (ASTM D1169)	100	100	100
Inorganic chlorides, ppm (ASTM D1821 and C, E Method E4C418)	0.10 max	0.10 max	0.05 max
Refractive index, 25 C (ASTM D1807)	1.6110 to 1.6120	1.6153 to 1.6173	1.6240 to 1.6260
Viscosity at 37.8 C (ASTM D88-56)	44 to 48	56 to 61	82 to 92
Saybolt Universal Seconds			
Pour Point, °C (ASTM D 97-57)	30 or lower	30 or lower	17 or lower
Specific gravity 25/15.5°C (ASTM D1810)	1.495 to 1.510	1.518 to 1.528	1.381 to 1.392
Flash point (ASTM D92)	None to boiling	None to boiling	None to boiling
Distillation range (ASTM D 20-56) corrected to standard barometric pressure	1st drop 200°C min 40% max. to below 270°C 90% 379 to 394	1st drop 200°C min 35% below 270°C 90% 379 to 394	10% 325°C min 90% 360 max
Chlorine content	54 ± 0.5%	55.6% min.	43 ± 0.5%
Corrosion test	After heating with aluminum for 6 hrs. at 200 to 220°C, the aluminum must not be corroded on either visual or weight inspection and the askarel should meet the following specifications		
Color APHA	200 max	200 max.	200 max
Acidity mg KOH/g	0.014 max	0.014 max	0.01 max
Inorganic chlorides ppm	0.15 max	2.0 max	0.15 max
Corrosion	Clear	Clear	Clear
Stabilizer content	0.115 to 0.135% Diepoxide	0.18 to 0.22% phenoxypropene oxide	0.18 to 0.22% phenoxypropene oxide
Typical Properties[2]			
Coefficient of Thermal Expansion (ASTM D1903) cm³/cm³/°C	0.00077	0.0007	0.00068
Arc-Inhibiting			

Askarels of various compositional types are used. Under arcing conditions the gases produced while consisting predominantly of non-combustible hydrogen chloride can include varying amounts of combustible gases depending upon the askarel type. Insulation systems incorporating these askarels and cellulose or other organic materials may evolve gases producing gaseous mixtures which are moderately flammable. As a precaution such gases should be removed from the askarel by bubbling dry nitrogen through the askarel and flushing the gas space with dry nitrogen before any arcing occurs on the apparatus.

[1] Specifications are in accordance with Monsanto's published specifications.

[2] Typical properties are not specification requirements. Write us for complete data sheets and specifications for Askarel fluids.

MONS 219789

operating askarel transformers — take every precaution to guard the askarel insulation from exposure to high humidity and moisture contamination. Keep 5 or 55 gallon drums of askarel dry. Lay stored drums on their sides with the bung at the highest point from floor to keep water off the drum head (which can be sucked into the askarel by the drum "breathing"). This precaution is not necessary when drums are stored indoors, which is the preferred place for storage.

To avoid leakage the drums used for askarel are of heavy construction. Sixteen gauge metal is used, with special rim seal and bung construction. The drums should be drained as completely as possible and then flushed twice with kerosene type solvent to remove all of the askarel. Accumulated liquids and washings should be collected and should be incinerated at high temperatures, e.g., about 2000°F, to destroy the polychlorinated biphenyls (PCBs). See Section A, VIII.

Tank cars used to transport askarels are in exclusive service and not used interchangeably for other products. All cars must be unloaded through the top (dome fitting) either by pumping or with controlled pressure using dry air or dry nitrogen. If nitrogen has been used for unloading it is necessary to advise the shipper so that when the car returns the nitrogen can be replaced with dry air before any one may enter the car. If the car is to be unloaded by pumping it will be necessary to use a dryer on the air intake line to remove moisture.

All tank cars are fitted with steam coils, which are available for unloading under extreme low temperature conditions.

Convenient handling and pumping temperatures are given in Table III.

B. Use Ordinary Personal Precautions:
Transformer askarel has been made, handled, and used for over 40 years. It can be handled safely with recommended precautions. If accidentally spilled on hands, no serious skin irritation will occur. However, liquid askarel has a solvent action (similar to paint

Table III
Handling and Pumping Temperatures

Product	Unloading, Handling and Pumping Temperature °C
Pyranol A13B3B 3	20 - 55
Inerteen 70-30	20 - 55
Inerteen 100-42	35 - 75

thinner) on the fats and oils of the skin and prolonged contact may lead to drying and chapping of the skin.

In case of contact wash the skin with soap and water, remove and dry clean saturated clothing. Clean up spills with rags, sawdust and absorbent clay. Eye contact may result in painful irritation but no permanent damage to tissues. If askarel gets in the eyes, flush with large amounts of water. As with all eye first aid, refer to a physician. To relieve irritation, physicians have used an [illegible] anesthetic solution as well as opthalmic cortisone [illegible] or castor oil.

Infrequent exposure to [illegible] vapors will not [illegible]
[illegible]

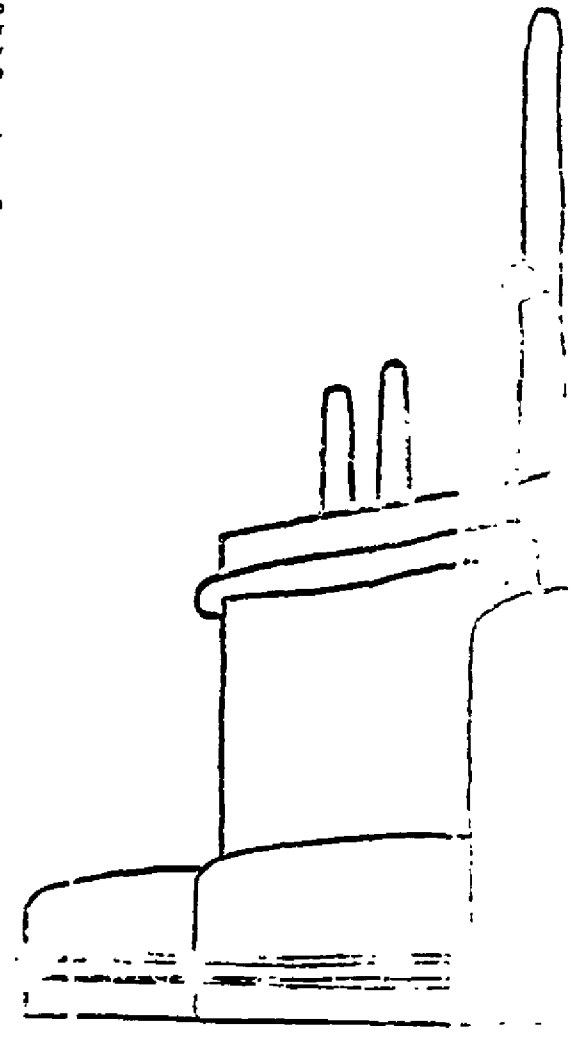

MONS 219790

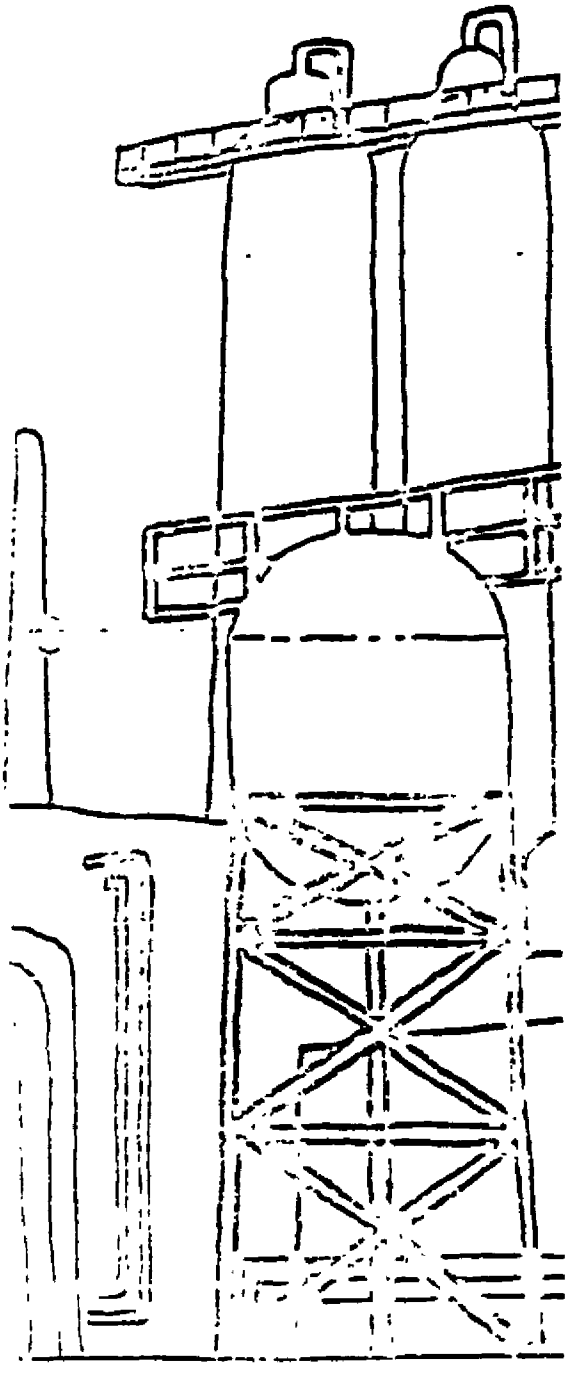

wear an organic cartridge respirator approved by the U.S. Bureau of Mines

C Precautions On Opening an Askarel Transformer

Askarels of various compositional types are used. Under arcing conditions the gases produced while consisting of predominantly non combustible hydrogen chloride can yield varying amounts of combustible gases depending upon the askarel type

Insulation systems incorporating these askarels and cellulosic or other organic materials may, when arced, produce gaseous mixtures which are moderately flammable. As a precaution, such gases should be removed from the askarel by bubbling dry nitrogen through the askarel and flushing the gas space with dry nitrogen before any work is performed on the apparatus

The American Institute of Electrical and Electronic Engineers Guide No. 76, March, 1974 gives more detailed instructions and guidance *"For Acceptance and Maintenance of Transformer Askarel in Equipment"*. This guide is published by the Institute of Electrical & Electronics Engineers, Inc., 345 East 47th Street, New York, New York 10017. We recommend that users of askarel transformers refer to this IEEE document

VIII. Avoid Environmental Pollution

Transformer askarels contain polychlorinated biphenyls (PCBs) which have been used in the United States and elsewhere over the past 40 years for many industrial and consumer applications. During the past several years evidence has accumulated to indicate that PCBs are widely dispersed throughout the environment and that they can have adverse ecological and toxicological effects

The United States Government's Interdepartmental Task Force on PCBs, Com-72-10119, in their March 20, 1972 report, [illegible] *"Polychlorinated Biphenyls and the Environment"* recommended restricting PCBs to use in capacitors and transformers

This report is distributed by the National Technical Information Service, U.S. Department of Commerce, Springfield, Virginia 2[illegible]

A document titled *Guidelines for Handling and Disposal of [illegible] and Transformer Grade Askarels, Containing Polychlorinated Biphenyls"* has been prepared and is available from [illegible] National Standards Institute, Committee C107, 1430 Broadway, New York, New York 10018

The scope, objectives and the composition of this committee [illegible]

ANSI Committee C107

Scope

Procedures and guides for safe use, maintenance and [illegible] askarel and askarel soaked materials used in electrical [illegible]

Objectives:

1. Source of technical information and advice [illegible] State, local authorities and all others concerned
2. Encourage development of suitable disposal [illegible] keep all concerned informed
3. Serve as the advisory group for United States [illegible] international organizations CEE, IEC, CIGRE

Composition

Organizations active in or represented by this [illegible] include: National Electrical Manufacturers Association, [illegible] Institute of Electrical [illegible] Society for Testing and [illegible] Certified [illegible] Protection [illegible] General Services [illegible]

MONS 219791

Bureau of Standards, Department of the Army, Rural Electrification Administration; Division of Environmental [illegible] TVA, American Public Power Association, Water Pollution Control Federation, Food and Drug Administration, National Fire Protection Association, Underwriters Laboratories, and several sections of the U.S. Department of Interior.

The following are pertinent excerpts taken from the ANSI Guidelines for askarel transformers:

1. LABELING ASKAREL TRANSFORMERS (Pg. 16)

4.2.2.1 New Transformers. All new transformers that contain PCBs shall have a label of adequate durability, permanently and prominently attached to the tank by the manufacturer, given adequate warning and instructions. A suggested label includes the following:

CAUTION. The insulating liquid in this transformer contains polychlorinated biphenyls (PCBs). Care should be taken to prevent entry into the environment. In case of malfunction or leaks, consult the instruction manual or the manufacturer.

4.2.2.2 In Service Transformers. The transformer manufacturer should make available suitable labels with a similar warning as shown in 4.2.2.1 for use on existing transformers.

2. DISPOSAL OF LIQUID AND SOLID WASTES (Pg. 15)

4.1.6.5.1 General. Disposal of askarels and askarel soaked materials should be accomplished by means in which there is no significant release of askarel to the environment. At present, disposal is accomplished by carefully controlled incineration of liquids and soaked software, and by controlled landfill burial of apparatus and other hardware from which askarel has been previously drained and washed.

Present knowledge indicates that proper incineration must involve a suitable balance between dwell time and temperature in the incineration plus oxygen availability and, finally, suitable scrubbers to remove the HCl that will be formed: for example, 2 second dwell time at 2000°F and 3% excess oxygen in stack gas, or 1.5-second dwell time at 2700°F and 2% oxygen in stack gas.

These facilities should meet the applicable requirements of the state in which they are located and should control effluents within the limits set forth in this standard.

Controlled landfill or deep well disposal can be used where permitted by federal, state, and local regulations.

The ANSI Guide lists the locations of facilities that conform with the above requirements. Monsanto has such an incinerator at the W. G. Krummrich Plant, Department 831, Sauget, Illinois 62201, where arrangements can be made for scrap askarel liquid disposal for a modest fee. For disposal of solid scrap a controlled dry land-fill can be used where permitted by Federal, State and local regulations.

3. CONDITIONING OF NEW OR RECYCLED ASKAREL (Pg. 16)

4.2.1.3.1 Askarel Conditioning Equipment. The conditioning unit should be located either at the storage tank area or at the main transformer manufacturing area for handling with askarel.

4.2.1.3.2 [illegible] Collection of new or recycled askarel requires full earth ground. The spent [illegible] with oxidation or base catalyzed dechlorination [illegible] to remove as much [illegible] as possible. [illegible] TREATED WITH [illegible] for disposal [illegible]

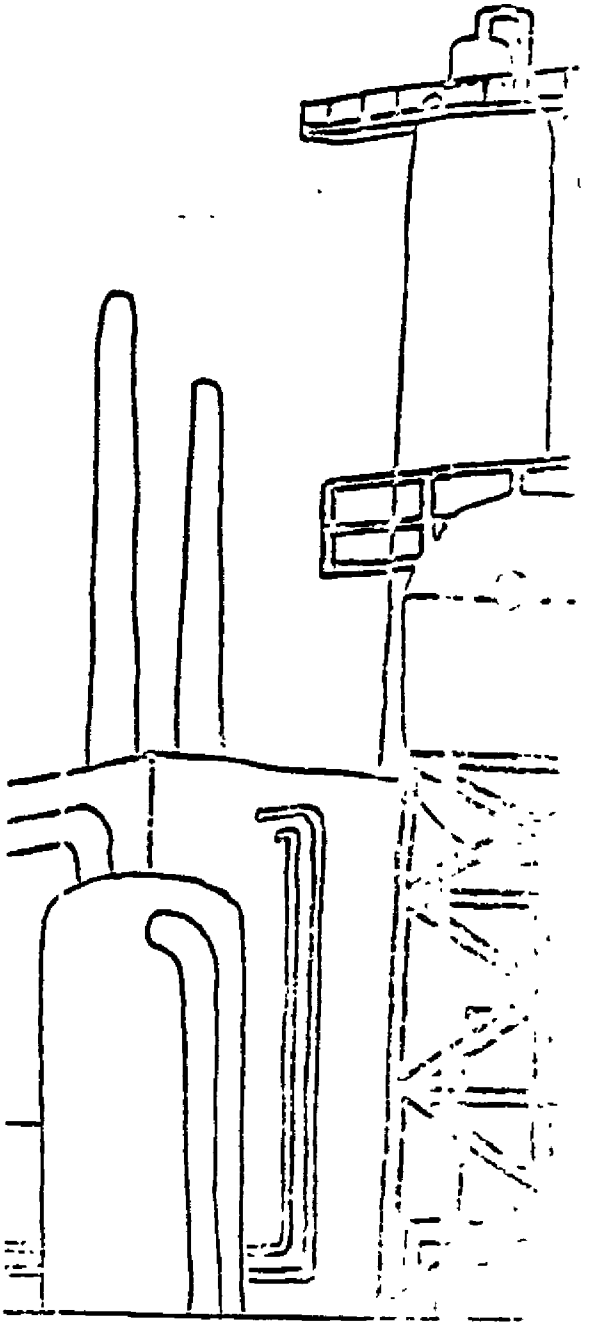

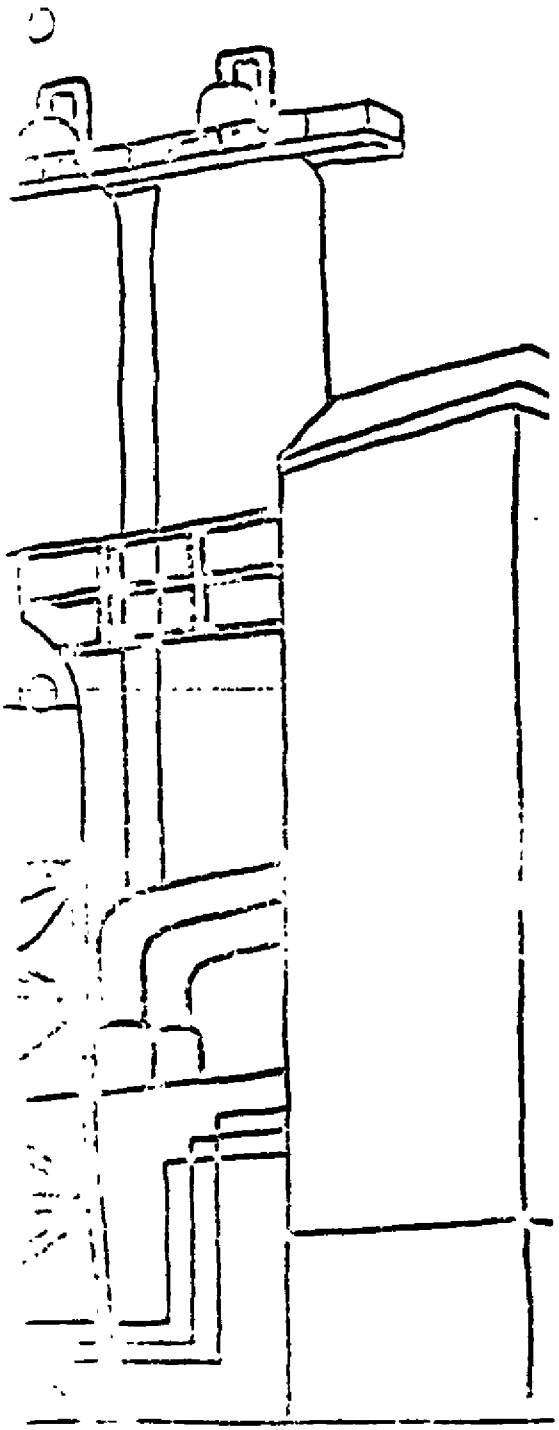

4 TEARDOWN OF TRANSFORMERS FOR REPAIR OR SCRAP (Pg 16)

4 2 1 4 1 Drain all askarel from the unit [illegible] holding tank or reuse or into the drum labeled "SCRAP ASKAREL" for disposition, and then allow sufficient time for all of the askarel to drain from the core and coils.

4 2 1 4 2 Remove the core and coil assembly from the transformer. Sufficient absorbent material should be placed on the floor to absorb any askarel fluid that still drips from the transformer.

4 2.1 4 3 Place all materials in the appropriate salvage containers during the dismantling for later disposition.

4 2 1 4 4 All used materials, including rags, sawdust, tape, etc, regardless of quantity, shall be put into the appropriate containers for disposition.

5 TRANSFORMER DISPOSAL (Pg 17)

4 2 3 6 The ultimate disposal of an askarel filled transformer may be accomplished in either of two ways.

(1) Complete drainage and dismantling with the proper disposal of the askarel and askarel-soaked components as described in 4 1 6.

(2) Disposition of askarel transformers by means of junk or scrap dealers. This should be avoided unless a transformer is first drained, followed by soaking the interior with a suitable solvent. Accumulated liquids and washings are to be disposed of as described in 4 1 6.

IX. Expected Service Life

Manufacturers indicate that properly designed and installed askarel transformers are expected to give trouble-free service for at least 30 years. Since their introduction in 1932 the manufacturers report finding the overall failure rate to be less than 0.5% for all units under test and service conditions. The Edison Electric Institute's report (1956-1956) on their member utilities publishes the failure rate for askarel transformers as 0.13 per hundred banks per year.

Mr. Frank M. Clark, who invented transformer askarels at the [illegible] Electric Company in the early 1930s, made the highly pertinent comment based on his many years of experience with G.E. [illegible] (askarel type) transformers that –

> *"The important thing is to keep them dry – otherwise [illegible] alone"*

These words of [illegible] became especially applicable in more [illegible] years when welding shut rather than gasketing became the main [illegible] of sealing askarel transformers. These units are [illegible] understanding that the liquid is in a normally hermetically [illegible] system.

X. General Characteristics of Transformer Askarel Fluid

Appreciation of the following characteristics as given in the [illegible] Guide, leads to understanding the reasons for selecting [illegible] breakdown voltage and moisture as the prime practical tests [illegible] the quality of transformer askarel fluid. Also, due [illegible] characteristics the power factor of transformer askarel [illegible] much higher than the corresponding values for mineral oil.

In comparison to mineral insulating oil, askarel is a relatively [illegible] material [illegible] molecules are dipoles free to rotate [illegible] and responsive to orientation by electrical forces. Askarel [illegible] a much higher dielectric constant and capacitance than [illegible] and these differences must be kept in mind when [illegible] test data.

[illegible] polar and possesses high [illegible] [illegible] sensitive than [illegible] [illegible] polar materials, and [illegible]

MONS 219793

constructional materials destined for use in askarel is very critical. This sensitivity is reflected in the power factor and resistivity (specific resistance) of the askarel.

It is important to note that, with the exception of water, the dielectric breakdown voltage of askarel is not generally adversely affected by many of the soluble polar materials to which its power factor and resistivity (specific resistance) are so sensitive. In fact, the dielectric breakdown voltage of askarel is somewhat greater than that of insulating oil. Therefore, the values assigned these dielectric fluids in newly supplied transformers are 30 KV min. and 26 KV min., respectively.

As with insulating oil, askarel must be kept dry. It can pick up moisture from exposure to humid atmosphere. Under similar conditions of exposure, askarel can pick up nearly twice as much moisture when measured on a parts per million weight basis.

XI. Sampling Transformer Askarel Fluid

The following precautions about sampling are quoted from the IEEE Guide.

"Representative samples, whether of the complete contents or only parts thereof, are extremely important from the standpoint of evaluation of the quality of the product sampled. Obviously careless sampling procedure or contamination in the sampling equipment will result in a sample that is not truly representative. This generally leads to erroneous conclusions concerning quality and incurs loss of time, effort, and expense involved in securing, transporting, and testing the sample. It is strongly recommended that all of the procedures and precautions outlined in the latest revision of ASTM D 923 (Sampling Electrical Insulating Liquids) be followed.

"Because of the high specific gravity (relative density) of askarel (greater than 1), water and some other impurities are most likely to be found at or near the surface. The top sample, therefore, is considered to represent the worst condition."

XII. Evaluation of Askarel Received in New Equipment

Some users of askarel equipment find it desirable to make "as received tests" on all equipment. It is quite common to use the dielectric breakdown voltage test and visual appearance as the most significant tests. If suitable equipment and trained personnel are available additional information may be obtained from the power factor, color, and moisture content tests.

In sampling askarel contained in apparatus extreme care must be exercised in order to obtain a representative sample. ASTM Method D 923 should be followed.

New equipment with askarel exhibiting the following characteristics is considered acceptable:

		ASTM Methods
Dielectric Breakdown Voltage	30 KV min	D 877
Color	300 max. (Straw color)	D 2129
Condition Visual	Clear	D 1702
Water Content	35 ppm max	D 1533
Power Factor at 25° C	*	D 924, D 150

*The power factor of askarel taken from new transformers, reactors and accessory equipment can reflect the presence of moisture, dissolved polar compounds, or other contaminants and may vary with the type of equipment from which the [illegible] taken due to the different ratios of liquid to solid [illegible] to the high solvency power of the [illegible] water content and [illegible] breakdown vol[illegible] indicated above a high power factor [illegible] serviceability of the askarel within [illegible]

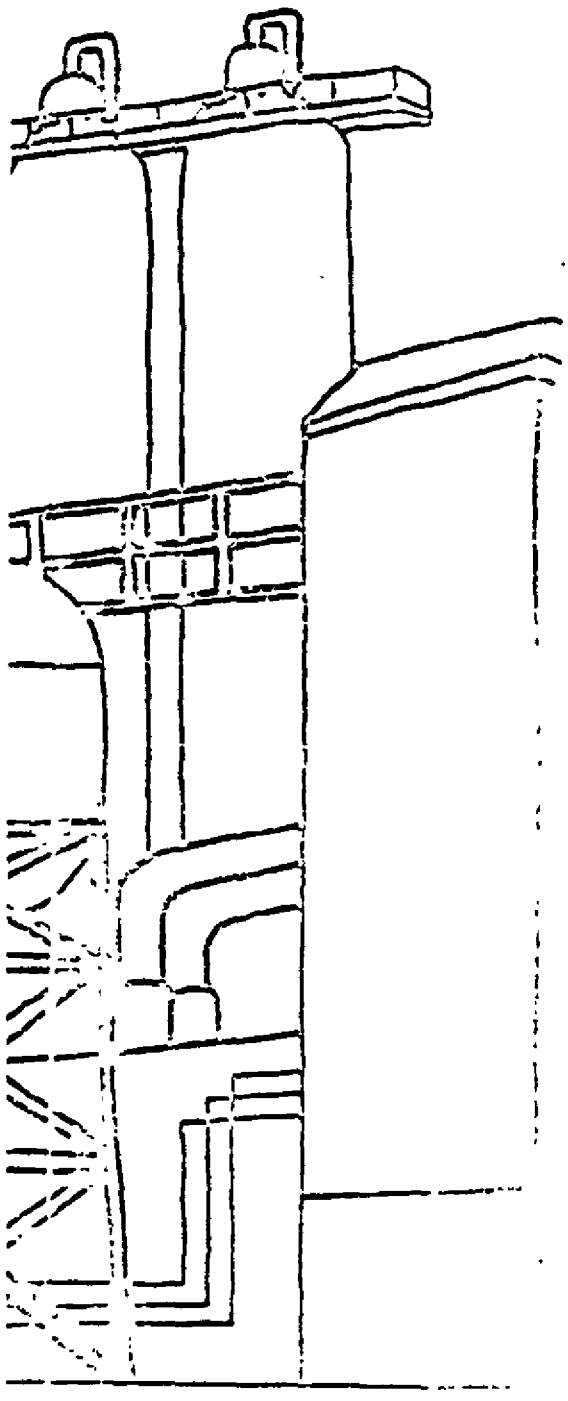

MONS 219794

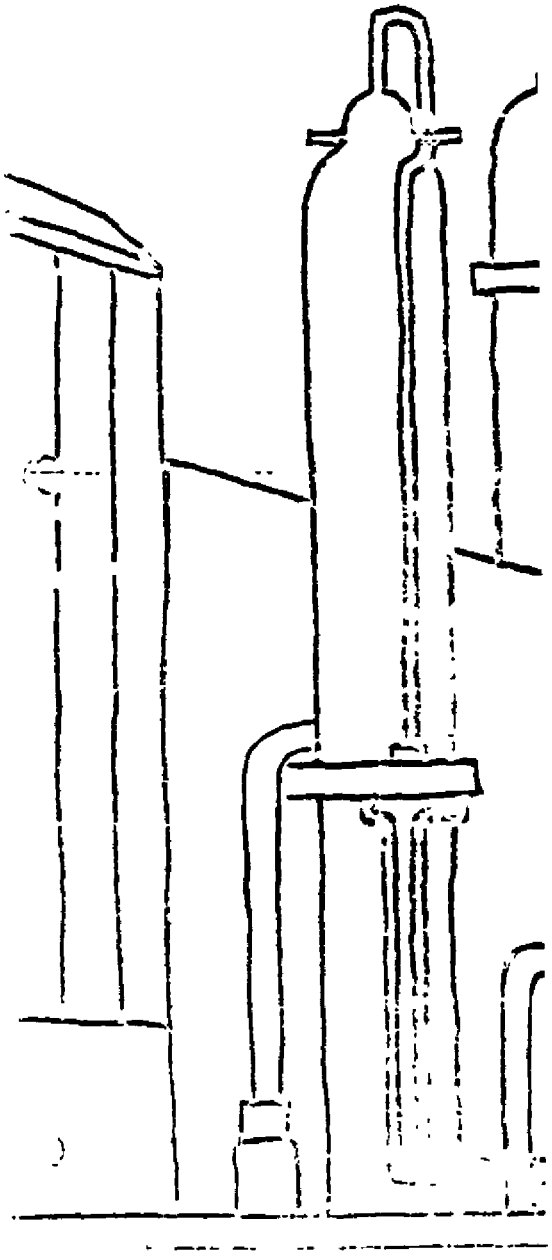

indicative of the degree of extraneous soluble polar mat[illegible] as present

Recognizing the possibility of a wide range of power factors being recorded for askarel in new equipment, it is difficult to establish a single limit which would be acceptable to both suppliers and [illegible] for all applications. However, as a broad guide, power factors up to about 10% at 25°C and 60 cycles per second (hertz) do not in general indicate any abnormal contamination provided that the other criteria (water content, dielectric breakdown voltage [illegible]) are met. Much higher power factors may indicate excessive contamination or the misapplication of the solid materials used in manufacture in contact with the askarel and should be investigated.

XIII. Dielectric Breakdown Voltage — Moisture Relationship

The dielectric breakdown voltage of askarel is highly sensitive to excess moisture, not sensitive to ordinary dissolved polar materials. While the dielectric breakdown voltage can also be lowered by severe arcing, askarel turns noticeably black or has particles of sooty carbon floating in it if arcing has occurred. Then the transformer should be repaired and the askarel replaced.

If the dielectric breakdown voltage is checked periodically and decreases significantly — this indicates moisture pick up, arcing, or both. When the dielectric breakdown voltage has dropped to 26 KV or less, an analysis for water is necessary. If water is found in excess of 40 ppm at room temperature, its source should be located and corrections made.

When the moisture content approaches 125 ppm (saturation level at room temperature), the dielectric breakdown voltage of askarel drops below the value required for efficient insulating. The moisture content should not be allowed to rise over 70 ppm, sampled at operating temperature. If the moisture content is found to be in a satisfactory range and the dielectric breakdown voltage is low, the transformer manufacturer should be consulted.

Table IV shows the relationship of dielectric breakdown voltage to moisture and Table V indicates the approximate water solubility limits in askarel and mineral oil.

Table IV
Relation of Dielectric Breakdown Voltage to Amount of Dissolved Water in Askarel and Mineral Oil

Water Content (PPM)	Breakdown Voltage (AST[illegible] D877)	
	Askarel	Min[illegible]
0	70 KV	[illegible]
20	55	[illegible]
40	47	[illegible]
60	40	[illegible]
80	38	[illegible]
110	10	[illegible]

MONS 219795

Table V
Approximate Solubility of Water in Transformer
Askarel and Mineral Oil

		Amount of Water (PPM) Dissolved	
°C	°F	Askarel	Mineral Oil
30	22	8	8
20	-4	16	10
10	14	28	13
0	32	41	20
10	50	65	33
20	68	94	58
30	86	128	85
40	104	170	130

XIV Turbidity

may be the visual sign of undissolved water, or may indicate dirt. Cloudiness may also result from cold precipitation of tin tetraphenyl "scavenger" that was used in the earlier Pyranol transformers. This scavenger begins to come out of solution around 15°F above zero. To redissolve it requires heating to 150-200°F and agitation.

High dielectric breakdown voltage will quickly indicate that any turbidity present is not moisture; that the insulating efficiency of the askarel is still excellent. However, if the dielectric strength is below 26 KV, moisture should be determined, using the Karl Fischer method (ASTM D1533-60).

The dielectric breakdown voltage test for askarel serves primarily as an indicator for moisture. It is by far the most important maintenance test for transformer askarel.

XV. Check Points for Maintaining Askarel Insulation

A. General Considerations

Modern askarel transformers with welded construction or silicone or Viton* gaskets (hand hol cover, switch and terminal compartment covers) and with properly constructed bushings require little maintenance. With properly constructed transformers, annual or semi-annual visual inspection and dielectric breakdown voltage test of the askarel fluid should suffice for routine maintenance checking over many years of service.

However, many askarel units were installed in the early 1930s – before the development of some of the better modern gasketing materials and before improved designs were developed for sealing out moisture. Such early units should be, and can be, modernized. Leaky or deteriorated gaskets should be replaced. If the askarel has become contaminated, it should be reconditioned. At the same time a general clean-up of the unit and possible refinishing may be desirable.

If it is not convenient to take an old transformer out of service for general repairs, leaky gaskets can be sealed temporarily by painting over the leaky area with epoxy cement.

A survey of users indicates a good number of early built askarel transformers (ex. 20 years old) are kept in continuous service [illegible] installations by the following steps [illegible]

[illegible] are equipped with compound pressure [illegible]

[illegible]

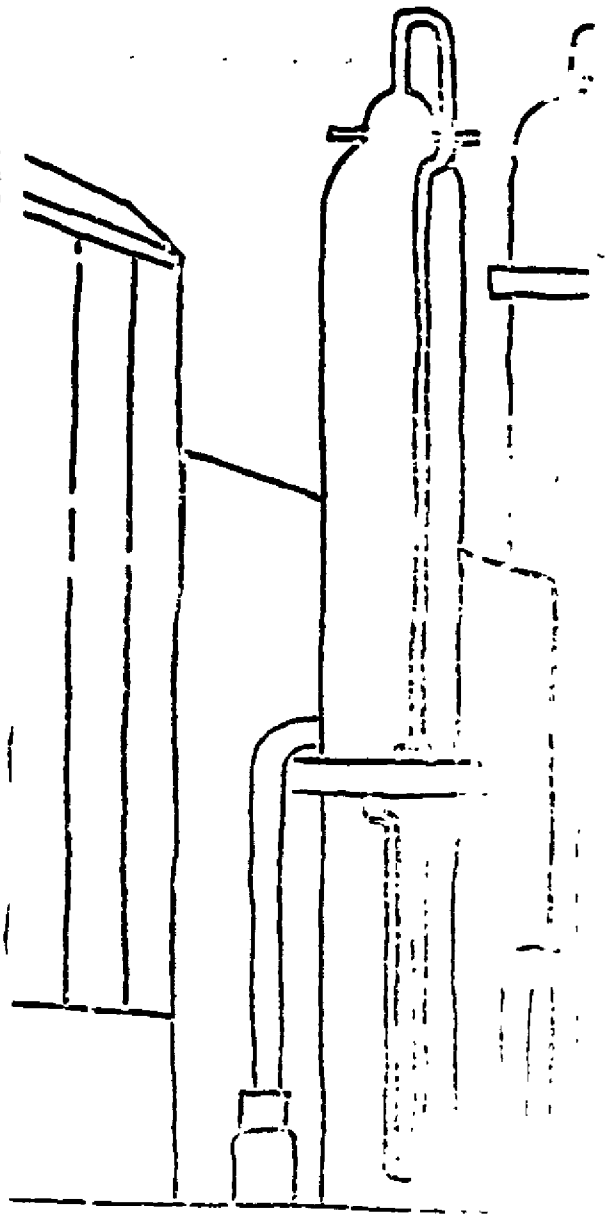

MONS 219796

pressure is maintained on the shell by introducing nitrogen [illegible] pounds above atmospheric. Regular workmen in the area [illegible] record the temperature and pressure. If a sudden pressure drop is noted more nitrogen is introduced and the gaskets are checked for leaks with soap solution. Leaks are sealed by applying epoxy cement.

B Modern Sealing Procedures

Transformer purchasers should specify the following modern techniques for sealing:

1 Welding Construction. Covers, radiator connections, switch and terminal housings, instrument connections, etc. should be welded.

2 Bushing Connections. A number of bushings have been developed to obtain a proper seal for the electrical connection through the tank wall. They are classified as follows:

1) Welded Type (Bushing flange welded to tank wall)
   a. Cast resin bushing with a molded seal to the bushing stud and external stainless steel or copper flanges.
   b. Rolled flange bushing with the metal to porcelain seal at the cap and flange made by being rolled into grooves in the porcelain over silicone rubber rings. The seal between the cap and stud is made by welding.
   c. Porcelain or glass bushings with metal to glass or metal to porcelain seals.

2) Bolted Type - (Bolted to tank wall)
   a. Cast resin bushings with either cast or metal flanges containing recessed gasket grooves.
   b. Porcelain or glass bushings with flanges containing recessed grooves or gasket stop.

The gaskets may be either of rectangular or circular cross section usually ¼ inch thick. Bushings with recessed grooves are suitable to use with cork, cork nitrile rubber combinations or nitrile rubber as well as gasket materials such as silicone or Viton.

3. Small Size Connections. When not possible to weld small size connection seals should be made with Flexitallic* stainless steel rings. The surfaces must be machined and parallel. The filler between the steel laminations of the Flexitallic ring should be either silicone or Viton.

4 Gaskets for Hand-Hole Covers. Modern design should use silicone gaskets. Such gaskets must be retained in a groove. The groove preferably is machined into the flange or cover. However, it can also be formed by welding concentric steel strips to the flange or the cover. Generally the gaskets should be 5/16 to 1/2 in. thick for covers, depending on the design of the groove or stop. A rectangular cross section is usually used.

The silicone material should be Dow Corning No. 50 Silastic** or equivalent. This is a low compression set material. For best sealing 20-25% compression is recommended with ample clearance in the groove allowed to allow for this compression.

No cement is required. With reasonable care the gasket is removable without damage and is reusable.

Silastic 50 is slightly swelled by askarel which contributes to the tightness of the seal. It is not deteriorated by askarel oil or vapors. It resists weathering and it is thermally stable.

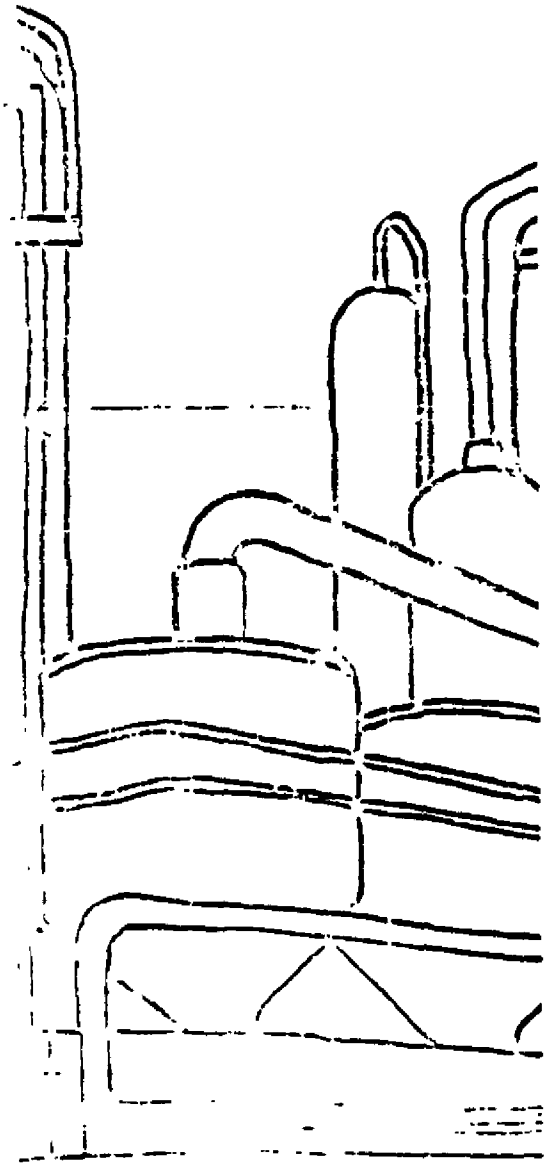

*) [illegible] Garlock Gasket Company.
**) Trademark of Dow Corning.

flexible at all operating temperatures. It is an excellent [illegible]

NOTE: Dow Corning, Midland, Michigan will supply a list of Silastic 50 gasket fabricators to all transformer manufacturers or users. They will also furnish technical data. See Appendix J, Seals, Properties and Procurements.

c. The Older Sealing Arrangements.
The older type gaskets consist of either cork or cork nitrile rubber combinations or straight nitrile rubber.

1. Cork Nitrile Combinations. Covers for the main tank, hand holes, switch and terminal chambers, relief diaphragms, etc., are held in place by studs welded to the flange or by bolts. The gaskets are cut with openings and placed over the bolts. Often Shellac (Westinghouse Style No. 1150419, or General Electric Company's Glyptal* 1276) is used to cement the cork to the flanges.

The following is recommended for sealing with the cork – nitrile rubber combinations.

Use Armstrong NC 757 cork nitrile material or equivalent. The gasket can be cut from a single sheet or by scarfing strips of the material. A convenient method for joining strips is to make a Keystone Type joint. For this purpose, Westinghouse, Sharon, Pennsylvania, offers their gasket cutter Style No. 328 8614 G01, (about $15).

The joints – and also the gasket – should be cemented to the flange, using one of the above cements. Excess cement should not be allowed to reach the interior of the transformer.

After installation and bolting, the outside edge of the gasket should be coated thoroughly with epoxy cement to increase weather resistance.

This epoxy cement is a paste to which a curing catalyst is added immediately before use. Typical are:

a. Epoxy Patch Kit #1-C
Hysol Corporation, Olean, New York
b. Scotchcast** Resin #4
Minnesota Mining & Manufacturing Company
St. Paul, Minnesota
c. Adhesive A-1 and Activator Type B
Armstrong Products Company
Argonne Road, Warsaw, Indiana
d. Adhesive 9360-1, Synthetics Organic Company, Cleveland, Ohio, used with activetor diethylene triamine (Carbide and Carbon Chemical Company)

2. Straight Nitrile Rubber. When straight nitrile rubber was originally used, invariably the gasket was recessed in a groove. This was to prevent gasket flow and to protect the material against excessive compression. Although this type seal was [illegible] the nitrile rubber gasket is not reuseable.

[illegible] stops have already been provided for the nitrile rubber seal. Silastic 50 can be easily substituted and is [illegible]. This conforms with modern practice.

XVI. [illegible] Fluid Inspection and What Checkpoints Mean
[illegible] at six, nine, or twelve month intervals [illegible] your askarel insulation and [illegible]

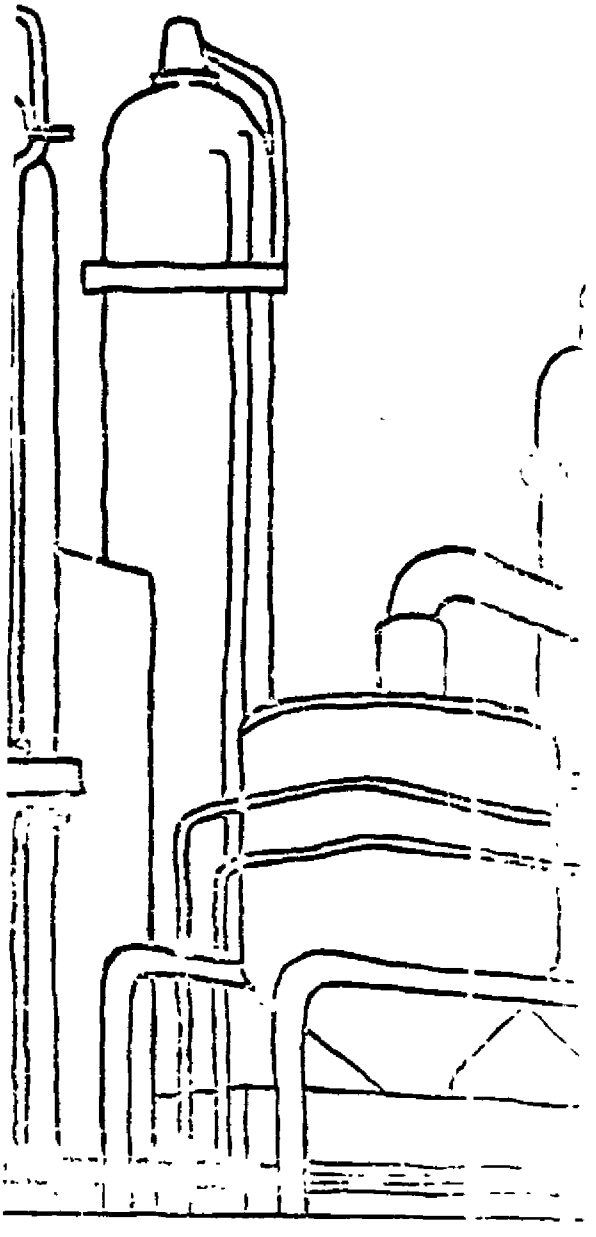

[illegible]

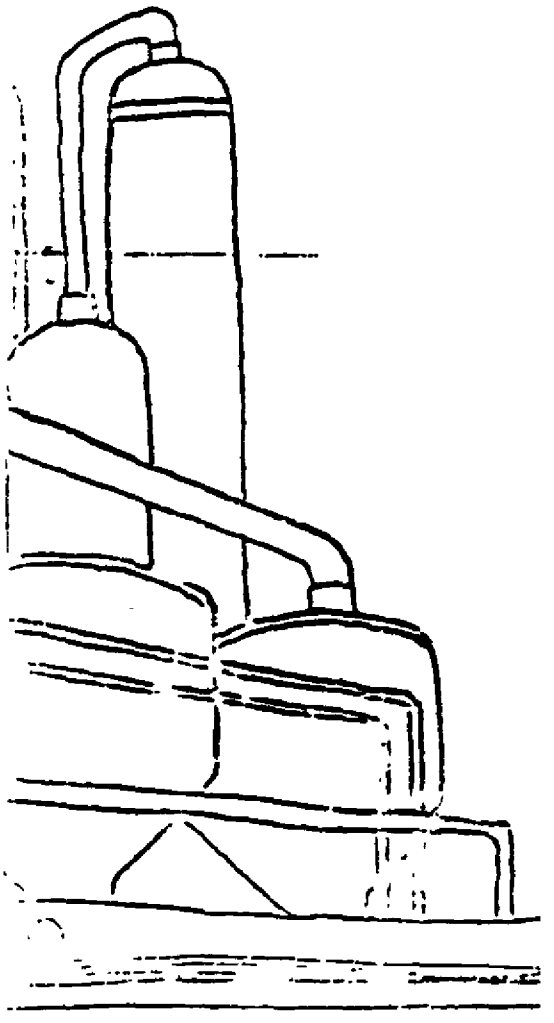

A Visual Inspection

Askarel is a clear, faint yellow liquid. After long-term use this color may gradually intensify to light brown. The liquid should remain clear and free from turbidity or cloudiness.

Any color change – such as to a green, red or blue cast – indicates extraction of impurities (color materials) from the solid insulation. If a distinct foreign color pick-up is noted, check the complete range of electrical characteristics and notify the transformer maker. Blackening of the askarel may indicate an arcing condition. Other color changes alone are not danger signals since the dielectric breakdown voltage is not likely to be impaired.

B Dielectric Breakdown Voltage

If the dielectric breakdown voltage has decreased significantly from the last inspection, or if it has gradually decreased below 26 KV range (at 25°C) – **RUN A CHECK FOR MOISTURE** (use **ASTM D1533 (Karl Fischer Method).**

The dielectric breakdown voltage of askarel is the major indicator to the operating efficiency of your liquid insulation. Besides the visual inspection tests, dielectric breakdown voltage is the only test necessary to run on a routine basis. Well-sealed askarel transformers have service records of 25 to 30 years on the original askarel.

XVII. Inspection Checklist

1. If askarel is clear – even though darkened to light brown, has no sediment or turbidity, has dielectric breakdown voltage over 26 KV – give it the inspection "OK".

2. If askarel is clear, but has foreign color of blue, green, red [illegible] it is "extracting color" from internal materials. This is not, of itself, an operating hazard when the dielectric breakdown voltage stays over 26 KV and moisture remains low. However, this rare occurrence calls for checking into the condition of the interior construction and consulting the transformer maker. However, when sampling the fluid care should be taken to avoid getting color into the askarel from paint that may be inside or outside of the sample valve.

3. If the moisture content is found to be above 70 ppm at operating temperature, then sampling should be done at more frequent intervals to establish a possible trend, particularly on outdoor installations.

4. If askarel is clear, but dielectric breakdown voltage drops to 22 or lower KV, and moisture rises over 80 ppm when sampled at operating temperature [illegible] the askarel is ready for [illegible] "refining". If the moisture is near the saturation level (about 125 ppm at room temperature) a thorough inspection should be made for water droplets in the transformer tank and even for "globules" of water floating on the askarel surface. If found, the transformer manufacturer should be consulted for recondition [illegible] both the transformer and the fluid.

5. If askarel is dark brown to black, if black particles of carbon are seen, and dielectric strength is low [illegible] the askarel has been [illegible] down by arcing. It cannot be refined and should be removed [illegible] operating [illegible] conditions. (See ANSI Committee [illegible] report on *Use and Disposal of Askarel and Askarel Materials*, 1430 Broadway, New York, New York 10018.

If any of these five simple inspection tests appear out of [illegible] ordinary [illegible] abnormal, contact your transformer supplier for [illegible]

[illegible] shipped to [illegible] "SAMPLING ASKAREL"

MONS 219799

XVIII Contamination in Transformers

[illegible] known to be serious contaminating influences on transformer askarel.

The power factor test normally used for the detection of contamination in *mineral oil filled* transformers is of little use for this purpose in askarel filled transformers, due to the extreme effect of extraneous soluble polar materials. This increase in power factor as illustrated in Table VI has no adverse effect on dielectric breakdown voltage.

Table VI
Effect of Common Insulation Materials on Power Factor and Dielectric Strength
(Heat Aged 96 Hours in Askarel at 100°C.)

Material Immersed	Askarel After Exposure: Power Factor, Percent at 60 cyc., 100°C	Askarel After Exposure: Dielectric Strength 25°C
None (control)	1.0	35 KV
Black varnished cloth	85.0	42
Copper	1.5	40
Pressboard	2.0	37
Manila paper	1.5	39
Phenol formaldehyde resins	1.6	41
Shellac	6.0	36
Iron	5.0	39
Synthetic rubber	70.0	39

Similarly, trace contaminants from commonly used construction materials can lower the volume-resistivity of askarel, without affecting its dielectric breakdown voltage. This is shown in Table VII.

Table VII
Effect of Common Insulation Materials on Volume Resistivity of Askarel

Sample	Volume Resistivity x 10^{9} ohm-cm (at 100°C., 500 Volts DC., 0.1" gap)
1 New askarel before heat aging	2,000
2 New askarel after heat aging 96 hours at 100°C	1,900
3 After heat aging with 1 sq. inch specimens of:	
a Phenolic resin tap changer material	1,200
b Paper	750
c Grade A pressboard (tan)	500
d Grade A pressboard (gray)	500
e Grade A pressboard, laminated strip	400
f Cotton wrapping	300
g Glyptal 1276 cement, cured 48 hrs. at 110°C	100

While trace contamination easily lowers volume resistivity from high levels, it is important to note that heavy contamination (as when arcing) does not lower the resistivity below the order of 10^{3} ohm-cm at 100°C.

The [illegible] behavior of askarel vs. mineral oil in these respects can be summarized as follows:

High power factor and low volume resistivity in transformer [illegible] commonly regarded as danger signals that [illegible] has deteriorated and broken down chemically or electrically [illegible]

This is NOT TRUE of askarel. Should askarel [illegible] the above [illegible] of the material can still [illegible]

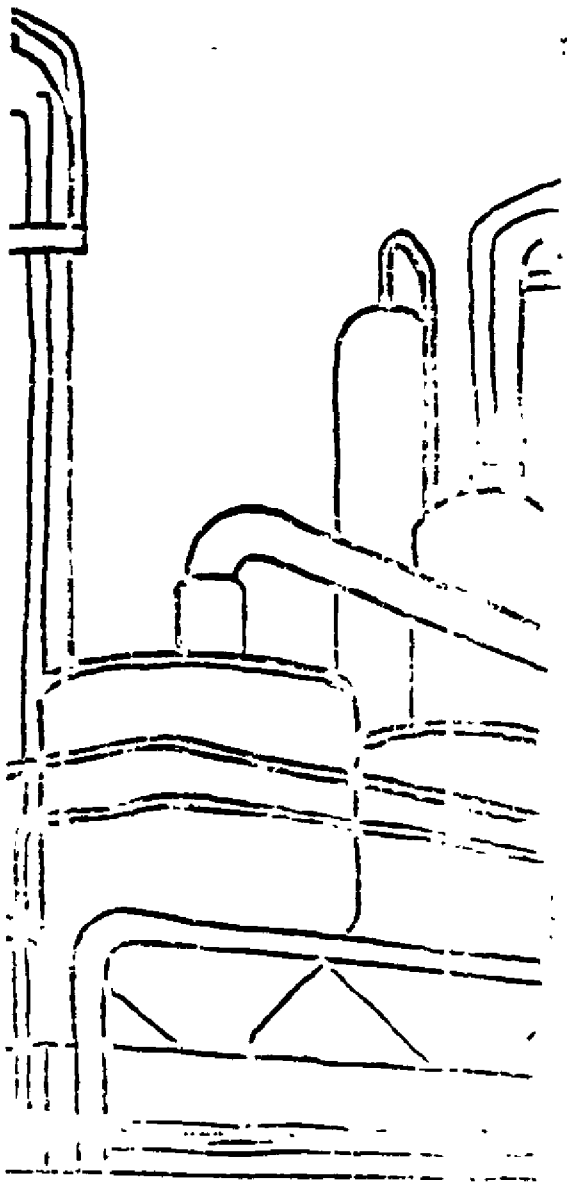

Manufacturers of askarel type transformers point out that it is [illegible] well known that askarel transformers with initial power factor of askarel fluid in excess of [illegible] room temperature have had satisfactory service life. However there needs to be assurance that both dielectric breakdown voltage and moisture are at satisfactory levels and do not show adverse trends

XIX. ASTM D3255 Method For Investigating The Compatibility of Transformer Insulation and Construction Materials in Askarels

This method uses the change of electrical and/or chemical characteristics of transformer askarel resulting from its controlled exposure to insulation and construction materials, in order to evaluate their immediate major "contamination" effect on the askarel fluid. Delayed or long time contamination effects may not be detected.

The method also utilizes various physical tests on the insulation and construction materials after controlled exposure to the askarel to determine the compatibility of these materials with transformer askarel.

Properly proportioned specimens of the insulation or structural materials are immersed in refined askarel for 168 hours at 100 ± 1°C in a forced draft oven. Changes in electrical and chemical properties of the transformer askarel are compared against a control sample of the askarel treated in the same manner, in absence of the test specimens.

Dissipation factor (ASTM D 924) change is one of the criteria used. The askarel fluid is refined by absorptive treatment to a dissipation factor level of 0.05 max. at 100°C and 60 Hz and 0.01 max. at 25°C and 60 Hz. Corresponding values of the askarel fluid after heating 168 hours at 100°C in absence of a test specimen are 0.075 and 0.02 respectively. The maximum dissipation factor levels suggested for the askarel after heating in presence of the test specimen are 0.20 at 100°C and 60 Hz and 0.04 at 25°C and 60 Hz.



XX. Refining Askarel for Reuse

A. Filtering Through Dry Blotter Paper to Remove Moisture and Extraneous Particles

Most operators prefer portable refining apparatus, such as a press fitted with a dolly, available from Sparkler, Mundelein, Illinois or General Electric Company, Pittsfield, Massachusetts, the earthan cartridge filter type available from Industrial Corporation, Lebanon, Indiana. Filter paper liners for the press are available from Carl Schleicher and Schuell Co., Keane, New Hampshire and manufacturers of filter presses above.

The filter paper must be dried immediately before use. For best results, spread the paper for maximum surface exposure in an air circulating oven and heat it for 4 to 6 hours at 110°C.

Circulate the askarel hot (but not over 40°C) through the unit fitted with the dry paper liners.

After filtration the dielectric breakdown voltage of the askarel should be 35 KV minimum.

PRECAUTIONS

1. Filtering should not be done when the moisture exceeds 5%.
2. Any flexible hoses and gaskets on the refining unit should be lined with or made of materials that will not be softened by contact with askarel such as lined with Silicone, Viton or Teflon. (Only these materials are suitable.)

*The symbol (R) Du Pont Elastomers & Chemicals, Inc.

B Make sure that the askarel is at least as warm as the surrounding air. (Cold liquids can condense moisture from humid air.)

C When sampling askarel from transformers, it is best to take the sample when the unit is warm and operating at average or maximum load especially for a check on moisture as reflected by a dielectric breakdown voltage test. Sampling the warm askarel more truly represents its condition during operation.

Experience shows that water will migrate from a transformer's solid insulation to the askarel liquid and vice versa, depending on temperature. Therefore, when the transformer is hot, the moisture is most likely to be found in the liquid. This accounts largely for periodic variations in dielectric breakdown voltage. For example, a relatively high dielectric breakdown voltage may be found during winter months and a relatively low dielectric breakdown voltage during the summer months on samples taken from the same unit.

When testing has been completed, the remainder of the fluid sample should be destroyed by high temperature incineration described in Section VIII.

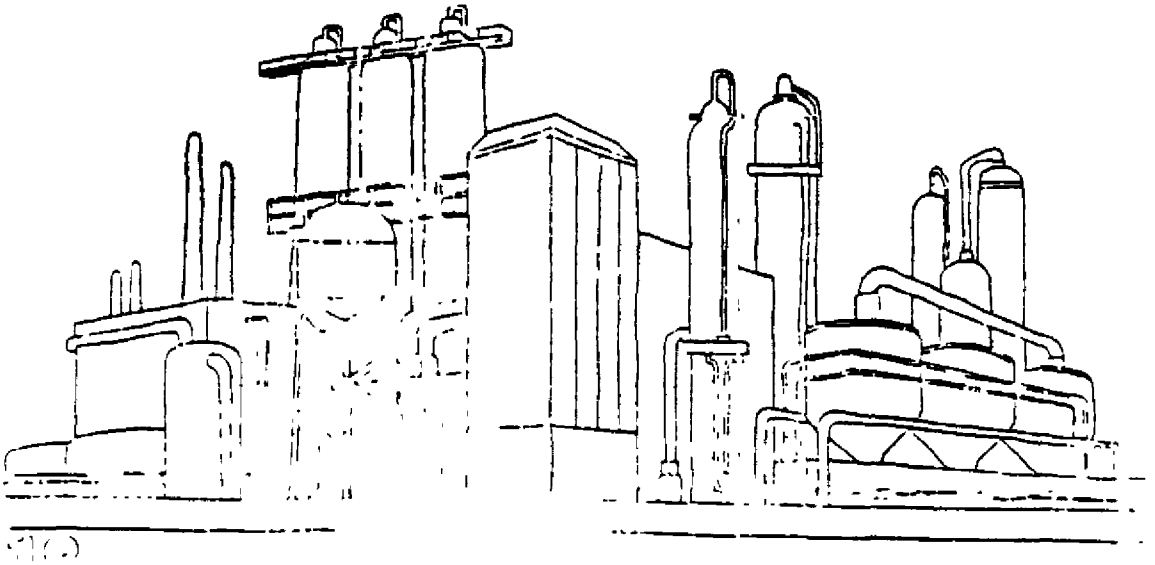

Section B
Askarel Filled Switches and Terminal Chambers

I. Introduction

High voltage leads are usually connected to askarel or mineral oil filled network transformers and power centers through terminal chambers and switches. In some cases terminal chambers are not used, and the high voltage leads are connected directly to the switch terminals. They may be filled with either askarel or mineral oil. Switches are usually rotary or drum type fitted with a revolving block and porcelain unit as the principal element arranged for three-phase service.

Askarel transformers with attached switches have been in use for about 30 years. When they were first introduced, the availability of insulating and gasketing materials was rather limited and even the best materials at the time had no service history. As a result, inadequate gasketing materials such as cork, nitrile rubber, and nitrile rubber-and cork particles were used. While satisfactory for a limited period of time these materials cannot be depended upon for the expected long life of the equipment.

The terminal chamber is usually above or below the switch compartment and separated by a steel wall through which the bushings are inserted. When bushings are properly selected and correctly installed, there is no leakage from one compartment to the other. With poor bushing seals, and the terminal chamber above the switch, potting compounds or cable oil can seep into the askarel. When the terminal chamber is below the switch, askarel can drain into the terminal chamber.

II. Sources of Contamination

There are three possible sources of contamination for askarel in switches and terminal chambers, they rank in this order of frequency (1) water entering through poor gaskets, (2) decomposition products from arcing when switch is used to break magnetizing current, (3) entrance of pothead or cable compounds through leaky bushing seals.

Unlike an askarel transformer where the amount of contamination is likely to be very small (probably only trace amounts) in relation to the volume of askarel fluid — in switches or terminal chambers with faulty seals, the amount of contamination can be relatively large.

Experience has shown that, based on the number of installed askarel-switch units, the percentage of failures is extremely small. When investigated, it has been found that most failures originate in the switch chamber. Water is the chief source of contamination. However, heavy contamination of askarel with petrolatum and asphalt material, due to leakage, have caused a few failures.

Petrolatum is used frequently for filling terminal chambers. When some cable oil or petrolatum seeps into askarel no great harm results. The fire resistance will be somewhat decreased and power factor of the askarel will increase with an accompanying drop in resistivity. While highly undesirable, it is doubtful that failure of the unit results. If more asphaltic compound, are used in place of petrolatum, the power factor is increased somewhat because asphaltic contamination may cause excessively high dielectric losses in the askarel.

When the terminal chamber is below the switch compartment, the potting compound can be kept moistured by askarel if the bushing seals are leaky. This is undesirable because the askarel will increase the power factor and conductivity of the potting compound or [illegible] dielectric loss. If this feature is known [illegible]

insulation a possible failure is likely. This again emphasizes the importance of tight bushing assemblies.

III. Sealing Switches and Terminal Chambers

Proper bushing construction, use of Silastic seals and welding wherever possible is highly desirable (as covered in Section A). Where an elastomeric seal is to be used in contact with both askarel and petroleum oil, DuPont's Viton is suggested.

For new equipment the user should specify these modern sealing arrangements to keep out contaminants and minimize maintenance.

IV. Askarel Used Under Mild Arcing Conditions

The IEEE Guide for Transformer Askarel calls attention to the following:

> "Askarel is used, to some extent, in apparatus where it is subjected to light intermittent arcing, such as in self contained induction regulators, where operating switches are continually producing slight arcs in transformer de-energizing switches, etc. Under normal conditions, deterioration of the askarel is very slight. However improperly adjusted or defective switches in this type of apparatus can produce excessive and prolonged arcing and accelerated deterioration of the askarel. It is recommended that when askarel is used under these conditions, checks of the liquid, especially for moisture and dielectric breakdown voltage made more frequently than when it is used only as a cooling and insulating fluid. Deterioration of this type is indicated by a blackening of the liquid. It can usually be reconditioned as previously described. Special attention should be given to maintaining the scavenger at the appropriate concentration."

V. Maintenance for Askarel Filled Switches

A. Switches used for grounding after power source has been de-energized will not undergo arcing.

B. Switches interrupting magnetizing current will be subject to arcing, the amount of decomposition will depend on power interrupted, time and frequency of operation. As a general rule, the liquid should be checked after 5 to 10 operations.

1. On newly installed switches, check the askarel at 3, 6 and 12 month intervals, if found satisfactory, check once annually thereafter. With proper attention to the gasketing of covers and bushings, experience will probably indicate that less frequent inspection is warranted.
2. Check askarel for:
   a. Dielectric breakdown voltage (ASTM D877). It should be 26 KV minimum. If dielectric breakdown voltage is low, confirm presence of water by Karl Fischer method ASTM D 1533. Filter to remove moisture. Dielectric strength should then be 30 KV minimum.
   b. Presence of carbon from arcing. Fluid should be relatively free of carbon. If badly arced and very black, replace fluid. If only minute amounts of carbon are present, filtration is recommended. Check power factor of liquid (should not be over 5% at 25°C and 60 cycles). Flush out switch chamber with several gallons of fresh askarel before refilling.
3. If there is discoloration, high power factor, detectable change in [illegible] gravity or refractive index, or if fluid flashes below 350°F, [illegible] is a possibility of seepage of potting compound into the switch compartment. In these cases, correct any leaky bushing seals with proper replacements and fill with new [illegible].
4. If terminal chamber is below switch, check potting compound for presence of askarel (can usually be detected by odor or by an increase in specific gravity). If askarel is present, correct any leaky bushing seals with proper replacements and refill with new [illegible].
5. [illegible]

by swelling and cracking of the [illegible] severe deterioration liquid se[illegible] is usually present

6 Check for leakage at packing [illegible] of [illegible] leaking repack with a Silastic ring type gasket.

VI. Askarel Under Excessive Temperature or Fault Conditions

The IEEE Guide also points out that

> "Chlorobenzenes used in transformer askarels begin to boil at temperatures of about 205 C under atmospheric conditions. If the material is heated to such high temperature in a sealed system pressure develops. Pressure will also develop in the system if the askarel is arced sufficiently to generate copious hydrogen chloride gas.
>
> "Therefore, it is recommended that wherever possible sealed askarel-filled equipment be provided with pressure relief devices. These devices must be large enough to provide immediate relief at a definite pressure, and to prevent further build up of pressure if decomposition continues. It must be remembered that the presence of devices of this sort does not necessarily preclude the rupturing of containing vessels, since pressure build up can be extremely rapid under violent arcing conditions."

Section C
Toxicity & Safe Handling

I. Inhalation

At ordinary temperatures the chlorinated biphenyls in Askarel have not presented industrial toxicological problems. The hazard of potential toxic exposure varies with their volatility: the lower-chlorinated more volatile ones present more of a potential problem from the standpoint of both inhalation and skin contact. When Askarel fluids are used at elevated temperatures engineering controls must be applied, either by the use of closed systems or by effective local-exhaust ventilation together with general workroom exhaust.

Vapors of Askarel at room temperature should not be breathed in a confined space, and no vapor of any fluid evolved at [illegible] temperatures should be allowed to be dispersed into the general workroom.

Inhalation tests on animals indicate that the maximum safe concentration of vapor is in the range of from 0.5 to 1.0 milligram per cubic meter of air. The threshold limit value (maximum allowable concentration of an 8 hour working day) set by the American Conference of Government Hygienists are 1.0 milligram of the lower chlorinated biphenyl compounds per cubic meter of air and 0.5 milligram of the more highly-chlorinated compounds, per cubic meter of air.

II. Skin Contact

Prolonged or repeated skin contact with the Askarel fluids [illegible] avoided by the use of gloves and protective garments because [illegible] possible occurrence of a condition called chloracne. Although [illegible] of this condition caused by Askarel are rare, it can be [illegible] excessive skin contact. If the fluid is spilled on the skin [illegible] be washed in the [illegible] manner with a soap solution.

A burn caused by contact with a hot Askarel should be [illegible] ordinary burn.

[illegible] of Askarel fluids, [illegible] Section A [illegible]

MONS 219805

Section D Analytical Service on Transformer Askarel Available From Monsanto

Transformer users not wishing to make their own fluid analyses can obtain the service from Monsanto. Simply contact Monsanto and specify what analyses are wanted. You will be sent the proper sized, clean sample container, fitted with a proper label. When you receive this, carefully take your sample (following the procedure for sampling in this guide). Send the container to Monsanto's laboratory. Charges listed include sample container and laboratory costs. The charges are those in effect March 1, 1975 and are subject to change.

Types of Analyses Available

Analysis 1)
ROUTINE MAINTENANCE CHECK — Total Charge: $30.00

To determine the general condition of the fluid and find whether further analysis is necessary (one-quart sample required)

Properties Tested	Dielectric Breakdown Voltage
Color and Condition	Moisture

You will be notified of the results of this test. If further testing is indicated, and you want a complete analysis, you will be sent a five pint sample container. This sample will be used for the following series of tests

Analysis 2)
COMPLETE ANALYSIS — Total Charge: $75.00

(1) To determine the extent of fluid contamination, (2) earth refinement to determine what degree of restoration of electrical and insulating properties is possible, (3) check test to see how the fluid responded to earth treatment.

a) Complete Analysis to determine the extent of contamination

Properties Tested	Free Chlorides
Color and Condition	Acidity
Specific Gravity	Dielectric Breakdown Voltage
Refractive Index	Power Factor, Dielectric Constant, and Resistivity
Water	

b) Earth Refinement Response
Consists of treatment for 2.5 hours at 50-60°C. with 0.1 to 0.2 percent by weight of properly conditioned Attapulgus clay and then filtration through dry filter paper

c) Analysis After Laboratory Earth Refinement.

Properties Tested	Acidity
Refractive Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant, and Resistivity
Free Chlorides	

You will be notified of the results of this test series on your sample. Then after refining your entire transformer fluid filling you can check on the results by requesting the following analysis.

Analysis 3)
ANALYSIS AFTER EARTH REFINEMENT — Total Charge: $50.00
(This charge will not apply when analyses 1 and 2 have already been made.)

To determine whether the entire lot of the askarel fill responded to the same extent as the laboratory sample (five pint sample required)

Properties Tested	Free Chlorides
Color and Condition	Acidity
Refractive Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant, and Resistivity

Samples for the tests described above write to the following address:

David Wood
Industrial Chemicals Company
[illegible]
St. Louis, Missouri 63166

Samples to be tested should be clearly marked for identification and sent directly to:

[illegible] Company
[illegible] Laboratory
[illegible]

Section E Appendices

APPENDIX A

Askarel Stability and Composition of Arc Formed Gas. Askarel insulation is one of the most inert, chemically stable heat resistant, non-corrosive liquids known. It will not break down, oxidize or sludge when exposed to air and high temperatures to 150°C or even somewhat higher. Arcing, however, will break down the compound to liberate some hydrogen chloride and small amounts of carbon.

APPROXIMATE COMPOSITION
ARC FORMED GAS FROM TRANSFORMER ASKAREL BLENDS
ASTM TYPES D AND G
(INERTEEN 70-30 AND PYRANOL A1393B-3, RESPECTIVELY)

Gas	Amount
carbon monoxide	0.3%
carbon dioxide	0.3%
oxygen	0.8%
inert gases	1.5%
hydrogen chloride	97.3%
(note the absence of phosgene)	

This arc-formed gas from ASTM Type D and Type F transformer askarels is non-flammable and non-combustible.

For all practical purposes, the amount of gas liberated from askarel under a given set of arcing conditions is about 100 cubic centimeters per kilowatt-second.

APPENDIX B

SOLUBILITY OF GAS IN TRANSFORMER ASKARELS
ASTM TYPES D AND G

	Percent of Gas by Volume Corrected to			
	25°C 760 mm		0°C 760 mm	
	25°C	100°C	25°C	100°C
Carbon dioxide	7.1%	4.7%	–	–
Air	5.7	4.2	5.8	5.0
Nitrogen	6.0	4.8	5.5	4.4
Hydrogen chloride[1]	37.8	50.9	–	–

[1] In absence of scavenger

APPENDIX C

EFFECT OF TEMPERATURE ON DIELECTRIC BREAKDOWN VOLTAGE OF ASKAREL

Temperature °C	Dielectric Breakdown Voltage ASTM D877
−10	67 KV
−10	63
−20	57
0	55
20	50
10	50
60	48
60	45

APPENDIX D

COMPARISON OF THE APPROXIMATE VISCOSITY IN SAYBOLT UNIVERSAL SECONDS OF TRANSFORMER ASKARELS AND MINERAL OIL

Temp. °C	Pyranol A13838 3	10-C Mineral Oil	Inerteen 70 30
−20	1,000	1,000	2,800
0	100	150	195
20	70	85	85
40	45	49	50
60	39	40	40
80	34	34	36
100	30	30	33

APPENDIX E

THE DENSITY OF INERTEEN 70-30 AND TRANSFORMER PYRANOL A13838-3

Approx. Density gm/cc.

Temp. °C	Inerteen 70-30	Pyranol A13838-3
0	1.574	1.577
20	1.552	1.555
40	1.529	1.532
60	1.507	1.510
80	1.485	1.488

APPENDIX F

The thermal conductivity values of transformer Pyranol A13838 3 at 27°C and 58°C are 26.2 and 25.8 x 10^{-5} calories centimeters^{-1}, degrees centigrade^{-1}, second^{-1}, respectively. Or, approximately 0.06 BTU per (hr.) (sq. ft.) (°F.) per foot. This same approximation applies to Inerteen 70-30.

APPENDIX G

Heat Capacity

Over the temperature range of 25° to 125°C the specific heat of transformer askarel is close to 0.30 calories per gram per degree

APPENDIX H

Coefficient of Expansion

The average coefficient of expansion of transformer askarel over the temperature range 20 to 100°C is 0.0007 cc/cc/°C. One gallon would increase to 1.056 gallons on heating from 20 to 100°C.

APPENDIX I

Fire Resistance

Askarels of various compositional types are used. Under arcing conditions the gases produced, while consisting predominantly non-combustible hydrogen chloride can yield varying amounts of combustible gases depending upon the molecular type.

Installations systems incorporating these askarels and cellulosic or other organic materials may, when arced, produce gaseous mixtures which are moderately flammable. As a precaution, such gases should be removed from the askarel by bubbling dry nitrogen through the askarel and flushing the gas space with dry nitrogen before any work is performed on the apparatus.

APPENDIX J

Seals Properties and Procurement

Dow Corning Corporation, Midland, Michigan with Districts at Atlanta, Boston, Chicago, Cleveland, Dallas, Los Angeles, New York City, Washington, D.C. and Toronto has available Bulletin 07-019, August 1962 entitled "Silastic Design Data". This lists the gasket fabricators throughout the country from whom the "Silastic 50" gasketing can be purchased in sheet extrusions or molded shapes.

Generally, Silastic 50 sheet goods are stocked by local die cutters; hence, could be generally purchased locally. Usually small quantities of gaskets are die cut. If larger quantities are needed, tools are made of the same type used to cut other elastomers.

Where the gasket is extruded for fitting into a machined groove or between gasket stops, Dow Corning advises use of a scarved joint. This joint is then cemented using Dow Corning's Silastic 140 (clear) or their RTV 731 (white) materials which air cure.

Dow Corning points out that the local "rubber" fabricators purchase the Silastic 50 in billet form. This is worked on a roll mill in preparation for sheeting or extrusion. Then to obtain the desired physical properties the fabricator must oven cure the Silastic 50 for 24 hours at 480°F.

SPECIFICATIONS*

	Color	White
	Specific Gravity at 77°F	1.20 ± 0.02
ASTM D676	Hardness, Shore A, Scale	45 to 60
ASTM D412	Tensile Strength, psi, min	800
ASTM D412	Elongation, percent, min	250
ASTM D395	Compression Set after 22 hrs at 300°F, percent, max	30

*All physical properties measured on 0.075 inch thick samples molded 5 minutes at 240°F, and oven cured 24 hours at 480°F.

APPENDIX K

Caution Label

The following or equivalent caution statements should be fixed on all containers of transformer askarels and the transformers themselves.

This product contains Polychlorinated Biphenyls (PCBs). Care should be taken to prevent entry into the environment through spills, leakage, use, vaporization, or disposal of liquid or containers. Avoid prolonged breathing of vapors or mists. Avoid contact with eyes or prolonged contact with skin. If skin contact occurs, remove by washing with soap and water. Following eye contact, flush with water. In case of spillage onto clothing, the clothing should be removed as soon as practical, skin washed, and clothing laundered.

Monsanto

MONSANTO INDUSTRIAL CHEMICALS COMPANY
SPECIALTY PRODUCTS GROUP
800 N. LINDBERGH BLVD.
ST. LOUIS, MISSOURI 63166

The information herein regarding obtaining optimum results from askarel fluids in your transformer has been accumulated by Monsanto for over 40 years from the experience of makers and users of askarel transformers and it is believed will be helpful.

Nothing herein shall be construed as applying to other than askarel insulation. Data and maintenance suggestions herein do not apply to the other components of the transformer. All operating and maintenance suggestions recommended by the manufacturer of the transformer should also be carefully followed.

Because these maintenance directions apply only to the askarel insulation, Monsanto disclaims any liability for damage to property or injury to persons arising from transformer operation.

MONS 219809

BULLETIN NO IC/FF 38R 2
(Revised August 1976)

TRANSFORMER

Askarel

Inspection & Maintenance Guide

Monsanto

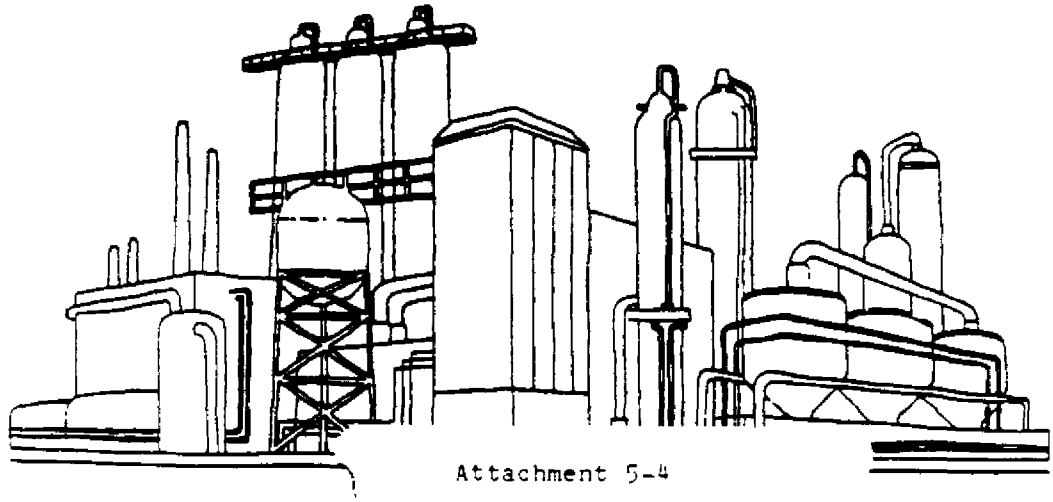

Attachment 5-4

5-U

MONS 219810

Table of Contents

SECTION A
TRANSFORMER ASKARELS 1
I Introduction 1
II History of Trade Name Types 1
Table I – The Composition of Transformer Askarels 2
III Interchangeability 2
IV Table II – Official Transformer Askarel Shipping Specifications 3
V Ordering Instructions 2
VI. Stability 2
VII. Precautions When Handling Drums, Tank Cars and When Opening Transformers 2
A Keep Dry During Handling 2
Table III – Handling and Pumping Temperatures 4
B Use Ordinary Personal Precautions 4
C. Precautions on Opening an Askarel Transformer 5
VIII Avoid Environmental Pollution 5
1 Labeling Askarel Transformers 6
2 Disposal of Liquid and Solid Wastes 6
3 Conditioning of New or Recycled Askarel 6
4 Teardown of Transformers for Repair or Scrap 7
5 Transformer Disposal 7
IX. Expected Service Life 7
X. General Characteristics of Transformer Askarel Fluid 7
XI. Sampling Transformer Askarel Fluid 8
XII. Evaluation of Askarel Received in New Equipment 8
XIII. Dielectric Breakdown Voltage – Moisture Relationship 9
Table IV – Relation of Dielectric Breakdown Voltage to Amount of Dissolved Water in Askarel and Mineral Oil 9
Table V – Approximate Solubility of Water in Transformer Askarel and Mineral Oil 10
XIV. Turbidity 10
XV. Check Points for Maintaining Askarel Insulation 10
A General Considerations 10
B Modern Sealing Procedures 11
C. The Older Sealing Arrangements 12
XVI. Periodic Field Inspection and What Checkpoints Mean 12
A Visual Inspection 13
B Dielectric Breakdown Voltage 13
XVII Inspection Checklist 13
XVIII Contamination in Transformers 14
Table VI – Effect of Common Insulation Materials on Power Factor and Dielectric Strength 14
Table VII – Effect of Common Insulation Materials on Volume Resistivity of Askarel 14
XIX ASTM Method for Investigating the Compatibility of Transformer Insulation and Construction Materials in Askarels 15
XX Refining Askarel for Re-Use 15
A Filtering Through Dry Blotter Paper to Remove Moisture and Extraneous Particles 15
Table VIII – Water Removal by Filtering Askarel Through a Paper Press 16
B Disposal of Solid Wastes 16
C Solid Insulation Requiring Drying 16
D Earth Treatment for Maximum Improvement of Power Factor and Volume Resistivity 16
Table IX – Effect of Power Factor and Volume Resistivity 17
XXI Cleaning Arced Transformers 17
XXII. Sampling Askarel 17

SECTION B
ASKAREL FILLED SWITCHES AND TERMINAL CHAMBERS 19
I. Introduction 19
II. Sources of Contamination 19
III. Sealing Switches and Terminal Chambers 20
IV. Askarel Used Under Mild Arcing Conditions 20
V. Maintenance for Askarel Filled Switches 20
VI. Askarel Under Excessive Temperature or Fault Conditions 21

SECTION C
TOXICITY AND SAFE HANDLING 21
I. Inhalation 21
II. Skin Contact 21

SECTION D
ANALYTICAL SERVICES ON TRANSFORMER ASKAREL AVAILABLE FROM MONSANTO 22
Types of Analyses Available 22
1) Routine Maintenance Check 22
2) Complete Analysis 22
3) Analysis After Earth Refinement 22

SECTION E
APPENDICES 23
Appendix A – Askarel Stability and Composition of Arc Formed Gas 23
Appendix B – Solubility of Gas in Transformer Askarels 23
Appendix C – Effect of Temperature on Dielectric Breakdown Voltage of Askarel 23
Appendix D – Comparison of the Approximate Viscosity in Seybolt Universal Seconds of Transformer Askarels and Mineral Oil 24
Appendix E – The Density of Inertean 54201 KA 7336-9 and Transformer Pyranol A13836-3 24
Appendix F – Thermal Conductivity Values of Transformer Pyranol A13836 3 24
Appendix G – Heat Capacity 24
Appendix H – Coefficient of Expansion 24
Appendix I – Fire Resistance 24
Appendix J – Seals, Properties and Procurement 25
Appendix K – Caution Label 25

NOTICE "Nothing contained herein is to be construed as a recommendation to use any product in conflict with any patent. MONSANTO MAKES NO WARRANTIES AS TO THE FITNESS FOR A PARTICULAR PURPOSE OR MERCHANTABILITY OF ANY PRODUCT REFERRED TO, no guarantee of satisfactory results from reliance upon contained information or recommendations and disclaims all liability for any resulting loss or damage."

MONS 219811

Section A
Transformer Askarel

I. Introduction

The term "askarel" as defined by IEEE, ASTM and the National Electrical Code generally describes a broad class of fire resistant* synthetic chlorinated hydrocarbon insulating liquids widely used in transformers, reactors and accessory equipment operated at power frequencies. Askarels of various compositional types are in use. (For the general properties and types see ASTM D-2283.) Under arcing conditions the gases produced, while consisting of predominantly non-combustible hydrogen chloride, can contain varying amounts of combustible gases depending upon the askarel type.

This manual describes the operating characteristics of transformer askarel liquid insulation as manufactured by Monsanto and how it differs from mineral oil. Appropriate handling and disposal procedures for both scrap askarel liquid and impregnated solid materials are given in accordance with the guidelines recommended by the American National Standards Institute.

The information is based on facts gathered by Monsanto over 40 years as a producer of askarel, plus knowledge gained from the experience of transformer manufacturers and users. This guide outlines the maintenance required for askarel fluid in "modern" transformers and offers suggestions for sealing and maintaining askarel in old units. By following this guide, we believe users will obtain maximum service from askarel insulation with a reasonable minimum of maintenance. If questions arise relating to the designing and building of transformers these should be referred to regular transformer suppliers.

Monsanto gratefully acknowledges the assistance, guidance and the contributions of certain data by the following:

Edward L. Raab – General Electric
Dr. T. K. Soat – Westinghouse Electric

II. History of Trade Name Types

"Askarel" is the generic name for the fire-resistant liquid insulation and coolant first used by General Electric Company in 1932 for their Pyranol[1] brand name fire-resistant transformers. Westinghouse Electric Corporation uses their brand name, Inerteen.[2]

Whatever the trademarked brand, the askarel contains chlorinated biphenyl – one of the best liquid insulations developed by science. This inert material is chemically stable, fire-resistant, heat stable, non-corrosive, and has high dielectric strength under the operating conditions encountered in transformers.

In addition to manufacturing Aroclor® chlorinated biphenyl, Monsanto also mixes this dielectric fluid with chlorobenzenes to produce the presently used Inerteen and Pyranol blends described in Table I.

*NOTE: Materials designated "fire resistant" generally are more difficult to ignite or once ignited burn at a slower rate than corresponding conventional materials. This term does not mean that fire resistant materials will not burn. However, when properly used, Monsanto's fire resistant ASKAREL FLUIDS are useful in helping customers meet their fire safety requirements.

[1]Trademark of General Electric Company
[2]Trademark of Westinghouse Electric Corporation

®Registered trademark of Monsanto Company

operating askarel transformers — take every precaution to guard the askarel insulation from exposure to high humidity and moisture contamination. Keep 5 or 55 gallon drums of askarel dry. Lay stored drums on their sides with the bung at the highest point from floor to keep water off the drum head (which can be sucked into the askarel by the drum "breathing"). This precaution is not necessary when drums are stored indoors, which is the preferred place for storage.

To avoid leakage the drums used for askarel are of heavy construction. Sixteen gauge metal is used, with special rim seal and bung construction. The drums should be drained as completely as possible and then flushed twice with kerosene type solvent to remove all of the askarel. Accumulated liquids and washings should be collected and should be incinerated at high temperatures, e.g., about 2000°F, to destroy the polychlorinated biphenyls (PCBs). See Section A, VIII.

Tank cars used to transport askarels are in exclusive service and not used interchangeably for other products. All cars must be unloaded through the top (dome fitting) either by pumping or with controlled pressure using dry air or dry nitrogen. If nitrogen has been used for unloading it is necessary to advise the shipper so that when the car returns the nitrogen can be replaced with dry air before any one may enter the car. If the car is to be unloaded by pumping it will be necessary to use a dryer on the air intake line to remove moisture.

All tank cars are fitted with steam coils, which are available for unloading under extreme low temperature conditions.

Convenient handling and pumping temperatures are given in Table III.

8 Use Ordinary Personal Precautions:
Transformer askarel has been made, handled, and used for over 40 years. It can be handled safely with recommended precautions. If accidentally spilled on hands, no serious skin irritation will occur. However, liquid askarel has a solvent action (similar to paint

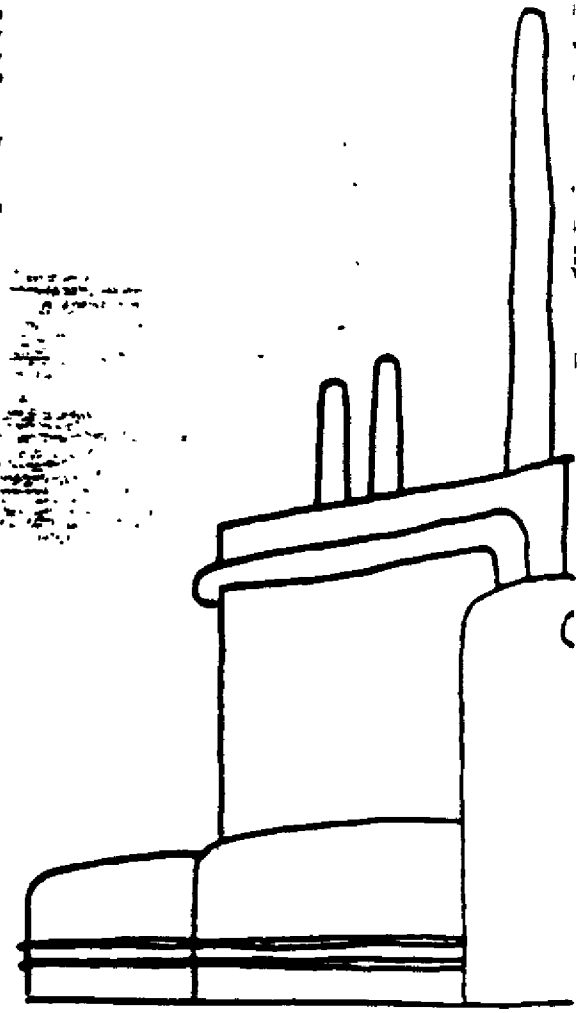

Table III
Handling and Pumping Temperatures

Product	Unloading, Handling and Pumping Temperature °C
Pyranol A1383B-3	20 - 88
Inerteen 70-30	20 - 88
Inerteen 100-42	38 - 75

thinners) on the fats and oils of the skin and prolonged contact may lead to drying and chapping of the skin.

In case of contact, wash the skin with soap and water; remove and destroy saturated clothing. Clean up spills with rags, sawdust and absorbent clay. Segregate these items for proper disposal. (See page 6, "Disposal of Liquid and Solid Wastes".) Eye contact may result in painful irritation but no permanent damage to tissues. If askarel gets in the eyes, flush with large amounts of water. As with all eye first aid, refer to a physician. To relieve irritation, physicians have used an opthalmic anesthetic solution as well as opthalmic cortisone acetate solution.

Infrequent exposure to askarel vapors will not cause ill effects. However prolonged exposure to high vapor concentrations should be avoided. If hot askarel must be handled in a closed or confined area provide the area with mechanical exhaust ventilation — or

MONS 219813

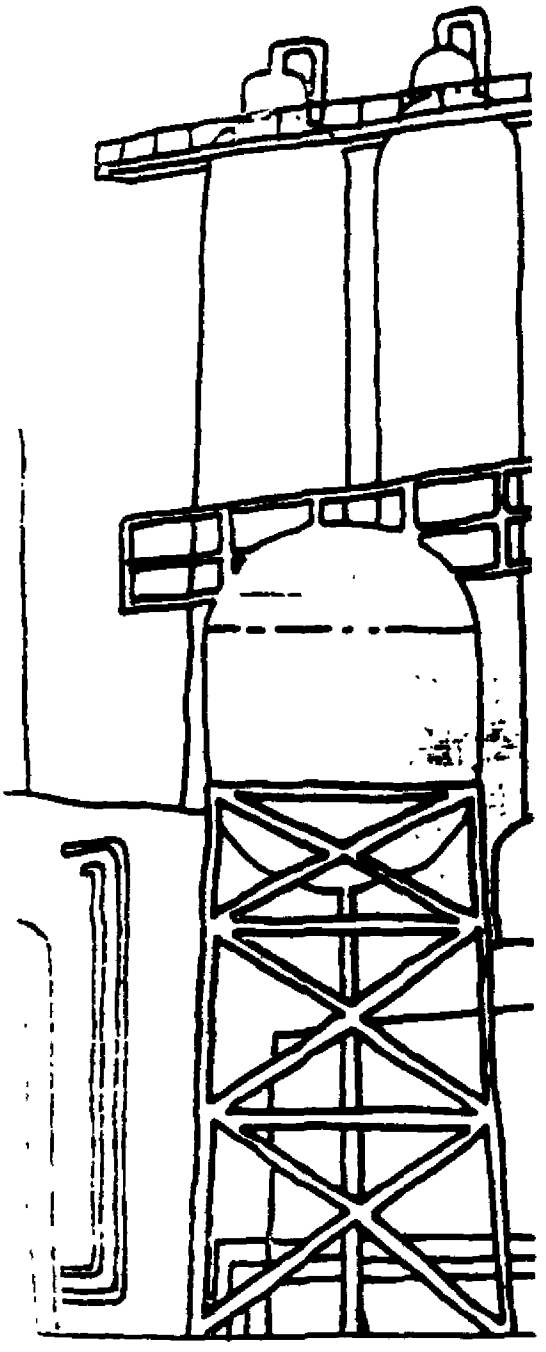

wear an organic cartridge respirator approved by the U.S. Bureau of Mines

C Precautions On Opening an Askarel Transformer
Askarels of various compositional types are used. Under arcing conditions the gases produced, while consisting of predominantly non-combustible hydrogen chloride can yield varying amounts of combustible gases depending upon the askarel type

Insulation systems incorporating these askarels and cellulosic or other organic materials may when arced, produce gaseous mixtures which are moderately flammable. As a precaution such gases should be removed from the askarel by bubbling dry nitrogen through the askarel and flushing the gas space with dry nitrogen before any work is performed on the apparatus.

The American Institute of Electrical and Electronic Engineers Guide IEEE Std. 76-1974 gives more detailed instructions and guidance *"For Acceptance and Maintenance of Transformer Askarel in Equipment"* This guide is published by the Institute of Electrical & Electronics Engineers, Inc., 345 East 47th Street, New York, New York 10017. We recommend that users of askarel transformers refer to this IEEE document.

VIII. Avoid Environmental Pollution

Transformer askarels contain polychlorinated biphenyls (PCBs) which have been used in the United States and elsewhere over the past 40 years for many industrial and consumer applications. During the past several years evidence has accumulated to indicate that PCBs are widely dispersed throughout the environment and that they can have adverse ecological and toxicological effects.

The United States Government's Interdepartmental Task Force on PCBs, Com-72-10419, in their March 20, 1972 report titled *"Polychlorinated Biphenyls and the Environment"*, recommended restricting PCBs to use in capacitors and transformers.

This report is distributed by the National Technical Information Service, U.S. Department of Commerce, Springfield, Virginia 22151

A document titled, *"Guidelines for Handling and Disposal of Capacitor and Transformer Grade Askarels, Containing Polychlorinated Biphenyls"*, has been prepared and is available from the American National Standards Institute, Committee C107, 1430 Broadway, New York, New York 10018. Document number is ANSI C107.1-1974 (This guideline is being revised during 1976. The new edition should be available 1976/77).

The scope, objectives and the composition of this committee are:

ANSI Committee C107

Scope:
Procedures and guides for safe use, maintenance and disposal of askarel and askarel-soaked materials used in electrical equipment.

Objectives:
1. Source of technical information and advice for Federal State, local authorities and all others concerned
2. Encourage development of suitable disposal facilities and keep all concerned informed.
3. Serve as the advisory group for United States participation in international organizations CEE IEC, CIGRE

Composition.
Organizations active in or represented by this ANSI committee include National Electrical Manufacturers Association Electronic Industries Association, Institute of Electrical and Electronic Engineers, American Society for Testing and Materials Electric Light and Power Association, Certified Ballast Manufacturers Association, Environmental Protection Agency, Office of Environmental Affairs, General Services Administration National

... of Standards, Department of the Army, Rural ... Administration, Division of Environmental ... TVA, American Public Power Association, Water ... Federation, Food and Drug Administration, ... Fire Protection Association, Underwriters Laboratories, ... of the U.S. Department of Interior.

... pertinent excerpts taken from the ANSI Guidelines ... transformers.

1 LABELING ASKAREL TRANSFORMERS (Pg 16)

4.2.2.1 New Transformers. All new transformers that contain PCBs shall have a label of adequate durability, permanently and prominently attached to the tank by the manufacturer, given adequate warning and instructions. A suggested label includes the following:

CAUTION The insulating liquid in this transformer contains polychlorinated biphenyls (PCBs). Care should be taken to prevent entry into the environment. In case of malfunction or leaks, consult the instruction manual or the manufacturer.

4.2.2.2 In Service Transformers. The transformer manufacturer should make available suitable labels with a similar warning as shown in 4.2.2.1 for use on existing transformers.

2 DISPOSAL OF LIQUID AND SOLID WASTES (Pg 15)

4.1.6.5.1 General. Disposal of askarels and askarel-soaked materials should be accomplished by means in which there is no significant release of askarel to the environment. At present, disposal is accomplished by carefully controlled incineration of liquids and soaked software, and by controlled landfill burial of apparatus and other hardware from which askarel has been previously drained and washed.

Present knowledge indicates that proper incineration must involve a suitable balance between dwell time and temperature in the incineration plus oxygen availability and, finally, suitable scrubbers to remove the HCl that will be formed, for example, 2-second dwell time at 2000°F and 3% excess oxygen in stack gas, or 1.5-second dwell time at 2700°F and 2% oxygen in stack gas.

These facilities should meet the applicable requirements of the state in which they are located and should control effluents within the limits set forth in this standard.

Controlled landfill or deep-well disposal can be used where permitted by federal, state, and local regulations.

The ANSI Guide lists the locations of facilities that conform with the above requirements. Monsanto has such an incinerator at the W. G. Krummrich Plant, Department 831, Sauget, Illinois 62201, where arrangements can be made for scrap askarel liquid disposal for a modest fee. For disposal of solid scrap a controlled dry land-fill can be used where permitted by Federal, State and local regulations.

3 CONDITIONING OF NEW OR RECYCLED ASKAREL (Pg 15)

4.2.1.2.1 Askarel Conditioning Equipment. The conditioning unit should be located either in the storage tank area or in the main transformer manufacturing area for filling with askarel.

4.2.1.2.2 Fuller's Earth. Conditioning of new askarel or recycled askarel requires fuller's earth treatment. The spent fuller's earth in cartridges or bags, when replaced, should be allowed to drain thoroughly over drip pans to remove as much liquid askarel as possible. The cartridge units of steel mesh construction should be placed in the "STEEL CONTAMINATED WITH ASKAREL" container for disposition. Cloth bags filled with fuller's earth should be placed in the "SCRAP BURNABLE ASKAREL WASTE" container for disposition.

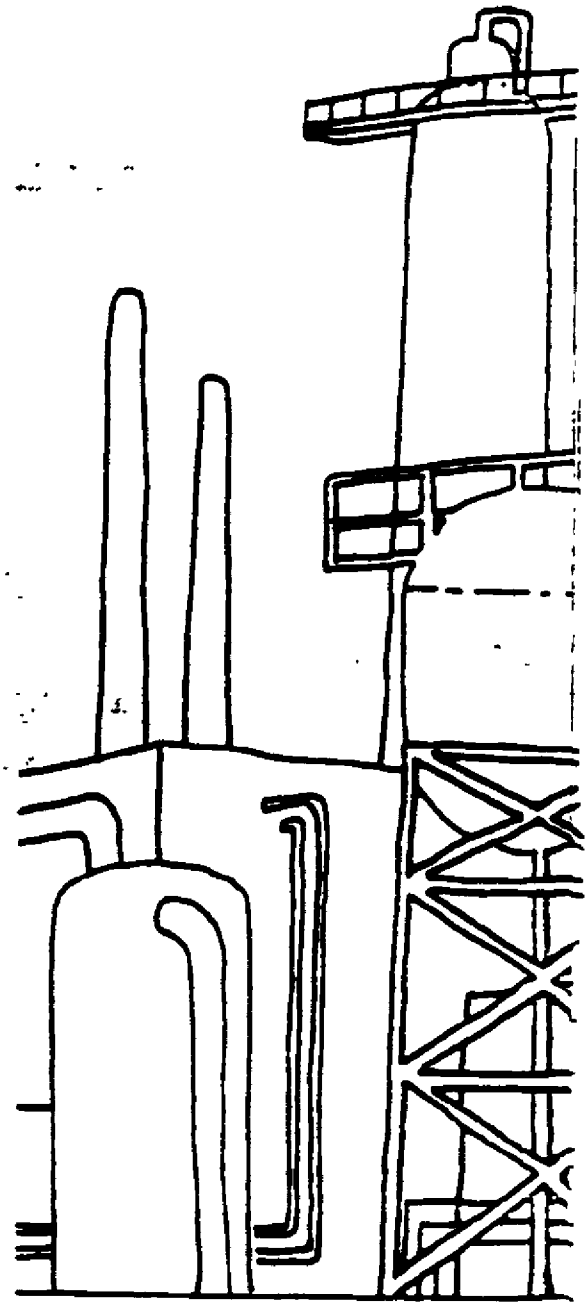

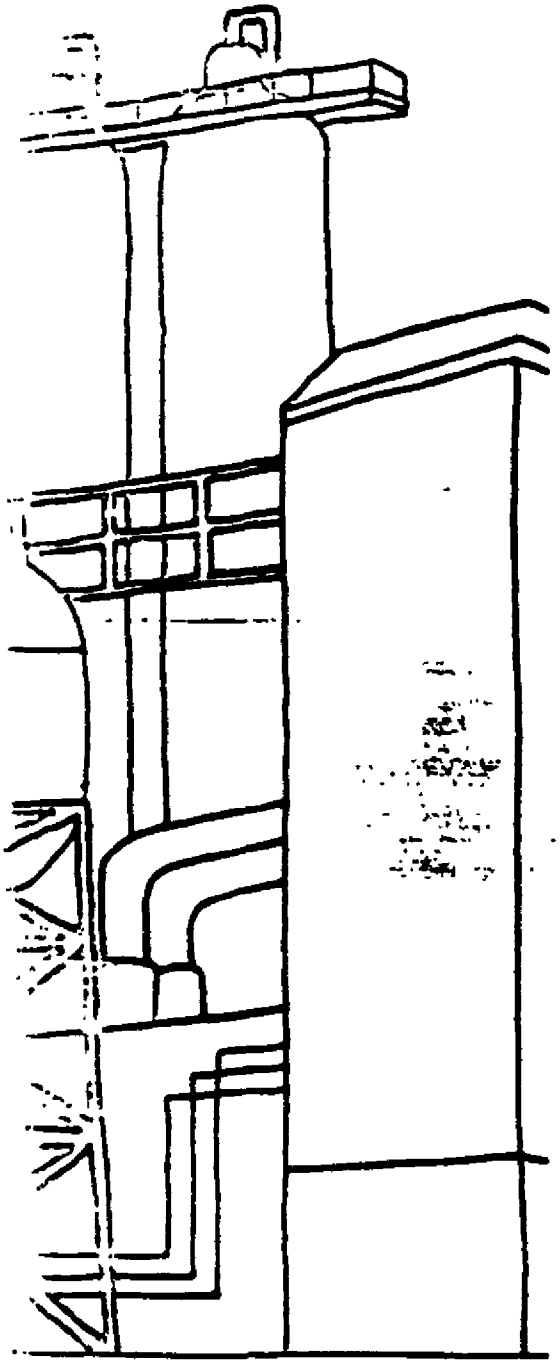

4 TEARDOWN OF TRANSFORMERS FOR REPAIR OR SCRAP (Pg 16)

4 2 1 4 1 Drain all askarel from the unit either into a holding tank or reuse or into the drum labled "SCRAP ASKAREL" for disposition and then allow sufficient time for all of the askarel to drain from the core and coils

4 2 1 4 2 Remove the core and coil assembly from the transformer Sufficient absorbent material should be placed on the floor to absorb any askarel fluid that still drips from the transformer

4 2 1 4 3 Place all meteriels in the appropriate salvage containers during the dismantling for later disposition

4.2.1 4 4 All used materials including rags sawdust tape, etc, regardless of quantity, shall be put into the appropriate containers for disposition

5. TRANSFORMER DISPOSAL (Pg. 17)

4.2.3.6 The ultimate disposal of an askarel filled transformer may be accomplished in either of two ways

(1) Complete drainage and dismantling with the proper disposal of the askarel and askarel-soaked components as described in 4 1.6

(2) Disposition of askarel transformers by means of junk or scrap dealers. This should be avoided unless a transformer is first drained, followed by soaking the interior with a suitable solvent. Accumulated liquids and washings are to be disposed of as described in 4 1 6

IX. Expected Service Life

Manufacturers indicate that properly designed and installed askarel transformers are expected to give trouble-free service for at least 30 years. Since their introduction in 1932, the manufacturers report finding the overall failure rate to be less than 0.5% for all units under test and service conditions. The Edison Electric Institute's report (1956-1968) on their member utilities publishes the failure rate for askarel transformers as 0.13 per hundred banks per year

Mr. Frank M. Clark, who invented transformer askarels at the General Electric Company in the early 1930s, made the highly pertinent comment based on his many years of experience with G E Pyrenol (askarel type) transformers that –

"The important thing is to keep them dry – otherwise leave them alone".

These words of wisdom became especially applicable in more recent years when welding shut rather than gasketing became the main method of sealing askarel transformers. These units are sold with the understanding that the liquid is in a normally hermetically closed system.

X. General Characteristics of Transformer Askarel Fluid

Appreciation of the following characteristics as given in the IEEE Guide, leads to understanding the reasons for selecting dielectric breakdown voltage and moisture as the prime practical tests to judge the quality of transformer askarel fluid Also, due to these characteristics the power factor of transformer askarel will be normally much higher than the corresponding values for mineral oil

In comparison to mineral insulating oil askarel is a relatively polar material, i.e., its molecules are dipoles, free to rotate around their axes and responsive to orientation by electrical forces Askarel also exhibits a much higher dielectric constant and capacitance than insulating oil and these differences must be kept in mind when interpreting electrical test data.

Because it is relatively polar, and possesses high solvency power askarel is much more electrically sensitive than mineral oil to traces of extraneous soluble polar materials, and consequently the choice of

construction materials destined for use in askarel is very critical. This [illegible] is reflected in the power factor and resistivity (specific resistance) of the askarel.

It is important to note that, with the exception of water, the dielectric breakdown voltage of askarel is not generally adversely affected by many of the soluble polar materials to which its power factor and resistivity (specific resistance) are so sensitive. In fact, the dielectric breakdown voltage of askarel is somewhat greater than that of insulating oil. Therefore, the values assigned these dielectric fluids in newly supplied transformers are 30 KV min. and 26 KV min., respectively.

As with insulating oil, askarel must be kept dry. It can pick up moisture from exposure to humid atmosphere. Under similar conditions of exposure, askarel can pick up nearly twice as much moisture when measured on a parts per million weight basis.

XI. Sampling Transformer Askarel Fluid

The following precautions about sampling are quoted from the IEEE Guide:

Representative samples, whether of the complete contents or only parts thereof, are extremely important from the standpoint of evaluation of the quality of the product sampled. Obviously careless sampling procedure or contamination in the sampling equipment will result in a sample that is not truly representative. This generally leads to erroneous conclusions concerning quality and incurs loss of time, effort, and expense involved in securing, transporting, and testing the sample. It is strongly recommended that all of the procedures and precautions outlined in the latest revision of ASTM D 923 (Sampling Electrical Insulating Liquids) be followed.

"Because of the high specific gravity (relative density) of askarel (greater than 1), water and some other impurities are most likely to be found at or near the surface. The top sample, therefore, is considered to represent the worst condition."

XII. Evaluation of Askarel Received in New Equipment

Some users of askarel equipment find it desirable to make "as received tests" on all equipment. It is quite common to use the dielectric breakdown voltage test and visual appearance as the most significant tests. If suitable equipment and trained personnel are available additional information may be obtained from the power factor, color, and moisture content tests.

In sampling askarel contained in apparatus extreme care must be exercised in order to obtain a representative sample. ASTM Method D 923 should be followed.

New equipment with askarel exhibiting the following characteristics is considered acceptable:

		ASTM Methods
Dielectric Breakdown Voltage	30 KV min.	D 877
Color	300 max. (Straw color)	D 2129
Condition, Visual	Clear	D 1702
Water Content	35 ppm max.	D 1533
Power Factor at 25° C	*	D 924, D 150

*The power factor of askarel taken from new transformers, reactors and accessory equipment can reflect the presence of moisture, dissolved polar compounds, or other contaminants and may vary with the type of equipment from which the sample was taken due to the different ratios of liquid-to-solid insulation and to the high solvency power of the askarel. Given an acceptable water content and dielectric breakdown voltage of the askarel as indicated above, a high power factor seldom impairs the serviceability of the askarel within rather broad limits and is

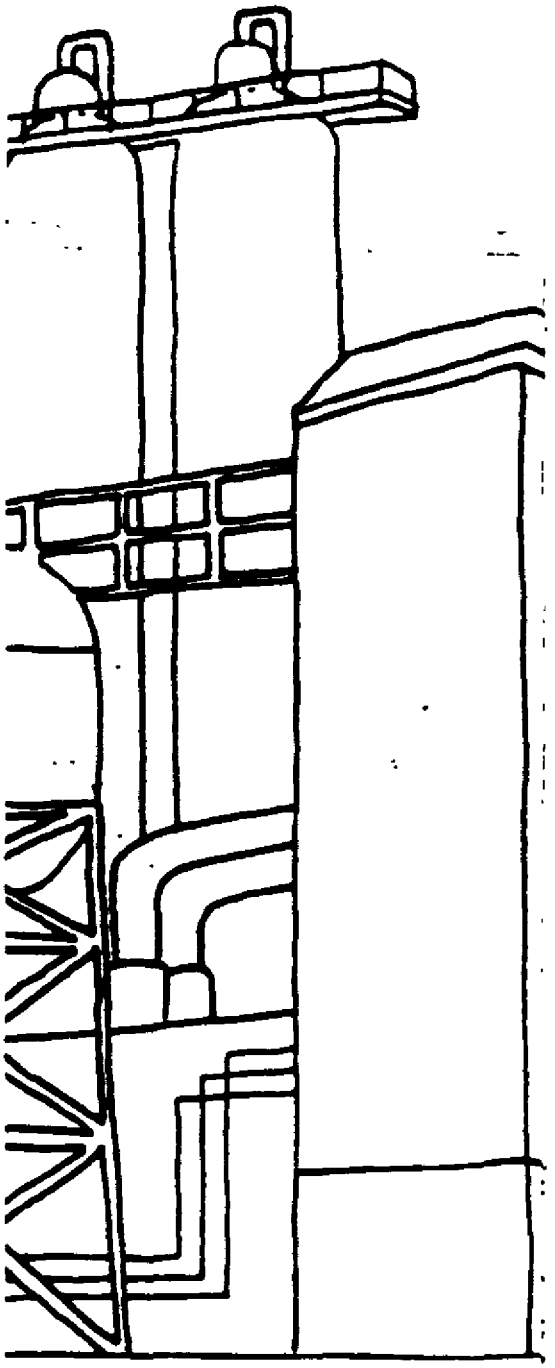

indicative of the degree of extraneous soluble polar materials present

Recognizing the possibility of a wide range of power factors being recorded for askarel in new equipment, it is difficult to establish a single limit which would be acceptable to both suppliers and users for all applications. However, as a broad guide, power factors up to about 10% at 25°C and 60 cycles per second (hertz) do not in general indicate any abnormal contamination providing that the other criteria (water content, dielectric breakdown voltage, etc.) are met. Much higher power factors may indicate excessive contamination or the misapplication of the solid materials used in manufacture in contact with the askarel and should be investigated.

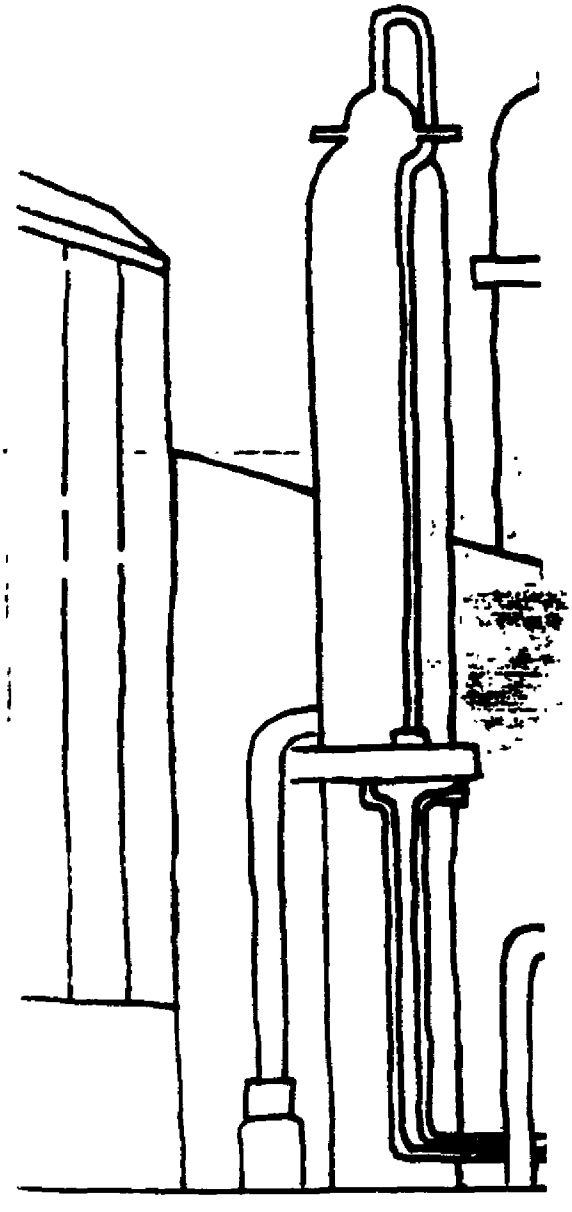

XIII. Dielectric Breakdown Voltage – Moisture Relationship

The dielectric breakdown voltage of askarel is highly sensitive to excess moisture, not sensitive to ordinary dissolved polar materials. While the dielectric breakdown voltage can also be lowered by severe arcing, askarel turns noticeably black or has particles of sooty carbon floating in it if arcing has occurred. Then the transformer should be repaired and the askarel replaced.

If the dielectric breakdown voltage is checked periodically and decreases significantly – this indicates moisture pick up, arcing, or both. When the dielectric breakdown voltage has dropped to 26 KV or less, an analysis for water is necessary. If water is found in excess of 40 ppm at room temperature, its source should be located and corrections made.

When the moisture content approaches 125 ppm (saturation level at room temperature), the dielectric breakdown voltage of askarel drops below the value required for efficient insulating. The moisture content should not be allowed to rise over 70 ppm, sampled at operating temperature. If the moisture content is found to be in a satisfactory range and the dielectric breakdown voltage is low, the transformer manufacturer should be consulted.

Table IV shows the relationship of dielectric breakdown voltage vs moisture and Table V indicates the approximate water solubility limits in askarel and mineral oil.

Table IV
Relation of Dielectric Breakdown Voltage to Amount of Dissolved Water in Askarel and Mineral Oil

	Breakdown Voltage (ASTM D877)	
Water Content (PPM)	Askarel	Mineral Oil
0	70 KV	50 KV
20	55	39
40	47	30
60	40	26
80	38	22
110	10	5

Table V
Approximate Solubility of Water in Transformer Askarel and Mineral Oil

°C	°F	Amount of Water (PPM) Dissolved: Askarel	Mineral Oil
	32	8	8
-10	4	16	10
-5	14	28	13
0	32	41	20
10	50	65	33
20	68	94	58
30	86	128	85
40	104	170	130

XIV Turbidity

may be the visual sign of undissolved water, or may indicate dirt. Cloudiness may also result from cold precipitation of tin tetraphenyl "scavenger" that was used in the earlier Pyranol transformers. This "scavenger" begins to come out of solution around 15°F above zero. To redissolve it requires heating to 150-200°F and agitation.

High dielectric breakdown voltage will quickly indicate that any turbidity present is not moisture, that the insulating efficiency of the askarel is still excellent. However, if the dielectric strength is below 28 KV, moisture should be determined, using the Karl Fischer method (ASTM D1533-60).

The dielectric breakdown voltage test for askarel serves primarily as an indicator for moisture. It is by far the most important maintenance test for transformer askarel.

XV. Check Points for Maintaining Askarel Insulation

A. General Considerations:

Modern askarel transformers with welded construction or silicone or Viton* gaskets (hand hole-cover, switch and terminal compartment covers) and with properly constructed bushings require little maintenance. With properly constructed transformers, annual or semi-annual visual inspection and dielectric breakdown voltage test of the askarel fluid should suffice for routine maintenance checking over many years of service.

However, many askarel units were installed in the early 1930s — before the development of some of the better modern gasketing materials and before improved designs were developed for sealing out moisture. Such early units should be, and can be, modernized. Leaky or deteriorated gaskets should be replaced. If the askarel has become contaminated, it should be reconditioned. At the same time a general clean-up of the unit and possible refinishing may be desirable.

If it is not convenient to take an old transformer out of service for general repairs, leaky gaskets can be sealed temporarily by painting over the leaky area with epoxy cement.

A survey of users indicates a good number of early-built askarel transformers (over 20 years old) are kept in continuous service in outdoor installations by the following steps (instead of modernization):

The operating units are equipped with compound pressure gauges for reading pressure above and below atmospheric. Positive

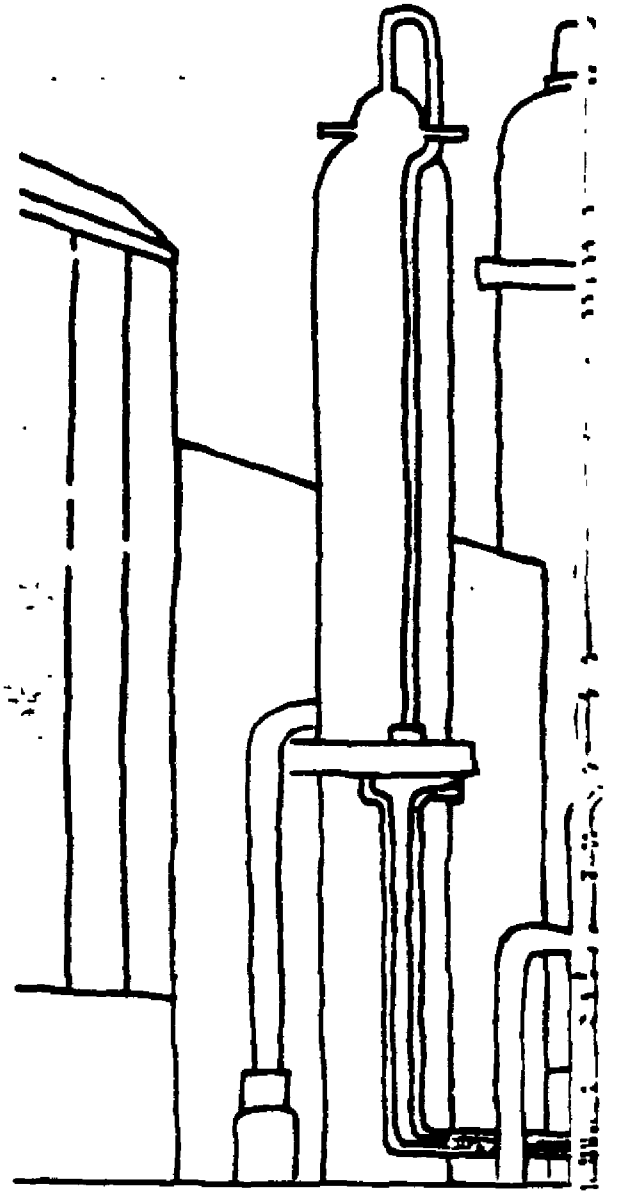

*Trademark of E. I. DuPont DeNemours & Company, Inc.

pressure is maintained on the shell by introducing nitrogen at 2 to 3 pounds above atmospheric. Regular workmen in the area daily record the temperature and pressure. If a sudden pressure drop is noted more nitrogen is introduced and the gaskets are checked for leaks with soap solution. Leaks are sealed by applying epoxy cement.

8 Modern Sealing Procedures

Transformer purchasers should specify the following modern techniques for sealing.

1. Welding Construction. Covers, radiator connections, switch and terminal housings, instrument connections, etc., should be welded.
2. Bushing Connections. A number of bushings have been developed to obtain a proper seal for the electrical connection through the tank wall. They are classified as follows.
   1) Welded Type - (Bushing flange welded to tank wall)
      a. Cast resin bushing with a molded seal to the bushing stud and external stainless steel or copper flanges.
      b. Rolled flange bushing with the metal to porcelain seal at the cap and flange made by being rolled into grooves in the porcelain over silicone rubber rings. The seal between the cap and stud is made by welding.
      c. Porcelain or glass bushings with metal to glass or metal to porcelain seals.
   2) Bolted Type - (Bolted to tank wall)
      a. Cast resin bushings with either cast or metal flanges containing recessed gasket grooves.
      b. Porcelain or glass bushings with flanges containing recessed grooves or gasket stop.

The gaskets may be either of rectangular or circular cross section, usually ¼ inch thick. Bushings with recessed grooves are suitable to use with cork, cork-nitrile rubber combinations or nitrile rubber as well as gasket materials such as silicone or Viton.

3. Small Size Connections. When not possible to weld, small size connection seals should be made with Flexitallic* stainless steel rings. The surfaces must be machined and parallel. The filler between the steel laminations of the Flexitallic ring should be either silicone or Viton.
4. Gaskets for Hand-Hole Covers. Modern design specified silicone gaskets. Such gaskets must be retained in a groove. The groove preferably is machined into the flange or cover. However, it can also be formed by welding concentric steel strips to the flange or the cover. Generally the gaskets should be 5/16 to 1/2 in. thick for covers depending on the depth of the groove or stop. A rectangular cross section is usually used.

   The silicone material should be Dow Corning No. 50 Silastic** or equivalent. This is a low compression set material. For best sealing 20-25% compression is recommended with ample clearance in the groove or stop to allow for this compression.

   No cement is required. With reasonable care the gasket is removable without damage and is reuseable.

   Silastic 50 is slightly swelled by askarel which contributes to the tightness of the seal. It is not deteriorated by askarel fluid or vapors. It resists weathering and it is thermally stable and

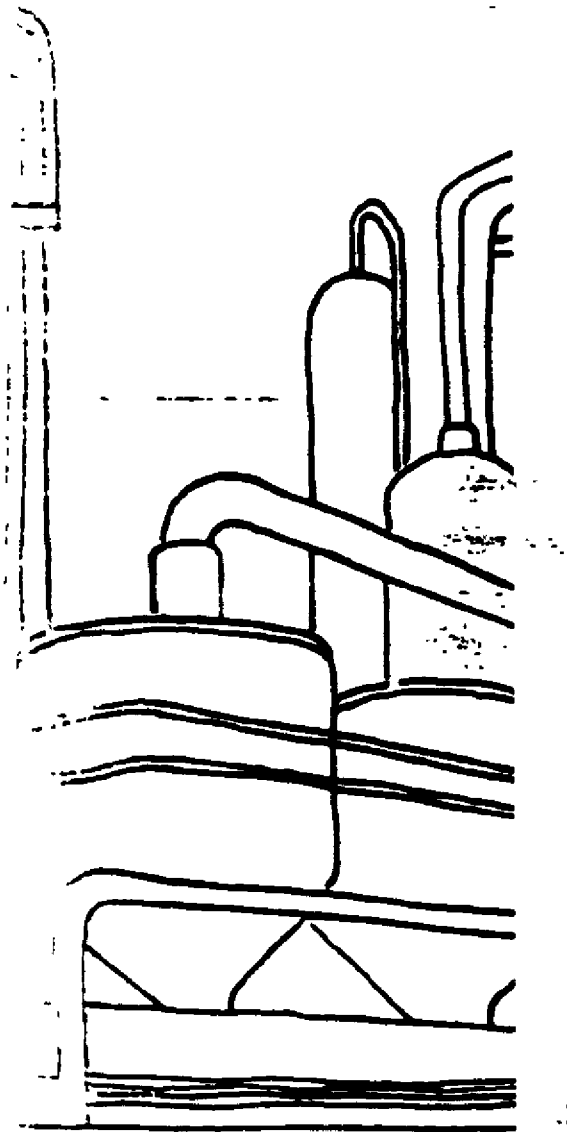

*Trademark of Flexitallic Gasket Company
**Trademark of Dow Corning

[illegible] of all operating temperatures. It is an excellent moisture barrier.

NOTE: Dow Corning Midland, Michigan will supply a list of Silastic 50 gasket fabricators to all transformer manufacturers or users. They will also furnish technical data. See Appendix J, Seals, Properties and Procurements.

[illegible] Cover Sealing Arrangements

[illegible] cover gaskets consist of either cork or cork nitrile rubber combinations or straight nitrile rubber.

1. Cork-Nitrile Combinations. Covers for the main tank, [illegible] switch and terminal chambers, relief diaphragms, etc. are held in place by studs welded to the flange or by bolts. The gaskets are cut with openings and placed over the ports. Often Shellac (Westinghouse Style No. 1150419, or General Electric Company's Glyptal® 1276) is used to cement the cork to the flanges.

   The following is recommended for sealing with the cork – nitrile rubber combinations.

   Use Armstrong NC 757 cork-nitrile material or equivalent. The gasket can be cut from a single sheet or by scarfing strips of the material. A convenient method for joining strips is to make a Keystone Type joint. For this purpose, Westinghouse, Sharon, Pennsylvania, offers their gasket cutter Style No. 328 8614 G01 (about $15).

   The joints – and also the gasket – should be cemented to the flange using one of the above cements. Excess cement should not be allowed to reach the interior of the transformer.

   After installation and bolting, the outside edge of the gasket should be coated thoroughly with epoxy cement to increase weather resistance.

   This epoxy cement is a paste to which a curing catalyst is added immediately before use. Typical are:

   a. Epoxy Patch Kit #1-C
      Hysol Corporation, Olean, New York
   b. Scotchcast™ Resin #4
      Minnesota Mining & Manufacturing Company
      St. Paul, Minnesota
   c. Adhesive A-1 and Activator Type B
      Armstrong Products Company
      Argonne Road, Warsaw, Indiana
   d. Adhesive 9880-1, Synthetics Organic Company, Cleveland, Ohio, used with activator diethylene triamine (Carbide and Carbon Chemical Company)

2. Straight Nitrile Rubber. When straight nitrile rubber was originally used, invariably the gasket was recessed in a groove. This was to prevent gasket flow and to protect the material against excessive compression. Although this type seal was not cemented, the nitrile rubber gasket is not reuseable.

   Since grooves or stops have already been provided for the nitrile rubber seal, Silastic 50 can be easily substituted and is recommended. This conforms with modern practice.

XVI. Periodic Fluid Inspection and What Checkpoints Mean

[illegible] a regular schedule – at six, nine, or twelve-month intervals – make a simple visual inspection of your askarel insulation and run a dielectric breakdown voltage check.

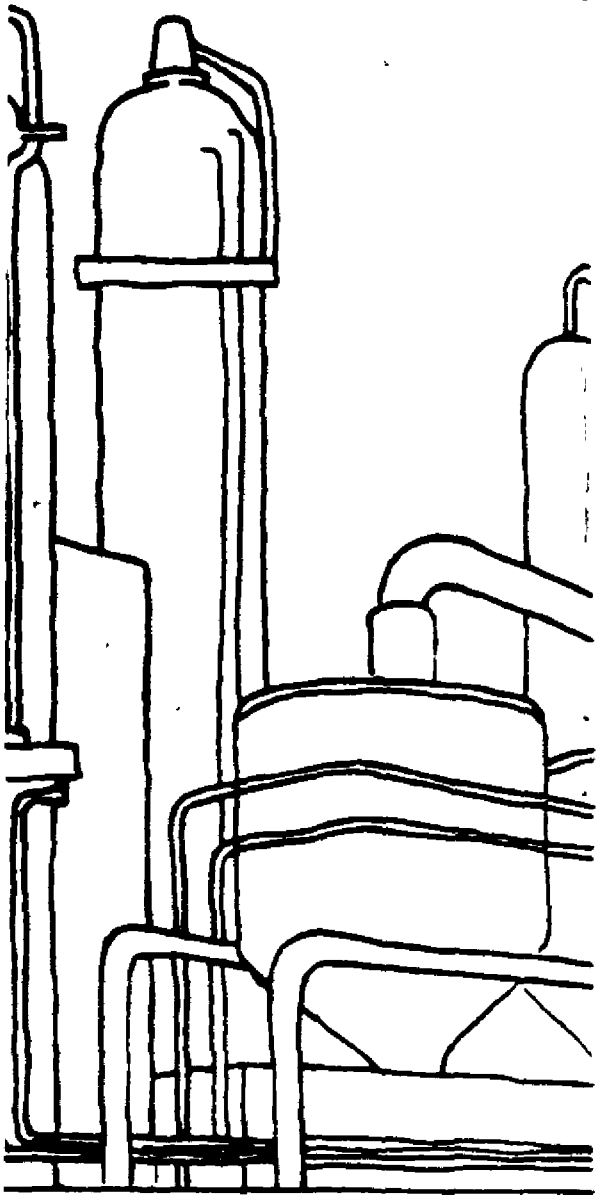

® Registered trademark of General Electric Company
™ Trademark of Minnesota Mining & Manufacturing Company

MONS 219821

A Visual Inspection
Askarel is a clear, faint yellow liquid. After long term use its color may gradually intensify to light brown. The fluid should remain clear and free from turbidity or cloudiness.

Any color change – such as to a green, red or blue cast – indicates extraction of impurities (color materials) from the solid insulation. If a distinct foreign color pick up is noted, check the complete range of electrical characteristics and notify the transformer maker. Blackening of the askarel may indicate an arcing condition. Other color changes alone are not danger signals since the dielectric breakdown voltage is not likely to be impaired.

B Dielectric Breakdown Voltage
If the dielectric breakdown voltage has decreased significantly from the last inspection, or if it has gradually decreased below 26 KV range (at 28°C) – **RUN A CHECK FOR MOISTURE**. Use ASTM D1533 (Karl Fischer Method).

The dielectric breakdown voltage of askarel is the major indicator to the operating efficiency of your liquid insulation. Besides the visual inspection tests, dielectric breakdown voltage is the only test necessary to run on a routine basis. Well-sealed askarel transformers have service records of 25 to 30 years on the original askarel.

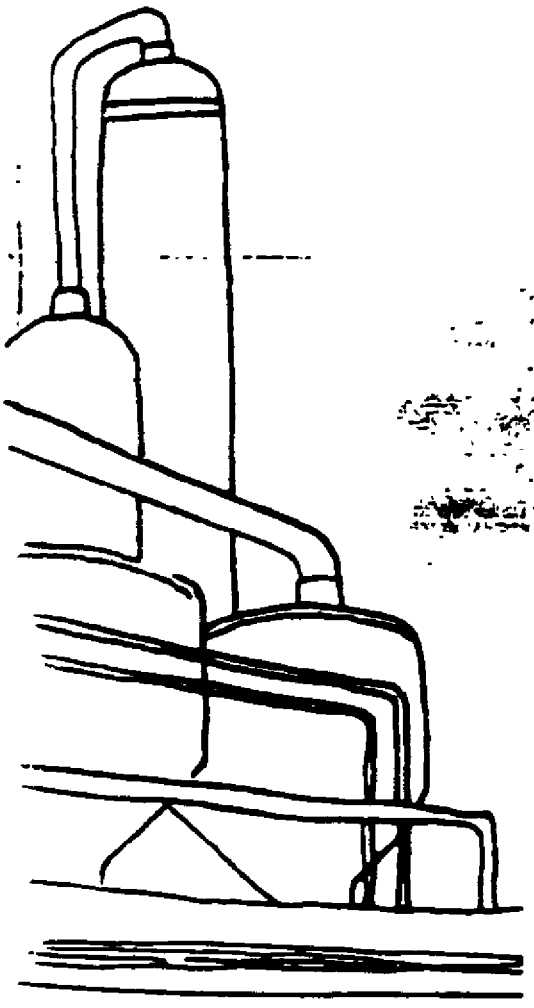

XVII. Inspection Checklist

1. If askarel is clear – even though darkened to light brown, has no sediment or turbidity, has dielectric breakdown voltage over 26 KV – give it the inspection "OK".

2. If askarel is clear, but has foreign color of blue, green, red – it is "extracting color" from internal materials. This is not, of itself, an operating hazard when the dielectric breakdown voltage stays over 28 KV and moisture remains low. However, this rare occurrence calls for checking into the condition of the interior construction and consulting the transformer maker. However, when sampling the fluid care should be taken to avoid getting color into the askarel from paint that may be inside or outside of the sample valve.

3. If the moisture content is found to be above 70 ppm at operating temperature, then sampling should be done at more frequent intervals to establish a possible trend, particularly on outdoor installations.

4. If askarel is clear, but dielectric breakdown voltage drops to 22 or lower KV, and moisture rises over 80 ppm when sampled at operating temperature – the askarel is ready for simple "refining". If the moisture is near the saturation level (about 125 ppm at room temperature) a thorough inspection should be made for water droplets in the transformer tank, and even for "globules" of water floating on the askarel surface. If found the transformer manufacturer should be consulted for reconditioning both the transformer and the fluid.

5. If askarel is dark brown to black, if black particles of carbon are seen, and dielectric strength is low – the askarel has been broken down by arcing. It cannot be refined and should be removed and incinerated under proper conditions. (See ANSI C107.1-1974, Section 4.1.6).

If any of these five simple inspection tests appear out of the ordinary or the relationship between appearance and test values is abnormal, contact your transformer supplier for a complete analysis.

Whenever a sample is to be shipped to Monsanto please follow the directions shown under "SAMPLING ASKAREL".

XVIII Contamination in Transformers

[illegible] carbonaceous matter and arced decomposition products are known to be serious contaminating influences on transformer askarel

The power factor test normally used for the detection of contamination in mineral oil filled transformers is of little use for this purpose in askarel filled transformers due to the extreme effect of extraneous [illegible] materials This increase in power factor as illustrated in [illegible] has little effect on dielectric breakdown voltage

Table VI
Effect of Common Insulation Materials on Power Factor and Dielectric Strength
(Heat Aged 96 Hours in Askarel at 100°C.)

	Askarel After Exposure	
Material Immersed	Power Factor, Percent at 60 cyc., 100°C	Dielectric Strength 25°C.
None (control)	1.0	35 KV
Black varnished cloth	85.0	42
Copper	1.5	40
Pressboard	2.0	37
Manila paper	1.5	39
Phenol formaldehyde resins	1.6	41
Shellac	6.0	36
Iron	5.0	39
Synthetic rubber	70.0	39

Similarly trace contaminants from commonly used construction materials can lower the volume-resistivity of askarel, without affecting its dielectric breakdown voltage This is shown in Table VII.

Table VII
Effect of Common Insulation Materials on Volume Resistivity of Askarel

Sample	Volume Resistivity x 10^9 ohm-cm (at 100°C., 500 Volts DC., 0.1" gap)
1 New askarel before heat aging	2,000
2 New askarel after heat aging 96 hours at 100°C	1,900
3 After heat aging with 1 sq. inch specimens of:	
a Phenolic resin tap changer material	1,200
b Paper	750
c Grade A pressboard (tan)	500
d Grade A pressboard (grey)	500
e Grade A pressboard, laminated strip	400
f Cotton wrapping	300
g Glyptal 1276 cement, cured 48 hrs. at 110°C	100

[illegible] trace contamination easily lowers volume resistivity from high [illegible] it is important to note that heavy contamination (as when arced) [illegible] not lower the resistivity below the order of 10^9 ohm-cm at 100°C

The different behavior of askarel vs. mineral oil in these respects can be [illegible] as follows

High power factor and low volume resistivity in transformer mineral oils are commonly regarded as "danger signals" that the oil has deteriorated and broken down chemically or excessive moisture is present

This is NOT TRUE of askarel liquid insulation unless the dielectric breakdown voltage is low or the moisture content is high

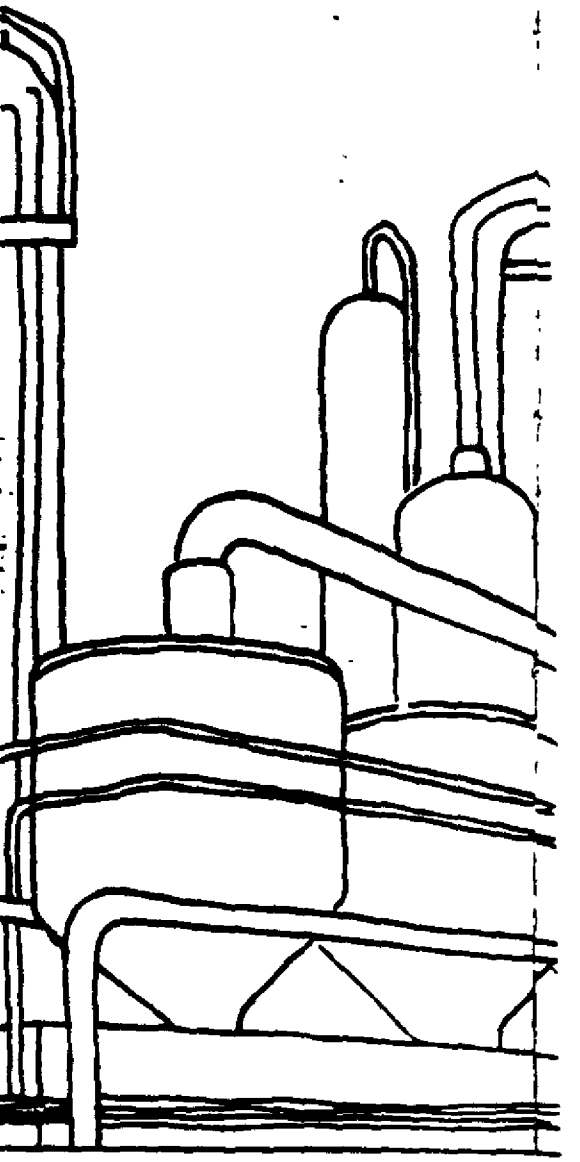

MONS 219823

Manufacturers of askarel type transformers point out that it is quite well known that askarel transformers with a power factor of the askarel fluid in excess of 50% at room temperature and 60 Hz are giving satisfactory service life. However, there needs to be assurance that both dielectric breakdown voltage and moisture are at satisfactory levels and do not show adverse trends.

XIX. ASTM D3255 Method For Investigating The Compatibility of Transformer Insulation and Construction Materials in Askarels

This method uses the change of electrical and/or chemical characteristics of transformer askarel resulting from its controlled exposure to insulation and construction materials in order to evaluate their immediate major "contamination" effect on the askarel fluid. Delayed or long time contamination effects may not be detected.

The method also utilizes various physical tests on the insulation and construction materials after controlled exposure to the askarel to determine the compatibility of these materials with transformer askarel.

Properly proportioned specimens of the insulation or structural materials are immersed in refined askarel for 168 hours at 100 ± 1°C in a forced draft oven. Changes in electrical and chemical properties of the transformer askarel are compared against a control sample of the askarel treated in the same manner, in absence of the test specimens.

Dissipation factor (ASTM D 924) change is one of the criteria used. The askarel fluid is refined by absorptive treatment to a dissipation factor level of 0.06 max. at 100°C and 60 Hz and 0.01 max. at 25°C and 60 Hz. Corresponding values of the askarel fluid after heating 168 hours at 100°C in absence of a test specimen are 0.075 and 0.02 respectively. The maximum dissipation factor levels suggested for the askarel after heating in presence of the test specimen are 0.20 at 100°C and 60 Hz and 0.04 at 25°C and 60 Hz.

XX. Refining Askarel for Reuse

A. Filtering Through Dry Blotter Paper to Remove Moisture and Extraneous Particles:

Most operators prefer portable refining apparatus, such as a plate press fitted with a dolly, available from Sparkler, Mundelein, Illinois or General Electric Company, Pittsfield, Massachusetts, or the earthen cartridge filter type available from Industrial Filter Corporation, Lebanon, Indiana. Filter paper liners for the plate press are available from Carl Schleicher and Schuell Company, Keene, New Hampshire and manufacturers of filter presses listed above.

The filter paper must be dried immediately before use. For best results, spread the paper for maximum surface exposure in a hot air circulating oven and heat it for 4 to 5 hours at 110°C.

Circulate the askarel hot (but not over 40°C) through the filter fitted with the dry paper liners.

After filtration the dielectric breakdown voltage of the askarel should be 35 KV minimum.

PRECAUTIONS:

1. Filtering should not be done when the relative humidity exceeds 75%.
2. Any flexible hoses and gaskets on the refining equipment should be lined with or made of materials that will not be softened by contact with askarel fluid. (Materials lined with Silicone, Viton or Teflon* or flexible metal materials are suitable.)

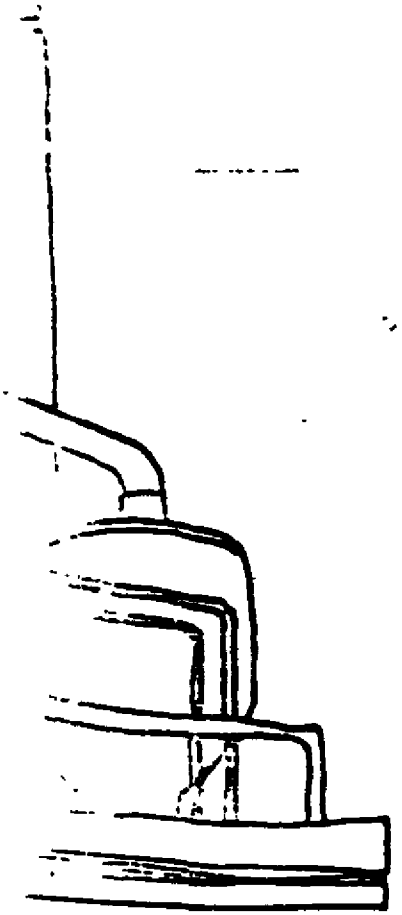

*Trademark of E. I. DuPont DeNemours & Company, Inc.

TABLE VIII
Guide to Rate of Dissolved Water Removal
By Filtering Askarel Through e Paper Press

Passes Through Paper Press	Water in Askarel PPM
0	115
1	35
2	22
3	18
4	12
5	10
6	10

E Disposal of Solid Wastes
The ANSI guide C107 1 1974, Section 4 1.6 gives detailed recommendations

C Solid Insulation Requiring Drying
If the solid insulation of the transformer requires drying, consult the transformer manufacturer or an apparatus service shop, as in such case oven drying is preferred.

D Earth Treatment for Maximum Improvement of Power Factor and Volume Resistivity*
We question whether pumping and filtering the fluid solely to achieve a change in power factor or volume resistivity alone is justified in today s ecological climate regarding PCBs. We recommend that in these situations the original transformer manufacturer be contacted.

1 Procedure:
The askarel liquid should be relatively dry prior to the following earth filtration.

As a coating on the filter paper surface use finely divided Attapulgus* clay or Fuller's earth dried and activated by heating for 12 hours at 300-350°F immediately prior to use. The amount of earth used should be 0.1 to 0.2 percent by weight on the weight of the askarel to be treated. Askarel weighs about 12.5 pounds per gallon.

To deposit the earth evenly, stir one-third of the earth with a small portion of askarel in a clean container Pump the mixture through the filter and follow with two more one-third portions. Then circulate askarel taken from near the top of the transformer, pass it warm (not over 55°C) through the earth-coated filter and feed back through the bottom transformer outlet. Continue circulation until the fluid is clear and test shows that the electrical properties are fully restored.

2 Effect of Earth on Removal of Scavengers
Only slight and insignificant loss by selective absorption of tin tetraphenyl and epoxides occurs when askarel is refined by treatment with 0.1 to 0 2 percent by weight of earth. To remove significant amounts of the scavengers requires repetitious treatment with much larger amounts of earth.

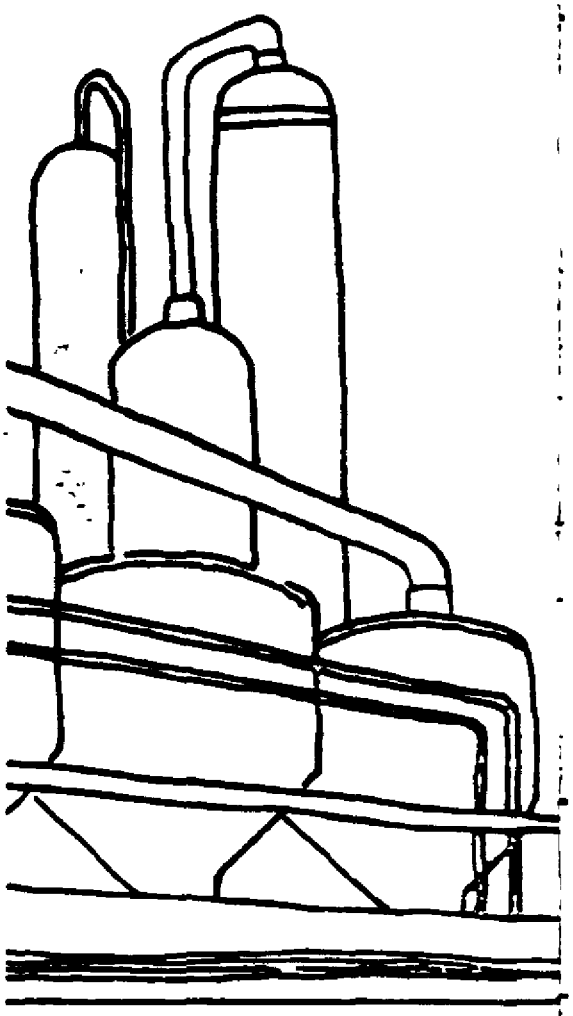

*Trademark of Engelhard Minerals and Chemicals Corp

MONS 219825

Table IX
Approximate Relationship Showing the Insignificant Effect of Power Factor and Volume-Resistivity on Dielectric Breakdown Voltage of Transformer Askarel

Power Factor (60 cycl		Volume Resistivity x 10^9 ohm-cm (at 100°C 500 Volts DC, 0.1 gap)	Breakdown Voltage 25 C 0.1 gap
100°C	25 C		
2%	0.05%	1500	35 KV
55%	0.1%	500	35
15%	0.7%	100	35
20-25%	2.0%	60 70	35
40-50%	–	25	35

XXI. Cleaning Arced Transformers

If a unit has arced so that the askarel is no longer fit for use a thorough cleaning of the unit is necessary before refilling with new askarel insulation and returning it to service* Follow this procedure insuring care is taken to prevent any loss of liquid askarel to effluent streams

A Drain out all dark carbon-contaminated askarel Arrange to have the scrap fluid incinerated under proper conditions (See AIEE Committee C107 report)

B Carefully brush carbon deposits from internal parts and insulation using a soft bristle brush making sure that insulation is not damaged.

C. Flush thoroughly using new askarel – *not* an oil, *not* a cleaning solvent.

D. Flush a second time with fresh askarel, drain, then fill to the proper level with new askarel.

E. Energize transformer to warm the fluid for 24 to 48 hours then circulate the askarel through a filter, returning it to the unit filtered and ready for use.

XXII. Sampling Askarel

Take a sample as close to the top of the liquid surface as possible Many large askarel transformers have a built-in sampling tube near the surface for convenient sampling. Then, to make sure that your sample truly represents your askarel insulation, take another sample from the bottom. If additional sampling tube connections are contrived on the valves for easier sampling, make the tubes of clean glass, stainless steel, aluminum or tin for rigid types, and silicone, or Viton or Teflon tubing for flexible types.

Use NEW containers for the askarel sample A new and thoroughly pre-dried, small-mouth quart glass bottle fitted with a Bakelite** screw cap with aluminum or tin cap liner is recommended for quick on-site testing (If complete analysis is to be made, a 5 pint size sample is required)

Be sure that the new bottle does not stand open to collect dust or moisture Rinse the sample bottle and cap lining two or three times with askarel from the transformer, then fill it If the sample will be tested promptly a clear glass bottle can be used If sample is to be stored indefinitely, use an amber glass bottle or wrap clear glass with aluminum foil.

A. Select a dry day Do not sample insulation on a warm moist day when humidity exceeds 75% and

*This assumes that the cause of arcing has been established and corrections made When severe arcing occurs major repairs are usually necessary and the unit rebuilt This procedure can be applied for flushing out the repaired units

**Trademark of Union Carbide Corporation

9 Make sure that the askarel is at least as warm as the surrounding air. (Cold liquids can condense moisture from humid air.)

10 When sampling askarel from transformers, it is best to take the sample when the unit is warm and operating at average or maximum load, especially for a check on moisture as reflected by a dielectric breakdown voltage test. Sampling the warm askarel more truly represents its condition during operation.

Experience shows that water will migrate from a transformer's solid insulation to the askarel liquid and vice versa, depending on temperature. Therefore, when the transformer is hot, the moisture is most likely to be found in the liquid. This accounts largely for periodic variations in dielectric breakdown voltage. For example, a relatively high dielectric breakdown voltage may be found during winter months and a relatively low dielectric breakdown voltage during the summer months on samples taken from the same unit.

When testing has been completed, the remainder of the fluid sample should be destroyed by high temperature incineration described in Section VIII.

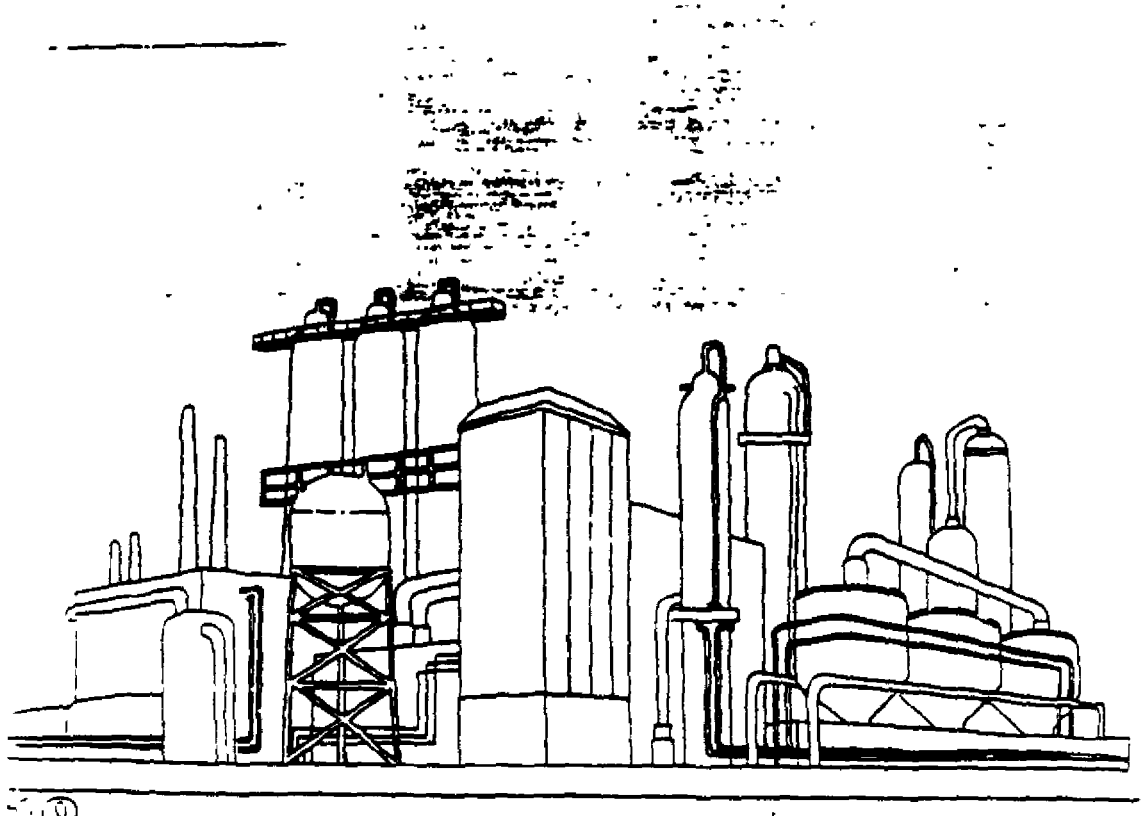

MONS 219827

Section B
Askarel Filled Switches and Terminal Chambers

I. Introduction

High voltage leads are usually connected to askarel or mineral oil filled network transformers and power centers through terminal chambers and switches. In some cases terminal chambers are not used and the high voltage leads are connected directly to the switch terminals. They may be filled with either askarel or mineral oil. Switches are usually rotary or drum type fitted with a revolving block and porcelain unit as the principal element arranged for three-phase service.

Askarel transformers with attached switches have been in use for about 30 years. When they were first introduced the availability of insulating and gasketing materials was rather limited and even the best materials at the time had no service history. As a result, inadequate gasketing materials such as cork, nitrile rubber, and nitrile rubber and cork particles were used. While satisfactory for a limited period of time these materials cannot be depended upon for the expected long life of the equipment.

The terminal chamber is usually above or below the switch compartment and separated by a steel wall through which the bushings are inserted. When bushings are properly selected and correctly installed, there is no leakage from one compartment to the other. With poor bushing seals, and the terminal chamber above the switch, potting compounds or cable oil can seep into the askarel. When the terminal chamber is below the switch, askarel can drain into the terminal chamber.

II. Sources of Contamination

There are three possible sources of contamination for askarel in switches and terminal chambers, they rank in this order of frequency (1) water entering through poor gaskets, (2) decomposition products from arcing when switch is used to break magnetizing current (3) entrance of pothead or cable compounds through leaky bushing seals.

Unlike an askarel transformer where the amount of contaminant is likely to be very small (probably only trace amounts) in relation to the volume of askarel fluid – in switches or terminal chambers with faulty seals, the amount of contamination can be relatively large.

Experience has shown that, based on the number of installed askarel-switch units, the percentage of failures is extremely small. When investigated, it has been found that most failures originate in the switch chamber. Water is the chief source of contamination. However, heavy contamination of askarel with petrolatum and asphalt material due to leakage have caused a few failures.

Petrolatum is used frequently for filling terminal chambers. When either cable oil or petrolatum seeps into askarel, no great harm results. The fire resistance will be somewhat decreased and power factor of the askarel will increase with an accompanying drop in resistivity. While highly undesirable, it is doubtful that failure of the unit results. Where asphaltic compounds are used in place of petrolatum, the danger is increased somewhat because asphaltic contamination may cause excessively high dielectric losses in the askarel.

When the terminal chamber is below the switch chamber, the potting compound can be contaminated by askarel if the bushing seals are leaky. This is undesirable because the askarel will increase the power factor and conductivity of the potting compound or cable oil and develop heat from dielectric loss. If this mixture is drawn into the joint

...ation a cable failure is likely. This again emphasizes the importance of tight bushing assemblies.

III Sealing Switches and Terminal Chambers

For new bushing construction, use of Silastic seals and welding wherever possible is highly desireable (as covered in Section A). Where an elastomeric seal is to be used in contact with both askarel and mineral oil, DuPont's Viton is suggested.

For new equipment the user should specify these modern sealing arrangements to keep out contaminants and minimize maintenance.

IV Askarel Used Under Mild Arcing Conditions

The IEEE Guide for Transformer Askarel calls attention to the following:

> Askarel is used, to some extent, in apparatus where it is subjected to light intermittent arcing, such as in self-contained induction regulators, where operating switches are continually producing slight arcs, in transformer de-energizing switches, etc.. Under normal conditions, deterioration of the askarel is very slight. However, improperly adjusted or defective switches in this type of apparatus can produce excessive and prolonged arcing and accelerated deterioration of the askarel. It is recommended that when askarel is used under these conditions, checks of the liquid, especially for moisture and dielectric breakdown voltage made more frequently than when it is used only as a cooling and insulating fluid. Deterioration of this type is indicated by a blackening of the liquid. It can usually be reconditioned as previously described. Special attention should be given to maintaining the scavenger at the appropriate concentration."

V Maintenance for Askarel Filled Switches

A Switches used for grounding after power source has been de-energized will not undergo arcing.

B Switches interrupting magnetizing current will be subject to arcing, the amount of decomposition will depend on power interrupted, time and frequency of operation. As a general rule, the liquid should be checked after 8 to 10 operations.

1. On newly installed switches, check the askarel at 3, 6 and 12 month intervals; if found satisfactory, check once annually thereafter. With proper attention to the gasketing of covers and bushings, experience will probably indicate that less frequent inspection is warranted.
2. Check askarel for:
   - a Dielectric breakdown voltage (ASTM D877): It should be 26 KV minimum. If dielectric breakdown voltage is low, confirm presence of water by Karl Fischer method ASTM D-1533. Filter to remove moisture. Dielectric strength should then be 30 KV minimum.
   - b Presence of carbon from arcing: Fluid should be relatively free of carbon. If badly arced and very black, replace fluid. If only minute amounts of carbon are present, filtration is recommended. Check power factor of liquid (should not be over 5% at 25°C and 60 cycles). Flush out switch chamber with several gallons of fresh askarel before refilling.
3. If there is discoloration, high power factor, detectable change in specific gravity or refractive index, or if fluid flashes below 250°F, there is a possibility of seepage of potting compound into the switch compartment. In this case, correct any leaky bushing seals with proper replacements and fill with new askarel.
4. If terminal chamber is below switch, check potting compound for presence of askarel (can usually be detected by odor or by an increase in specific gravity). If askarel is present, correct any leaky bushing seals with proper replacements, and renew compounds.
5. Examine cover gaskets visually. Deterioration can be detected

MONS 219829

by swelling and cracking of the exposed edge. In cases of severe deterioration, liquid seepage is usually present.

6 Check for leakage at packing gland of switching shaft. If leaking, repack with a Silastic ring type gasket.

VI. Askarel Under Excessive Temperature or Fault Conditions

The IEEE Guide also points out that,

"Chlorobenzenes used in transformer askarels begin to boil at temperatures of about 205°C under atmospheric conditions. If the material is heated to such high temperature in a sealed system, pressure develops. Pressure will also develop in the system if the askarel is arced sufficiently to generate copious hydrogen chloride gas.

"Therefore, it is recommended that wherever possible, sealed askarel-filled equipment be provided with pressure relief devices. These devices must be large enough to provide immediate relief at a definite pressure, and to prevent further build up of pressure if decomposition continues. It must be remembered that the presence of devices of this sort does not necessarily preclude the rupturing of containing vessels, since pressure build up can be extremely rapid under violent arcing conditions."

Section C Toxicity & Safe Handling

I. Inhalation

At ordinary temperatures the chlorinated biphenyls in Askarel have not presented industrial toxicological problems. The hazard of potential toxic exposure varies with their volatility, the lower-chlorinated, more-volatile ones present more of a potential problem from the standpoint of both inhalation and skin contact. When Askarel fluids are used at elevated temperatures, engineering controls must be applied, either by the use of closed systems or by effective local-exhaust ventilation together with general workroom exhaust.

Vapors of Askarel at room temperature should not be breathed in a confined space, and no vapor of any fluid evolved at elevated temperatures should be allowed to be dispersed into the general workroom.

Inhalation tests on animals indicate that the maximum safe concentration of vapor is in the range of from 0.5 to 1.0 milligram per cubic meter of air. The threshold limit value (maximum allowable concentration of an 8-hour working day) set by the American Conference of Government Hygienists are 1.0 milligram of the lower chlorinated biphenyl compounds per cubic meter of air and 0.5 milligram of the more-highly-chlorinated compounds, per cubic meter of air.

II. Skin Contact

Prolonged or repeated skin contact with the Askarel fluids must be avoided by the use of gloves and protective garments, because of the possible occurrence of a condition called chloracne. Although reports of this condition caused by Askarel are rare, it can be produced by excessive skin contact. If the fluid is spilled on the skin the skin should be washed in the usual manner with a soap solution.

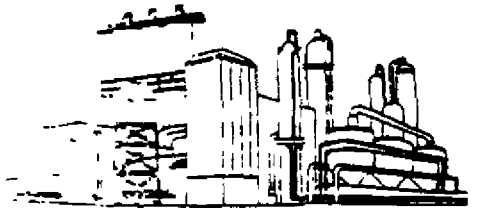

A burn caused by contact with a hot Askarel should be treated like any ordinary burn.

For disposal instructions of Askarel fluids, see Section A VIII page 6

Analytical Services on Transformer Askarel Available From Monsanto

[illegible] to make their own fluid analyses can obtain the service from Monsanto. Simply contact Monsanto [illegible] what analyses are wanted. You will be sent the proper-sized clean sample container, fitted with a proper label. When [illegible] carefully take your sample (following the procedure for sampling in this guide). Send the container to [illegible] laboratory. Charges listed include sample container and laboratory costs. The charges are those in effect August 6, [illegible] and are subject to change.

Types of Analyses Available

Analysis 1)
ROUTINE MAINTENANCE CHECK — **Total Charge: $35.00 Per Sample**

To determine the general condition of the fluid and find whether further analysis is necessary. (one-quart sample required)

Properties Tested	Dielectric Breakdown Voltage
Color and Condition	Moisture

[illegible] will be notified of the results of this test. If further testing is indicated, and you want a complete analysis, you will be sent a [illegible] pint sample container. This sample will be used for the following series of tests:

Analysis 2)
COMPLETE ANALYSIS — **Total Charge: $165.00 Per Sample**

(1) To determine the extent of fluid contamination, (2) earth refinement to determine what degree of restoration of electrical and insulating properties is possible, (3) check test to see how the fluid responded to earth treatment.

a) Complete Analysis to determine the extent of contamination

Properties Tested	Free Chlorides
Color and Condition	Acidity
Specific Gravity	Dielectric Breakdown Voltage
Refractive Index	Power Factor, Dielectric Constant, and Resistivity
Water	

b) Earth Refinement Response:
Consists of treatment for 2.5 hours at 50-60°C. with 0.1 to 0.2 percent by weight of properly conditioned Attapulgus clay and then filtration through dry filter paper.

c) Analysis After Laboratory Earth Refinement:

Properties Tested	Acidity
Refractive Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant, and Resistivity
Free Chlorides	

You will be notified of the results of this test series on your sample. Then after refining your entire transformer fluid fill you can check on the results by requesting the following analysis:

Analysis 3)
ANALYSIS AFTER EARTH REFINEMENT — **Total Charge: $70.00 Per Sample**
(This charge will not apply when analyses 1 and 2 have already been made.)

To determine whether the entire lot of the askarel fill responded to the same extent as the laboratory sample. (five pint sample required)

Properties Tested	Free Chlorides
Color and Condition	Acidity
Refractive Index	Dielectric Breakdown Voltage
Water	Power Factor, Dielectric Constant, and Resistivity

[illegible] arrange for the tests described above write to the following address:
[illegible] Wood
Monsanto Industrial Chemicals Company
[illegible] North Lindbergh Blvd
[illegible], Missouri 63166

[illegible] requested should be clearly marked for identification and sent directly to:
Monsanto Company
[illegible] Krummrich Laboratory
[illegible], Illinois 62201
Attention J. A. Gloeckner

[illegible]

MONS 219831

Section E Appendices

APPENDIX A

Askarel Stability and Composition of Arc Formed Gas Askarel insulation is one of the most inert, chemically stable heat resistant non-corrosive liquids known. It will not break down, oxidize or sludge when exposed to air and high temperatures 150°C or even somewhat higher. Arcing, however, will break down the compound to liberate some hydrogen chloride and small amounts of carbon.

APPROXIMATE COMPOSITION
ARC-FORMED GAS FROM TRANSFORMER ASKAREL BLENDS
ASTM TYPES D AND G
(INERTEEN 70-30 AND PYRANOL A1338-3, RESPECTIVELY)

Gas	Amount
carbon monoxide	0.3%
carbon dioxide	0.3%
oxygen	0.5%
inert gases	1.5%
hydrogen chloride	97.3%
(note the absence of phosgene)	

This arc formed gas from ASTM Type D and Type F transformer askarels is non-flammable and non-combustible

For all practical purposes, the amount of gas liberated from askarel under a given set of arcing conditions is about 100 cubic centimeters per kilowatt-second.

APPENDIX B

SOLUBILITY OF GAS IN TRANSFORMER ASKARELS
ASTM TYPES D AND G

	Percent of Gas By Volume Corrected to:			
	25°C 760 mm		0°C. 760 mm	
	25°C	100°C	25°C	100°C
Carbon dioxide	71%	47%	–	–
Air	5.7	4.9	5.8	5.0
Nitrogen	8.0	4.8	5.5	4.4
Hydrogen chloride[1]	37.8	50.9	–	–

[1] In absence of scavenger

APPENDIX C

EFFECT OF TEMPERATURE ON DIELECTRIC BREAKDOWN VOLTAGE OF ASKAREL

Temperature °C	Dielectric Breakdown Voltage ASTM D877
–60	67 KV
–40	63
–20	57
0	55
20	50
40	50
60	48
80	45

NONS 219832

APPENDIX D

COMPARISON OF THE APPROXIMATE VISCOSITY IN SAYBOLT UNIVERSAL SECONDS OF TRANSFORMER ASKARELS AND MINERAL OIL

Temp. °C	Pyranol A13838 3	10-C Mineral Oil	Inerteen 70 30
−20	1,000	1,000	2 800
0	100	150	195
20	70	85	85
40	45	49	50
60	39	40	40
80	34	34	36
100	30	30	33

APPENDIX E

THE DENSITY OF INERTEEN 70-30 AND TRANSFORMER PYRANOL A13838-3

Approx. Density gm/cc.

Temp. °C	Inerteen 70-30	Pyranol A13838-3
0	1 574	1.577
20	1.552	1.556
40	1.529	1 532
60	1 507	1.510
80	1 486	1 488

APPENDIX F

The thermal conductivity values of transformer Pyranol A13838-3 at 27°C and 58°C are 26.2 and 25.8 x 10^{-4} calories centimeters^{-1}, degrees centigrade^{-1}, second^{-1}, respectively. Or, approximately 0.06 BTU per (hr.) (sq. ft.) (°F) per foot This same approximation applies to Inerteen 70-30.

APPENDIX G

Heat Capacity

Over the temperature range of 28° to 128°C the specific heat of transformer askarel is close to 0.30 calories per gram per degree.

APPENDIX H

Coefficient of Expansion

The average coefficient of expansion of transformer askarel over the temperature range 20 to 100°C is 0 0007 cc/cc/°C One gallon would increase to 1.056 gallons on heating from 20 to 100°C.

APPENDIX I

Fire Resistance

Askarels of various compositional types are used. Under arcing conditions the gases produced, while consisting of predominantly non-combustible hydrogen chloride can yield varying amounts of combustible gases depending upon the askarel type.

Insulation systems incorporating these askarels and cellulosic or other organic materials may, when arced, produce gaseous mixtures which are moderately flammable. As a precaution, such gases should be removed from the askarel by bubbling dry nitrogen through the askarel and flushing the gas space with dry nitrogen before any work is performed on the apparatus

MONS 219833

APPENDIX J

Seals Properties and Procurement

Dow Corning Corporation, Midland Michigan with Districts at Atlanta, Boston, Chicago, Cleveland Dallas, Los Angeles New York City, Washington, D C and Toronto has available Bulletin 09-019, August 1962 entitled "Silastic Design Data This lists the gasket fabricators throughout the country from whom the "Silastic 50" gasketing can be purchased in sheet extrusions or molded shapes

Generally Silastic 50 sheet goods are stocked by local die cutters, hence, could be generally purchased locally Usually small quantities of gaskets are die cut If larger quantities are needed, tools are made of the same type used to cut other elastomers

Where the gasket is extruded for fitting into a machined groove or between gasket stops, Dow Corning advises use of a scarved joint This joint is then cemented using Dow Corning's Silastic 140 (clear) or their RTV 731 (white) materials, which air cure

Dow Corning points out that the local "rubber" fabricators purchase the Silastic 50 in billet form This is worked on a roll mill in preparation for sheeting or extrusion Then to obtain the desired physical properties the fabricator must oven cure the Silastic 50 for 24 hours at 480°F

SPECIFICATIONS*

	Color	White
	Specific Gravity at 77°F	1.20 ± 0 02
ASTM D676	Hardness, Shore A, Scale	45 to 60
ASTM D412	Tensile Strength, psi, min	800
ASTM D412	Elongation, percent, min	250
ASTM D395	Compression Set after 22 hrs at 300°F, percent, max	30

*All physical properties measured on 0.075 inch thick samples molded 5 minutes at 240°F, and oven cured 24 hours at 480°F

APPENDIX K

Caution Label

The following or equivalent caution statements should be fixed on all containers of transformer askarels and the transformers themselves

This product contains Polychlorinated Biphenyls (PCBs). Care should be taken to prevent entry into the environment through spills, leakage, use, vaporization, or disposal of liquid or containers. Avoid prolonged breathing of vapors or mists Avoid contact with eyes or prolonged contact with skin. If skin contact occurs, remove by washing with soap and water Following eye contact, flush with water. In case of spillage onto clothing, the clothing should be removed as soon as practical and the skin washed. Dispose of any contaminated materials as suggested in the American National Standards Institute document C107 1, "Guidelines for Handling and Disposal of Capacitor and Transformer Grade Askarels, Containing Polychlorinated Biphenyls".

Monsanto

MONSANTO INDUSTRIAL CHEMICALS COMPANY
FUNCTIONAL PRODUCTS GROUP
800 N. LINDBERGH BLVD.
ST LOUIS, MISSOURI 63166

The information herein regarding obtaining optimum results from askarel fluids in your transformer has been accumulated by Monsanto for over 40 years from the experience of makers and users of askarel transformers and it is believed will be helpful

Nothing herein shall be construed as applying to other than askarel insulation Data and maintenance suggestions herein do not apply to the other components of the transformer All operating and maintenance suggestions recommended by the manufacturer of the transformer should also be carefully followed.

Because these maintenance directions apply only to the askarel insulation, Monsanto disclaims any liability for damage to property or injury to persons arising from transformer operation

U.S. CUSTOMER SERVICE CENTERS

AKRON, OHIO 44313
260 Springside Drive
Box 5444
Frontier Development Park
Tel: (216) 666-4111

ATLANTA, GEORGIA 30339
320 Interstate North Parkway
Suite 500
Tel: (404) 434-4949

HOUSTON, TEXAS 77056
1300 Post Oak Tower
5051 Westheimer Road
Tel: (713) 621-9550

LOS ANGELES, CALIFORNIA
1401 Dove Street
Suite 350
Newport Beach, California 92660
Tel: (714) 833-9150

NEW YORK, NEW YORK 10036
1114 Avenue of the Americas
Tel: (212) 764-6000

ST. LOUIS, MISSOURI 63166
800 N. Lindbergh Blvd.
Tel: (314) 694-1000

INTERNATIONAL OFFICES

ARGENTINA
Monsanto Argentina S.A.I.C.
Avda. Madero 1020, Floors 17th & 18th
Buenos Aires, Argentina

AUSTRALIA
Monsanto Australia Limited
East Tower, Princes Gate Bldg.
151 Flinders Street
Melbourne, Victoria 3001
Australia

Monsanto Australia Limited
38 Terry Street
Rozelle, Sydney, NSW
Australia 2039

Monsanto Australia Limited
Post Office Box 1111K, Adelaide
South Australia 5001

Monsanto Australia Limited
Brisbane
P.O. Box 63, Hamilton Central
Queensland, Australia 4007

Monsanto Australia Limited
Perth
P.O. Box 77
Doubleview
West Australia 6018

AUSTRIA
Monsanto GmbH Austria
Am Stadtpark
(Hilton Center)
A-1030 Wien, Austria

BELGIUM
Monsanto Europe S.A.
Avenue de Tervuren 270-272
B 1150 Brussels, Belgium

Monsanto Europe NV/SA
163 Mechelsesteenweg
2000 Antwerp, Belgium

BRAZIL
Industrias Monsanto Ltda.
881 Conselheiro
First through Fifth Floors
Sao Paulo, Brazil 01220

CANADA
Monsanto Canada Ltd.
175 Rexdale Blvd.
Rexdale, Ontario, Canada

Monsanto Canada Ltd.
100 Park Royale, Suite 701
West Vancouver, B.C. Canada

CHILE
Monsanto Chile Comercial e Industrial Limitada
Edificio Espana Oficina 502
Calle Estado 337
Santiago de Chile

COLOMBIA
Monsanto Colombiana Inc.
Carrera 14 No 77 59
Bogota, Colombia

DENMARK
Monsanto A/S
6 Rymarksvaenget
DK 1864 Copenhagen
Denmark

EL SALVADOR
Monsanto Centroamerica (El Salvador) S.A.
Edificio Plaza
67 Avenida Sur y Calle a Santa Tecla
San Salvador, El Salvador

FEDERAL REPUBLIC OF GERMANY
Monsanto (Deutschland) GmbH
Immermannstrasse 3
D-4000 Dusseldorf
Federal Republic of Germany

FINLAND
Monsanto (Scandinavia) AB
Arkadiankatu 6 C 20
00100 Helsinki 10, Finland

FRANCE
Societe Monsanto S.A.
9 rue d'Argenson
75 Paris (8) France

GUATEMALA
Monsanto Guatemala Inc.
Edificio Cass
7a Avenida 7-11 Zona 9
Guatemala City, Guatemala

HONG KONG
Monsanto Far East Ltd.
Management House, 2nd Floor
36 Canal Road West
Hong Kong

INDIA
Mindla Chemicals Ltd.
Wakefield House
11 Sprott Rd., Ballard Estate
Bombay 400 001, India

Mindla Chemicals Ltd.
18 Rajendranath Mukherjee Rd.
Calcutta 700 001, India

Mindla Chemicals Ltd.
310-311 Linghi Chetty Street
Madras 600 001, India

Mindla Chemicals Ltd.
3/6 Asaf Ali Road
New Delhi 110 001, India

INDONESIA
P.T. Monsanto Pan Electronics
191 Di. Dr. Sahardjo
Jakarta, Indonesia

ITALY
Monsanto Italiana S.p.A.
Via Melchiorre Gioia 8
Milano 20124, Italy

JAPAN
Monsanto Japan Ltd.
Room 217 Shin Kokusai Bldg.
4-1 Marunouchi 3-chome
Chiyoda-ku Tokyo, Japan

MALAYSIA
Monsanto Far East Ltd.
(Malaysia Branch)
118 Jalan Semangat
Petaling Jaya Selangor, Malaysia

MEXICO
Monsanto Comercial S.A. de C.V.
Thiers No. 248
Mexico 5, D.F. Mexico

NETHERLANDS
Monsanto B.V.
Jan van Nassaustraat 53 55
Den Haag
Holland, The Netherlands

NEW ZEALAND
Monsanto New Zealand Ltd.
19 Great South Road
Remuera
Auckland 5, New Zealand

NICARAGUA
Monsanto (Nicaragua) S.A.
P.O. Box 288
Managua, Nicaragua

NORWAY
Monsanto Norge A.S.
Fred Olsensgate 11
Oslo 1, Norway

PHILIPPINES
Monsanto Philippines Inc.
Suite 1101 Security Bank & Trust
6788 Ayala Ave.
Makati, Rizal D-708, Philippines

PUERTO RICO
Monsanto Puerto Rico Company
Munoz Rivera Ave. Borinquen St.
Rio Piedras, Puerto Rico

SINGAPORE
Monsanto Singapore Company (Pte.) Ltd.
Suite 708 Cathay Bldg., 7th Floor
Mount Sophia, Singapore 9

SOUTH AFRICA
Monsanto South Africa (Pty.) Ltd.
11th Floor, Sanlam Ctr. Bldg.
Sanlam, Transvaal, South Africa

SPAIN
Monsanto Iberica S.A.
Lagasca 35-6
Barcelona 13, Spain

SWEDEN
Monsanto (Scandinavia) AB
Kahammarsgatan 27
Boras, Sweden

SWITZERLAND
Monsanto (Suisse) S.A.
Postfach
CH 8809, Lanzburg, Switzerland

TAIWAN
Monsanto Far East Ltd. (Taiwan Branch)
36 Chung An East Road 8th Floor
Section 1, Taipei
Taiwan

THAILAND
Monsanto Thailand Ltd.
8th Floor, Kasemkij Bldg.
120 Silom Road
Bangkok, Thailand

UNITED KINGDOM
Monsanto Ltd.
10-18 Victoria Street
Monsanto House
London SW1H 0NG England

VENEZUELA
Monsanto (Venezuela) C.A.
Torre Phelps Piso 24
Plaza Venezuela
Caracas 101 Venezuela

Monsanto

Monsanto Industrial Chemicals Co. / A Unit of Monsanto Company / 800 N. Lindbergh Blvd., St. Louis, Mo. 63166

MONS 219835

August 21, 1972
Review Copy

INCINERATION OF POLYCHLORINATED BIPHENYLS

A.F. Pier
Corporate Engineering Division
Monsanto Company
St. Louis, Mo.

Polychlorinated biphenyls (PCB's), manufactured by Monsanto Company, are presently sold as transformer fluids under the trade name Aroclor® Sales as heat transfer fluids under the trade name Therminol® have been discontinued.

Used Aroclors and Therminols could not be discarded indiscriminately, and a method of destroying these waste PCB's would have to be developed. Incineration was, of course, the most obvious method to try, despite the fact that the Aroclors and Therminols do not support combustion under normal conditions of use. Laboratory tests showed that these materials could be burned in a bench scale refractory lined incinerator if the incinerator were preheated to a temperature of 1800 to 2000°F and some auxiliary fuel added.

In March, 1970, tests were run on Aroclor 1242 (42% chlorine) and Aroclor 1260 (60% chlorine) in the John Zink Company pilot plant thermal oxidizer at temperature of 1600, 1800, and 2000°F. Both Aroclors were burned successfully, although the 1260 required auxiliary fuel to maintain a stable flame.

® Registered Trademark of Monsanto Company, St. Louis, Mo.

MONSANTO MAKES NO WARRANTIES AS TO MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF ANY PRODUCTS REFERRED TO, no guarantee of satisfactory results from reliance upon information or recommendations contained herein and disclaims all liability of any resulting loss or damage. Nothing contained herein is to be construed as a recommendation to use any product or process in conflict with any patent.

Attachment 5-5

Samples of the flue gas were analyzed for HCl, chlorine, and PCB's. Although high levels of destruction of PCB's were achieved (99.99+%) even more complete destruction was deemed advisable.

Further tests on Aroclor 1260 were run in the John Zink pilot plant in May. The incinerator was operated at 2000, 2400, and 2800°F and at a residence time of 1.2 to 1.9 seconds. The results, shown in Figure 1, indicate that the unburned Aroclor decreases at the higher temperature. The levels of destruction were higher than those attained in the March test. The highest level of PCB measured in the flue gas (.089 mg per cu. meter) is equivalent to 99.9999% destruction of the Aroclor 1260.

Based on the pilot plant results, a system to burn 1250 pounds per hour of PCB's was designed and installed at Monsanto's Sauget, Illinois, plant. The full scale system consists of a Thermal oxidizer, a quench pot, a Venturi scrubber to remove particulate, and a packed scrubber to remove HCl as shown in Figure 2. Water is used as the quenching and scrubbing liquor. The scrubber system was designed to meet the following requirements on emissions to the atmosphere:

HCl	5 lb/hr. maximum
Cl_2	50 ppm maximum
Particulate	.05 gr/scf max.

The scrubber system has consistently operated well within these limits.

The design rate of 1250 pounds per hour has been attained for short periods of time. However, the average operating rate, for the reasons noted below, has been about 800 pounds per hour.

The incinerator system was designed to destroy wastes containing a high percentage of Aroclors, which have heats of combustion ranging from 9000 BTU per pound for Aroclor 1242 to 6000 BTU per pound for Aroclor 1260. However, much of the waste returned contains large percentages of hydrocarbon solvents used to flush out heat transfer systems. These solvents have heats of combustion of about 17,000 BTU per pound. Since the incinerator has a constant capacity for heat release, the capacity for solvents on a pound basis is correspondingly reduced. This reduction in capacity is reflected in the current charge of 3¢ per pound for burning straight PCB's to 5¢ per pound for solvent - PCB mixtures.

Early in the operation of the incinerator system, the scrubber liquor and the scrubber off gas were monitored for PCB's to determine the level of destruction. Fig. 3 shows the relationship between the temperature in the oxidation chamber and the total quantity of undestroyed PCB leaving the oxidizer. The data indicate that at temperatures below 2000°F the quantity of undestroyed PCB may rise sharply and that there is no significant increase in destruction at temperatures above 2200°F. Current practice is to operate the oxidizer at 2200 to 2400°F. It should be noted that at normal operating temperatures, 99.9998% of the PCB's are destroyed. Even the highest sample encountered in the test is equivalent to 99.998% destruction.

A number of mechanical problems were encountered in the startup and operation of the oxidizer-scrubber system, primarily with the refractory lining in the oxidizer and the polyester lining in the scrubber.

The refractory originally installed in the burner plenum and the oxidizer chamber was a high chrome basic brick. A basic brick was selected to resist attack by the lime present in some of the waste materials as well as to resist the chlorine and HCl released in the combustion of straight chlorinated hydrocarbons.

The unit was started up on waste PCB's containing no lime. After one month of operation, the brick lining showed general deterioration, sanding, and loss of strength, with spalling in localized areas. Analysis of the brick (Fig. 4) showed severe losses of MgO and SiO_2. It was concluded that the brick was being attacked by chlorine or phosphorous in the oxidizer atmosphere. Phosphorous is not a normal component of Aroclors, but is believed to have been present in some of the waste received.

Since the predicted life of the original refractory was low, a search was started for a brick that would give better service. Samples of alumina brick containing from 70 to 90% Al_2O_3 were tested in the furnace. The samples were exposed to chlorine and HCl gases during the test, but were not exposed to any lime. Under these conditions, the alumina brick was much more resistant to attack than the basic brick, and the resistance increased at the higher alumina levels.

On January 28, 1972, the shell at the top of the burner plenum burned through, scattering pieces of hot metal and insulating refractory over a radius of 20 ft. Fortunately, no one was injured and the damage was confined to the oxidizer. The failure appears to have occurred when the refractory brick had deteriorated to a point where the arch collapsed. Failure of the insulating

refractory and the steel shell followed.

The plenum chamber was repaired and relined with 80% alumina brick, which was immediately available, and the unit was returned to operation. At present the unit is down to replace the original basic refractory lining with 90% alumina brick.

The packed scrubber column is constructed of polyester lined steel. After a month and a half of operation there were a number of failures in the polyester lining. Inspection disclosed that there was no chemical attack on the liner, but large areas had disbonded from the steel shell. Visual and microscopic examination of the shell revealed that the surface had not been properly sandblasted prior to application of the lining. The original lining was removed, the interior surface were sandblasted, and a new polyester lining applied. The new lining has maintained its bond to the shell, and only minor repairs have been required.

The original lining was also eroded at the flue gas inlet nozzle It was concluded that the erosion was caused by small particles spalled from the brick in the oxidizer and trapped in the water in the quench pot. In the original installation, water from the quench pot was used as make-up for the Venturi scrubber as shown in Fig. 5. Water containing the brick dust was accelerated to a high velocity in the Venturi scrubber and impinged on the wall of the packed scrubber column. The problem was solved quite simply by using water only from the bottom of the scrubber column to supply the Venturi.

In conclusion, the thermal oxidizer scrubber system has performed well in achieving high levels of destruction of PCB's and in controlling losses of particulate, chlorine, and HCl to the atmosphere. Mechanically, performance has been less satisfactory. Maintenance costs have been high, and on-stream time low.

A great deal of progress has been in solving mechanical, refractory, and corrosion problems. However, it is doubtful that this will ever be a low maintenance operation.

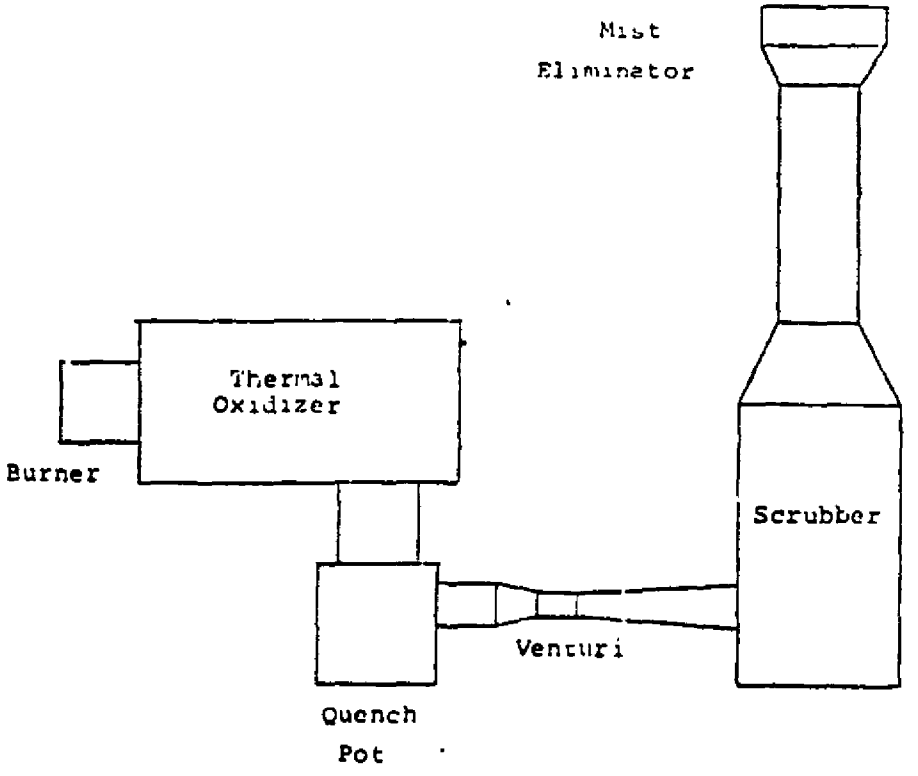

Fig. 2 - Oxidizer - Scrubber System

MONS 219842

Fig. 1 and 3 - These data are based upon samples tested in the laboratory and are not guaranteed for all samples.

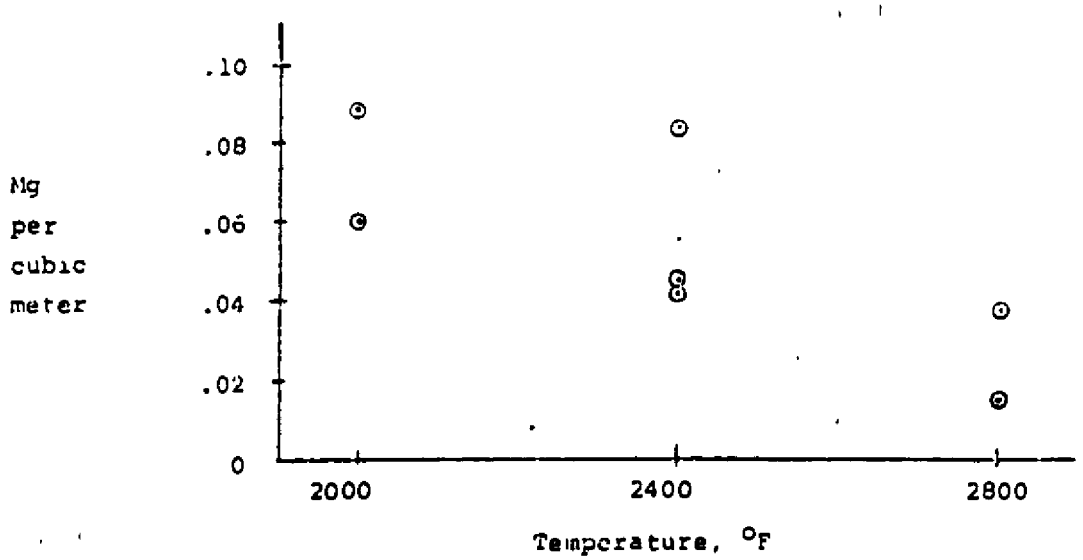

Fig. 1 - PCB in Flue Gas - Pilot Plant

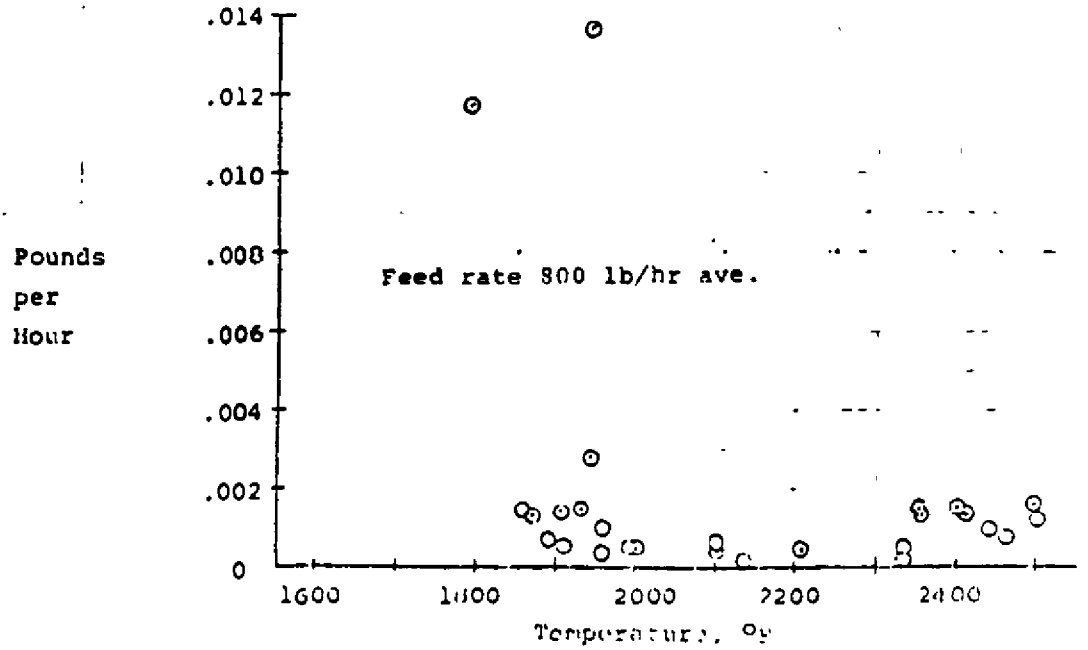

Fig. 3 - PCB in Flue Gas - Sauget Plant

MONS 219843