

TEXAS CITY PLANT
UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.


TOTAL AREA
NO. 2 (Revised)
PAGE: Cover Sheet
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

This S.O.P. is a Revision of two S.O.P.'s combined: S.O.P. No. 2 three pages issued August 23, 1976 and S.O.P. No. 26 issued January 16, 1979, eight pages for Bldgs. 115 and 117. Please take those two S.O.P.'s from your Manual and insert this new Revised S.O.P. No. 2 for TOTAL AREA, effective March 15, 1981.

It contains the following:

- A. POLICY
- B. MONITORING EQUIPMENT
- C. LEAK DETECTION
- D. RESPIRATORY EQUIPMENT
- E. EMERGENCY

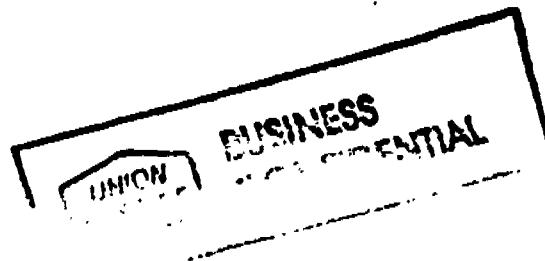

UCC
048491

TEXAS CITY PLANT
UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

Bldgs. 115 & 117

NO. 26
PAGE:
EFFECTIVE:

SUBJECT:

S.O.P. No. 26 is combined in TOTAL AREA, S.O.P. No. 2 (Revised effective March 15, 1981, pages 1 through 11.



UCC
048492

TEXAS CITY PLANT



**BUSINESS
CONFIDENTIAL**

UCAR SOLUTION VINYLIS COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 1 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

A. POLICY

1. UCC Policy is to fully comply with the OSHA Regulation for Exposure to VC1 (1910.1017) reference letter by D.L. Engle dated 3/1/76 to all employees, Texas City Plant.
2. The OSHA standard for VC1 requires that no employee may be exposed to VC1 in concentrations greater than 1) 1 ppm averaged over any 8-hr period, 2) 5 ppm averaged over any period exceeding 15 minutes, & 3) may not be exposed by direct contact with liquid VC1 (1910.1017c).
3. At any time the allowable levels are exceeded in an area, personnel working in the area must wear respiratory protection and rain suits if required.
4. All Visitors to the Regulated Area will register at Bldg. 114 Control Room. The Regulated Area is shown on an attached plot.
5. All Operations & Maintenance personnel regularly assigned to the Regulated Area will be registered on Rosters kept by the Chief Operators & Leadmen. The Contract Division will keep Rosters on contract personnel entering the area. The UCAR Vinyls Staff Roster will be maintained by the Vinyls Secretary. These Rosters (Logsheets) must be forwarded to Bldg. 197 on a regular basis for filing.
6. The Regulated Area will be monitored by three continuous vapor fraction analyzers (VFA's) with sample points scattered throughout the area.

B. MONITORING EQUIPMENT

1. Continuous Vapor Fraction Analyzer (VFA)

Two continuous vapor fraction analyzers are currently in service in the Unit and located in Bldg. 115. A third unit will be added during 1981. Each analyzer consecutively analyzes sample points requiring 40 minutes to complete a scan (2 minutes/point). The analyzer is designed to analyze for VC1 only. Results are

UCC
048493

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX



BUSINESS
CONFIDENTIAL

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 2 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

recorded on a strip chart and stored in a micro-computer for further processing. After each 20 point cycle, the stored information is printed out showing VCl concentrations for each of 19 sample points. The 20th point is a 10 ppm calibration point. The first analyzer covers Tank Area 1, Bldgs. 115 & 117. The second analyzer covers Bldgs. 121, 122, & 114. The location of the sample points are shown in the attached lists. The third analyzer will be located at Bldg. 113 and cover Bldg. 119 and the VCl Tank Car Unloading Rack.

Calibration samples are taken every 40 minutes. Whenever the calibration samples read out of the specified range (± 1 ppm), the analyzer must be reported to Maintenance for repair.

The Bldg. 115 Operator & Bldg. 113 Operator when VFA is installed are responsible for monitoring the VFA, regulating maintenance for repairs if required, ordering & replacing the printout sheets, and removal of completed sheets each Monday Day Shift. The completed sheets should be placed in the DPS's box with other charts. A file is maintained at Bldg. 115 for filing the VFA printout sheets.

2. Portable Organic Vapor Analyzer (OVA)

Portable OVA units (Century) are currently available at Bldg. 113 for pin pointing leaks in the unit. One unit will also be located at Bldg. 113. The analyzers can be used to measure total organic vapors, or specifically for VCl. The analyzer is accurate to 1 ppm.

C. LEAK DETECTION

1. Vinyl Chloride Leak (Defined)

A leak, other than one that can be detected by sight, sound, or smell, is defined as a single reading of 10 ppm or greater, or two consecutive readings of 5 ppm or greater on the VFA.

UCC
048494

TEXAS CITY PLANT

UCAR SOLUTION VINYLs COMPLEX

UNION
CARBIDE

BUSINESS
CONFIDENTIAL

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)

PAGE: 3 of 11

EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

2. Leak Detection Procedure (North Area)

- a. The Bldg. 115 Operator is responsible for monitoring the continuous analyzer (VFA) printouts and determine if there is a leak as previously defined.
- b. The North Area Chief Operator must be notified immediately when a leak is indicated. Other personnel in the affected area must also be notified immediately over the public address (PA) system.
- c. The Chief Operator, or the Operator if delegated, will determine the source of the leak using the portable organic analyzer (OVA). The Operator searching for the leak must wear respiratory protection (MSA Pack). It must be assumed that he will be exposed to levels higher than the permissible exposure limits when the source of the leak is discovered.
- d. When the source has been determined, corrective action must begin immediately to stop the leak. If maintenance is required to repair the leak, the request should have a high priority, normally 24 unless the leak is very large or a vapor cloud release, then 1A. Maintenance personnel repairing the leak must also wear respiratory protection (MSA Pack) and rain suits if danger of exposure to liquid.
- e. Non-essential personnel shall be withdrawn from the area of the leak. Personnel required to remain in an affected area are required to wear respiratory protection when spending 15+ minutes in an area where the latest reading is 5 ppm, or anytime the individuals 8-hr TWA is forecast to be over 1 ppm.
- f. If, for any reason, repairs cannot be made immediately, the area must be isolated until the leak is fixed and VFA monitor indicates a return to normal conditions (< 1 ppm).

UCC
048495

TEXAS CITY PLANT



BUSINESS
CONFIDENTIAL

UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2:(Revis d)

PAGE: 4 of 11

EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

- g. The Chief Operator or Bldg. 115 Operator will notify personnel in the area over the PA system when the VC1 level is back to normal.
- h. All leaks, as defined, must be recorded on the forms provided (copy attached) with a description of the action taken to eliminate the leak. The completed form should be routed to the SPS, DPS, and Vinyls Dept. Head.

3. Leak Investigation Procedure (Bldg. 113 Area)

- a. The Bldg. 113 Operator is responsible for monitoring the VF printouts and determine if there is a leak as previously defined.
- b. The Bldg. 113 Chief Operator must be notified immediately, as well as any other personnel in the affected area, when a leak is indicated.
- c. Other steps of procedure same as procedure for North Area and as listed above.

4. Routine Check For Leaks

A weekly check will be conducted to find small leaks in the area. The Bldg. 116 Operator and the Bldg. 113 Chief Operator will be responsible for conducting the checks for their areas each Saturday on Day Shift. Areas to be checked using the OVA include

North Area (Bldg. 116 Operator)

- a. Autoclave steam pumps
- b. Autoclave safety relief devices & manual vents
- c. Centrifugal pumps in the Stripping Unit
- d. Reciprocating (steam) pumps in the Stripping Unit
- e. The second & third levels of the Stripping Unit
- f. Safety relief devices in the Stripping Unit

UCC
048496

TEXAS CITY PLANT
UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 5 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

- g. The compressors (unloaders and packing)
- h. Centrifugal pumps in Tank Area 1
- i. Reciprocating pumps in Tank Area 1
- j. The second level of Tank Area 1
- k. Safety relief devices in Tank Area 1
- l. Scrubber vent to atmosphere in Stripping Unit.

VC1 Tank Car Rack (Bldg. 113 Chief Operator)

- a. First level - transfer pump
- b. Second level - four hookup spots.

Building 119 (Bldg. 113 Chief Operator)

- a. First level - compressor, reflux pump, cycle tank, knockout pot
- b. Second level - condenser
- c. Third level - stripper feed motor valve

Tank Area 4 (Bldg. 113 Chief Operator)

- a. Transfer pump
- b. Acetone purge pump

All leaks discovered should be recorded on the forms provided and ~~filed~~ at the Chief Operator's desk at Bldg. 115 and Bldg. 113. Action should be taken to eliminate any leaks as soon as practical.



UCC
048497

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)

PAGE: 6 of 11

EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

D. RESPIRATORY EQUIPMENT

1. The approved respiratory equipment in the Unit for protection from exposure to VCl are 1) the MSA self-contained 30-minute air pack, and 2) the Breathing Air Systems.
2. One or more MSA air packs are located at each building in the vinyls area. A list is attached showing the number and location. Each Operator should know the location of the respiratory equipment in his/her working area. The MSA air pack contains a clean MSA mask and a full air bottle. Anytime an air pack is used, it must be reported to the Safety Dept. (Ext. 6027 or 5199) for refilling the bottle and cleaning the mask.
3. The Breathing Air System consists of a mask and hose connected to a cylinder of "breathing" air. Some buildings have cylinders connected to a manifold with several take-off points for hose use. Clean masks should be stored conveniently located to each Breathing Air Station or in the Control Rooms.

When a mask has been used, the Safety Dept. should be called (Ext. 6827 or 5199) and they will pick up the mask for cleaning.

Breathing Air Systems are located at Bldgs. 113, 115, 116, 117, 122 and the VCl Tank Car Rack.

E. EMERGENCY

A vinyl chloride emergency occurs when there is a massive VCl release threatening a vapor cloud hazard. In this case, the Flammable Vapor Cloud Release S.O.P. (Vinyls Area S.O.P. No. 1) should be followed.



BUSINESS
CONFIDENTIAL

UCC
048498

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX



BUSINESS
CONFIDENTIAL

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 7 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

The main steps of that procedure are as follows:

1. Actuate the deluge system for the affected area.
2. Evacuate the endangered area.
3. Activate the plant fire alarm and the toxic gas alarm.

Locations of toxic gas alarm boxes:

Box 612 - Pipe Rack east of Bldg. 117
Box 623 - Pipe Rack east of Bldg. 113
Box 632 - Pipe Rack northeast of Bldg. 120

4. Isolate the affected area, roping it off if possible. Do not allow ignition source near area.
5. Do not re-enter the area. Only Fire and Rescue Squad wearing proper protective equipment are allowed in the area.
6. Isolate the leak by remote valve or pumping arrangements, if possible.
7. All available water should be used to dispense the cloud and form a water curtain to prevent vapors from reaching an ignition source. Deluge, spray systems, monitor nozzles, and fire hoses should be used.
8. As a last resort, entry to the area shall be made from upwind by Fire/Rescue Squad especially trained to cope with vapor releases, wearing protective clothing and respiratory protection and under a protective water spray. An ignition should be anticipated at any time.
9. If a fire occurs, do not extinguish until the source of the fuel is shut off. A re-ignition could be more hazardous than the fire.

UCC
048499



**BUSINESS
CONFIDENTIAL**

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 8 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

LOCATION OF VINYL CHLORIDE
CONTINUOUS SAMPLE POINTS - NORTH END

<u>Point No.</u>	<u>Building</u>	<u>Level</u>	<u>Location</u>
1	Tank Area 1	1	North of 602 & 612 tanks
2	Tank Area 1	1	North of 676 tank
3	Tank Area 1	1	South of 615 tank
4	Tank Area 1	1	South of 675 tank
5	Bldg. 117	1	Middle of compressor room
6	Bldg. 117	1	Control Room
7	Bldg. 117	2	Middle of deck
8	Bldg. 117	3	Middle of deck
9	Bldg. 117	1	North of #2 Dilution tank
10	Bldg. 115	1	North of B-8, 9 autoclaves
11	Bldg. 115	1	South of B-7, 8 autoclaves
12	Bldg. 115	1	South of B-9, 10 autoclaves
13	Bldg. 115	1	Office
14	Bldg. 115	1	Control Room
15	Bldg. 115	1	Lab
16	Bldg. 115	1	North of B-4, 5 autoclaves
17	Bldg. 115	1	North of B-2, 3 autoclaves
18	Bldg. 115	3	North of B-3, 4 autoclaves
19	Bldg. 115	3	B-6 autoclave pump
20	Calibration Point	1	Calibration point

UCC
048500



**BUSINESS
CONFIDENTIAL**

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)

PAGE: 9 of 11

EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

LOCATION OF VINYL CHLORIDE
CONTINUOUS SAMPLE POINTS - SOUTH END

<u>Point No.</u>	<u>Building</u>	<u>Level</u>	<u>Location</u>
1	121	1	Office - Bldg. 121
2	121	1	West end of building
3	121	1	East end of building
4	121	2	West end of No. 3 Bird chute
5	121	2	Control Room
6	121	2	East end by No. 4 wash tank
7	121	3	Middle of atomizer room
8	121	3	Center north wall of Bird room
9	121	3	Middle of cyclone room
10	Tank Area 2	1	Northeast of 13004 tank
11	122	1	North of structure
12	122	2	Between 013 and 031
13	122	1	North wall of gel tank room
14	122	1	North wall of ionexer room
15	122	2	Middle of floor
16	122	3	Middle of floor
17	121	2	Outside northeast corner of bldg.
18	114	1	Office
19	114	1	Control Room
20	115	1	Calibration point - 10 ppm

UCC
048501

TEXAS CITY PLANT

UCAR SOLUTION VINYL COMPLEX

VINYLS AREA
S.O.P.

TOTAL AREA

NO. 2 (Revised)
PAGE: 10 of 11
EFFECTIVE: March 15, 1981

SUBJECT: Vinyl Chloride Exposure Protection

VINYL CHLORIDE LEAK DETECTION LOG

Date: _____

Time: _____

Operator: _____

Please list below the sources or leaks of VCl found in the Solutions Unit
Please list how the source was discovered and the action taken to
eliminate the leak.

Source

How Discovered

Action Taken




**BUSINESS
CONFIDENTIAL**

UCC
048502

VINYL CHLORIDE REGULATED AREA

S.O.P. 2 (Revised)
 Page: 11 of 11
 Effective: March 15, 19

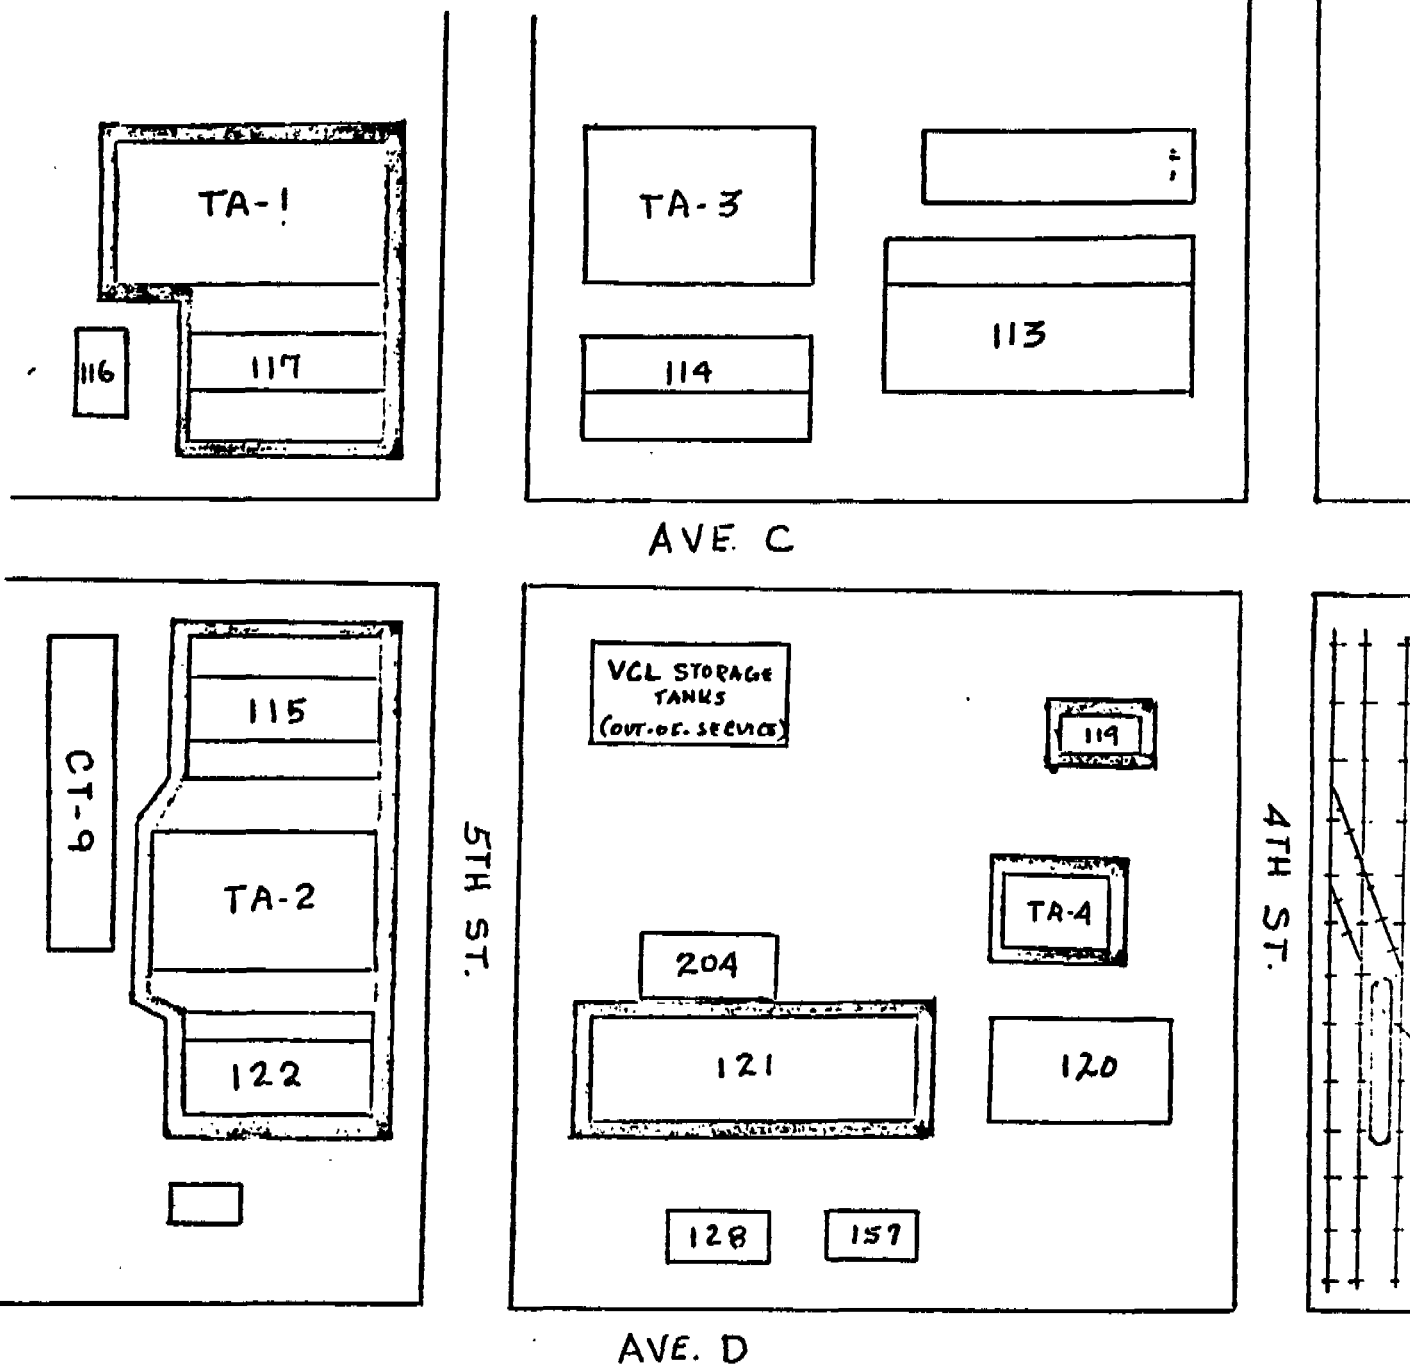

**BUSINESS
 CONFIDENTIAL**

NOTE: REGULATED AREA
 IS OUTLINED IN **RED**

UCC
 048503

FLS
 3/2/8