

FRICITION MATERIALS STANDARDS INSTITUTE, 588 MONROE TURNPIKE, MONROE, CT 06468
 A U T O M O T I V E D A T A B O O K B U L L E T I N #2-981
 September 18, 1998

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>BMW</u>				
1998, M3		7284-D394**	D/D	7286-D396**
1998, Z3		7437-D558**	D/D	7567-D692**
1998, 318Ti		7437-D558**	D/D	7567-D692**
1998, 328i		7437-D558**	D/D	7567-D692**
1998, 328iS		7437-D558**	D/D	7567-D692**
1998, 740iL		7560-D681**	D/D	7427-D683**
1998, 750iL		7561-D682**	D/D	7427-D683**
<u>CHEVROLET TRUCK</u>				
S-10 Electric	1998-97	7634-D767**	D/	
		(Notes #2 & #17)		
<u>CHEVROLET/GMC TRUCK</u>				
C6H042	1998-95	7636-D769**	D/D	7636-D769**
		(Notes #4 & #19)		
C7H042	1998-95	7636-D769**	D/D	7636-D769**
		OR 1308TT-S649	A/A	4515E
		OR	/A	4515G
<u>FORD (See Corrections)</u>				
1998, Taurus SHO		7633-D765**	D/	
		(Notes #1 & #15)		
1998-97(late), Contour			/N	1504-S736*
				(Notes #12 & #27)
<u>JAGUAR</u>				
1998, XJ8		7395-D394**	D/D	7563-D688**
1998-97, XK8		7395-D394**	D/D	7563-D688**
<u>KIA (See Comments & Corrections)</u>				
1998-97, Sephia		7529-D766**	D/	
		(Note #16)		
1998, Sephia			/D	7642-D775**
				(Notes #10 & #25)
1998, Sportage		7641-D774**	D/N	1505-S737*
		(Notes #9 & #24) (Notes #13 & #28)		
<u>LEXUS</u>				
1998, GS300			/D	7638-D771**
				(Notes #6 & #21)
1998, GS400		7495-D619**	D/D	7638-D771**
1998, RX300		7581-D772**	D/D	7223-D325**
1998, LX470		7639-D772**	D/D	7640-D773**
		(Notes #7 & #22) (Notes #8 & #23)		
<u>MAZDA</u>				
1998, MPV		7430-D551**	D/D	7432-D553**
1998, Protege		7219-D466**	D/N	8104-S702*
		OR 7353-D473**	D/D	7514-D663**

SEE DISCLAIMER AT END OF BULLETIN

FMSI® and FMS® are registered trademarks of the Friction Materials Standards Institute, Inc.

Copyright© by Friction Materials Standards Institute, Inc.

	FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>MERCURY</u> (See Corrections)			
1998-97(late), Mystique		/N	1504-S736*

PORSCHE

1998, 911 Carrera	7643-D776** D/ (Notes #11 & #26)
1998, 911 Carrera 4S	7643-D776** D/
1998, 911 Carrera 4	7643-D776** D/
1998, 911 Carrera S	7643-D776** D/
1998, 911 Carrera Targa	7643-D776** D/

ROCKWELL AXLE

16 1/2dd 8 5/8 Cast Plus	4728 A/ (Note #14)
--------------------------	-----------------------

SUBARU

1998, Forester	/D	7637-D770** (Notes #5 & #20)
1998, Impreza	7590-D722** D/N	1462-S676*
OR	7589-D721** D/D	7351-D471**

THOMAS

Bus	1998-95	7636-D769** D/D	7636-D769**
-----	---------	-----------------	-------------

TOYOTA

1998, Land Cruiser	7639-D772** D/D	7640-D773**
--------------------	-----------------	-------------

VOLKSWAGEN

1998, Beetle	7635-D768** D/ (Notes #3 & #18)
--------------	------------------------------------

VOLVO

1998, S90	7512-D634** D/D	7422-D541**
OR	/D	7279-D391**
1998, V90	7512-D634** D/D	7422-D541**
OR	/D	7279-D391**

COMMENTS

Existing lining used with new shoe:

Lining	Assembly	Application
7529	7529-D766	1998-97 KIA Sephia Front

CORRECTIONS

The correct listing for 1998-97 KIA Sephia Front is 7529-D766.

The correct rear drum brakes for 1998-97(late) Ford Contour and Mercury Mystique is 1504-S736. The 1997(early)-95 rear drum remains 1479-S696.

The correct listing for 1998 Ford Taurus SHO front is 7633-D765.

DISC BRAKE LINING ASSIGNMENTS

Note #1	FMSI 7633	7633-D765
	55.1 x 17.5 x 117.9	4 IM
	(2.17 x .689 x 4.64)	

DISC BRAKE LINING ASSIGNMENTS (cont'd)

Note #2	<u>FMSI 7634</u>	7634-767
	41.1 x 13.7 x 123.7	2 IM
	40.1 x 13.5 x 121.9	2
	(1.62 x .540 x 4.87)	
	(1.58 x .531 x 4.80)	
Note #3	<u>FMSI 7635</u>	7635-D768
	49.3 x 19.0 x 113.0	4 IM
	(1.94 x .748 x 4.45)	
Note #4	<u>FMSI 7636</u>	7636-D769
	63.8 x 25.2 x 211.1	4 IM
	(2.51 x .992 x 8.31)	
Note #5	<u>FMSI 7637</u>	7637-D770
	33.8 x 13.8 x 82.3	4 IM
	(1.33 x .543 x 3.24)	
Note #6	<u>FMSI 7638</u>	7638-D771
	40.1 x 15.5 x 55.4	4 IM
	(1.58 x .610 x 2.18)	
Note #7	<u>FMSI 7639</u>	7639-D772
	56.9 x 17.4 x 117.6	4 IM
	(2.24 x .685 x 4.63)	
Note #8	<u>FMSI 7640</u>	7640-D773
	38.4 x 17.4 x 104.4	4 IM
	(1.51 x .685 x 4.11)	
Note #9	<u>FMSI 7641</u>	7641-D774
	45.2 x 15.1 x 136.7	4 IM
	(1.78 x .594 x 5.38)	
Note #10	<u>FMSI 7642</u>	7642-D775
	37.1 x 12.8 x 88.1	4 IM
	(1.46 x .504 x 3.47)	
Note #11	<u>FMSI 7643</u>	7643-D776
	61.0 x 16.3 x 118.4	4 IM
	(2.40 x .642 x 4.66)	

DRUM BRAKE LINING ASSIGNMENTS


Note #12	<u>FMSI 1504</u>	1504-S736
	228.6dd - 43.0 x 6.3 x 220.0	2 Bonded
	228.6dd - 43.0 x 3.6 x 220.0	2
	(9.00 - 1.69 x .248 x 8.66)	
	(9.00 - 1.69 x .142 x 8.66)	
Note #13	<u>FMSI 1505</u>	1505-S737
	260.0dd - 45.0 x 6.0 x 261.6	4 Bonded
	(10.24 - 1.77 x .236 x 10.30)	

AUTOMOTIVE DATA BOOK BULLETIN #2-981 -4- September 18, 1998
BRAKE BLOCK LINING ASSIGNMENTS

Note #14 FMSI 4728
 16.50dd - 8.63 x .875 x 8 27/64 4 1/4R 128
 Tapered
 - 8.63 x .875 x 8 15/64 4
 Tapered

DISC BRAKE SHOE ASSIGNMENTS



Note #15 FMS D765 7633-D765
 124.0 x 6.6 Ford
 (4.88 x .260)

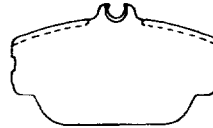

Note #16 FMS D766 Inner Outer
 151.4 x 6.0 7529-D766
 (5.96 x .236) KIA



Note #17 FMS D767 Inner Outer
 152.7 x 5.1 7634-D767
 123.4 x 3.4 Chevrolet Truck
 (6.01 x .201)
 (4.81 x .134)






Note #18 FMS D768 7635-D768
 146.0 x 5.0 Volkswagen
 (5.75 x .197)



Note #19 FMS D769 7636-D769
 240.0 x 6.6 Chevrolet Truck
 (9.45 x .260) GMC Truck
 Thomas Bus



DISC BRAKE SHOE ASSIGNMENTS (cont'd)

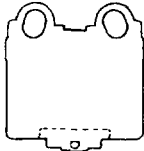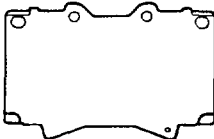Note #20	 <u>FMS D770</u> 108.2 x 5.1 (4.26 x .201)	7637-D770 Subaru
Note #21	 <u>FMS D771</u> 57.2 x 5.0 (2.25 x .197)	7638-D771 Lexus
Note #22	 <u>FMS D772</u> 119.4 x 6.5 (4.70 x .240)	7639-D772 Lexus Toyota
Note #23	 <u>FMS D773</u> 123.2 x 5.6 (4.85 x .220)	7640-D773 Lexus Toyota
Note #24	 <u>FMS D774</u> 149.1 x 6.2 (5.87 x .244)	7641-D774 KIA
Note #25	 <u>FMS D775</u> 98.8 x 5.1 (3.89 x .201)	7642-D775 KIA

DISC BRAKE SHOE ASSIGNMENTS (cont'd)

Note #26	<u>FMS D776</u> 121.2 x 4.6 (4.77 x .181)		7643-D776 Porsche
----------	---	--	----------------------

DRUM BRAKE SHOE ASSIGNMENTS

Note #27	<u>FMS S736</u> 228.6 x 43.0 (9.00 x 1.69)		
		Forward	Reverse 1504-S736 Ford Mercury

Note #28	<u>FMS S737</u> 260.0 x 45.0 (10.24 x 1.77)		1505-S737 KIA
----------	---	---	------------------

The data shown in this bulletin has been supplied by sources considered to be reliable. While we believe that such information is correct, the Institute cannot and does not accept any responsibility or liability for errors or omissions, or harm resulting therefrom.

The data shown in this bulletin indicates dimensions only and in no way refers to quality of any materials that may be embodied in the product or particular application involved, and moreover, SINCE FIELD CONDITIONS AND OTHER FACTS MAY NECESSARILY VARY FROM ONE APPLICATION TO ANOTHER, FRICTION MATERIALS SUPPLIERS AND INSTALLERS SHOULD RELY ULTIMATELY AND SOLELY UPON THEIR OWN EXPERTISE AND JUDGMENT AS TO QUALITY AND DIMENSIONAL SIZE. Under no circumstances should replacement items be used when they do not appear to fit, nor be "forced" to fit, nor be modified in the field instead of obtaining a proper sized item from a supplier. If such items are modified in the field to fit, the Institute specifically disclaims all liability and responsibility for any harm resulting therefrom.

If any error or omission is noted in this bulletin, it should be reported immediately to the Friction Materials Standards Institute, Inc., 588 Monroe Turnpike, Monroe, Connecticut 06468.