

FRICITION MATERIALS STANDARDS INSTITUTE, 588 MONROE TURNPIKE, MONROE, CT 06468
 A U T O M O T I V E D A T A B O O K B U L L E T I N #3-961
 January 14, 1997

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>AUDI</u>				
1997, A6 Quattro		7306-D419**	D/D	7498-D228**
	OR	7434-D555**	D/	
1997, S6		7306-D419**	D/D	7498-D228**
<u>BUICK (See Comments & Corrections)</u>				
1997, Park Avenue			/D	7387-D714** (Note #18)
1997-95, Riviera			/D	7387-D714**
1996, Regal			/D	7387-D714**
<u>CADILLAC (See Comments & Corrections)</u>				
1997-95, DeVille			/D	7387-D714**
1997-95, Eldorado			/D	7387-D714**
1997-95, Seville			/D	7387-D714**
1997, Catera			/D	7582-D709** (Notes #4 & #13)
<u>CHEVROLET (See Comments & Corrections)</u>				
1997-96(late), Lumina			/D	7387-D714**
1996(early), Lumina			/D	7387-D508**
1997, Monte Carlo			/D	7387-D714**
1997, Malibu			/N	1496-S720 (Notes #10 & #21)
<u>CHEVROLET TRUCK/GMC TRUCK</u>				
C1500	1997	7259-D369**	D/N	1404A-S675
		OR	7260-D370**	D/BH 2073AT-S653
C2500	1997	7259-D369**	D/BH	2073AT-S653
		OR	7260-D370**	D/BH 2042BT-S655
C3500	1997	7260-D370**	D/BH	2042BT-S655
		OR	7339-D459**	D/BH 2157AT-S656
C3500 DRW	1997	7339-D459**	D/BH	2157AT-S656
		OR	7815-D380**	D/D 7815-D380**
K1500	1997	7259-D369**	D/BH	2073AT-S653
		OR	7260-D370**	D/
K2500	1997	7259-D369**	D/BH	2073AT-S653
		OR	7260-D370**	D/BH 2042BT-S655
		OR	7339-D459**	D/
K3500	1997	7260-D370**	D/BH	2157AT-S656
		OR	7339-D459**	D/
K3500 DRW	1997	7339-D459**	D/BH	2157AT-S656
		OR	7815-D380**	D/D 7815-D380**
Tahoe/Yukon	1997	7259-D369**	D/N	1404A-S675
		OR	7260-D370**	D/BH 2073AT-S653
Suburban 1500	1997	7259-D369**	D/BH	2073AT-S653
		OR	7260-D370**	D/

SEE DISCLAIMER AT END OF BULLETIN

FMSI® and FMS® are registered trademarks of the Friction Materials Standards Institute, Inc.

Copyright© by Friction Materials Standards Institute, Inc.

		FRONT	SYSTEM	REAR
		FMSI NO.	F/R	FMSI NO.
<u>CHEVROLET TRUCK/GMC TRUCK (con't)</u>				
Suburban 2500	1997	7260-D370**	D/BH	2042BT-S655
	OR	7339-D459**	D/BH	2157AT-S656
Astro Van/Safari Van	1997	7214A-D52	D/BH	2117BTT-S651
Astro Van4WD/Safari Van4WD	1997	7259-D369**	D/BH	2117BTT-S651

CHRYSLER (See Comments)

1997, Sebring Convertible		7530A-D650	D/N	1449-520
	OR		/D	7438B-D641
1997, Town & Country		7470A-D642	D/N	1485ATT-S714
	OR		/D	7424A-D715
				(Note #19)

DODGE (See Comments)

1997, Caravan		7470A-D642	D/N	1485ATT-S714
	OR		/D	7424A-D715
1997, Grand Caravan		7470A-D642	D/N	1485ATT-S714
	OR		/D	7424A-D715

DODGE TRUCK

Ram Van 1500	1997	7179A-D269	D/BH	2025T-446*
Ram Van 2500	1997	7179A-D269	D/BH	2025T-446*
Ram Van 3500	1997	7179A-D269	D/BH	2146AT-357
	OR		/BH	2140AT-358

FORD

1997-96, Thunderbird			/D	7477-D708**
				(Notes #2 & #12)

FORD TRUCK

1997, Expedition			/D	7584-D711**
				(Notes #6 & #15)

HONDA (See Comments & Corrections)

1997-96, Passport		7585-D579**	D/N	1360-S619*
		(Note #7)		
	OR		/D	7586-D580**
				(Note #8)

ISUZU (See Comments & Corrections)

1997-96, Rodeo		7585-D579**	D/N	1360-S619*
	OR		/D	7586-D580**

JEEP

1997, Grand Cherokee		7358-D712**	D/D	7502-D713**
		(Notes #1 & #16)		(Notes #3 & #17)
1997, Cherokee		7358-D712**	D/D	7502-D713**
1997, Wrangler		7358-D712**	D/D	7502-D713**

MERCEDES

1996, E300		7583-D710**	D/	
		(Notes #5 & #14)		

MERCURY

1997-96, Cougar			/D	7477-D708**
-----------------	--	--	----	-------------

	FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>OLDSMOBILE (See Comments & Corrections)</u>			
1997-95, Aurora		/D	7387-D714**
1997, Cutlass		/D	7387-D714**
1997-96(late), Cutlass Supreme		/D	7387-D714**
1996(early), Cutlass Supreme		/D	7387-D508**
<u>PLYMOUTH (See Comments)</u>			
1997, Voyager	7470A-D642	D/N	1485ATT-S714
OR		/D	7424A-D715
1997, Grand Voyager	7470A-D642	D/N	1485ATT-S714
OR		/D	7424A-D715
<u>ROCKWELL AXLE</u>			
16-1/2dd 6 Cast-Plus	4715A	A/	
	(Note #11)		
<u>SATURN (See Comments & Corrections)</u>			
1997-95(late),		/D	7387-D714**
1995(early),		/D	7387-D508**
<u>TOYOTA</u>			
1997, Previa	7587-D716**	D/D	7381-D501**
	(Notes #9 & #20)		
1997, Land Cruiser	7298-D502**	D/D	7487-D606**
1997, Rav-4	7441-D695**	D/N	1447-587*
1997, T100 1/2 Ton 2WD	7485-D686**	D/N	1397-589*
1997, T100 1 Ton 2WD	7486-D605**	D/N	1383-549*
1997, Tacoma 2WD	7548-D433**	D/N	1358-505*
1997, Tacoma 4WD	7549-D436**	D/N	1397-589*

C O M M E N T SExisting lining used with new shoe:

<u>Lining</u>	<u>Assembly</u>	<u>Application</u>
7387	7387-D714	1997-95 Various GM Vehicles Rear Disc
7424A	7424A-D715	1997 Chrysler Town & Country Rear
		1997 Dodge Caravan/Grand Caravan Rear
		1997 Plymouth Voyager/Grand Voyager Rear

Existing shoe with new lining:

<u>Shoe</u>	<u>Assembly</u>	<u>Application</u>
D579	7585-D579	1997-96 Honda Passport Front
		1997-96 Isuzu Rodeo Front
D580	7586-D580	1997-96 Honda Passport Rear
		1997-96 Isuzu Rodeo Rear

C O R R E C T I O N S

1996 Honda Passport and 1997-96 Isuzu Rodeo were originally listed with FMSI 7459-D579 front brakes. The correct listing is FMSI 7585-D579. Also were listed with FMSI 7460-D580 rear brakes. The correct listing is FMSI 7586-D580.

Various GM rear disc applications originally listed as FMSI 7387-D508 are actually FMSI 7387-D714. The FMS D714 gives additional clearance on the between notch dimension.

DISC BRAKE LINING ASSIGNMENTS

Note #1	<u>FMSI 7358</u> 44.0 x 17.0 x 157.8 (1.73 x .669 x 6.21)	7358-D712 4 IM
Note #2	<u>FMSI 7477</u> 33.2 x 16.8 x 99.3 (1.31 x .661 x 3.91)	7477-D708 4 IM
Note #3	<u>FMSI 7502</u> 29.7 x 15.0 x 125.4 (1.17 x .591 x 4.94)	7502-D713 4 IM
Note #4	<u>FMSI 7582</u> 40.6 x 16.7 x 58.6 (1.60 x .657 x 2.31)	7582-D709 4 IM
Note #5	<u>FMSI 7583</u> 47.0 x 18.9 x 111.0 47.0 x 18.9 x 111.0 (1.85 x .744 x 4.37) (1.85 x .744 x 4.37)	7583-D710 2 IM 2
Note #6	<u>FMSI 7584</u> 33.3 x 16.0 x 124.7 (1.31 x .630 x 4.91)	7584-D711 4 IM
Note #7	<u>FMSI 7585</u> 47.5 x 15.5 x 122.7 (1.87 x .610 x 4.83)	7585-D579 4 IM
Note #8	<u>FMSI 7586</u> 37.3 x 14.0 x 94.5 (1.47 x .551 x 3.72)	7586-D580 4 IM
Note #9	<u>FMSI 7587</u> 47.2 x 15.6 x 113.0 47.5 x 15.6 x 114.0 (1.86 x .614 x 4.45) (1.87 x .614 x 4.49)	7587-D716 2 IM 2

DRUM BRAKE LINING ASSIGNMENTS

Note #10	<u>FMSI 1496</u> 225.0dd - 44.2 x 6.8 x 227.7 (8.86 - 1.74 x .268 x 8.96)	1496-S720 4 - 40
----------	---	---------------------

BRAKE BLOCK LINING ASSIGNMENTS

Note #11	<u>FMSI 4715A</u> 16.50 - 6.00 x .875 x 8.13 Tapered 8.38	4 1/4R 96 4
----------	---	----------------

DISC BRAKE SHOE ASSIGNMENTS

Note #12

FMS D708114.3 x 5.8
(4.50 x .228)

7477-D708


Ford
Mercury

Note #13

FMS D70961.7 x 4.1
(2.43 x .161)

7582-D709

Cadillac




Note #14

FMS D710151.4 x 5.6
151.4 x 5.6
(5.96 x .220)
(5.96 x .220)

7583-D710

Mercedes

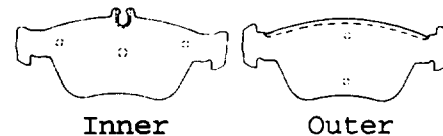


Note #15

FMS D711142.5 x 5.1
(5.61 x .201)

7584-D711

Ford



Note #16

FMS D712177.0 x 5.3
177.0 x 5.3
(6.97 x .209)
(6.97 x .209)

7358-D712

Jeep



Note #17

FMS D713143.2 x 5.0
(5.64 x .197)

7502-D713


Jeep



Note #18

FMS D714107.8 x 5.0
(4.24 x .197)

7387-D714

Buick
Cadillac
Chevrolet
Oldsmobile
Pontiac
Saturn

DISC BRAKE SHOE ASSIGNMENTS (con't)

Note #19

FMS D715


155.6 x 5.0
 155.7 x 5.0
 (6.12 x .197)
 (6.13 x .197)

7424A-D715

Chrysler
 Dodge
 Plymouth



Inner



Outer

Note #20

FMS D716

128.3 x 5.6
 127.0 x 5.5
 (5.05 x .220)
 (5.00 x .217)

7587-D716

Toyota



Inner



Outer

DRUM BRAKE SHOE ASSIGNMENTS

Note #21

FMS S720

225.0 x 45.0
 (8.86 x 1.77)

1496-S720

Chevrolet



The data shown in this bulletin has been supplied by sources considered to be reliable. While we believe that such information is correct, the Institute cannot and does not accept any responsibility or liability for errors or omissions, or harm resulting therefrom.

The data shown in this bulletin indicates dimensions only and in no way refers to quality of any materials that may be embodied in the product or particular application involved, and moreover, SINCE FIELD CONDITIONS AND OTHER FACTS MAY NECESSARILY VARY FROM ONE APPLICATION TO ANOTHER, FRICTION MATERIALS SUPPLIERS AND INSTALLERS SHOULD RELY ULTIMATELY AND SOLELY UPON THEIR OWN EXPERTISE AND JUDGMENT AS TO QUALITY AND DIMENSIONAL SIZE. Under no circumstances should replacement items be used when they do not appear to fit, nor be "forced" to fit, nor be modified in the field instead of obtaining a proper sized item from a supplier. If such items are modified in the field to fit, the Institute specifically disclaims all liability and responsibility for any harm resulting therefrom.

If any error or omission is noted in this bulletin, it should be reported immediately to the Friction Materials Standards Institute, Inc., 588 Monroe Turnpike, Monroe, Connecticut 06468.