

OHIO FARMERS QUALITY HOUSE PAINT

The unusual elasticity of this paint makes it ideal for all exterior painting on wood and metal. New self-cleaning properties make its brightness last. Recommended as a finishing coat in a two-coat system.

DIRECTIONS

SURFACE PREPARATION: New wood surfaces must be cured, dry and clean. Shellac all knots. Prime with #120 Primer as directed for usage. Allow to dry at least 48 hours, or longer if atmospheric conditions are not ideal. Putty all cracks, nail holes and open joints. Caulk casings and chimneys where necessary.

Previously painted wood surfaces in good repaint condition need only be clean. Painted surfaces that are badly worn, heavily chalked, cracked, blistered, flaking or peeling should be wire brushed, scraped or burned off to the bare wood. Prime these areas with #120 Primer. When two finish coats are to be applied, thin first coat by adding one pint of turpentine or mineral spirits per gallon.

NOTE: Ohio Farmers Quality House Paint may be used for the prime coat on new wood or on bare spots on old work when thinned with one pint of raw linseed oil and one pint of turpentine or mineral spirits per gallon. Allow at least 72 hours drying before applying finish coat.

MATERIAL PREPARATION: Stir thoroughly and then pour from one container to another several times ("boxing"). Ohio Farmers Quality House Paint should be applied without thinning, although thinning with one-half pint of turpentine or mineral spirits per gallon is permissible when using over extremely hot or very cool surfaces. Always box after thinning. Do not add dilers.

MATERIAL APPLICATION: Paint only when weather conditions are favorable and temperature is above 50°F. Brush Ohio Farmers Quality House Paint uniformly and evenly, working paint well into surface of one board at a time. After spreading, make light finishing strokes. For best performance, do not cover more than 550 square feet of surface with each gallon of paint. To spray, reduce 10% - 15% with turpentine or mineral spirits and use 30 - 40 pounds air pressure.

HOW TO MAKE SHINGLE STAIN FROM OHIO FARMERS QUALITY HOUSE PAINT

Add one gallon of Shingle and Shale Paint Blending Liquid to two gallons of Ohio Farmers Quality House Paint White or desired color. See Shingle and Shale Paint color card for complete information. L.C. 457221

CAUTION: Do not tint this paint. It is self-cleaning and will streak or fade if tinted.

MADE IN U. S. A.


OHIO FARM *Quality* PA

**MILDEW
AND
FUME RESISTANT**

CAUTION! COMBUSTIBLE!
CONTAINS LEAD. HARMFUL IF SWALLOWED.
Keep away from heat and open flame.
Do not apply on toys, furniture, window
sills, or other interior surfaces of rooms
which may be used by children. Avoid
prolonged contact with skin and breath-
ing of vapors or spray/mist. Close con-
tainer after each use.

Use With Adequate Ventilation.
KEEP OUT OF THE REACH OF CHILDREN.

HIGHEST QUALITY

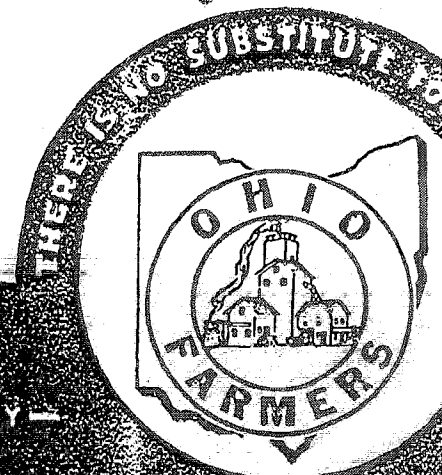

ONE GALLON U.S. MEASURE
3.785 LITRES

HOUSE PA

★100-OUTSIDE V

MANUFACTURED FOR AND GUARANTEED BY THE OHIO FARMERS GRAIN