


Form Approved OMB
No. 44-R1387
Approval Expires:
July 30, 1972

U.S. DEPARTMENT OF LABOR

Form No. OSHA-20
May, 1971

MATERIAL SAFETY DATA SHEET

SECTION I			
MANUFACTURER'S NAME MONSANTO COMPANY		EMERGENCY TELEPHONE NO. (314) 694-1000	
ADDRESS (Number, Street, City, State, and ZIP Code) 800 North Lindbergh Boulevard, St. Louis, Missouri 63166			
CHEMICAL NAME AND SYNONYMS		TRADE NAME AND SYNONYMS Inerteen 100-42	
CHEMICAL FAMILY Chlorinated aromatic		FORMULA Mixture	
SECTION II HAZARDOUS INGREDIENTS			
PAINTS, PRESERVATIVES, & SOLVENTS	TLV (Units)	ALLOYS AND METALLIC COATINGS	%
PIGMENTS		BASE METAL	
CATALYST		ALLOYS	
VEHICLE		METALLIC COATINGS	
SOLVENTS		FILLER METAL PLUS COATING OR CORE FLUX	
ADDITIVES		OTHERS	
OTHERS			
HAZARDOUS MIXTURES OF OTHER LIQUIDS, SOLIDS, OR GASES			%
SECTION III PHYSICAL DATA			
BOILING POINT (°F.)	760 mm	325-360°C	SPECIFIC GRAVITY (H ₂ O=1) (25/25°C)
VAPOR PRESSURE (mm Hg.)	(155-195°)	3 mm	PERCENT VOLATILE BY VOLUME (%)
VAPOR DENSITY (AIR=1)			EVAPORATION RATE (BuAc = 1)
SOLUBILITY IN WATER 20°C	negligible	<0.02%	
APPEARANCE AND ODOR	colorless oil aromatic odor		
SECTION IV FIRE AND EXPLOSION HAZARD DATA			
FLASH POINT (Method used)	C.O.C. 180°C	FLAMMABLE LIMITS	LeI N.A.
EXTINGUISHING MEDIA	Water foam, CO ₂ or dry chemical		
SPECIAL FIRE-FIGHTING PROCEDURES Respiratory protection when fighting fires where exposure to vapors or gases is possible.			
UNUSUAL FIRE AND EXPLOSION HAZARDS Highly toxic gases (chlorides and chlorine) can be evolved in fires of this product.			

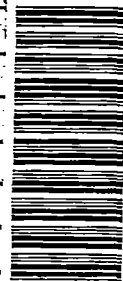

00002138

SECTION V HEALTH HAZARD DATA

THRESHOLD LIMIT VALUE	Not available.
EFFECTS OF OVEREXPOSURE	Skin irritation in the form of chloracne, systematic intoxication leads to nausea, vomiting, loss of weight, edema and abdominal pain
EMERGENCY AND FIRST AID PROCEDURES	Remove from exposure. Remove contaminated clothing. Wash contacted area with large amounts of water and soap. Refer to physician.

SECTION VI REACTIVITY DATA

STABILITY	UNSTABLE		CONDITIONS TO AVOID
	STABLE	X	
INCOMPATIBILITY (Materials to avoid)			
HAZARDOUS DECOMPOSITION PRODUCTS CO, CO ₂ , smoke, soot, chlorides & chlorine			
HAZARDOUS POLYMERIZATION	MAY OCCUR		CONDITIONS TO AVOID
	WILL NOT OCCUR	X	

SECTION VII SPILL OR LEAK PROCEDURES

STEPS TO BE TAKEN IN CASE MATERIAL IS RELEASED OR SPILLED	Absorb on clay, sawdust or other absorbant material. Place in drums. Bury in approved chemical landfill in accordance with local and state regulations.
WASTE DISPOSAL METHOD	Burn in an approved incinerator in accordance with local and state regulations.

SECTION VIII SPECIAL PROTECTION INFORMATION

RESPIRATORY PROTECTION (Specify type) Bureau of Mines approved respirator for organic vapors.			
VENTILATION	LOCAL EXHAUST	Yes - for vapors	SPECIAL vapors.
	MECHANICAL (General)		OTHER
PROTECTIVE GLOVES	rubber	EYE PROTECTION	chemical goggles
OTHER PROTECTIVE EQUIPMENT			

SECTION IX SPECIAL PRECAUTIONS

PRECAUTIONS TO BE TAKEN IN HANDLING AND STORING	Avoid skin and eye contact. Avoid inhalation of vapors.
OTHER PRECAUTIONS	

While the information and recommendations set forth herein are believed to be accurate as of the date hereof, MONSANTO COMPANY MAKES NO WARRANTY WITH RESPECT THERETO AND DISCLAIMS ALL LIABILITY FROM RELIANCE THEREON.

JAG:HOH:JTG:WBP

1/26/72