

FRICITION MATERIALS STANDARDS INSTITUTE, 588 MONROE TURNPIKE, MONROE, CT 06468
 A U T O M O T I V E D A T A B O O K B U L L E T I N #1-971
 October 31, 1997

		FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>CHEVROLET TRUCK</u>				
W5 Series	1996-95		/N	1498-S727 (Notes #10 & #19)
<u>CHEV TRUCK/GMC TRUCK (See Notes)</u>				
B7T042	1997	7819-D225**	D/	(Note #9)
C6H042	1997	7819-D225**	D/D	7819-D225**
C7H042	1997	7819-D225**	D/	
F6B042	1997	7819-D225**	D/D	7819-D225**
F7B042	1997	7819-D225**	D/	
<u>DODGE</u>				
1997, Viper		7471-D592**	D/D	7472-D491**
<u>EAGLE</u>				
1997, Talon			/N	1445-S658*
<u>GMC Truck</u>				
W5 Series	1996-95		/N	1498-S727
<u>HONDA</u>				
1997, CRV			/N	1429-S627*
<u>INFINITI</u>				
1997, Q45		7566-D691**	D/	
<u>ISUZU</u>				
FRR	1997-95		/N	1498-S727
<u>JAGUAR</u>				
1997, XJ6		7395-D394**	D/D	7563-D688**
1997, XJR		7395-D394**	D/D	7563-D688**
1997, XK8		7395-D394**	D/	
<u>LAND ROVER(See Comments)</u>				
1997, Range Rover 4.0SE			/D	7601-D493** (Note #1)
1997, Range Rover 4.6HSE			/D	7601-D493**
<u>MERCEDES</u>				
1996, C220		7523-D645**	D/	
1996, E320			/D	7526-D603**
1997, E320			/D	7526-D603**
1997, E420			/D	7526-D603**
1997, C230		7523-D645**	D/D	7608-D739** (Notes #8 & #18)

SEE DISCLAIMER AT END OF BULLETIN

FMSI® and FMS® are registered trademarks of the Friction Materials Standards Institute, Inc.
 Copyright© by Friction Materials Standards Institute, Inc.

	FRONT FMSI NO.	SYSTEM F/R	REAR FMSI NO.
<u>MITSUBISHI</u>			
1997, Eclipse		/N	1445-S658*
1997, Montero Sport		/N	1499-S728*
			(Notes #11 & #20)
		/D	7602-D733**
			(Notes #2 & #12)

MITSUBISHI FUSO

1997, FE649 (Dual Caliper)	7603-D734** D/D	7603-D734**
	(Notes #3 & #13)	
1996, FE649 (Dual Caliper)	7603-D734** D/	
1997-96, FE639 (Dual Caliper)	7604-D735** D/	
	(Notes #4 & #14)	

PORSCHE

1997, 911 Carrera 2	7327-D447** D/D	7326-D446**
1997, 911 Carrera 4	7327-D447** D/D	7326-D446**
1997, 911 Carrera Targa	7327-D447** D/D	7326-D446**
1997, 911 Turbo	7473-D594** D/D	7327-D447**
1997, Boxter	7606-D737** D/D	7607-D738**
	(Notes #6 & #16)	(Notes #7 & #17)

SAAB

1997, 900	7605-D736** D/
	(Notes #5 & #15)

TOYOTA (See Corrections)

1997, Avalon	7357-D697** D/	
1997, Celica	7357-D697** D/	
1997, Supra	/D	7491-D613**

VOLKSWAGEN (See Corrections)

1995-94, Corrado		/D	7335-D340**
1993, Corrado		/D	7335-D340**
	OR	/D	7234-D340**
1997, Golf		/D	7335-D340**
1996, Golf		/D	7335-D340**
	OR	/D	7234-D340**
1997, Jetta		/D	7335-D340**
1996, Jetta		/D	7335-D340**
	OR	/D	7234-D340**
1995, Jetta III		/D	7335-D340**
	OR	/D	7234-D340**
1994, Jetta III GLX		/D	7335-D340**
	OR	/D	7234-D340**
1997, Passat		/D	7335-D340**
1996-95, Passat		/D	7335-D340**
	OR	/D	7234-D340**

C O M M E N T SExisting shoe with new lining:

<u>Shoe</u>	<u>Assembly</u>	<u>Application</u>
D225	7819-D225	Chev Truck/GMC Truck various models
D493	7601-D493	1997 Land Rover Range Rover 4.0SE Rear
		1997 Land Rover Range Rover 4.6HSE Rear

C O R R E C T I O N S

1997 Toyota Avalon & Celica front brakes are FMSI 7357-D697 not 7357-D476 as shown in the 1997 Catalog.

1997 Toyota Supra rear brakes are FMSI 7491-D613 not 7452-D572 as shown in the 1997 Catalog.

1995-94 VW Corrado rear disc uses FMSI 7335-D340 not 7234-D340.

1993 VW Carroado rear disc uses FMSI 7335-D340 or 7234-D340.

1997 VW Golf rear disc uses FMSI 7335-D340 not 7234-D340.

1996 VW Golf rear disc uses FMSI 7335-D340 or 7234-D340.

1997 VW Jetta rear disc uses FMSI 7335-D340 not 7234-D340.

1996 VW Jetta rear disc uses FMSI 7335-D340 or 7234-D340.

1995 VW Jetta III rear disc uses FMSI 7335-D340 or 7234-D340.

1994 VW Jetta III GLX rear disc uses FMSI 7335-D340 or 7234-D340.

1997 VW Passat rear disc uses FMSI 7335-D340 not 7234-D340.

1996-95 VW Passat rear disc uses FMSI 7335-D340 or 7234-D340.

DISC BRAKE LINING ASSIGNMENTS

Note #1	<u>FMSI 7601</u>				7601-D493	
	38.1	x	15.2	x	88.6	4 IM
	(1.50	x	.600	x	3.49)	
Note #2	<u>FMSI 7602</u>				7602-D733	
	39.1	x	14.9	x	78.0	4 IM
	(1.54	x	.587	x	3.07)	
Note #3	<u>FMSI 7603</u>				7603-D734	
	58.2	x	19.2	x	112.0	6 IM
	58.2	x	19.2	x	112.0	2 IM
	(2.29	x	.756	x	4.41)	
	(2.29	x	.756	x	4.41)	
Note #4	<u>FMSI 7604</u>				7604-D735	
	48.0	x	17.4	x	103.4	2 IM
	48.0	x	17.4	x	108.2	6 IM
	(1.89	x	.685	x	4.07)	
	(1.89	x	.685	x	4.26)	
Note #5	<u>FMSI 7605</u>				7605-D736	
	53.1	x	19.2	x	106.4	4 IM
	(2.09	x	.756	x	4.19)	
Note #6	<u>FMSI 7606</u>				7606-D737	
	53.8	x	15.5	x	111.5	4 IM
	(2.12	x	.610	x	4.39)	
Note #7	<u>FMSI 7607</u>				7607-D738	
	48.8	x	15.4	x	109.5	4 IM
	(1.92	x	.606	x	4.31)	
Note #8	<u>FMSI 7608</u>				7608-D739	
	36.1	x	14.8	x	58.7	4 IM
	(1.42	x	.583	x	2.31)	

Note #9 FMSI 7819 7819-D225
 2.44 x 1.100 x 6.82 2 IM
 2.43 x .915 x 10.47 2 IM


DRUM BRAKE LINING ASSIGNMENTS

Note #10 FMSI 1498 1498-S727
 320.0dd - 145.0 x 13.0 x 167.0 8 - 96
 (12.60 - 5.71 x .512 x 6.57)

Note #11 FMSI 1499 1499-S728
 270.0dd - 52.0 x 5.0 x 278.0 4 Bonded
 (10.23 - 2.05 x .197 x 10.95)

DISC BRAKE SHOE ASSIGNMENTS

Note #12 FMS D733
 78.7 x 5.1
 (3.10 x .201)

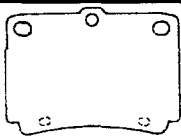

7602-D733
 Mitsubishi

Note #13 FMS D734
 125.2 x 5.6
 (4.93 x .220)



7603-D734
 Mitsubishi Fuso

**Eight piece set - one shoe as shown, one shoe mirror image.
 Six shoes with no hole.**



Inner



Outer

**Eight piece set
 one piece as shown,
 one piece mirror image**

**Eight piece set
 6 pieces as shown**


Note #14 FMS D735
 116.1 x 5.6
 116.1 x 5.6
 (4.57 x .220)
 (4.57 x .220)

7604-D735
 Mitsubishi Fuso

	 Inner	 Outer
Note #15	<u>FMS D736</u> 155.2 x 5.6 156.5 x 5.6 (6.11 x .220) (6.16 x .220)	7605-D736 Saab

		
Note #16	<u>FMS D737</u> 114.0 x 4.7 (4.49 x .185)	7606-D737 Porsche

		
Note #17	<u>FMS D738</u> 112.3 x 4.7 (4.42 x .185)	7607-D738 Porsche

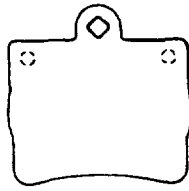		
Note #18	<u>FMS D739</u> 63.5 x 4.2 (2.50 x .165)	7608-D739 Mercedes

DRUM BRAKE SHOE ASSIGNMENTS

		
Note #19	<u>FMS S727</u> 320.0 x 145.0 (12.60 x 5.71)	1498-S727 Chev Truck GMC Truck Isuzu

DRUM BRAKE SHOE ASSIGNMENTS (con't)

			
Note #20	<u>FMS S728</u>		1499-S728
	270.0 x 52.0		Mitsubishi
	(10.63 x 2.05)		

CLUTCH FACING APPLICATIONS BY MODELFORD

1964-82, Ford 10033
(Note #21)

FORD TRUCK

1961-96, Ford Truck 10033

MASSEY FERGUSON

Massey Ferguson 11026
(Note #22)

MERCURY

1963-71, Mercury 10033

CLUTCH FACING ASSIGNMENTS

Note #21	<u>FMSI 10033</u>					
	10.00	x	6.50	x	.138	40 DGAP - 40
Note #22	<u>FMSI 11026</u>					
	11.86	x	7.78	x	.156	40 DGPA - 40

The data shown in this bulletin has been supplied by sources considered to be reliable. While we believe that such information is correct, the Institute cannot and does not accept any responsibility or liability for errors or omissions, or harm resulting therefrom.

The data shown in this bulletin indicates dimensions only and in no way refers to quality of any materials that may be embodied in the product or particular application involved, and moreover, SINCE FIELD CONDITIONS AND OTHER FACTS MAY NECESSARILY VARY FROM ONE APPLICATION TO ANOTHER, FRICTION MATERIALS SUPPLIERS AND INSTALLERS SHOULD RELY ULTIMATELY AND SOLELY UPON THEIR OWN EXPERTISE AND JUDGMENT AS TO QUALITY AND DIMENSIONAL SIZE. Under no circumstances should replacement items be used when they do not appear to fit, nor be "forced" to fit, nor be modified in the field instead of obtaining a proper sized item from a supplier. If such items are modified in the field to fit, the Institute specifically disclaims all liability and responsibility for any harm resulting therefrom.

If any error or omission is noted in this bulletin, it should be reported immediately to the Friction Materials Standards Institute, Inc., 588 Monroe Turnpike, Monroe, Connecticut 06468.