


104 • ONE COAT WHITE

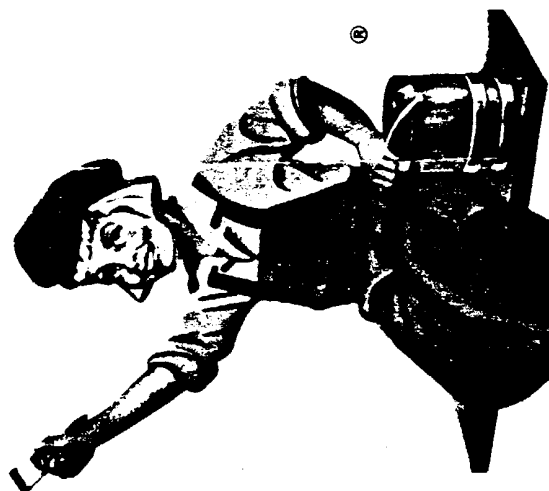

1 GALLON

Dutch Boy®

HOUSE PAINT

Dutch Boy® ONE COAT WHITE HOUSE

High Hiding . . . Long Lasting . . .

Dutch Boy One Coat White House Paint is designed to produce a finished job in one coat on previously painted surfaces. The extremely high hiding power of this durable exterior finish makes it possible to repaint white and light colored surfaces in one coat, producing a dense, white, long lasting coating.

Follow Directions—STIR WELL—Do Not Add

Do not tint this paint. If color is desired, use Dutch Boy 111 White or Dutch Boy House Paint in Color. All surfaces to be painted must be clean and dry. Scrape or burn off all loose or scaling paint. Be certain the paint is well mixed before using.

On previously painted white surfaces which are in good condition, apply one coat of this paint as it comes in the package without thinning. Apply One Coat White House Paint in a somewhat heavier film than is normally used, at a spreading rate not to exceed 500 square feet per gallon.

Dutch Boy One Coat White House Paint is designed to produce a finished job in one coat on previously painted surfaces. The extremely high hiding power of this durable exterior finish makes it possible to repaint white and light colored surfaces in one coat, producing a dense, white, long lasting coating.

For new or unpainted wood, and on surfaces which are badly weathered and peeling, apply one coat of Dutch Boy 010 Prime Coat House Paint. Allow at least 3 days before applying the finish coat.

COMPOSITION OF PAINT BY WEIGHT

PIGMENT 62.1%	
Basic Carbonate	
White Lead 63.5%	} 28.8%
Basic Silicate	
White Lead	
(48% PbO type) 36.5%	
Titanium Dioxide 30.7%	
Zinc Oxide 24.2%	
Magnesium Silicate 16.3%	
VEHICLE 37.9%	
Linseed Oil 79.1%	
Liquid Drier 5.0%	
Mineral Spirits 15.9%	

PAINTING HINTS

Moisture getting behind the paint film may cause any paint to blister and peel. Seal cracks and other openings, repair leaky flashings, downspouts and roofs to prevent entrance of water. Ventilate areas where moisture condenses within the walls.

Paint in good weather—not when it is damp, stormy or there is likelihood of a temperature drop to near freezing. Avoid painting in the late evening or in an intense sun.

Apply a good full coat of paint, covering the surface thoroughly and evenly.

Coat sappy knots with thin shellac and brush off any similar defects before brushing on a finish coat.

Stains from exposed copper, bronze, iron, etc., which are not the fault of the paint, are minimized by coating such surfaces with Marine Spar Varnish or Screen Enamel.

CAUTION—COMBUSTIBLE: CONTAINS LEAD. HARMFUL IF SWALLOWED. Keep away from heat. Do not apply on window sills, toys, furniture or interior surfaces of rooms which may be used by children. Avoid prolonged contact with skin and breathing of vapor or spray mist. Close container after use. Provide adequate ventilation. **KEEP OUT OF THE REACH OF CHILDREN.**



NATIONAL LEAD COMPANY

PAINT DIVISION: NEW YORK, NEW YORK

NL