

FILE NAME: Reynolds Metals (RM)

DATE: 1943 Jan

DOC#: RM101

DOCUMENT DESCRIPTION: Journal Article - Safety in Handling Aluminum Powders

CHEMICAL & METALLURGICAL ENGINEERING

ESTABLISHED 1902

In this Issue

JANUARY, 1943

Volume 50

Number 1

S. D. KIRKPATRICK Editor
JAMES A. LEE Managing Editor
THEODORE R. OLIVE Associate Editor
HENRY M. BATTERS Market Editor
JOHN R. CALLAHAM Assistant Editor
NORMAN G. FARQUHAR Assistant Editor
LESTER B. POPE Assistant Editor

EDITORIAL REPRESENTATIVES

E. S. STATELER Chicago
R. S. McBRIDE Washington
EARLE MAULDIN Atlanta

M. A. WILLIAMSON Publisher DISTRICT MANAGERS

E. H. BEDELL New York
R. G. FREDERICK New York
FRED GRANT Cleveland
L. A. CUNNINGHAM Chicago
W. D. BOYD Boston
J. R. VAN ARSDALE Philadelphia

Published monthly. Price 35 cents per copy. Address communications about subscriptions to Director of Circulation, Chem. & Met., 330 West 42 St., New York, N. Y. Subscription rates: United States, Mexico, Central and South American countries, \$3 a year, \$4 for two years, \$5 for three years. Canada, \$3.50 a year, \$5 for two years, \$6 for three years (payable in Canadian funds). Great Britain and British Possessions, 30 shillings a year, 80 shillings for three years. All other countries, \$5 a year, \$10 for three years. Entered as second class matter, September 3, 1936, at Post Office at Albany, N. Y., U. S. A., under act of March 3, 1879. Contents copyrighted, 1943, by McGraw-Hill Publishing Company, Inc. Branch offices: 520 North Michigan Avenue, Chicago; 68 Post Street, San Francisco; Aldwych House, Aldwych, London, W. C. 2; Washington; Philadelphia; Cleveland; Detroit; St. Louis; Boston; Los Angeles; Atlanta.

McGRAW-HILL PUBLISHING CO., INC.
JAMES H. McGRAW
Founder and Honorary Chairman

Publication Office

99-129 North Broadway, Albany, N. Y.

Editorial and Executive Offices

330 West 42 Street, New York, N. Y.

JAMES H. McGRAW, Jr. President
HOWARD EHRLICH Executive Vice-President
MASON BRITTON Vice-President
H. B. PUTNAM Treasurer
J. A. GERARDI Secretary
E. BLACKBURN, Jr. Director of Circulation
Member A.B.P. Member A.B.C.
Cable address McGRAWHILL, New York

Our Year II of World War II	75
EDITORIAL FOREWORD	
Waste Disposal Problems in Wartime	78
By F. W. MOHLMAN	
Safety in Handling Aluminum Powders	82
By G. M. BABCOCK and F. B. RETHWISCH	
Progress Report of the Rubber Director	85
Selection of Pumps for Oleum and Strong Sulphuric Acid	86
By WARD E. PRATT	
Effect of the Kinetic Energy Term in Gas Flow Calculations	90
By BENJAMIN MILLER	
Nylon Research Wins its War Wings	92
EDITORIAL STAFF REPORT	
Manufacture of Butadiene From Ethyl Alcohol—II	94
By J. A. GAMMA and T. INOUE	
Labor Relations and Collective Bargaining in Chemical Industry	99
A CHEM. & MET. REPORT	
Chrome Tanning Leather	112
A CHEM. & MET. PICTURED FLOWSHEET	

Chem. & Met. Plant Notebook	98	Personalities	137
Process Equipment News	107	Meetings and Conventions	145
Chemical Engineering News	119	News From Abroad	156
News From Washington	121	Chem. & Met. Bookshelf	167
Interpreting Washington	124	Chemical Economics and Markets	175
New Products and Materials	129	Current Prices	187
From the Log of Experience	133	New Construction	190

An index to advertisers will be found on page 286



A McGRAW-HILL PUBLICATION

CHANGE OF ADDRESS

McGRAW-HILL PUBLISHING COMPANY
330 West 42nd Street, New York, N. Y.

Director of Circulation:

Please change my address on Chemical & Metallurgical Engineering

From

To

Safety in Handling Aluminum Powders

G. M. BABCOCK and F. B. RETHWISCH *Reynolds Metals Co., Louisville, Ky.*

Chem. & Met. INTERPRETATION

Except for those people who work constantly with aluminum powders, sufficient respect for the explosibility of this material does not appear to exist. With the present widespread use of aluminum powders for the manufacture of military pyrotechnics, need has developed for the more widespread dissemination of information on safe practices in their handling and in manufacturing pyrotechnics. The article which follows is based on the experience gained by the Reynolds Metals Co. in many years of producing and handling metallic powders and is offered as a starting point in the development of safety programs for concerns engaged in or beginning operations in pyrotechnic work. Certain fundamental precautions are discussed by the authors as a service to the industry, but neither they nor their company assume liability of any kind in presenting this information.—Editors.

FLAKE ALUMINUM POWDER, somewhat similar to the material commonly used in aluminum paint under the rather misleading name of "aluminum bronze powder," is a valuable component of pyrotechnic mixtures used for flares and signals. The high surface area of a given weight of aluminum flake powder makes it easily ignitable when in the presence of oxygen or air. Burning, it evolves a tremendous amount of heat and light. Owing to its low apparent density, fine particles of the material tend to float in air with the attendant danger of violent explosion upon ignition, when a proper ratio of aluminum to oxygen is reached.

A somewhat different aluminum powder, the grained variety, consists of spheres, sausage shapes or irregular grains of aluminum, which are relatively hard to ignite. When mixed with oxygen-producing compounds, the grained powder will burn with the evolution of much heat and light. This material, however, has a high apparent density and low surface area which tends to keep it from suspension in air so that the danger of explosion or fire from aluminum "fog" is almost nil.

Both flake and grained aluminum are shipped in sealed drums with fully removable heads. These drums

should be stored unopened in a separate area wherever possible, since if they are stored along with such chemicals as sulphur, nitrates and others of similar character, a fire from any cause would present a most serious problem. Whenever a drum of aluminum powder is opened for loading or inspection, it should be closed and re-sealed as soon as possible. This not only insures greater safety against fire from external causes but also limits the likelihood of tramp material getting into the powder, or of the powder absorbing water from the air. In one instance a sealed drum of flake aluminum withstood an aluminum dust explosion and subsequent fire without ignition of the drum contents.

There are few practical means of extinguishing fires involving aluminum powder or mixtures containing this powder. Anything which tends to disturb the burning mass may throw the aluminum into the air and result in a violent explosion of tremendous destructive power. It is true that dry sand, carefully placed over a pile of burning aluminum, will smother the flame, but in the excitement attending such a fire, there is danger that the sand will be thrown or shoveled on to the mass, and that the powder will be thrown into the air. There have been

several cases where relatively harmless fires have been changed to serious and fatal explosions from this cause.

Consequently, the safer and more prudent rule is to instruct employees to walk out of the building in the case of an aluminum fire, shutting the door securely but as gently as possible to avoid disturbing the burning mass.

All employees should be instructed in procedures to avoid. They should understand thoroughly that water, carbon tetrachloride, fire foam, carbon dioxide and similar extinguishing agents should not be used on aluminum fires. Use of such materials will cause explosions. Night watchmen should be instructed to convey this information to any regular or volunteer group which attempts to extinguish an aluminum fire. Furthermore, the use of a fine spray of water from a stirrup pump, such as is used by civilian defense workers on incendiary bombs, should never be used on aluminum powder fires.

It is of utmost importance that local fire departments be informed of these precautions. The department should be provided with complete information and charts regarding those warehouses which contain aluminum, as well as those containing other chemicals. These charts should also be readily available to the watchmen and to the plant's own protection division at all times.

AVOIDING HAZARDS

A source of great danger in the handling of aluminum powder is the presence of foreign substances, particularly hard or metallic materials. Care should be taken to see that closing bolts, nails and similar bits of metal cannot contaminate aluminum powder or pyrotechnic mixtures.

Good plant housekeeping is one of the most effective methods in achieving plant safety and care must be taken particularly in the weighing, mixing and pressing rooms. As little material as is practical should be kept in one place at one time. Scoops for handling powders should be of non-sparking material and the handling should be slow and deli-

berate to reduce dusting to a minimum. Rooms in which powder is handled should be cleaned at frequent intervals, but never during weighing, mixing or pressing operations. All material should be kept in closed containers while cleaning is in progress. If oil is used in the pyrotechnic mixture, special care must be taken to insure that all oily rags or waste are deposited in closed safety cans away from the storage or loading areas. These rags must be disposed of daily. In cleaning, care must be taken particularly to keep all corners, window ledges, beams, building steel and other resting places free from dust.

BUILDING PROTECTION

The buildings used for weighing, mixing and loading operations should, wherever possible, be so spaced and protected that fires or explosions in one unit cannot be communicated to other units. Construction should be adapted to the venting of explosions, using either a "soft" wall or roof, or a blow-out panel. All equipment should be located so that the operator has a free path to an outside door, without a mixing bench, press or mixer between him and the door.

All metal in the buildings should be grounded. This not only includes the equipment itself, but also metal window and door frames and other building elements. Clips connected to flexible grounded leads should be placed on all metal drums or other movable equipment. Only explosion-proof motors should be permitted, and for these the controls should be fully inclosed and non-arcing, located outside the workroom so that no worker need be in the mixing or pressing room from the time of starting these operations until they are completed.

All lights should be of a type approved for explosive operations and conditions. Particular care must be taken when automatic or manual tools are to be used in buildings for repairs or changes. When such work is to be carried out, the rooms must first be emptied of all ignitable material and thoroughly cleaned. Fatal explosions have been caused in dust-filled rooms by an arc from the switch of an ordinary flashlight. Therefore, only flash-



lights, electric lighting and power equipment carrying Underwriters' approval for use in explosive areas and where explosive vapors are encountered should be used.

Wherever possible, both the shoes of workers and the floors should be of a conductive but non-sparking type. Electrical discharges produced by static or lightning are the most difficult safety hazards to control. The danger from static charges produced by friction is greatest in cold, dry weather. Even walking on concrete or composition flooring in non-conducting shoes may produce sparks capable of igniting pyrotechnic mixtures or fine aluminum particles suspended in the air. Even the friction caused by aluminum powder poured from a scoop to a container can create high static charges on the aluminum particles.

Particularly in the case of flake aluminum powder, considerable time is required to dissipate this charge.

Several types of non-sparking, conductive floors have been employed successfully.* Three types may be described briefly here, including (1) Magnesite flooring installed over a wood or concrete base, with conductive metal grids placed beneath the surface of the floor and properly grounded; (2) emulsified asphalt composition flooring with a conductive aggregate which also is laid over grounded metal grids; and (3) industrial graphite tile made of a conductive mastic, the edges of the tile being melted together with a hot iron on installation to provide a continuous surface. With this last mentioned type no metal grid is necessary, the tile itself being grounded at various points.

These views, from photos by the U. S. Army Signal Corps, show a thermite bomb demonstration at the Army War College, Washington, D. C.; the upper view shows the bomb beginning to explode, while the lower shows the climax of the explosion where the bomb, having reached a temperature of about 4,000 deg. F., is melting through the slab of steel on which it rests.

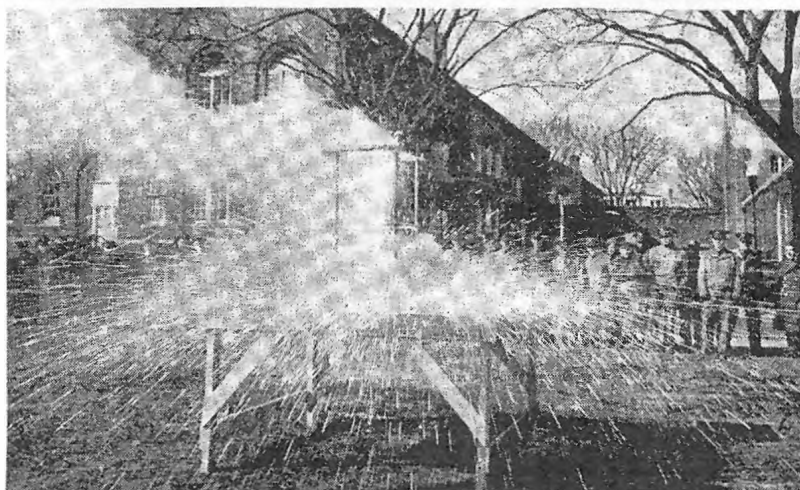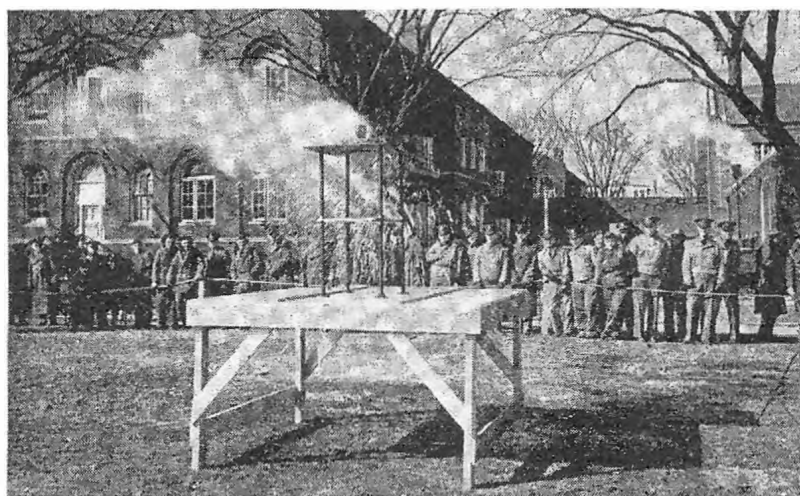

* Further information on these floors can be secured from Armstrong Cork Co., Building Products Div., Lancaster, Pa.; the Flintkote Co., Industrial Emulsions Div., 80 Rockefeller Plaza, New York, N. Y.; and the Koppelite Co., 111 Clay St., Brooklyn, N. Y.

The causes of static should be explained to employees, using simple illustrations such as the rubbing of silk in cold weather, or the combing of hair. Belt drives should not be used on machines in the mixing, pressing or loading rooms. Special care should be taken in screen rooms, since the friction of the particles passing over the screens and their temporary suspension and separation in air can build up high static charges. All metal in processing and storage rooms should be grounded and every possibility of a spark from machinery, from broken electric light bulbs, or from the dropping of steel tools should be guarded against. Properly grounded metal containers on spark-proof conductive flooring will permit more rapid dissipation of static charges than wooden containers. Mixers should be allowed to remain at rest for a short time before the mixture is removed, thus permitting any static charge induced in the metal par-

ticles in the mix to be conducted to ground. Simple electroscopes can be made to determine when a mixture is free of static charge.

Adequate lightning protection is an important requirement for the plant handling aluminum powders. The grounding of all metal window and door frames and approved lightning protection of all wiring will largely eliminate the possibility of high charges collecting before or during a thunderstorm and perhaps discharging to the ground with an accompanying flash or spark. Protection against actual lightning strokes is best left to authorities on this subject.^{3,4} Many concerns shut down all mixing and loading operations during severe, nearby lightning storms, the employees leaving the processing rooms during that period. Radio sets are good indicators of approaching electrical storms, but if they are used, they should not be installed in the loading area owing to the hazard they introduce.

MIXERS AND PRESSES

Machinery used in mixing and pressing operations should be equipped with outboard dust-proof bearings, which should be kept well lubricated. Excessive temperature rise in any part should call for an immediate shutdown. If a shaft or other part should freeze on a bearing surface, no attempt should be made to loosen the part by force, such as by a hammer blow on the shaft, as long as any ignitable material is in the room. Exposed ring gears or bevel gears should be protected from aluminum-powder-containing materials, liberal applications of a heavy grease minimizing this danger.

The clothing worn by plant employees should be kept clean and free from aluminum dust by frequent washing. Many concerns supply shirts and slacks to both male and female employees, the slacks being made without cuffs. There is a possibility of danger when employees wear their work clothes to their homes before changing. For example, a spark from a cigarette may easily cause fatal burns to a person whose clothing is filled with the dust of a pyrotechnic mixture. Owing to the possibility of static charges, silk and silk-like materials should not be worn at work by employees.

The ideal arrangement in locker rooms for employees is to use a double locker system with an intervening shower or washroom. With this method, a locker is provided for each employee at each side of the shower or washroom. The employee removes his work clothes and places them in the work clothes locker, then takes his shower and continues to his second locker on the other side of the shower room where he secures his street clothing. Thus his work clothes locker is always available for inspection by company officials or for the removal of soiled clothing for replacement with clean clothing. As previously mentioned, spark-proof and conductive shoes should always be worn by employees in the loading and mixing areas.

Highlights in Avoiding Aluminum Powder Explosions

1. All machinery and all metal door and window frames should be well grounded.
2. All mixing and conveying equipment should be constructed so as to minimize the escape of dust into rooms.
3. Spatulas, scoops, conveyors and the like should be of non-sparking materials.
4. Motors, as far as possible, should be kept in separate rooms, outside the workrooms. Where it is necessary to have them in the workrooms, they should be of the explosion-proof, dust-proof, splash-proof and water-proof type of squirrel-cage construction.
5. Dust should not be permitted to collect in workrooms; they should be cleaned several times a day, if necessary, although not while operations are going on.
6. Dust in the air should be kept at a minimum. Most people who do not work constantly with aluminum powder do not fully appreciate the explosibility of this material. Trostel and Frevert¹ state that the lower explosive limit for aluminum powder suspended in air varies with the method of ignition. With an electrically heated glowing wire, or with an arc, the lower explosive limit was found to be at a concentration of 7.0 mg. Al per liter of air, and at a concentration of 13.7 mg. with an induction spark.
7. Lighting of rooms should be provided by dust-proof, explosion-proof bulbs.
8. If necessary to use flashlights, they should always be of an Underwriters'-approved type, for use in explosive atmospheres.
9. All bearings and gears should be kept well lubricated and protected from dust.
10. All employees should wear approved type clothing, without pockets or cuffs, if feasible.
11. Operators engaged in mixing should wear respirators as a health precaution.
12. Safety shoes of a type which are both conductive and non-sparking should be worn by operators.
13. Conductive flooring should be employed if possible.
14. Operators should be instructed that, in case of fire, they should walk out and close the door of the room until someone in authority arrives to take charge.
15. Aluminum powders should be stored only in sealed drums and apart from other materials, especially oxidizing agents or easily oxidizable substances.
16. Only dry sand or Underwriters'-approved extinguishers should be used on aluminum powder fires.
17. Care should be taken to prevent foreign substances from getting into aluminum powder.
18. Building construction should follow the recommendations of the National Fire Protection Association.²
19. In general, it is advisable to follow most of the precautions usually observed in the handling of explosives.

REFERENCES

1. Trostel and Frevert, The Lower Limits of Concentration for Explosions of Dusts in Air, *Chem. & Met.*, 30, No. 4, p. 141, Jan. 28, 1924.
2. "National Fire Code for the Prevention of Dust Explosions, 1940," National Fire Protection Association, Boston, Mass.
3. "Code for Protection Against Lightning," Bulletin H21, U. S. Bureau of Standards. Obtainable from Supt. of Documents, Washington, D. C.
4. McEachron and Patrick, "Playing with Lightning," Random House, New York, N. Y.

Advertisers In This Issue

	Page		Page		Page		Page
Abba Inc., Paul O.	127	Dow Chem. Co.	193	Lawrence Mach. & Pump Corp.	274	Richardson Scale Co.	250
Acme Copper Smelting & Machine Co.	48	Downingtown Iron Works	42	Layne & Bowler, Inc.	169	Roberts Filter Mfg. Co.	33
Allis-Chalmers Mfg. Co.	5, 15	Dracoo Corp.	179	Lebanon Steel Fdry.	235	Robins Conveying Belt Co.	40
Allis Co., Louis.	223, 224	Drakenfeld & Co., Inc., B. F.	273	Lee Metal Prods. Co. Inc.	246	Robinson Mfg. Co.	156
Aluminum Co. of America	59	Duraloy Co.	271	Leeds & Northrup Co.	72	Roots-Connersville Blower Corp.	126
Aluminum Ore Co.	216	Durametallic Corp.	142	Linde Air Products Co.	13	Rowan Controller Co.	285
American Chain & Cable Co.	198, 244	Durlon Co., Inc.	21	Link-Belt Co.	7, 17	R-S Products Corp.	130
American District Steam Co.	143	Eagle-Picher Lead Co.	253	Loeb Equip. Supply Co.	280	Ryerson & Son, Inc., J. T.	161
American Flange & Mfg. Co.	44	Edge Moor Iron Works, Inc.	285	Lubriplate Div., Fiske Bros., Refining Co.	8	Sarco Co. Inc.	254
American Locomotive Co.	230	Electrical Engineers Equip. Co.	70	Lukens Steel Co.	269	Searchlight Section	278-284
American Mach. & Metals, Inc.	67, 264	Elliot Co.	288	Lummus Co.	259-260	Sharples Corp.	18
American Meter Co., Inc.	64	Electric Equipment Co.	280	Lunkenheimer Co.	200	Shepard, Niles Crane & Hoist Corp.	246
American Pipe & Const. Co.	131	Emsco Equip. Co.	283	Machinery & Equip. Corp.	284	Shriver & Co., T.	258
American Pulverizer Co.	160	Eppenbach, Inc.	164	Manheim Mfg. & Belt Co.	11	Solvay Sales Corp.	258
American Smelting & Refining Co.	194	Eppler Laboratory, Inc.	206	Marley Co. Inc.	225	Sperry & Co., D. R.	264
American Tool & Machine Co.	34	Erman-Howell Sales Co.	282	Master Electric Co.	3rd Cover	Sprout-Waldron Mfg. Co.	275
American Wringer Co. Inc.	192	Evans & Co., Victory J.	278	McGraw-Hill Book Co.	220	Standard Conveyor Co.	210
Armstrong Mach. Works	128	Everlasting Valve Co.	184	Mercer Engrg. Works, Inc.	158	Standard Oil Co. (Indiana)	55-56
Atlas Mineral Products of Penna.	231	Fairbanks Co.	238	Merrick Scale Co.	276	Stebbins Engrg. & Mfg. Co.	134
Atlas Powder Co.	202	Fairbanks, Morse & Co.	186	Metric Metal Works	64	Stein Equip. Corp.	282
Babcock & Wilcox Co.	10, 58, 154-155	Fanwall Inc.	270	Michigan Steel Casting Co.	132	Struthers Wells Corp.	141
Baggack, Inc.	212	Filter Paper Co.	276	Midvale Co.	69	Sturtevant Mill Co.	140
Badger & Sons Co., E. B.	226	First Machy. Corp.	280, 282, 283, 284	Midwest Piping & Supply Co. Inc.	85	Sutton Steele & Steele, Inc., Separation Engrg. Corp.	162
Baker & Co. Inc.	46	Fletcher Works	127	Miller, Inc., I.	278	Taber Pump Co.	270
Baldwin-Hill Co.	150	Foster Wheeler Corp.	219	Mixing Equip. Co. Inc.	135	Taylor Forge & Pipe Works	71
Barcan Co., I.	283	Fluor Corp. Ltd.	237	Monarch Mfg. Works, Inc.	165	Taylor Inst. Cos.	30
Bates Co., W.	159	Foote Bros. Gear & Mach. Corp.	227	Monsanto Chemical Co.	123	Texas Co.	14
Bausch & Lomb Optical Co.	287	Foxboro Co.	45	Morris Mach. Works	162	Thermal Syndicate, Ltd.	126
Bemis Bro. Bag Co.	203	Frederick Iron & Steel Co.	158	Morse Chain Co.	48	Tidewater Equip. & Mach. Corp.	283
Bird Mach. Co.	9	Fuller Co.	147	Mount Vernon Woodberry Mills, Inc.	168	Timken Roller Bearing Co., Roller Bearing Div.	217
Blaw-Knox Co.	51	Garlock Packing Co.	50	Murray Mfg. Co., D. J.	268	Timken Roller Bearing Co., Steel & Tube Div.	35
Blickman, Inc., S.	185	Gelb & Son, R.	280	Nash Engrg. Co.	251	Titanium Alloy Mfg. Co.	232
Bolta Co.	280	General Ceramics Co.	243	National Box & Lumber Co.	252	Tolhurst Centrifugal Div., American Mach. & Metals, Inc.	67
Bonney Forge & Tool Works	152	General Controls	178	National Radiator Co.	261	Traylor Engrg. & Mfg. Co.	139
Bradley Machinery Co.	376	General Elec. Co.	28-29, 41	National Technical Labs.	174	Tube-Turns, Inc.	8
Brighton Copper Works	283	General Elec. Co. Air Conditioning & Refrigeration Dept.	22	Neville Co.	266	Turner Halsey Co.	168
Brill Equip. Corp.	281	Girdler Corp.	2nd Cover, 4, 118	Niagara Alkali Co.	241-242	Union Bag & Paper Co.	54
Bristol Co.	153	Globe Steel Tubes Co.	257	Niagara Filter Corp.	233	Union Bay State Co.	26
Buell Engrg. Co.	255	Gladding, McBean & Co.	268	North American Mfg. Co.	47	Union Carbide & Carbon Corp.	13, 191
Buffalo Forge Co.	201	Goulds Pumps, Inc.	244	Nukem Pros. Corp.	41	Union Standard Equip. Co.	280
Buffalo Fdry. & Mach. Co.	209	Graver Tank & Mfg. Co. Inc.	262	Oliver United Filters Inc.	213	U. S. Ind. Alcohol Co.	19-20
Bump Pump Co.	178	Greene, Tweed & Co.	180	Pangborn Corporation	164	U. S. Stoneware Co.	37-38
Carbide & Carbon Chemicals Corp.	191	Grinnell Co. Inc.	23	Partridge, Arthur S.	283	Viking Pump Co.	248
Carpenter Steel Co.	254	Grove Regulator Co.	211	Pearless Pump Div., Food Machy. Corp.	165	Virginia-Carolina Chemical Corp.	208
Cash Co., A. W.	111	Hardinge Co. Inc.	52	Pennsylvania Crusher Co.	273	Vogt Mach. Co., H.	240
Cecilco Co.	276	Harvey Bros.	280	Pennsylvania Salt Mfg. Co.	57	Wall-Colmonoy Corp.	250
Century Electric Co.	36	Hersey Mfg. Co.	116	Perez, Martyn	280	Watson-Stillman Co.	261
Chapman Valve Co.	249	Hatharington & Berner, Inc.	256	Perkin-Elmer Corp.	248	Warren Steam Pump Co.	151
Chase Bag Co.	229	Hicks Engrg. Co., Inc., S. D.	266	Perry Equip. & Supply Co.	282	Western Precipitation Corp.	125
Chemical Construction Corp.	214	Hodgman Rubber Co.	161	Petro-Chem Development Co. Inc.	177	Westinghouse Elec. & Mfg. Co.	39
Chicago Bridge & Iron Co.	245	Homestead Valve Mfg. Co.	207	Pfaunder Co.	Back Cover	Weston Elec. Inst. Co.	270
Chicago Metal Hose Corp.	149	Hooker Electrochemical Co.	256	Philadelphia Gear Works	222	Where to Buy	276
Clapay Corp.	273	Howell Electric Motors Co.	53	Photoswitch Inc.	63	Whitlock Mfg. Co.	252
Cochrane Corp.	248	Illinois Water Treatment Co.	146	Pittsburgh Lectordryer Corp.	197	Wickwire Spencer Steel Co.	256
Cohen & Co., L.	283	Ingersoll-Rand	60	Pittsburgh Piping & Equip. Co.	221	Wilfley & Sons, Inc., A. R.	45
Cole Mfg. Co., R. D.	250	Ingersoll Steel & Disc Div., Borg-Warner Corp.	49	Porter Co., Inc., H. K.	144	Williams Pat. Crush & Pulv. Co.	171
Commercial Solvents Corp.	204-205	International Minerals & Chem. Corp.	16	Powell Co., Wm.	172-173	Willson Products Inc.	138
Consolidated Prods. Co. Inc.	279	International Nickel Co. Inc.	62, 226	Powers Regulator Co.	170	Worthington Pump & Machy. Corp.	195
Continental Gln Co.	163	Iron & Steel Prods. Inc.	280	Premier Mill Corp.	285	Wright Mfg. Div., American Chain & Cable Co. Inc.	244
Cooper Alloy Fdry. Co.	148	Island Equip. & Supply Co. Inc.	283	Prestfuel Corp.	283	Wyckoff & Sons, A.	278
Coppus Engrg. Corp.	31	Jacobowitz Co., C. S.	282	Pritchard & Co., J. F.	247		
Corning Glass Works	267	James Mfg. Co., D. O.	43	Proctor & Schwartz, Inc.	274		
C-O-Two Fire Equipment Co.	199	Jeffrey Mfg. Co.	215	Professional Services	274		
Crane Co.	117	Jenkins Bros.	239	Pulverizing Machy. Co.	246		
Debothzat Ventilating Equipment Div., American Mach. & Metals, Inc.	264	Johns-Manville	166	Quaker Oats Co.	157		
De Laval Separator Co.	218	Jones Fdry. & Mach. Co.	266	Raymond Pulverizer Div., Combustion Engrs. Co. Inc.	12		
De Laval Steam Turbine Co.	263	Kehoe Machy. Corp., L.	284	Reading Chain & Block Corp.	160		
Despatch Oven Co.	161	Kalley & Co., O. G.	265	Reading-Pratt & Cooy (Div.) American Chain & Cable Co.	198, 244		
Diamond Alkali Co.	27	Kemp Mfg. Co., C. M.	182	Reeves Pulley Co.	183		
Dicalite Co.	136	Kennedy Valve Mfg. Co.	234	Reichold Chemicals, Inc.	32		
Dings Magnetic Separator Co.	189	Kewaunee Mfg. Co.	252	Reilly Tar & Chem. Corp.	236		
Dodge Mfg. Corp.	25	Knight, Maurice A.	181	Republic Textile Equip. Co., Inc.	284		
Dorr Co., Inc.	24	Kold-Hold Mfg. Co.	254	Rhoads & Sons, J. E.	268		
Dougherty, James A.	284	La Motte Chem. Prod. Co.	276				
		Lapp Insulator Co. Inc.	196				

Professional Services..... 274

SEARCHLIGHT SECTION CLASSIFIED ADVERTISING

Business Opportunities	278
Employment Service	278
Patents	278
Positions Vacant	278
Positions Wanted	278
Selling Opportunities	278
Wanted to Purchase	278
Used Surplus Equipment	278-284