

INSPECTION REPORT

Inspection Entry Date/Time	3/26/2025 08:30 (CT)		Announced: No
Inspection Exit Date/Time	3/26/2025 11:45 (CT)		Access: Granted
Regulatory Program	RCRA		
Type of Inspection	Compliance Evaluation Inspection (CEI)		
Facility or Site Name	Modern American Recycling Services Inc.		
Facility/Site Identifier	LAR000027672		
Facility/Site Physical Address	499 Powhatten Ct.		
City, State, Zip Code	Gibson, LA 70356		
County/Borough	St. Mary		
Generator Status	Small Quantity Generator (SQG)		
NAICS	423930		
Type of Operation	Modern American Recycling Services (MARS) decommissions oil field platforms and recycles the scrap metal.		
Geographic Coordinates	29.65712, -91.03603		
Additional Persons Participating in Inspection:			
Name	Title	Organization	Email
John Penland	Inspector	EPA REGION 6	Penland.John@epa.gov
Erin Young-Dahl	Inspector	EPA REGION 6	Youngdahl.Erin@epa.gov
Janosh Wolters	Contractor	Eastern Research Group (ERG)	Janosh.Wolters@erg.com
Lead Inspector:			
Vince Damiano	Vincent Damiano		Digitally signed by Vincent Damiano Date: 2025.05.01 16:27:39 -04'00'
	ERG	Vince.Damiano@erg.com	

SECTION I – INTRODUCTION**Site Entry and Purpose of the Inspection**

The Port of Morgan City and surrounding facilities were selected for inspection based on a Regional initiative to evaluate facilities at ports receiving or transporting Resource Conservation and Recovery Act (RCRA)-regulated hazardous wastes, and/or have an International Convention for the Prevention of Pollution from Ships (MARPOL) Annex V Certificate of Adequacy (COA) issued by the U.S. Coast Guard (USCG).

This report is based on information supplied by the facility representatives, inspector observations, port related facilities, and records including photographs taken (see Appendix 1), verbal or written statements made during or after the on-site inspection, and/or materials shown, demonstrated, or submitted to the Environmental Protection Agency (EPA) during or after the on-site inspection. In addition, information gathered prior to or after the inspection from a review of EPA, State, and public records may be included in this report.

Attendees

Title/Organization	Name	Email	Opening Conf.	Closing Conf.
Lead Inspector/ Contractor/ERG	Vince Damiano	Vince.Damiano@erg.com	Yes	Yes
Inspector/Enforcement Officer/EPA Region 6	John Penland	Penland.John@epa.gov	Yes	Yes
Inspector/Enforcement Officer/EPA Region 6	Erin Young-Dahl	Youngdahl.Erin@epa.gov	Yes	Yes
RCRA Inspector/ Contractor/ERG	Janosh Wolters	Janosh.Wolters@erg.com	Yes	Yes
MARS/ Vice President	Kristi Caton	Kristi@marsrecyclers.com	Yes	Yes
MARS/ Corporate RSO	Greg Stephenson	Greg@marsrecyclers.com	Yes	Yes

Facility General Description

Tenant/Area	Inspection Date	Process Description	Area of Concern
Modern American Recycling Services Inc.	3/26/25	MARS decommissions oil field platforms and recycles the scrap metal. MARS does not operate under a MARPOL COA.	Yes

SECTION II – OBSERVATIONS

Facility: Modern American Recycling Services Inc.			
Section: 2.1	Date: 3/26/25, 08:30 AM	Contains AOC: Yes	Contains CBI: No
Lead Inspector: Vince Damiano	Attendees: Kristi Caton (Vice President) and Greg Stephenson (Corporate RSO)		
Modern American Recycling Services Inc (MARS) is located in Gibson, Louisiana, and operates as a scrap metal recycler for decommissioned offshore oil and gas platforms. The facility owns and operates supply vessels and barges that support the decommissioning and transportation of scrap metal structures. MARS also decontaminates naturally occurring radioactive material (NORM) piping brought back from offshore platforms. Decontamination is performed through a thermal heating and washing process, with the resulting solid waste managed as non-hazardous waste and sent to Sabine Environmental in Texas for disposal. Mr. Stephenson stated that MARS may collect used oil from machinery on the decommissioned platforms and transport it back to the facility for storage. He also indicated that discarded paint cans may be collected during the same operations. MARS is registered with the EPA as a Small Quantity Generator (SQG) of hazardous waste and a large quantity handler of universal waste under EPA ID LAR000027672. Following the opening conference, the inspection team conducted a visual inspection of the hazardous waste storage area, the universal waste yard and warehouse, and the used oil storage area. The inspection team first observed the hazardous waste storage area, which was storing 132 5-gallon containers, nine 1-gallon containers, and three 10-gallon containers of liquid waste. The containers ranged in capacity from ¼ full to full (see Appendix 1 – Photos 2 to 24). The contents of each container were not clear as none of the containers were labeled as hazardous waste, did not have an indication of the nature of the hazard, or an accumulation start date [AOC #1 – MARS did not clearly label containers as hazardous waste, indication of hazard, and accumulation start date - 40 CFR 262.16(b)(6)]. Some of the product labels or written labels on the containers indicated a mix of acids, corrosives, toxins, and flammable materials stored within the hazardous waste storage area, but it was unclear if these materials matched the labels on the containers; however, there was no berm or separations present in the hazardous waste storage area to separate incompatible wastes date [AOC #2 – MARS did not implement a means of separation between incompatible wastes - 40 CFR 262.16(b)(2)(v)(C)]. The inspection team also observed pallets storing paint-related materials with approximately 40 5-gallon containers, several 1-gallon containers, and several empty/dried paint containers (see Appendix 1 – Photos 24 to 37). These containers did not contain a hazardous waste label, an indication of the nature of the hazard, or an accumulation start date [see AOC #1]. Next, the inspection team observed eight full 55-gallon drums of paint-related materials. Six of which were labeled as hazardous waste and had an accumulation start date, but did not contain an indication of the hazard on the label (see Appendix 1 – Photos 1 and 38 to 49) [see AOC #1]. Four of the 55-gallon drums had an accumulation start date that were 8/06/2024, 9/24/2024, 9/25/2024, and 9/26/2024, exceeding the 180-day time limit for storage as an SQG			

(see Appendix 1 – Photos 39, 41, 47, and 49) [**AOC #3** – MARS accumulated hazardous waste for more than 180 days - 40 CFR 262.16(b)]. The inspection team noted that the hazardous waste storage area drains to a sump in the middle of the right side of the building, and the sump drains directly outside of the building onto the ground (see Appendix 1 – Photos 50 and 51). Mr. Stephenson stated weekly inspections of the central accumulation area are not completed weekly [**AOC #4** – MARS did not complete weekly inspections of the hazardous waste central accumulation area - 40 CFR 262.16(b)(2)(iv)]. Overview pictures, including signage indicating the Hazardous waste storage area, and views inside the area, can be seen in Photos 52 to 54.

Next, the inspection team observed the laydown yard for discarded marine batteries. Mr. Stephenson stated that most of these batteries have been accumulating here for longer than one year. The inspection team was unable to determine the exact number of discarded batteries observed in the laydown yard, but the batteries are scattered across approximately one-quarter of an acre, and many were damaged and broken open (see Appendix 1 – Photos 55 to 87, 119). For the batteries that are still intact, they were not labeled as universal waste batteries, and did not contain an accumulation start date [**AOC #4** – MARS did not label universal waste batteries (i.e., each battery), or a container in which the batteries are contained, with any one of the following phrases: “Universal Waste—Battery(ies),” or “Waste Battery(ies),” or “Used Battery(ies);” - 40 CFR 273.34(a)] and [**AOC #5** – MARS, a large quantity handler of universal waste, did not demonstrate the length of time that the universal waste has been accumulated from the date it becomes a waste or is received - 40 CFR 273.35(c)]. Given the state and amount of batteries observed on the yard, the inspection team noted to the facility representatives that it appears they are disposing of waste without permission and acting as a disposal facility per the definition outlined in 40 CFR 260.10.

Next, the inspection team entered the universal waste warehouse, where the inspection team observed approximately 25 pallets of universal waste batteries (see Appendix 1 – Photos 88 to 107, 110 to 112). The batteries observed were not labeled, and the facility was not able to demonstrate an accumulation start date at the time of the inspection [see **AOC #4** and **AOC #5**]. For the damaged batteries, Mr. Stephenson said they were filling them with expanding foam to prevent leakage (see Appendix 1 – Photo 92). However, the damaged batteries must be contained within a receptacle to prevent any leakage or spillage [**AOC #6** – MARS did not manage damaged universal waste lamps in a way that prevents spillage or leakage by using a closed, structurally sound container - 40 CFR 273.33(a)(1)]. On the shelves of the warehouse, the inspection team observed many (> 50) universal waste lamps, some of which were in open boxes, and some were left out across the warehouse (see Appendix 1 – Photos 107 to 110, 113 to 118). The universal waste lamps were unlabeled, did not display an accumulation start date, and were not stored in containers capable of containing any releases [**AOC #7** – MARS did not label universal waste lamps or a container in which the lamps are contained, with any one of the following phrases: “Universal Waste—Lamp(s),” or “Waste Lamp(s),” or “Used Lamp(s).” - 40 CFR 273.34(e)] and [**AOC #8** – MARS, a large quantity handler of universal waste, did not manage lamps in a way that prevents releases of any universal waste or component of a universal waste to the environment- 40 CFR 273.33(d)] and [see **AOC #5**].

The inspection team then observed the used oil storage area, where twenty 55-gallon drums were storing used oil, and used oil with rags/PPE was observed (see Appendix 1 – Photos 120 to 135). No drums displayed “Used Oil” labels at the time of the inspection [**AOC #9** – MARS did not clearly label containers used to store used oil with the words “Used Oil” - 40 CFR 279.22(c)(1)]. Next to the used oil storage area, the inspection team observed a pallet containing six half-full 5-gallon containers of sulfamic acid (see Appendix 1 – Photos 136 to 138). Mr. Stephenson stated that these are considered waste and are to be brought to the hazardous waste storage area. However, they were not labeled as such [see **AOC #1**]. One of the 5-gallon containers of sulfamic acid was open, pictured on the upper right in Photo 136 [**AOC #10** – MARS was storing hazardous

waste in a container that was not closed - 40 CFR 262.16(b)(2)(iii)(A)].

The inspection team did not observe other areas of concern (AOCs) at the time of the inspection. However, further EPA review may change or add to their potential AOCs. A closing conference was conducted at approximately 11:40 AM with MARS personnel. The AOCs were communicated during the closing. Following the inspection on 4/11/2025, Mr. Tony Authement sent a follow-up email in response to the AOCs observed during the inspection including:

- A response letter indicating the steps taken to address the AOCs observed during the inspection (Appendix 2)
- Photos of the hazardous waste storage area and labels on the 55-gallon drums of paint-related material (Appendix 3)
- Photos of universal waste battery labels on eight of the pallets inside of the universal waste warehouse (Appendix 4)
- Photos of used oil containers labeled (Appendix 5).
- Manifests from a hazardous waste shipment in March of 2024 and a CAA weekly inspection example (Appendix 6)

SECTION III – RECORDS REVIEW

No RCRA-regulated records were reviewed during this focused onsite inspection.

SECTION IV – AREAS OF CONCERN

The presentation of Area(s) of Concern does not constitute a formal compliance determination or violation.

Facility: Modern American Recycling Services Inc.		
AOC #1 – MARS did not clearly label containers as hazardous waste, indication of hazard, and accumulation start date.	Citation: 40 CFR 262.16(b)(6)	Section: 2.1
AOC #2 – MARS did not implement a means of separation between incompatible wastes	Citation: 40 CFR 262.16(b)(2)(v)(C)	Section: 2.1
AOC #3 – MARS accumulated hazardous waste for more than 180 days.	Citation: 40 CFR 262.16(b)	Section: 2.1
AOC #4 – MARS did not label universal waste batteries (i.e., each battery), or a container in which the batteries are contained, with any one of the following phrases: “Universal Waste—Battery(ies),” or “Waste Battery(ies),” or “Used Battery(ies).”	Citation: 40 CFR 273.34(a)	Section: 2.1
AOC #5 – MARS, a large quantity handler of universal waste, did not demonstrate the length of time that the universal waste has been accumulated from the date it becomes a waste or is received.	Citation: 40 CFR 273.35(c)	Section: 2.1

AOC #6 – MARS did not manage damaged universal waste lamps in a way that prevents spillage or leakage by using a closed, structurally sound container.	Citation: 40 CFR 273.33(a)(1)	Section: 2.1
AOC #7 – MARS did not label universal waste lamps or a container in which the lamps are contained, with any one of the following phrases: “Universal Waste—Lamp(s),” or “Waste Lamp(s),” or “Used Lamp(s).”	Citation: 40 CFR 273.34(e)	Section: 2.1
AOC #8 – MARS, a large quantity handler of universal waste, did not manage lamps in a way that prevents releases of any universal waste or component of a universal waste to the environment.	Citation: 40 CFR 273.33(d)	Section: 2.1
AOC #9 – MARS did not clearly label containers used to store used oil with the words “Used Oil”	Citation: 40 CFR 279.22(c)(1)	Section: 2.1
AOC #10 – MARS was storing hazardous waste in a container that was not closed.	Citation: 40 CFR 262.16(b)(2)(iii)(A)	Section: 2.1

SECTION V – FOLLOW UP

Any facility follow-up items are as discussed in the observations in Section II. Documents or files provided by the facility were transmitted via email and included responses to AOCs or provision of documents requested.

Communication Log

During and after the inspection, additional information was emailed to EPA including:

1. 4/11/25 MARS email – Mr. Tony Authement provided the inspection team with photos of attempted corrections made towards AOCs observed and requested documentation from the inspection team.

SECTION VI – LIST OF APPENDICES

Appendix 1. Photograph Log

Appendix 2. MARS Response Letter 4/11/2025

Appendix 3. Photos of the Hazardous Waste Area 4/11/2025

Appendix 4. Photos of the Universal Waste Batteries 4/11/2025

Appendix 5. Photos of the Used Oil Storage Area 4/11/2025

Appendix 6. 2024 Hazardous Waste Manifest and CAA Inspection Example

APPENDIX 1.
PHOTOGRAPH LOG



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 1

Photo File Name: DSCN7751

Date of Photo: 03/26/2025

Time of Photo: 09:34 hrs.

Photographer: Vince Damiano

Description: Two full 55-gallon drums containing paint-related materials inside the hazardous waste storage area that were not labeled.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 2

Photo File Name: DSCN7752

Date of Photo: 03/26/2025

Time of Photo: 09:35 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing four 1-gallon containers and six 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 3

Photo File Name: DSCN7753

Date of Photo: 03/26/2025

Time of Photo: 09:35 hrs.

Photographer: Vince Damiano

Description: Another view of the pallet containing four 1-gallon containers and six 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 4

Photo File Name: DSCN7754

Date of Photo: 03/26/2025

Time of Photo: 09:35 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 1-gallon containers and 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 5

Photo File Name: DSCN7755

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 1-gallon containers and 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 6

Photo File Name: DSCN7756

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of product label on one of the 1-gallon containers with "Sodium Metabisulphite" next to another 1-gallon container with the words "Battery Acid."



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 7

Photo File Name: DSCN7757

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing three 10-gallon containers and four 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 8

Photo File Name: DSCN7758

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing three 10-gallon containers and four 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 9

Photo File Name: DSCN7759

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing nine 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 10

Photo File Name: DSCN7760

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing twelve 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 11

Photo File Name: DSCN7761

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: Overview of the older tank farm found in the back of the facility in which there was no secondary containment system.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 12

Photo File Name: DSCN7762

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 13

Photo File Name: DSCN7763

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 14

Photo File Name: DSCN7764

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing fourteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 15

Photo File Name: DSCN7765

Date of Photo: 03/26/2025

Time of Photo: 09:36 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing fourteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 16

Photo File Name: DSCN7766

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing ten 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 17

Photo File Name: DSCN7767

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing ten 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 18

Photo File Name: DSCN7768

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing approximately fourteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 19

Photo File Name: DSCN7769

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing approximately fourteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 20

Photo File Name: DSCN7770

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing thirteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 21

Photo File Name: DSCN7771

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing thirteen 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 22

Photo File Name: DSCN7772

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 23

Photo File Name: DSCN7773

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers of undetermined liquid waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 24

Photo File Name: DSCN7774

Date of Photo: 03/26/2025

Time of Photo: 09:37 hrs.

Photographer: Vince Damiano

Description: Overview of the containerized waste inside the waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 25

Photo File Name: DSCN7775

Date of Photo: 03/26/2025

Time of Photo: 09:38 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 26

Photo File Name: DSCN7776

Date of Photo: 03/26/2025

Time of Photo: 09:38 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 27

Photo File Name: DSCN7777

Date of Photo: 03/26/2025

Time of Photo: 09:38 hrs.

Photographer: Vince Damiano

Description: View of an empty dried 1-gallon paint can inside of the hazardous waste storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 28

Photo File Name: DSCN7778

Date of Photo: 03/26/2025

Time of Photo: 09:38 hrs.

Photographer: Vince Damiano

Description: Another view of an empty dried 1-gallon paint can inside of the hazardous waste storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 29

Photo File Name: DSCN7779

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 30

Photo File Name: DSCN7780

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area..



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 31

Photo File Name: DSCN7781

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 32

Photo File Name: DSCN7782

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 33

Photo File Name: DSCN7783

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 34

Photo File Name: DSCN7784

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: View of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 35

Photo File Name: DSCN7785

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 36

Photo File Name: DSCN7786

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 37

Photo File Name: DSCN7787

Date of Photo: 03/26/2025

Time of Photo: 09:39 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet containing 5-gallon containers and 1-gallon containers of paint-related waste inside the hazardous waste accumulation area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 38

Photo File Name: DSCN7788

Date of Photo: 03/26/2025

Time of Photo: 09:40 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/25/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 39

Photo File Name: DSCN7789

Date of Photo: 03/26/2025

Time of Photo: 09:40 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/25/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 40

Photo File Name: DSCN7790

Date of Photo: 03/26/2025

Time of Photo: 09:40 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/26/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana

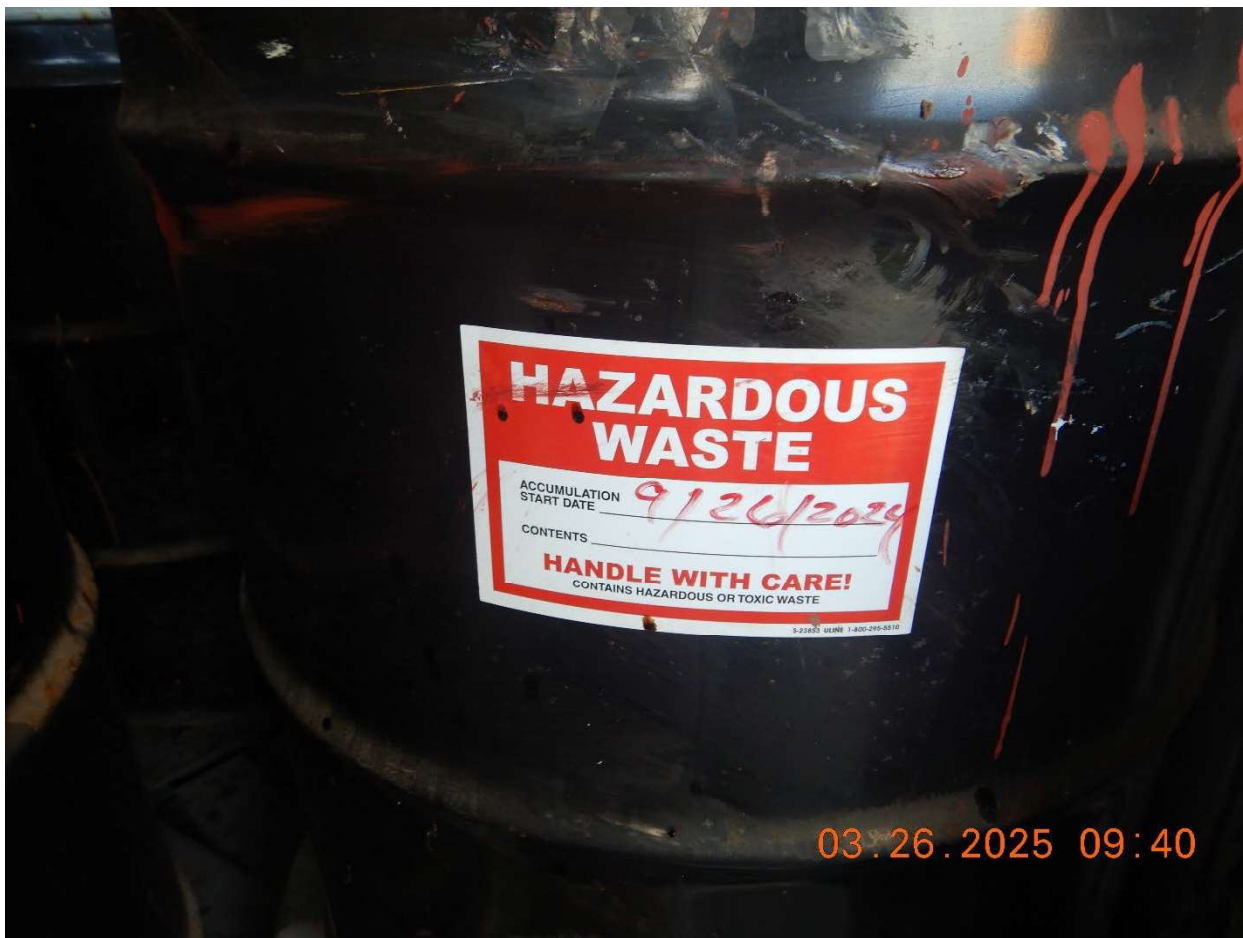


Photo No. 41

Photo File Name: DSCN7791

Date of Photo: 03/26/2025

Time of Photo: 09:40 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/26/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 42

Photo File Name: DSCN7792

Date of Photo: 03/26/2025

Time of Photo: 09:40 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 10/21/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 43

Photo File Name: DSCN7793

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 10/21/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 44

Photo File Name: DSCN7794

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 12/9/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 45

Photo File Name: DSCN7795

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 12/9/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 46

Photo File Name: DSCN7796

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/24/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 47

Photo File Name: DSCN7797

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 9/24/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 48

Photo File Name: DSCN7798

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 8/6/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 49

Photo File Name: DSCN7799

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of the label of a full 55-gallon drum inside the hazardous waste storage area with an accumulation start date of 8/6/2024.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 50

Photo File Name: DSCN7800

Date of Photo: 03/26/2025

Time of Photo: 09:41 hrs.

Photographer: Vince Damiano

Description: View of where the hazardous storage area drains to.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 51

Photo File Name: DSCN7801

Date of Photo: 03/26/2025

Time of Photo: 09:42 hrs.

Photographer: Vince Damiano

Description: View of where the drain inside the hazardous accumulation area leads to outside of the building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 52

Photo File Name: DSCN7802

Date of Photo: 03/26/2025

Time of Photo: 09:43 hrs.

Photographer: Vince Damiano

Description: View of hazardous waste storage sign.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 53

Photo File Name: DSCN7803

Date of Photo: 03/26/2025

Time of Photo: 09:43 hrs.

Photographer: Vince Damiano

Description: Overview of the hazardous waste storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 54

Photo File Name: DSCN7804

Date of Photo: 03/26/2025

Time of Photo: 09:43 hrs.

Photographer: Vince Damiano

Description: Overview of the hazardous waste storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 55

Photo File Name: DSCN7805

Date of Photo: 03/26/2025

Time of Photo: 09:48 hrs.

Photographer: Vince Damiano

Description: View of a discarded battery found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 56

Photo File Name: DSCN7806

Date of Photo: 03/26/2025

Time of Photo: 09:48 hrs.

Photographer: Vince Damiano

Description: View of a discarded battery found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 57

Photo File Name: DSCN7807

Date of Photo: 03/26/2025

Time of Photo: 09:48 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 58

Photo File Name: DSCN7808

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 59

Photo File Name: DSCN7809

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 60

Photo File Name: DSCN7810

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 61

Photo File Name: DSCN7811

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana

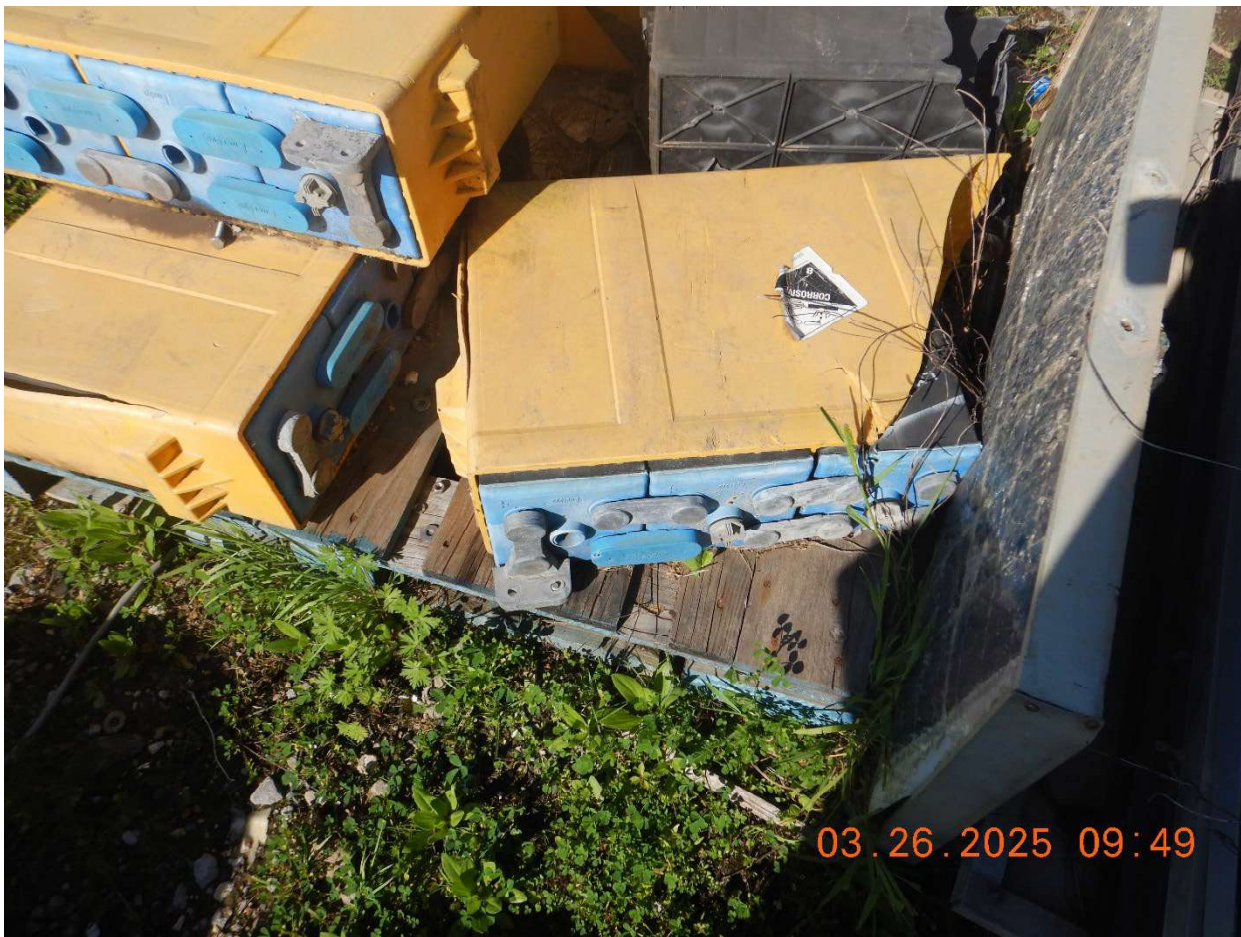


Photo No. 62

Photo File Name: DSCN7812

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 63

Photo File Name: DSCN7813

Date of Photo: 03/26/2025

Time of Photo: 09:49 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 64

Photo File Name: DSCN7814

Date of Photo: 03/26/2025

Time of Photo: 09:50 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 65

Photo File Name: DSCN7815

Date of Photo: 03/26/2025

Time of Photo: 09:50 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 66

Photo File Name: DSCN7816

Date of Photo: 03/26/2025

Time of Photo: 09:50 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 67

Photo File Name: DSCN7817

Date of Photo: 03/26/2025

Time of Photo: 09:51 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 68

Photo File Name: DSCN7818

Date of Photo: 03/26/2025

Time of Photo: 09:51 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 69

Photo File Name: DSCN7819

Date of Photo: 03/26/2025

Time of Photo: 09:51 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 70

Photo File Name: DSCN7820

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 71

Photo File Name: DSCN7821

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 72

Photo File Name: DSCN7822

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 73

Photo File Name: DSCN7823

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 74

Photo File Name: DSCN7824

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 75

Photo File Name: DSCN7825

Date of Photo: 03/26/2025

Time of Photo: 09:52 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 76

Photo File Name: DSCN7826

Date of Photo: 03/26/2025

Time of Photo: 09:53 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 77

Photo File Name: DSCN7827

Date of Photo: 03/26/2025

Time of Photo: 09:53 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 78

Photo File Name: DSCN7828

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 79

Photo File Name: DSCN7829

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 80

Photo File Name: DSCN7830

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 81

Photo File Name: DSCN7831

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 82

Photo File Name: DSCN7832

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 83

Photo File Name: DSCN7833

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 84

Photo File Name: DSCN7834

Date of Photo: 03/26/2025

Time of Photo: 09:54 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 85

Photo File Name: DSCN7835

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 86

Photo File Name: DSCN7836

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 87

Photo File Name: DSCN7837

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside the universal waste warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 88

Photo File Name: DSCN7838

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Two of the batteries on this pallet have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 89

Photo File Name: DSCN7839

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Two of the batteries on this pallet have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 90

Photo File Name: DSCN7840

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 91

Photo File Name: DSCN7841

Date of Photo: 03/26/2025

Time of Photo: 09:55 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Some of the batteries on this pallet have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 92

Photo File Name: DSCN7842

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Some of the batteries on this pallet have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 93

Photo File Name: DSCN7843

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 94

Photo File Name: DSCN7844

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: View of several pallets of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 95

Photo File Name: DSCN7845

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: Another view of pallets of unlabeled, non-dated universal waste batteries inside the universal storage building. Some of the batteries on this pallet have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 96

Photo File Name: DSCN7846

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: View of a pallet of damaged, unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 97

Photo File Name: DSCN7847

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: Another view of pallets of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 98

Photo File Name: DSCN7848

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: View of a pallet of damaged, unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 99

Photo File Name: DSCN7849

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet of damaged, unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 100

Photo File Name: DSCN7850

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: View of several pallets of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 101

Photo File Name: DSCN7851

Date of Photo: 03/26/2025

Time of Photo: 09:56 hrs.

Photographer: Vince Damiano

Description: Another view of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Some of the batteries have been damaged.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 102

Photo File Name: DSCN7852

Date of Photo: 03/26/2025

Time of Photo: 09:57 hrs.

Photographer: Vince Damiano

Description: An overview of the universal waste battery accumulation inside of the warehouse.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 103

Photo File Name: DSCN7853

Date of Photo: 03/26/2025

Time of Photo: 09:57 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 104

Photo File Name: DSCN7854

Date of Photo: 03/26/2025

Time of Photo: 09:57hrs.

Photographer: Vince Damiano

Description: View of a damaged, unlabeled, non-dated universal waste battery inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 105

Photo File Name: DSCN7855

Date of Photo: 03/26/2025

Time of Photo: 09:58 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 106

Photo File Name: DSCN7856

Date of Photo: 03/26/2025

Time of Photo: 09:58 hrs.

Photographer: Vince Damiano

Description: View of a pallet of electronic waste inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 107

Photo File Name: DSCN7857

Date of Photo: 03/26/2025

Time of Photo: 09:59 hrs.

Photographer: Vince Damiano

Description: View of a pallet of unlabeled, non-dated universal waste batteries inside the universal storage building. Universal waste lamps, which are not in a container, unlabeled, and non-dated, are on top.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 108

Photo File Name: DSCN7858

Date of Photo: 03/26/2025

Time of Photo: 09:59 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 109

Photo File Name: DSCN7859

Date of Photo: 03/26/2025

Time of Photo: 10:00 hrs.

Photographer: Vince Damiano

Description: Another view of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 110

Photo File Name: DSCN7860

Date of Photo: 03/26/2025

Time of Photo: 10:00 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 111

Photo File Name: DSCN7861

Date of Photo: 03/26/2025

Time of Photo: 10:00 hrs.

Photographer: Vince Damiano

Description: View of a pallet of non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 112

Photo File Name: DSCN7862

Date of Photo: 03/26/2025

Time of Photo: 10:00 hrs.

Photographer: Vince Damiano

Description: View of two pallets of unlabeled, non-dated universal waste batteries inside the universal storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 113

Photo File Name: DSCN7863

Date of Photo: 03/26/2025

Time of Photo: 10:02 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 114

Photo File Name: DSCN7864

Date of Photo: 03/26/2025

Time of Photo: 10:02 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 115

Photo File Name: DSCN7865

Date of Photo: 03/26/2025

Time of Photo: 10:03 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 116

Photo File Name: DSCN7866

Date of Photo: 03/26/2025

Time of Photo: 10:03 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 117

Photo File Name: DSCN7867

Date of Photo: 03/26/2025

Time of Photo: 10:03 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 118

Photo File Name: DSCN7868

Date of Photo: 03/26/2025

Time of Photo: 10:03 hrs.

Photographer: Vince Damiano

Description: View of universal waste lamps, which are not in a closed container, unlabeled, and non-dated, observed in the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 119

Photo File Name: DSCN7869

Date of Photo: 03/26/2025

Time of Photo: 10:10 hrs.

Photographer: Vince Damiano

Description: View of discarded batteries found outside of the universal waste storage building.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 120

Photo File Name: DSCN7870

Date of Photo: 03/26/2025

Time of Photo: 10:11 hrs.

Photographer: Vince Damiano

Description: View a full 55-gallon drum of used oil that was not labeled, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 121

Photo File Name: DSCN7871

Date of Photo: 03/26/2025

Time of Photo: 10:13 hrs.

Photographer: Vince Damiano

Description: View a half-full 55-gallon drum of used oil and PPE that was not labeled, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 122

Photo File Name: DSCN7872

Date of Photo: 03/26/2025

Time of Photo: 10:13 hrs.

Photographer: Vince Damiano

Description: Another view a half-full 55-gallon drum of used oil and PPE that was not labeled, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 123

Photo File Name: DSCN7873

Date of Photo: 03/26/2025

Time of Photo: 10:14 hrs.

Photographer: Vince Damiano

Description: View a half-full 55-gallon drum of used oil and PPE that was not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 124

Photo File Name: DSCN7874

Date of Photo: 03/26/2025

Time of Photo: 10:14 hrs.

Photographer: Vince Damiano

Description: View of the non-hazardous waste label of the drum seen in Photo No. 123.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 125

Photo File Name: DSCN7875

Date of Photo: 03/26/2025

Time of Photo: 10:14 hrs.

Photographer: Vince Damiano

Description: View two half-full 55-gallon drums of used oil and PPE that were not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 126

Photo File Name: DSCN7876

Date of Photo: 03/26/2025

Time of Photo: 10:15 hrs.

Photographer: Vince Damiano

Description: View of signs of damage on one of the 55-gallon drums seen in Photo No. 125.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 127

Photo File Name: DSCN7877

Date of Photo: 03/26/2025

Time of Photo: 10:15 hrs.

Photographer: Vince Damiano

Description: View two full 55-gallon drums of used oil and PPE that were not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana



Photo No. 128

Photo File Name: DSCN7878

Date of Photo: 03/26/2025

Time of Photo: 10:15 hrs.

Photographer: Vince Damiano

Description: View three full 55-gallon drums of used oil and PPE that were not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 129

Photo File Name: DSCN7879

Date of Photo: 03/26/2025

Time of Photo: 10:15 hrs.

Photographer: Vince Damiano

Description: View seven full 55-gallon drums of used oil and PPE that were not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 130

Photo File Name: DSCN7880

Date of Photo: 03/26/2025

Time of Photo: 10:15 hrs.

Photographer: Vince Damiano

Description: Another view seven full 55-gallon drums of used oil and PPE that were not labeled as used oil, found in the used oil storage area..



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 131

Photo File Name: DSCN7881

Date of Photo: 03/26/2025

Time of Photo: 10:16 hrs.

Photographer: Vince Damiano

Description: View two full 55-gallon drums of used oil that were not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 132

Photo File Name: DSCN7882

Date of Photo: 03/26/2025

Time of Photo: 10:17 hrs.

Photographer: Vince Damiano

Description: View of a half-full 55-gallon drum of used oil and PPE that was not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 133

Photo File Name: DSCN7883

Date of Photo: 03/26/2025

Time of Photo: 10:17 hrs.

Photographer: Vince Damiano

Description: Another view of a half-full 55-gallon drum of used oil and PPE that was not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 134

Photo File Name: DSCN7884

Date of Photo: 03/26/2025

Time of Photo: 10:17 hrs.

Photographer: Vince Damiano

Description: View of a half-full 55-gallon drum of used oil and PPE that was not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 135

Photo File Name: DSCN7885

Date of Photo: 03/26/2025

Time of Photo: 10:17 hrs.

Photographer: Vince Damiano

Description: Another view of a half-full 55-gallon drum of used oil and PPE that was not labeled as used oil, found in the used oil storage area.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 136

Photo File Name: DSCN7886

Date of Photo: 03/26/2025

Time of Photo: 10:19 hrs.

Photographer: Vince Damiano

Description: View of six half-full 5-gallon containers of sulfamic acid, determined to be a waste found in the used oil storage area. The containers were not labeled or managed as hazardous waste. The top right container is not closed.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.		
City: Gibson	County/Parish: St. Mary	State: Louisiana



Photo No. 137

Photo File Name: DSCN7887

Date of Photo: 03/26/2025

Time of Photo: 10:19 hrs.

Photographer: Vince Damiano

Description: View of the product label on the sulfamic acid containers found in Photo No. 136.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Location: Modern American Recycling Inc.

City: Gibson

County/Parish: St. Mary

State: Louisiana

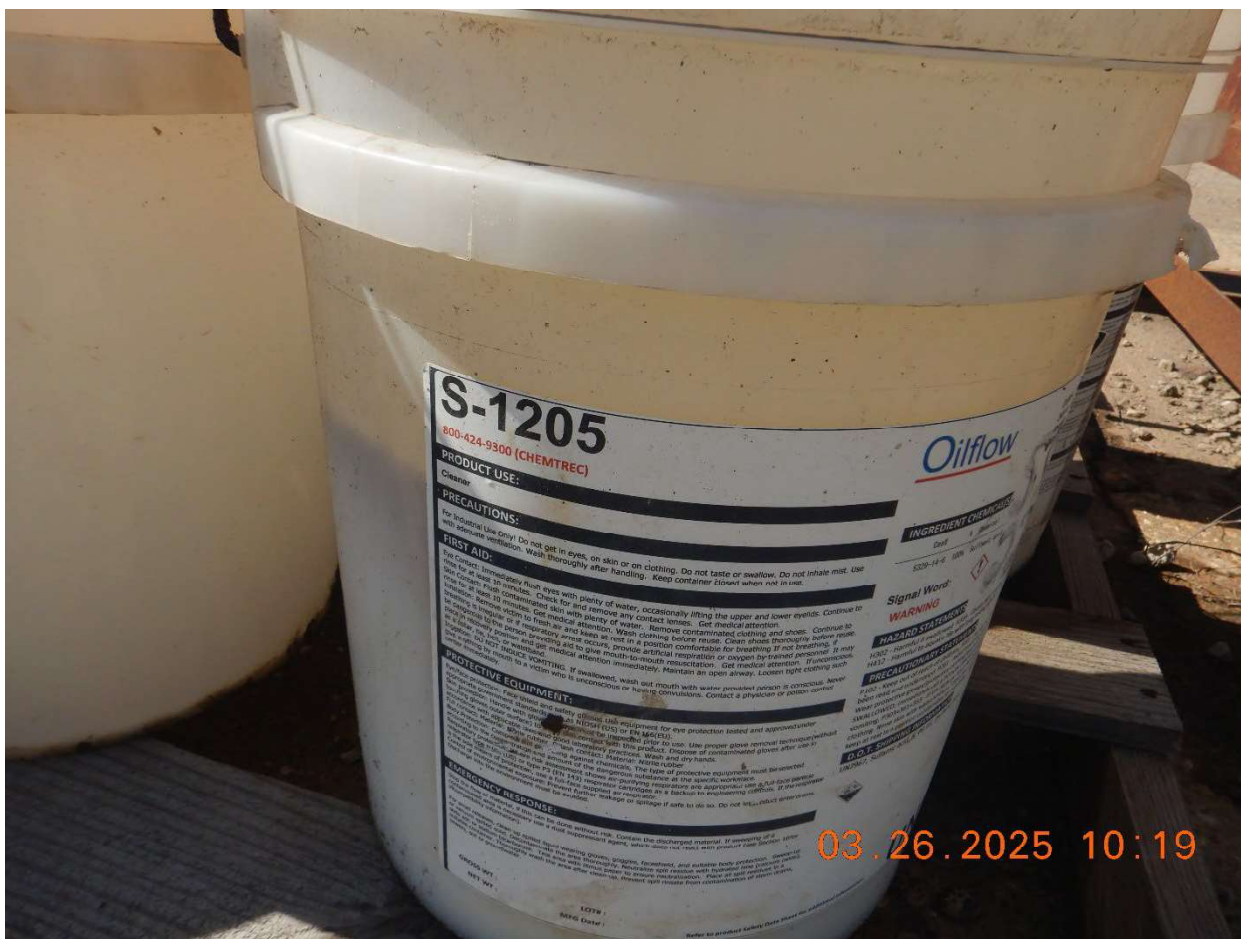


Photo No. 138

Photo File Name: DSCN7888

Date of Photo: 03/26/2025

Time of Photo: 10:19 hrs.

Photographer: Vince Damiano

Description: View of the product label on the sulfamic acid containers found in Photo No. 136.

APPENDIX 2. MARS RESPONSE LETTER 4/11/2025

Mr Damiano

In response to the list of items on the inspection at our facility on March 26, 2025 please find the following.

In the waste area we have addressed the items noted. Drums have been labeled with the correct identification label showing start date and the product inside. The pictures show the 27 drums are on pallets, shrink wrapped ready for shipment. The drums have sorbent pads, oil boom, oil filters and grease. We are waiting for information for a ship date from recycler.

In the waste area we also have 3-550 gallon and 9-350 gallon stainless steel totes. They have been properly labeled as used oil- non hazardous waste with the start date.

The attached pictures show these containers which are also ready for the recycler to suck out and transport to their facility.

In the waste area we also have 6-350 gallon and 6-550 gallon stainless steel totes that are non hazardous E&P waste. These are also labeled and dated and will be prepared for shipment to the disposal facility. The E&P totes also label the generator, the field code and the OCS-G code as per the attached pictures.

The waste area also has 11- 550 gallon totes of coolant that is labeled and dated as per attached pictures.

The waste storage building has 8 drums of paint that are labeled with the Hazardous Waste and flammable stickers and they are dated. We are waiting for ship date from Clean Harbor on this product.

In this storage building we have 15 pallets of various 5 gallon containers with some with names and others that have to be identified. We are lining up Waste Management to send a representative to come to the facility to identify and profile this waste in order to ship it out. In March of 2024 we did the same process with waste management and shipped out a large number of container both hazardous and non-hazardous waste.

Attached is the manifest for the shipment. That is the only hazardous waste that was shipped in 2024 . Also attached is the e mail from Michael Eibt with Waste Management to begin this process.

In the large blue ware house we currently have 8 pallets of lead acid batteries that are properly labeled with universal waste sticker and dated with start dates. They are shrink wrapped, weighed ready for shipment. We are continuing to accumulate batteries to get enough for a full load shipment. Pictures are attached. Damaged batteries are being placed in drums and labeled as hazardous waste with dates.

Lamps that were noted are being put in lamp boxes, labeled and dated. These will be put on the shelf in the ware house to accumulate for shipment.

The batteries that were outside of the ware house are being counted and itemized by type. We are currently working with a firm out of Maryland to recycle these batteries that are in racks and each individual battery is in a metal sleeve. Our current battery recycler will not accept these in the metal sleeves. The company in Maryland will accept them as long as they are lead acid batteries. We tried to remove them from the metal sleeves but were not too successful. A further update will be given once we conclude arrangements.


The other items that were noted is a no smoking sign in the waste storage along with a fire extinguisher which is completed as per the pictures.

A copy of the weekly inspection form that will be used is attached for review.

APPENDIX 3. PHOTOS OF THE HAZARDOUS WASTE AREA 4/11/2025





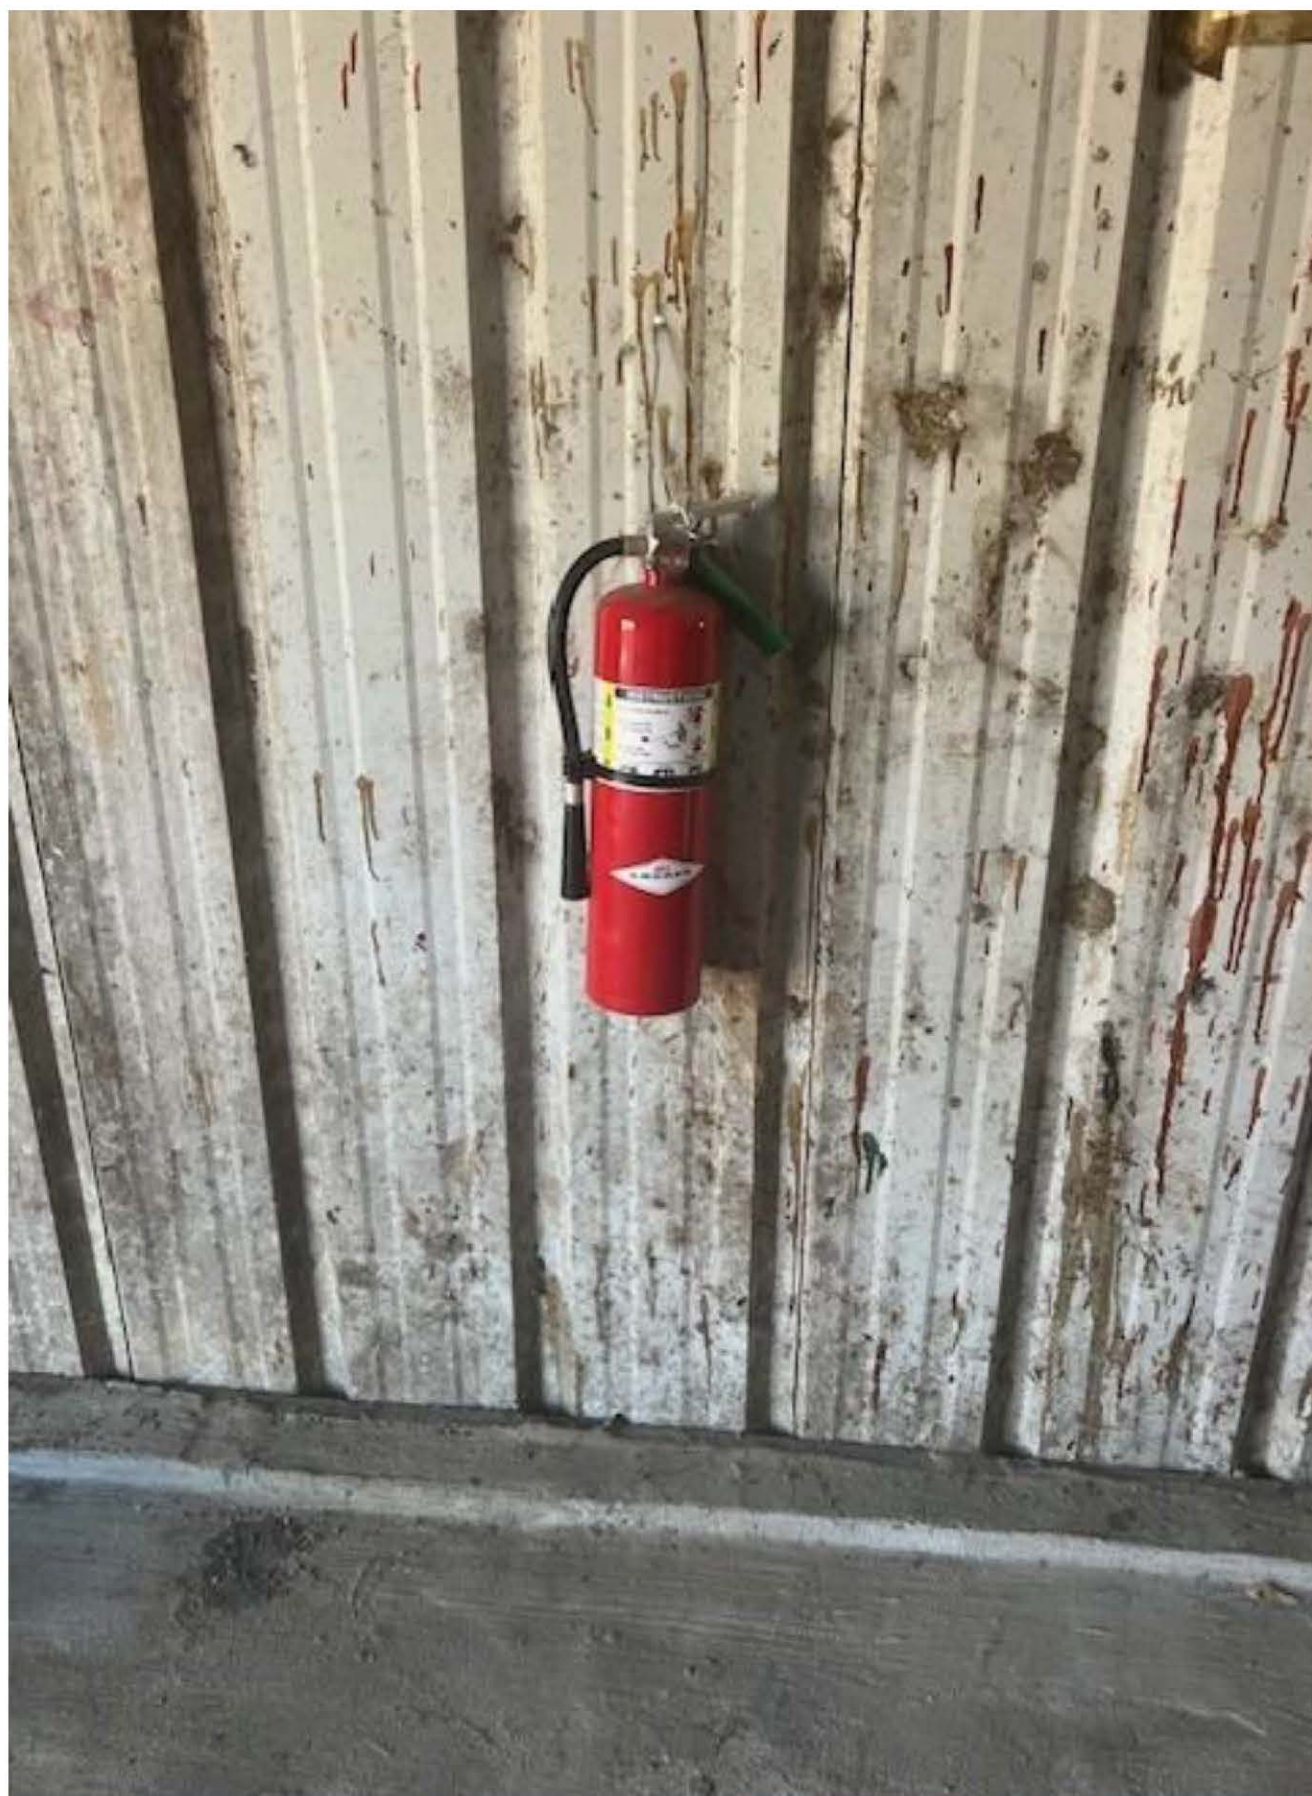



WASTE STORAGE

Hazardous Waste

Universal Waste

Non Regulated Waste

Authorized Entry Only

DANGER

**NO SMOKING
BEYOND
THIS POINT**

APPENDIX 4. PHOTOS OF THE UNIVERSAL WASTE BATTERIES 4/11/2025



UNIVERSAL WASTE

CONTENTS	Batteries
WT:	1750
ACCUMULATION START DATE	2-23-25
SHIPPER	M.A.R.S.
ADDRESS	499 Powhatten CT
CITY, STATE, ZIP	Gibson LA 7019

UNIVERSAL WASTE



UNIVERSAL WASTE

CONTENTS Batteries
WT: 1750
ACCUMULATION START DATE 2-03-05
SHIPPER M.A.R.S.
ADDRESS 499 Powhattan CT
CITY, STATE, ZIP Gibson LA 70367

UNIVERSAL WASTE

8-13829 ULINE 1-800-295-5510





APPENDIX 5. PHOTOS OF THE USED OIL STORAGE AREA 4/11/2025











APPENDIX 6. 2024 HAZARDOUS WASTE MANIFEST AND CAA INSPECTION EXAMPLE

EV-107-3435380
IN-107-1149800

NON-HAZARDOUS WASTE MANIFEST		1. Generator ID Number	2. Page 1 of	3. Emergency Response Phone	4. Waste Tracking Number
5. Generator's Name and Mailing Address		Generator's Site Address (if different than mailing address)			
Generator's Phone:		U.S. EPA ID Number			
6. Transporter 1 Company Name		U.S. EPA ID Number			
7. Transporter 2 Company Name		U.S. EPA ID Number			
8. Designated Facility Name and Site Address		U.S. EPA ID Number			
Facility's Phone:					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1.					
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information					
14. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations.					
Generator's/Offeror's Printed/Typed Name		Signature		Month	Day Year
Anthony Authement		[Signature]		3	28 24
15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit: Date leaving U.S.:					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name		Signature		Month	Day Year
Monica Trestethwaite		[Signature]		3	28 24
Transporter 2 Printed/Typed Name		Signature		Month	Day Year
17. Discrepancy					
17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection					
17b. Alternate Facility (or Generator) Manifest Reference Number: U.S. EPA ID Number					
Facility's Phone:					
17c. Signature of Alternate Facility (or Generator) Month Day Year					
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a					
Printed/Typed Name		Signature		Month	Day Year
Cynthia Pratt		[Signature]		5	17 24

Order #: 576453-03 (E)

Rec # 3853

NON-HAZARDOUS WASTE MANIFEST		1. Generator ID Number LA9001	2. Page 1 of 1	3. Emergency Response Phone 201-479-1807	4. Waste Tracking Number 076240001-2
5. Generator's Name and Mailing Address Greer Enterprises, LLC 499 Pritchard Ct. Gibson, LA 70356 501-246-9710		Generator's Site Address (if different than mailing address) Gibson, LA 70356			
6. Transporter 1 Company Name Greer Enterprises, LLC		U.S. EPA ID Number ALR000046581			
7. Transporter 2 Company Name EcoFlo, Inc.		U.S. EPA ID Number NCD980842132			
8. Designated Facility Name and Site Address 2750 Patterson Street Greensboro, NC 27407 800-899-6510		U.S. EPA ID Number NCD980842132			
Facility's Phone:					
9. Waste Shipping Name and Description		10. Containers No. Type	11. Total Quantity	12. Unit Wt./Vol.	
1. UN2922, CORROSIVE LIQUID, TOXIC, N.O.S. (GLUTARALDEHYDE), 8 (6.1), PG III, ERG 154		1 DM	55	U	
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information Df: 4260N-LP-61; Toxic Organic LP 7(f) DM 55 G Emergency Contact: Greer Enterprises, LLC Df to Greer Enterprises, LLC Project # 576453-0001					
14. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. Generator's/Officer's Printed/Typed Name: Anthony P. Rathement Signature: [Signature] Month Day Year: 13/08/24					
15. International Shipments: ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit: Date leaving U.S.:					
16. Transporter Acknowledgment of Receipt of Materials Transporter 1 Printed/Typed Name: [Signature] Transporter 2 Printed/Typed Name: Dusty Raybon Signature: [Signature] Month Day Year: 14/15/24					
17. Discrepancy 17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection Manifest Reference Number: U.S. EPA ID Number:					
17b. Alternate Facility (or Generator) Facility's Phone: Month Day Year:					
17c. Signature of Alternate Facility (or Generator) Month Day Year:					
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a Printed/Typed Name: Kimberly Shadrack Signature: [Signature] Month Day Year: 15/08/24					



VLS Mt. Pleasant, TN
101 South Park Drive
Mt. Pleasant, TN 38474

Certificate of Destruction

I certify that the following material received from MARS was handled by a method or methods approved by local, state, and federal regulations.

Shipping Document # -676240001-1

Invoice # -083656

VLS Approval # -AR28156

VLS Approval Description -NON-HAZARDOUS LOOSEPACK

Date Received -05/07/2024

Quantity Received -8.00 CYB

VLS Environmental Solutions

Order #: 578453-02 (E)

NON-HAZARDOUS WASTE MANIFEST	1. Generator ID Number LAVSQQ		2. Page 1 of 1	3. Emergency Response Phone 251-679-1967		4. Waste Tracking Number 676240001-1		
	5. Generator's Name and Mailing Address MAVMS 499 Ponderosa Ct. Greene, LA 70355 Generator's Phone: 501-246-9718				Generator's Site Address (if different than mailing address) 499 Ponderosa Ct. Greene, LA 70355			
	6. Transporter 1 Company Name Greene Enterprises, LLC				U.S. EPA ID Number ALR000046581			
	7. Transporter 2 Company Name				U.S. EPA ID Number			
	8. Designated Facility Name and Site Address MAVMS 107 South Park Drive Mossburn, LA 70355 Facility's Phone: 501-379-9663				U.S. EPA ID Number TND881920118			
	9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.		
			No.	Type				
	1. NONHAZAR / NONDOT REGULATED MATERIAL (NH LOOSEPACK)		8	CF	13477	EA		
	2.							
	3.							
4.								
13. Special Handling Instructions and Additional Information 01: (NH/HA) NH LOOSEPACK (5) CF 1 P Emergency Contact: Greene Enterprises, LLC 107 South Park Drive, Mossburn, LA 70355								
14. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations.								
Generator's/Officer's Printed/Typed Name Anthony Authement				Signature [Signature]		Month Day Year 10 12 21		
15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit: Date leaving U.S.:								
16. Transporter Acknowledgment of Receipt of Materials Transporter 1 Printed/Typed Name Greene Enterprises, LLC Signature [Signature] Month Day Year 10 12 21								
Transporter 2 Printed/Typed Name Signature Month Day Year								
17. Discrepancy								
17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection Manifest Reference Number: U.S. EPA ID Number								
17b. Alternate Facility (or Generator) Facility's Phone: U.S. EPA ID Number								
17c. Signature of Alternate Facility (or Generator) Month Day Year								
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a Printed/Typed Name Signature Month Day Year								

Please print or type.

Order #: 578453-01 (E)
Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator ID Number	2. Page 1 of	3. Emergency Response Phone	4. Manifest Tracking Number				
5. Generator's Name and Mailing Address		Generator's Site Address (if different than mailing address)							
MAERS 489 Providence Ct. Greenville, SC 29615 Generator's Phone: 754-479-1967		489 Providence Ct. Greenville, SC 29615 U.S. EPA ID Number: AL0900046584							
6. Transporter 1 Company Name		7. Transporter 2 Company Name		U.S. EPA ID Number					
Greer Enterprises, LLC		Greer Enterprises, LLC		U.S. EPA ID Number					
8. Designated Facility Name and Site Address		U.S. EPA ID Number							
Clean Earth of Alabama (Chancery) 402 Webster Chapel Rd Gadsden, AL 35905 Facility's Phone: 256-492-8340		State (abbr): AL- AL0901020894							
9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))		10. Containers		11. Total Quantity				
			No. Type		12. Unit Wt./Vol.				
	1. UN3265, WASTE CORROSIVE LIQUID, BASIC, INORGANIC, N.O.S. (SODIUM HYDROXIDE, SODIUM HYPOCHLORITE), 8, PG II, ERG 154		1		CF	1684	P	13. Waste Codes	
	2. RD, UN3264, WASTE CORROSIVE LIQUID, ACIDIC, INORGANIC, N.O.S. (HYDROCHLORIC ACID, PHOSPHORIC ACID), 8, PG II, ERG 154		1		CF	1684	P	D002	
	3. UN1993, WASTE FLAMMABLE LIQUIDS, N.O.S. (ISOPROPYL ALCOHOL, PETROLEUM DISTILLATES), 3, PG II, ERG 128		1		CF	1684	P	D001	
14. Special Handling Instructions and Additional Information*		15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.							
01: (2300035355) CLBI Loosepack (1) CF 1 Y 02: (2300035355) CLBI Loosepack (1) CF 1 Y Bill to Greer Enterprises, LLC Project # 678-24-0001		03: (2300035355) Flammable Liquids Loosepack (1) CF 1 Y 04: (2300035355) L/L 1 Y Emergency Contact: Greer Enterprises, LLC							
Generator's/Officer's Printed/Typed Name		Signature		Month Day Year					
Anthony Authentent		[Signature]		3/20/24					
16. International Shipments		17. Transporter Acknowledgment of Receipt of Materials		Port of entry/exit:					
☐ Import to U.S. ☐ Export from U.S.		Transporter signature (for exports only):		Date leaving U.S.:					
Transporter 1 Printed/Typed Name		Signature		Month Day Year					
Transporter 2 Printed/Typed Name		Signature		Month Day Year					
18. Discrepancy		18a. Discrepancy Indication Space							
		☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection							
18b. Alternate Facility (or Generator)		Manifest Reference Number: U.S. EPA ID Number							
Facility's Phone:		Month Day Year							
18c. Signature of Alternate Facility (or Generator)		Month Day Year							
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)		20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a							
1. 2. 3. 4.		Printed/Typed Name Signature Month Day Year							

Order #: 578453-03 (E)

NON-HAZARDOUS WASTE MANIFEST		1. Generator ID Number	2. Page 1 of	3. Emergency Response Phone	4. Waste Tracking Number
5. Generator's Name and Mailing Address Orb Enterprise LLC Cibola, LA 70305 Generator's Phone: 504-245-9710		Generator's Site Address (if different than mailing address) Cibola, LA 70305			
6. Transporter 1 Company Name Orb Enterprise LLC		U.S. EPA ID Number ALR000046581			
7. Transporter 2 Company Name		U.S. EPA ID Number			
8. Designated Facility Name and Site Address Orb Enterprise LLC 2050 Patterson Street Greensboro, NC 27407 Facility's Phone: 800-804-6510		U.S. EPA ID Number NCD980842132			
GENERATOR	9. Waste Shipping Name and Description		10. Containers		11. Total Quantity
			No.	Type	12. Unit Wt./Vol.
	1. LIN282, CORROSIVE LIQUID, TOXIC, N.O.S. (GUTTERAL DETRODE), 8 (6.1), PG III, ERG 154		1	DM	55 G
	2.				
	3.				
13. Special Handling Instructions and Additional Information DOT: 42000 (P-2, 54-61) Toxic, Organic L.P. (11) (B) (5) G Emergency Contact: Orb Enterprise, LLC DOB #: Orb Enterprise, LLC (Project # 17-24-001)					
14. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations.					
Generator's/Offeror's Printed/Typed Name: Anthony P. Harthement Signature: [Signature] Month: 13 Day: 28 Year: 2014					
TRANSPORTER	15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit: Date leaving U.S.:				
	16. Transporter Acknowledgment of Receipt of Materials Transporter Signature (for exports only): Transporter 1 Printed/Typed Name: [Signature] Signature: [Signature] Month: 12 Day: 28 Year: 2014 Transporter 2 Printed/Typed Name: Signature: Month: Day: Year:				
DESIGNATED FACILITY	17. Discrepancy 17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection Manifest Reference Number: U.S. EPA ID Number				
	17b. Alternate Facility (or Generator) Facility's Phone: U.S. EPA ID Number				
	17c. Signature of Alternate Facility (or Generator) Month: Day: Year:				
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a Printed/Typed Name: Signature: Month: Day: Year:					



GREER ENTERPRISES, LLC
Specializing in Waste Management & Recycling

Delivery Ticket

Ticket Number 676240001-001

Date of Delivery

<u>Customer</u> MARKS	<u>Customer #</u> 67624-0001	<u>Customer Contact</u> Jared Carr
<u>Customer Phone Number</u> 501-246-9719	<u>Delivery Address</u> 499 Rowhatten Ct, Gibson LA	<u>Customer PO#</u>

Item/Description	Quantity
Shrink wrap	1
Tape for CYB	4
Hazardous cubic yard boxes	5
Non-hazardous cubic yard boxes	10
Pallets	15
Open head metal drum, 55-gallon	1
Vermiculite No. 1 red	1

Anthony Authement
Print Customer Name
Signature / Date

Driver Signature 3/28/24
Date

**LAND DISPOSAL RESTRICTION NOTIFICATION FORM**

For Wastes Subject to the Treatment Standards Found in 40 CFR 268

Order: 578453-01 (E)

Generator Name: MARS

Manifest No: 025994834.JJK

WW	NWW	Approval #	EPA Waste Codes / Underlying Hazardous Constituents	LDR Code
☐	☒	2300035356	D002	E
☐	☒	2300035355	D002	E
☐	☒	2300035357	D001	E

**LDR
CODE****A. Restricted Waste Meets Treatment Standards (40 CFR 268.7(a) (3))**

The restricted waste identified above meets the treatment standards in 40 CFR 268.40 or Alternative LDR treatment standards for contaminated soil 40 CFR 268.49 and can be landfilled without further treatment. I have attached all supporting analytical data, where available. I certify under penalty of law that I personally have examined and am familiar with the waste through analysis and testing or through knowledge of the waste to support this certification that the waste complies with the treatment standards specified in 40 CFR Part 268 Subpart D. I believe that the information I submitted is true, accurate and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

B. Restricted Waste Treated To Treatment Standards (40 CFR 268.7(b) (1) and 268.7 (b) (2))

The treatment residue, or extract of such residue, or the restricted waste identified above has been tested to assure that the treatment residues or extract meet all applicable treatment standards in 40 CFR 268.40 and/or performance standards in 40 CFR 268.45. I have attached all supporting analytical data, where available. I certify under penalty of law that I personally have examined and am familiar with the waste through analysis and testing or through knowledge of the waste to support this certification that the waste complies with the treatment standards specified in 40 CFR Part 268 Subpart D. I believe that the information I submitted is true, accurate and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

C. Restricted Waste With Technology Based Treatment Standards (40 CFR 268.7(b) (4))

I certify under penalty of law that I personally have examined and am familiar with the treatment technology and operation of the treatment process used to support this certification and that based on my inquiry of those individuals immediately responsible for obtaining this information, I believe that the treatment process has been operated and maintained properly so as to comply with the treatment standards specified in 40 CFR 268.40, without impermissible dilution of the prohibited waste. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

D. Restricted Waste Decharacterized But Requires Treatment For UHC (40 CFR 268.9)

I certify under penalty of law that the waste has been treated in accordance with the requirements of 40 CFR 268.40 to remove the hazardous characteristic. This decharacterized waste contains Underlying Hazardous Constituents (UHC) that require further treatment to meet the universal treatment standards. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

E. Restricted Waste Subject To Treatment (40 CFR 268.7(a) (2))

The restricted waste identified above must be treated to the applicable treatment standards in 40 CFR 268.40, or treated to comply with applicable prohibitions set forth in Part 268.32 or RCRA Section 3004(d). I have attached all supporting analytical data, where available.

F. Hazardous Debris Subject To Treatment (40 CFR 268.45)

This hazardous debris identified above must be treated to the alternative treatment standards in 40 CFR 268.45.

G. Restricted Waste Subject To A Variance or Extension (40 CFR 268.7(a) (4))

This restricted waste identified above is subject to a case by case exemption under 40 CFR 268.5, an exemption under 40 CFR 268.6 or a nationwide capacity variance under Subpart C of 40 CFR 268, and is not prohibited from land disposal. LDR prohibitions become effective on _____ (date) for this restricted waste. The corresponding treatment standard(s) are promulgated in 40 CFR 268.40. I have attached all supporting analytical data, where available.

H. Restricted Waste Managed In A "Lab Pack" (40 CFR 268.7(a) (9))

I certify under penalty of law that I personally have examined and am familiar with the waste and that the lab pack contains only waste that have been excluded under appendix IV to 40 CFR Part 268 and that this lab pack will be sent to a combustion facility in compliance with the alternative treatment standards for lab packs at 40 CFR 268.42(c). I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

I certify and warrant that the information that appears on this form, and appended documents, is true and correct. I have correctly indicated how my waste is to be managed in accordance with 40 CFR 268. My certification is based on personal examination of the information submitted, or is based on my inquiries of those individuals responsible for obtaining the information.

Authorized Signature: _____

Title: _____

Date: _____

Weekly Hazardous Waste Inspection Checklist

Inspection Information

Container or area being inspected (number/contents/location):

Date and time:

Date last inspected:

Inspection completed by:

Hazardous Waste	Y / N	Corrective Action	Employee Responsible
Are containers properly and clearly labeled ("Hazardous Waste," the specific contents, and the collection date)?			
Are containers tightly closed?			
Are wastes stored in compatible containers?			
Is there evidence of container deterioration?			
Are spaces between containers clear of debris?			
Are incompatible wastes properly segregated?			
Are there any signs of leaks or spills?			
Is spill response equipment adequate and accessible?			
Does each container have adequate secondary containment for its volume?			
If required, is an eyewash station accessible and ready for use?			
Are "Hazardous Waste" signs in place and clearly visible?			
Is a fire extinguisher in place and clearly visible?			
Are all waste containers stored inside the waste storage area?			
Is the total volume of wastes stored below the facility's generator status?			