

Region 6 - Enforcement & Compliance Assurance Division

INSPECTION REPORT

Inspection Date(s):	12/10/2024	
Media Program:	Water (CWA)	
Regulatory Program(s)	Water (CWA) Brine Program (Oil & Gas inspection)	
Company Name:	Hanna Oil and Gas Company	
Facility Name:	Lincoln #1 Tank Battery	
Facility Physical Location:	In Van Buren from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442.	
(city, state, zip code)	Van Buren, AR, 72956	
Mailing address:	60 South 6th Street	
(city, state, zip code)	Fort Smith, AR 72901	
County/Parish:	Crawford County	
Facility Phone Number	479-782-8808	
Facility Contact:	William H. Hanna strick@hannaog.com	Person Responsible for Operation
FRS Number:	N/A	
Identification/Permit Number:	ARU002265	
Media Identifier Number:	N/A	
NAICS:	211111	
SIC:	1311	
Personnel participating in inspection:		
Kerri McCabe (lead)	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Michael Blaha	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Uma Lad	EPA / Region 6 ECDW	Inspector / Enforcement Officer
EPA Lead Inspector Signature/Date		
	Kerri McCabe	Date
Supervisor Signature/Date		
	Jeanne Eckhart	Date


Section I – INTRODUCTION

PURPOSE OF THE INSPECTION

EPA Region 6 inspectors Kerri McCabe (lead), Michael Blaha, and Uma Lad arrived at the Hanna Oil and Gas Company / Lincoln #1 Tank Battery, located from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442; at 1348 on 12/10/2024 for an unannounced inspection. No facility representatives were present at the time of the inspection. The inspection was conducted by the authority of the Clean Water Act (CWA) to determine compliance with Environmental Protection Agency (EPA) regulations. There were no other federal, state, or local agency representatives present at the time of the inspection.

FACILITY DESCRIPTION

EPA conducted an inspection on the Hanna Oil and Gas Company / Lincoln #1 Tank Battery, which contained one (1) storage tank for produced water, one (1) separator, one (1) compressor, and one (1) natural gas (dry) well, which was producing at the time of the inspection.

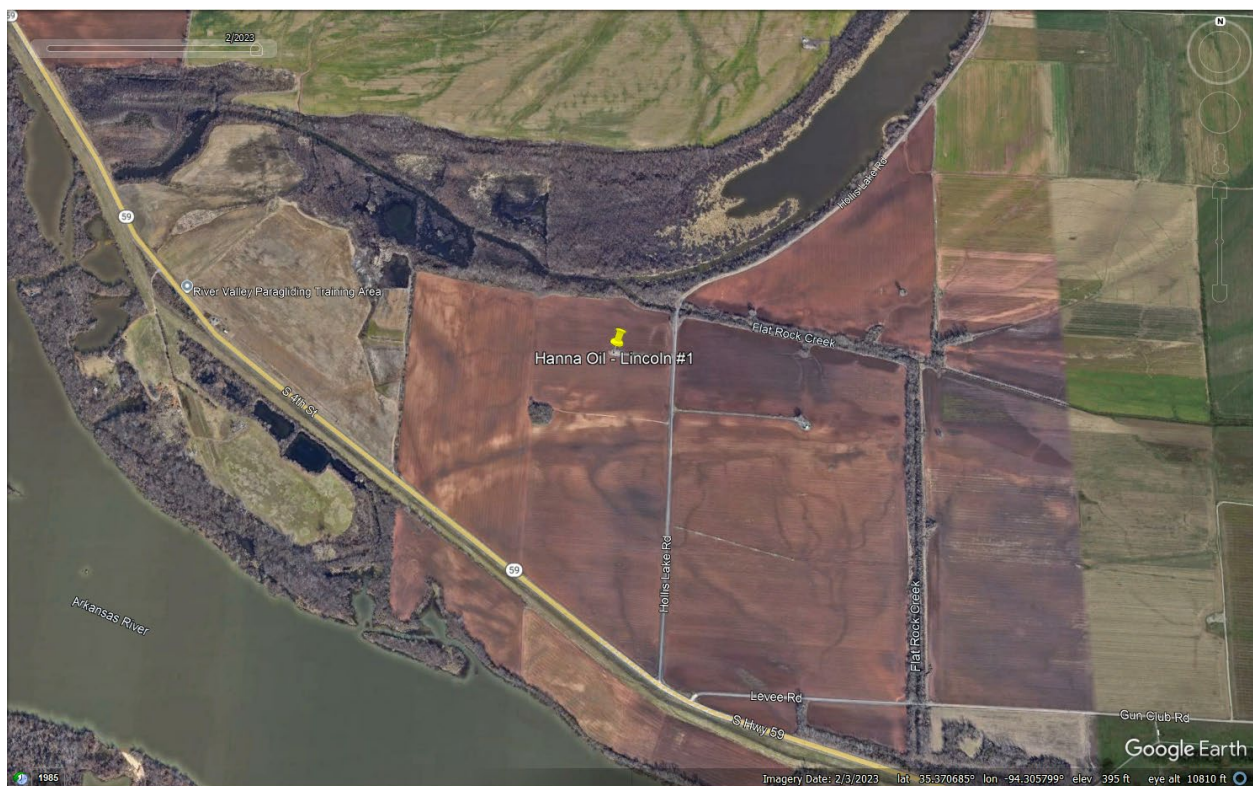

Map 1. Aerial imagery (Google Earth dated 02/03/2023) of the Hanna Oil and Gas Company / Lincoln #1 Tank Battery.

Section II – OBSERVATIONS

I observed the Hanna Oil and Gas Company / Lincoln #1 Tank Battery facility and associated secondary containment and storage tank; see Appendix 1 (Photographs Log), see Photo No. 1 and No. 2. For additional GPS location and photo metadata, see Appendix 1.

I observed one open-top storage tank (bird netting in place) within secondary containment, see Photo No. 3.

I observed one 2-phase gas-water separator, see Photo No. 4.

Section III – AREAS OF CONCERN

No closing conference was held due to no personnel with Hanna Oil and Gas Company being present during the inspection. There were no areas of concern at the time of the inspection.

Section IV – FOLLOW UP

Inspector will provide the completed inspection report to company representative(s).

Section V – LIST OF APPENDICES

Appendix 1 – Photograph Log – 4 photos taken 12/10/2024.

Appendix 1

Photograph Log 4 Photos



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 1

Location: Van Buren from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442.

City: Van Buren

County/Parish: Crawford

State: AR



Photo File Name: 100-0382

Orientation: 311° NW

Date of Photo: 12/10/2024

Time of Photo: 1352

Latitude: 35.371950

Longitude: -94.306467

Photographer: Kerri McCabe

Description: Looking NW, this photo shows the signage at the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 2

Location: Van Buren from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442.		
City: Van Buren	County/Parish: Crawford	State: AR



Photo File Name: 100-0383

Orientation: 329° NNW

Date of Photo: 12/10/2024

Time of Photo: 1353

Latitude: 35.371970

Longitude: -94.306427

Photographer: Kerri McCabe

Description: Looking NNW, this photo shows an overview of the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 3

Location: Van Buren from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442.

City: Van Buren

County/Parish: Crawford

State: AR



Photo File Name: 100-0384

Orientation: 1° N

Date of Photo: 12/10/2024

Time of Photo: 1353

Latitude: 35.371996

Longitude: -94.306489

Photographer: Kerri McCabe

Description: Looking N, this photo shows an open-top produced water tank (with bird netting applied) inside secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 4

Location: Van Buren from Highway 59 S, then Hollis Lake Rd, and left onto a gas lease road at 35.371959, -94.306442.		
City: Van Buren	County/Parish: Crawford	State: AR



Photo File Name: 100-0385

Orientation: 45° NE

Date of Photo: 12/10/2024

Time of Photo: 1353

Latitude: 35.371933

Longitude: -94.306300

Photographer: Kerri McCabe

Description: Looking NE, this photo shows the 2-phase gas-water separator and LACT unit for downstream sales.