

Region 6 - Enforcement & Compliance Assurance Division
INSPECTION REPORT

Inspection Date(s):	03/05/2025	
Media Program:	Water (CWA)	
Regulatory Program(s)	Water (CWA) Brine Program (Oil & Gas inspection)	
Company Name:	Bonds Company Production, LLC	
Facility Name:	Curry Lease Tank Battery	
Facility Physical Location:	From Stephens, State Highway 57, right on Ouachita County Road 79, left on oilfield road at 33.513497, -93.045767.	
(city, state, zip code)	Stephens, AR 71764	
Mailing address:	210 Jasper Street	
(city, state, zip code)	Stephens, AR 71764	
County/Parish:	Ouachita County	
Facility Phone Number	870-904-4719	
Facility Contact:	Paul Bonds (870-904-4719)	Person Responsible for Operation
FRS Number:	N/A	
Identification/Permit Number:	ARU002287	
Media Identifier Number:	N/A	
NAICS:	211111	
SIC:	1311	
Personnel participating in inspection:		
Kerri McCabe (lead)	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Michael Blaha	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Paul Bonds	Bonds Company Production, LLC	Person Responsible for Operation
RJ (no last name provided)	Bonds Company Production, LLC	Pumper
EPA Lead Inspector Signature/Date	KERRI MCCABE Kerri McCabe	Digitally signed by KERRI MCCABE Date: 2025.05.29 13:08:34 -05'00' Date
Supervisor Signature/Date	JEANNE ECKHART Jeanne Eckhart	Digitally signed by JEANNE ECKHART Date: 2025.05.29 15:56:19 -05'00' Date

Section I – INTRODUCTION

PURPOSE OF THE INSPECTION

Environmental Protection Agency (EPA) Region 6 inspectors Kerri McCabe (lead) and Michael Blaha arrived at the Bonds Company Production, LLC / Curry Lease Tank Battery (“facility”) located from State Highway 57, right on Ouachita County Road 79, left on oilfield road at 33.513497, -93.045767 in Stephens, Ouachita County, Arkansas; at 0945 on 03/05/2025 for an unannounced inspection. After notifying Mr. Glen Owens, Inspector Supervisor with the Arkansas Oil and Gas Commission (AOGC), Mr. Paul Bonds arrived onsite to represent the facility during the inspection. The inspection was conducted by the authority of the Clean Water Act (CWA) to determine compliance with EPA regulations. There were no other federal, state, or local agency representatives present at the time of the inspection.

FACILITY DESCRIPTION

EPA conducted an inspection on the Bonds Company Production, LLC / Curry Lease Tank Battery facility, which contains six (6) tanks for crude oil and saltwater storage and one (1) pump outside secondary containment used for saltwater injection into nearby Class II Saltwater Disposal (SWD) wells.



Map 1. Aerial imagery (Google Earth dated 12/11/2024) of the Bonds Company Production, LLC / Curry Lease Tank Battery facility.

Section II - OBSERVATIONS

I observed the facility signage, secondary containment, pipes and valves, storage tanks, separators/treaters, and a pump for nearby Class II SWD injection wells; see **Appendix 1** (Facility Photograph Log), Photo No. 1 through No. 3. For additional GPS location and photo metadata, see Appendix 1.

I observed the pump used for saltwater transfer outside secondary containment with loose crude oil and saltwater on the ground, see Photos No. 3 through No. 6 and Photo No. 16.

I observed transfer lines for product at the secondary containment structure and loose oil on the subsurface catchment buckets for those transfer lines, see Photos No. 7 through No. 10.

I observed the inside of the secondary containment with loose crude oil and saltwater, see Photos No. 11 through No. 15 and Photos No. 17 and No. 18.

I observed a saltwater storage tank with a hole that was actively leaking, see Photos No. 13 and No. 14. I observed a flowpath caused by the discharge of saltwater from the secondary containment drainpipe to the point of entry into the unnamed tributary of Cypress Creek, see Appendix 2.

I observed the interior drainage area, the drainpipe, and the exterior flowpath for the secondary containment structure, see Photos No. 17 through No. 23.

I observed the signage, two (2) production wells, two (2) SWD injection wells, and two (2) workover pits associated with the facility, see Photos No. 24 and No. 25 and Photos No. 35 through No. 41.

I observed loose crude oil and saltwater outside secondary containment as well as saltwater staining and dead vegetation associated with active and residual releases from the SWD pump and metal flowlines to the SWD injection wells, see Photos No. 26 through No. 34.

During the inspection, I observed the flowpath caused by the active releases from the secondary containment discharge pipe and the flowlines and measured Total Dissolved Solids (TDS) at the following locations (see Appendix 2 for photos and metadata):

Location	Time	TDS (mg/L)	Temperature (°C)	Photo No.
Drainpipe Flowpath	1004	13,035	13.3	1
Point of Entry (POE)	1007	2,741	11.0	4
Background	1012	45.1	10.3	7
Downstream #1	1015	182.8	10.1	10
Downstream #2	1018	191.9	9.7	13
Downstream #3	1022	158.7	9.7	16
Downstream #4	1025	155.1	9.2	19
Downstream of Flowline #1	1109	3,174	11.8	22
Downstream of Flowline #2	1111	1,577	12.0	25

Note: All TDS field readings observed throughout the inspection were taken with a properly calibrated, EPA-issued, YSI Pro30 Conductivity/TDS/Salinity/Temperature Meter (#Y60530).

Section III – AREAS OF CONCERN

A closing conference was held with Mr. Paul Bonds with Bonds Company Production, LLC. While EPA was at the facility, Mr. Bonds and RJ, his pumper, stopped the active releases of saltwater at a storage tank, secondary containment drainpipe, and the two (2) flowline couplings to the SWD injection wells. Mr. Bonds was informed that the inspection was still under review, and that an inspection report would be provided documenting the inspection findings. Areas of concern at the time of the inspection include the following:

- Loose crude oil and saltwater from an SWD pump outside secondary containment (Photos No. 3 through No. 6),
- Transfer pipes with subsurface or missing catchment buckets and loose crude oil on the ground (Photos No. 7 through No. 10),
- Loose crude oil and saltwater inside secondary containment (Photos No. 11 and No. 12 and Photos No. 15, No. 17 and No. 18),
- An active leak of saltwater from a storage tank (Photos No. 13 and No. 14),
- An open drainpipe without a cap actively draining loose crude oil and saltwater (Photos No. 19 through No. 23),
- Two (2) production wells with residual crude oil on the ground and unlined workover pits with loose crude oil (Photos No. 24 and No. 25 and Photos No. 40 and No. 41), and
- Loose crude oil and saltwater outside secondary containment from the SWD pump, open drainpipe, and two (2) metal flowlines (Photos No. 26 and No. 28 through No. 34).

Section IV – FOLLOW UP

Inspector will conduct follow-up phone calls with the company representative(s) over the coming weeks and months to ensure areas of concern are properly addressed.

Section V – LIST OF APPENDICES

Appendix 1 – Facility Photograph Log – 41 photos taken 03/05/2025.

Appendix 2 – TDS Photograph Log – 27 photos taken 03/05/2025.

Appendix 1

Facility Photograph Log 41 Photos



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 1

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0633

Orientation: 89° E

Date of Photo: 03/05/2025

Time of Photo: 0946

Latitude: 33.513667

Longitude: -93.051933

Photographer: Kerri McCabe

Description: Looking E, this photo shows the signage for the Bonds Company Production, LLC – Curry Lease ("facility").



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 2

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0634

Orientation: 56° ENE

Date of Photo: 03/05/2025

Time of Photo: 0948

Latitude: 33.513350

Longitude: -93.051883

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows an overview of the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 3

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0635

Orientation: 87° E

Date of Photo: 03/05/2025

Time of Photo: 0948

Latitude: 33.513417

Longitude: -93.051950

Photographer: Kerri McCabe

Description: Looking E, this photo shows the saltwater disposal (SWD) pump outside secondary containment with loose crude oil and saltwater observed on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 4

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0636

Orientation: 67° ENE

Date of Photo: 03/05/2025

Time of Photo: 0948

Latitude: 33.513433

Longitude: -93.051933

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows an open-top catch bucket for the SWD pump outside secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 5

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0637

Orientation: 64° ENE

Date of Photo: 03/05/2025

Time of Photo: 0948

Latitude: 33.513433

Longitude: -93.051947

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows loose crude oil and saltwater on the ground around the SWD pump.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 6

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0638

Orientation: 113° ESE

Date of Photo: 03/05/2025

Time of Photo: 0948

Latitude: 33.513483

Longitude: -93.051967

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows an additional view of the loose crude oil and saltwater on the ground from the SWD pump.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 7

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0639

Orientation: 32° NNE

Date of Photo: 03/05/2025

Time of Photo: 0949

Latitude: 33.513600

Longitude: -93.052050

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows the transfer lines for the crude oil tanks with subsurface catchment buckets for two of the three pipes.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 8

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0640

Orientation: 42° NE

Date of Photo: 03/05/2025

Time of Photo: 0949

Latitude: 33.513600

Longitude: -93.052050

Photographer: Kerri McCabe

Description: Looking NE, this photo shows one transfer pipe with a subsurface catchment bucket with loose crude oil on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 9

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0641

Orientation: 43° NE

Date of Photo: 03/05/2025

Time of Photo: 0949

Latitude: 33.513633

Longitude: -93.052083

Photographer: Kerri McCabe

Description: Looking NE, this photo shows an additional transfer pipe with a subsurface catchment bucket with loose crude oil on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 10

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0642

Orientation: 56° ENE

Date of Photo: 03/05/2025

Time of Photo: 0949

Latitude: 33.513633

Longitude: -93.052083

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows an additional transfer pipe without a catchment bucket.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 11

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0643

Orientation: 110° ESE

Date of Photo: 03/05/2025

Time of Photo: 0949

Latitude: 33.513717

Longitude: -93.052000

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows the inside of the secondary containment (front view; right) with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 12

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0644

Orientation: 21° NNE

Date of Photo: 03/05/2025

Time of Photo: 0950

Latitude: 33.513717

Longitude: -93.052000

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows the inside of the secondary containment (front view; left) with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 13

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0645

Orientation: 60° ENE

Date of Photo: 03/05/2025

Time of Photo: 0950

Latitude: 33.513650

Longitude: -93.051917

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows a saltwater storage tank that was actively leaking inside secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 14

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0646

Orientation: 53° NE

Date of Photo: 03/05/2025

Time of Photo: 0950

Latitude: 33.513650

Longitude: -93.051903

Photographer: Kerri McCabe

Description: Looking NE, this photo shows an additional view of the saltwater storage tank from Photo No. 13 that was actively leaking inside secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 15

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0647

Orientation: 105° ESE

Date of Photo: 03/05/2025

Time of Photo: 0951

Latitude: 33.513750

Longitude: -93.051903

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows the inside of the secondary containment (front view; right) with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 16

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0648

Orientation: 162° SSE

Date of Photo: 03/05/2025

Time of Photo: 0951

Latitude: 33.513550

Longitude: -93.051917

Photographer: Kerri McCabe

Description: Looking SSE, this photo shows an additional (top view) of the SWD pump outside secondary containment with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 17

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0649

Orientation: 26° NNE

Date of Photo: 03/05/2025

Time of Photo: 0952

Latitude: 33.513483

Longitude: -93.051833

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows the sump area and flowpath inside secondary containment for the drainpipe associated with the facility. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 18

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0651

Orientation: 20° NNE

Date of Photo: 03/05/2025

Time of Photo: 0952

Latitude: 33.513497

Longitude: -93.051791

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows an overview of the backside of the secondary containment with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 19

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0652

Orientation: 26° NNE

Date of Photo: 03/05/2025

Time of Photo: 0952

Latitude: 33.513383

Longitude: -93.051791

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows the drainpipe for secondary containment that was open and actively releasing loose saltwater. Note residual loose crude oil at drainpipe.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 20

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0653

Orientation: 316° NW

Date of Photo: 03/05/2025

Time of Photo: 0952

Latitude: 33.513350

Longitude: -93.051817

Photographer: Kerri McCabe

Description: Looking NW, this photo shows the flowpath for the drainpipe for the secondary containment. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 21

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0654

Orientation: 7° N

Date of Photo: 03/05/2025

Time of Photo: 0953

Latitude: 33.513433

Longitude: -93.051800

Photographer: Kerri McCabe

Description: Looking N, this photo shows an additional view of the drainpipe for secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 22

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0655

Orientation: 47° NE

Date of Photo: 03/05/2025

Time of Photo: 0953

Latitude: 33.513333

Longitude: -93.051867

Photographer: Kerri McCabe

Description: Looking NE, this photo shows an additional view of the flowpath for the drainpipe for the secondary containment. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 23

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0656

Orientation: 97° E

Date of Photo: 03/05/2025

Time of Photo: 0953

Latitude: 33.513183

Longitude: -93.051867

Photographer: Kerri McCabe

Description: Looking E, this photo shows the continuation of the flowpath from Photo No. 22. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 24

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0671

Orientation: 319° NW

Date of Photo: 03/05/2025

Time of Photo: 1016

Latitude: 33.512383

Longitude: -93.051967

Photographer: Kerri McCabe

Description: Looking NW, this photo shows a production well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 25

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0673

Orientation: 296° WNW

Date of Photo: 03/05/2025

Time of Photo: 1017

Latitude: 33.512250

Longitude: -93.052000

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows a pit next to the production well from Photo No. 24 that contained loose crude oil.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 26

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0683

Orientation: 257° WSW

Date of Photo: 03/05/2025

Time of Photo: 1034

Latitude: 33.513167

Longitude: -93.052017

Photographer: Kerri McCabe

Description: Looking WSW, this photo shows loose crude oil and saltwater adjacent to the facility (see Photo No. 16 for frame of reference).



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 27

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0684

Orientation: 50° NE

Date of Photo: 03/05/2025

Time of Photo: 1034

Latitude: 33.513167

Longitude: -93.052017

Photographer: Kerri McCabe

Description: Looking NE, this photo shows the proximity of the loose crude oil and saltwater from Photo No. 26 to the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 28

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0685

Orientation: 357° N

Date of Photo: 03/05/2025

Time of Photo: 1034

Latitude: 33.513050

Longitude: -93.052050

Photographer: Kerri McCabe

Description: Looking N, this photo shows a closeup of the loose crude oil and saltwater from Photo No. 26.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 29

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0686

Orientation: 355° N

Date of Photo: 03/05/2025

Time of Photo: 1036

Latitude: 33.513000

Longitude: -93.052200

Photographer: Kerri McCabe

Description: Looking N, this photo shows a metal flowline from the facility to the SWD injection well actively leaking.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 30

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0687

Orientation: 217° SW

Date of Photo: 03/05/2025

Time of Photo: 1036

Latitude: 33.513000

Longitude: -93.052216

Photographer: Kerri McCabe

Description: Looking SW, this photo shows saltwater staining and dead vegetation around the flowline in Photo No. 29.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 31

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0688

Orientation: 45° NE

Date of Photo: 03/05/2025

Time of Photo: 1037

Latitude: 33.513050

Longitude: -93.052250

Photographer: Kerri McCabe

Description: Looking NE, this photo shows an additional view of the actively leaking flowline from Photo No. 29.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 32

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0689

Orientation: 31° NNE

Date of Photo: 03/05/2025

Time of Photo: 1037

Latitude: 33.513083

Longitude: -93.052167

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows an additional view of the actively leaking flowline from Photo No. 29.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 33

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0690

Orientation: 102° ESE

Date of Photo: 03/05/2025

Time of Photo: 1038

Latitude: 33.512900

Longitude: -93.052367

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows an additional metal flowline with an active leak at a coupling on the line.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 34

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0691

Orientation: 177° S

Date of Photo: 03/05/2025

Time of Photo: 1039

Latitude: 33.512767

Longitude: -93.052467

Photographer: Kerri McCabe

Description: Looking S, this photo shows an overview of the area of the second actively leaking flowline from Photo No. 33.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 35

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0692

Orientation: 88° E

Date of Photo: 03/05/2025

Time of Photo: 1043

Latitude: 33.512450

Longitude: -93.052767

Photographer: Kerri McCabe

Description: Looking E, this photo shows the signage for the Curry #13 SWD injection well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 36

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0693

Orientation: 139° SE

Date of Photo: 03/05/2025

Time of Photo: 1044

Latitude: 33.512483

Longitude: -93.052867

Photographer: Kerri McCabe

Description: Looking SE, this photo shows the Curry #13 SWD injection well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 37

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0694

Orientation: 123° ESE

Date of Photo: 03/05/2025

Time of Photo: 1044

Latitude: 33.512183

Longitude: -93.052850

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows the signage for the Curry #A-1 SWD injection well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 38

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0695

Orientation: 4° N

Date of Photo: 03/05/2025

Time of Photo: 1045

Latitude: 33.512017

Longitude: -93.052900

Photographer: Kerri McCabe

Description: Looking N, this photo shows the Curry #A-1 SWD injection well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 39

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0696

Orientation: 319° NW

Date of Photo: 03/05/2025

Time of Photo: 1059

Latitude: 33.513467

Longitude: -93.053717

Photographer: Kerri McCabe

Description: Looking NW, this photo shows the signage for the Curry #7 production well associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 40

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0697

Orientation: 40° NE

Date of Photo: 03/05/2025

Time of Photo: 1059

Latitude: 33.513450

Longitude: -93.053683

Photographer: Kerri McCabe

Description: Looking NE, this photo shows the Curry #7 production well and a pit associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 41

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0698

Orientation: 35° NE

Date of Photo: 03/05/2025

Time of Photo: 1059

Latitude: 33.513460

Longitude: -93.053683

Photographer: Kerri McCabe

Description: Looking NE, this photo shows a closer view of the pit in Photo No. 40.

Appendix 2

TDS Photograph Log 27 Photos



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 1

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0659

Orientation: 358° N

Date of Photo: 03/05/2025

Time of Photo: 1004

Latitude: 33.513300

Longitude: -93.051483

Photographer: Kerri McCabe

Description: Looking N, this photo shows a Total Dissolved Solids (TDS) reading of **13,035 mg/L** for the water in the flowpath from the Bonds Company Production, LLC – Curry Lease Tank Battery ("facility").



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 2

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0660

Orientation: 351° N

Date of Photo: 03/05/2025

Time of Photo: 1004

Latitude: 33.513317

Longitude: -93.051517

Photographer: Kerri McCabe

Description: Looking N, this photo shows the upstream characteristics of the TDS reading from Photo No. 1. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 3

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0661

Orientation: 82° E

Date of Photo: 03/05/2025

Time of Photo: 1004

Latitude: 33.513317

Longitude: -93.051547

Photographer: Kerri McCabe

Description: Looking E, this photo shows the downstream characteristics of the TDS reading from Photo No. 1. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 4

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0662

Orientation: 3° N

Date of Photo: 03/05/2025

Time of Photo: 1007

Latitude: 33.513300

Longitude: -93.051450

Photographer: Kerri McCabe

Description: Looking N, this photo shows a TDS reading of **2,741 mg/L** at the discharge point of entry (POE) into an unnamed tributary of Cypress Creek.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 5

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0663

Orientation: 2° N

Date of Photo: 03/05/2025

Time of Photo: 1007

Latitude: 33.513233

Longitude: -93.051417

Photographer: Kerri McCabe

Description: Looking N, this photo shows the upstream characteristics of the TDS reading from Photo No. 4. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 6

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0664

Orientation: 181° S

Date of Photo: 03/05/2025

Time of Photo: 1008

Latitude: 33.513200

Longitude: -93.051433

Photographer: Kerri McCabe

Description: Looking S, this photo shows the downstream characteristics of the TDS reading from Photo No. 4. Directional arrows added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 7

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0665

Orientation: 73° ENE

Date of Photo: 03/05/2025

Time of Photo: 1012

Latitude: 33.513367

Longitude: -93.051250

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows a TDS reading of **45.1 mg/L** for the background location upstream of the discharge POE.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 8

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0666

Orientation: 87° E

Date of Photo: 03/05/2025

Time of Photo: 1012

Latitude: 33.513367

Longitude: -93.051240

Photographer: Kerri McCabe

Description: Looking E, this photo shows the upstream characteristics of the TDS reading from Photo No. 7. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 9

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0667

Orientation: 166° SSE

Date of Photo: 03/05/2025

Time of Photo: 1012

Latitude: 33.513304

Longitude: -93.051265

Photographer: Kerri McCabe

Description: Looking SSE, this photo shows the downstream characteristics of the TDS reading from Photo No. 7. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 10

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0668

Orientation: 51° NE

Date of Photo: 03/05/2025

Time of Photo: 1015

Latitude: 33.513050

Longitude: -93.051717

Photographer: Kerri McCabe

Description: Looking NE, this photo shows a TDS reading of **182.8 mg/L** for a location downstream (DS #1) of the discharge POE.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 11

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0669

Orientation: 47° NE

Date of Photo: 03/05/2025

Time of Photo: 1015

Latitude: 33.513050

Longitude: -93.051633

Photographer: Kerri McCabe

Description: Looking NE, this photo shows the upstream characteristics of the TDS reading from Photo No. 10. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 12

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0670

Orientation: 124° SE

Date of Photo: 03/05/2025

Time of Photo: 1015

Latitude: 33.512917

Longitude: -93.051700

Photographer: Kerri McCabe

Description: Looking SE, this photo shows the downstream characteristics of the TDS reading from Photo No. 10. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 13

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas

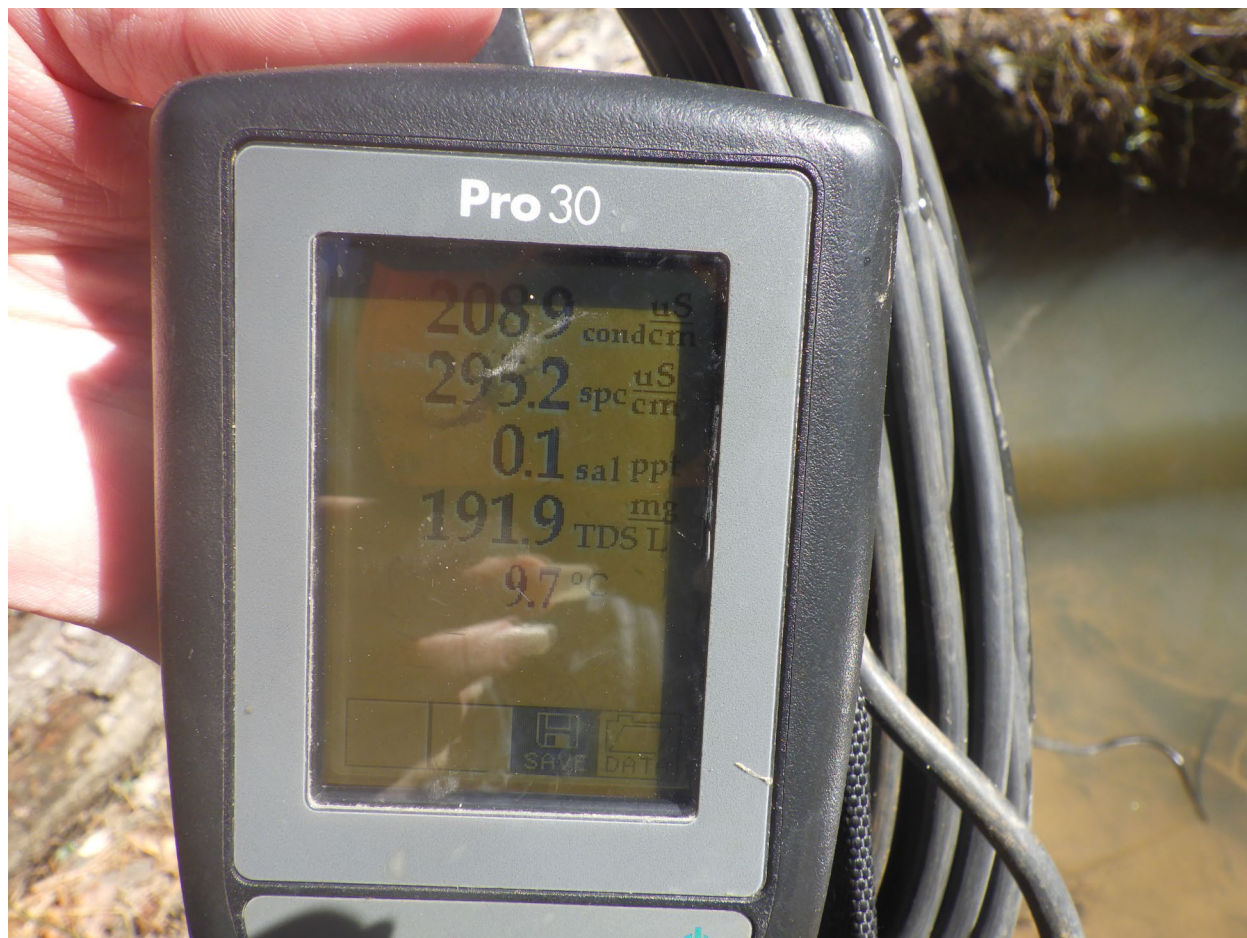


Photo File Name: 100-0674

Orientation: 11° NNE

Date of Photo: 03/05/2025

Time of Photo: 1018

Latitude: 33.512000

Longitude: -93.051650

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows a TDS reading of **191.9 mg/L** for a location downstream (DS #2) of the discharge POE.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 14

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0675

Orientation: 31° NNE

Date of Photo: 03/05/2025

Time of Photo: 1018

Latitude: 33.512167

Longitude: -93.051583

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows the upstream characteristics of the TDS reading from Photo No. 13. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 15

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0676

Orientation: 130° SE

Date of Photo: 03/05/2025

Time of Photo: 1018

Latitude: 33.512217

Longitude: -93.051600

Photographer: Kerri McCabe

Description: Looking SE, this photo shows the downstream characteristics of the TDS reading from Photo No. 13. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 16

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0677

Orientation: 89° E

Date of Photo: 03/05/2025

Time of Photo: 1022

Latitude: 33.511550

Longitude: -93.052383

Photographer: Kerri McCabe

Description: Looking E, this photo shows a TDS reading of **158.7 mg/L** for a location downstream (DS #3) of the discharge POE.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 17

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0678

Orientation: 85° E

Date of Photo: 03/05/2025

Time of Photo: 1022

Latitude: 33.511583

Longitude: -93.052400

Photographer: Kerri McCabe

Description: Looking E, this photo shows the upstream characteristics of the TDS reading from Photo No. 16. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 18

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0679

Orientation: 251° WSW

Date of Photo: 03/05/2025

Time of Photo: 1022

Latitude: 33.511597

Longitude: -93.052400

Photographer: Kerri McCabe

Description: Looking WSW, this photo shows the downstream characteristics of the TDS reading from Photo No. 16. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 19

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0680

Orientation: 349° N

Date of Photo: 03/05/2025

Time of Photo: 1025

Latitude: 33.511533

Longitude: -93.053267

Photographer: Kerri McCabe

Description: Looking N, this photo shows a TDS reading of **155.1 mg/L** for a location downstream (DS #4) of the discharge POE.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 20

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas

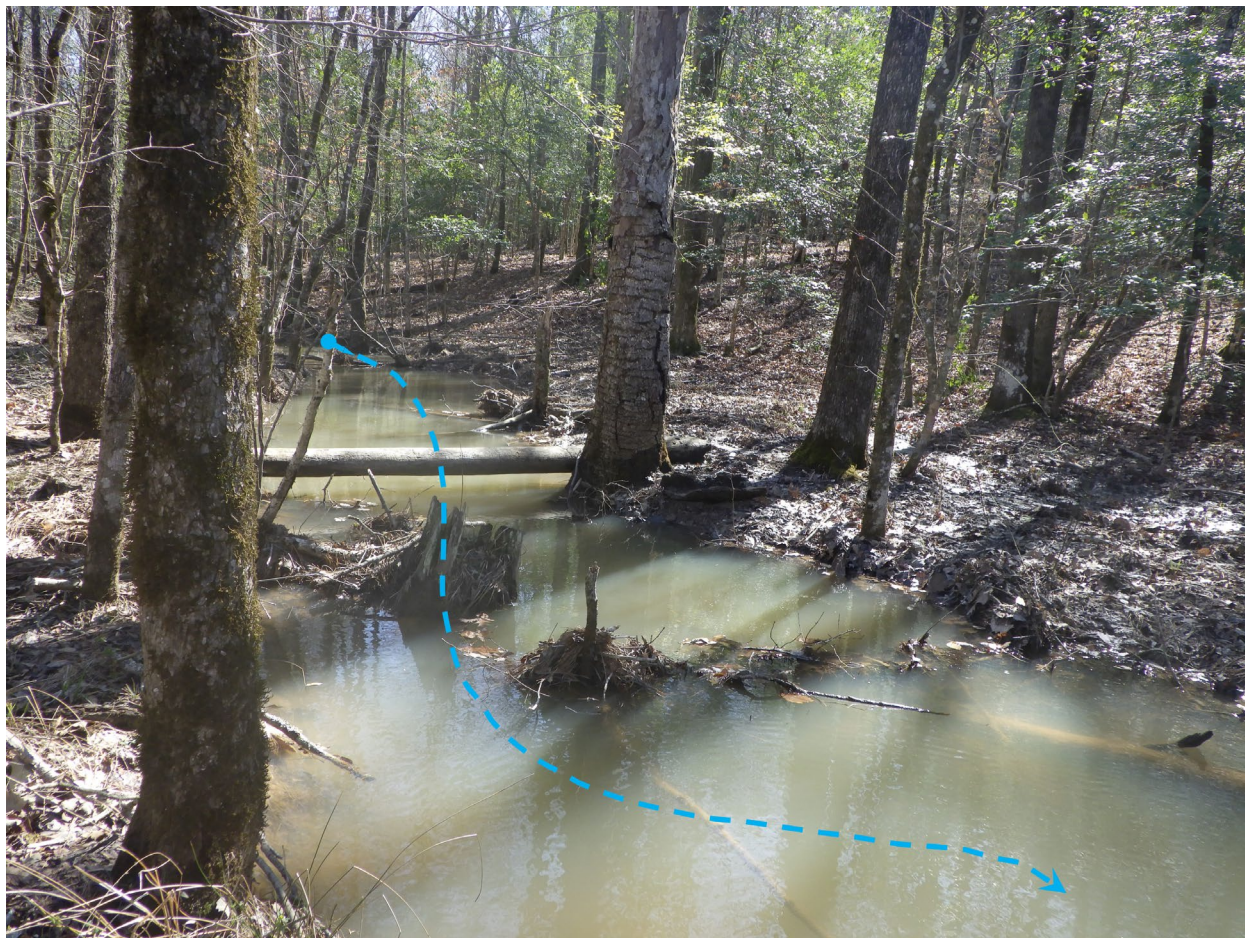


Photo File Name: 100-0681

Orientation: 95° E

Date of Photo: 03/05/2025

Time of Photo: 1026

Latitude: 33.511518

Longitude: -93.053219

Photographer: Kerri McCabe

Description: Looking E, this photo shows the upstream characteristics of the TDS reading from Photo No. 19. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 21

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0682

Orientation: 302° WNW

Date of Photo: 03/05/2025

Time of Photo: 1026

Latitude: 33.511501

Longitude: -93.053186

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows the downstream characteristics of the TDS reading from Photo No. 19. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 22

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0699

Orientation: 73° ENE

Date of Photo: 03/05/2025

Time of Photo: 1109

Latitude: 33.512783

Longitude: -93.053250

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows a TDS reading of **3,174 mg/L** for an unnamed tributary downstream of two flowline releases.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 23

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0700

Orientation: 92° E

Date of Photo: 03/05/2025

Time of Photo: 1109

Latitude: 33.512770

Longitude: -93.053250

Photographer: Kerri McCabe

Description: Looking E, this photo shows the upstream characteristics of the TDS reading from Photo No. 22. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 24

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0701

Orientation: 317° NW

Date of Photo: 03/05/2025

Time of Photo: 1109

Latitude: 33.512783

Longitude: -93.053267

Photographer: Kerri McCabe

Description: Looking NW, this photo shows the downstream characteristics of the TDS reading from Photo No. 22. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 25

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0702

Orientation: 53° NE

Date of Photo: 03/05/2025

Time of Photo: 1111

Latitude: 33.512900

Longitude: -93.053117

Photographer: Kerri McCabe

Description: Looking NE, this photo shows a TDS reading of **1,577 mg/L** for an unnamed tributary downstream of two flowline releases.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 26

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0703

Orientation: 45° NE

Date of Photo: 03/05/2025

Time of Photo: 1111

Latitude: 33.512900

Longitude: -93.053117

Photographer: Kerri McCabe

Description: Looking NE, this photo shows the upstream characteristics of the TDS reading from Photo No. 25. Directional arrow added for clarity.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 27

Location: From Stephens, State Highway 57, right on Ouachita County Road 79, left on Oilfield Road at 33.513497, -93.045767.

City: Stephens

County/Parish: Ouachita

State: Arkansas



Photo File Name: 100-0704

Orientation: 206° SSW

Date of Photo: 03/05/2025

Time of Photo: 1111

Latitude: 33.512900

Longitude: -93.053150

Photographer: Kerri McCabe

Description: Looking SSW, this photo shows the downstream characteristics of the TDS reading from Photo No. 25. Directional arrow added for clarity.