

Region 6 - Enforcement & Compliance Assurance Division
INSPECTION REPORT

Inspection Date(s):	04/17/2025	
Media Program:	Water (CWA)	
Regulatory Program(s)	Water (CWA) Brine Program (Oil & Gas inspection)	
Company Name:	C12: Arkansas Oil, LLC	
Facility Name:	Midway Smackover Unit Tract #3 Tank Battery	
Facility Physical Location:	From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.	
(city, state, zip code)	Lewisville, AR 71845	
Mailing address:	Hwy 25 1124	
(city, state, zip code)	Lowerville, AR 71545	
County/Parish:	Lafayette County	
Facility Phone Number	501-772-3456	
Facility Contact:	Paul Appel (832-628-3016)	Person Responsible for Operation
	Robert Thomasson, Representative / robert@standardgas.org	
FRS Number:	N/A	
Identification/Permit Number:	ARU002303	
Media Identifier Number:	N/A	
NAICS:	211111	
SIC:	1311	
Personnel participating in inspection:		
Kerri McCabe (lead)	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Michael Blaha	EPA / Region 6 ECDW	Inspector / Enforcement Officer
Uma Lad	EPA / Region 6 ECDW	Inspector / Enforcement Officer
EPA Lead Inspector Signature/Date		
	Kerri McCabe	Date
Supervisor Signature/Date		
	Jeanne Eckhart	Date


Section I – INTRODUCTION

PURPOSE OF THE INSPECTION

EPA Region 6 inspectors Kerri McCabe (lead), Michael Blaha, and Uma Lad arrived at the C12: Arkansas Oil, LLC / Midway Smackover Unit Tract #3 Tank Battery ("facility") located from State Highway 82 East, left on State Highway 29, right on Lafayette County Road 25, and then right onto an oilfield lease road at 33.443267, -93.533467 in Lewisville (Baker Community), Lafayette County, Arkansas; at 0845 on 04/17/2025 for an unannounced inspection. Mr. Michael Pearson represented the facility at the time of the inspection. The inspection was conducted by the authority of the Clean Water Act (CWA) to determine compliance with Environmental Protection Agency (EPA) regulations. There were no other federal, state, or local agency representatives present at the time of the inspection.

FACILITY DESCRIPTION

EPA conducted an inspection on the C12: Arkansas Oil, LLC / Midway Smackover Unit Tract #3 Tank Battery facility, which contains five (5) tank batteries for a total of thirteen (13) tanks that include storage, separation, and free water knock out (FWKO) for crude oil and saltwater processing and storage, and nearby three (3) Class II Saltwater Disposal (SWD) injection wells. There are four (4) additional storage tanks for refined product.

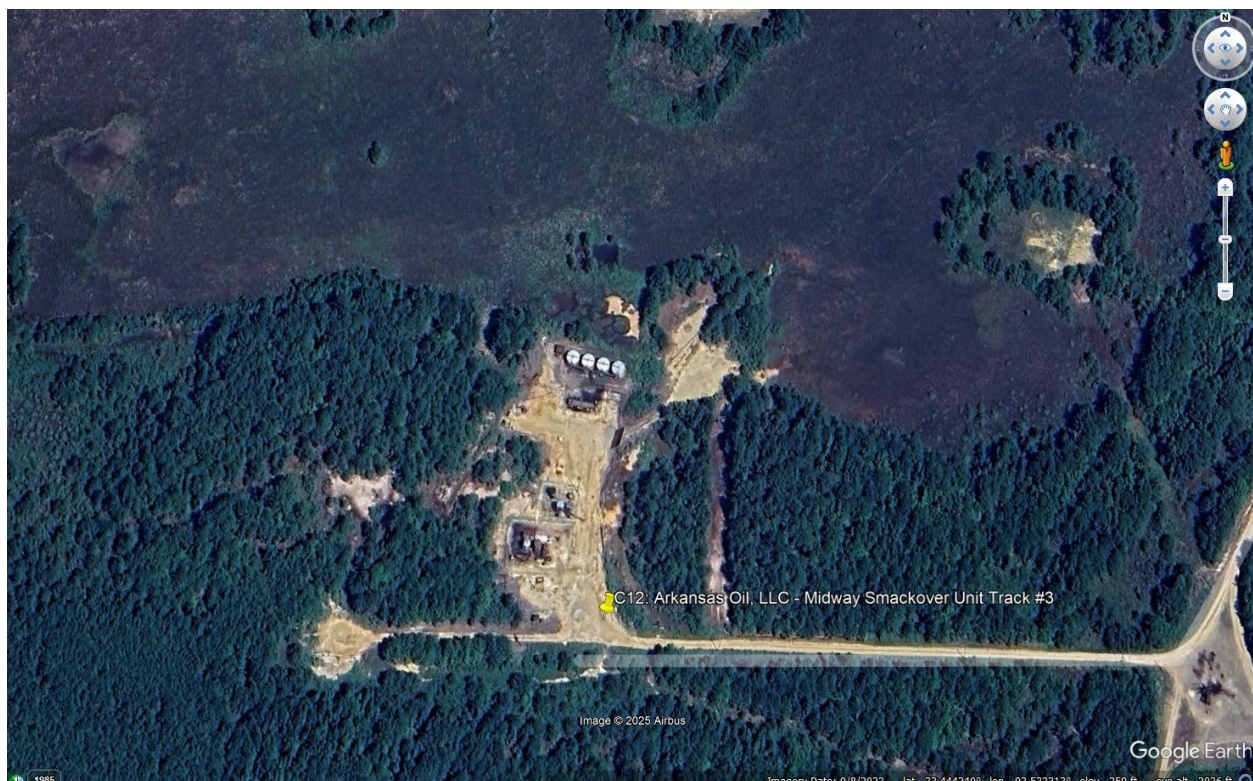

Map 1. Aerial imagery (Google Earth dated 09/08/2023) of the C12: Arkansas Oil, LLC / Midway Smackover Unit Tract #3 Tank Battery facility.

Section II - OBSERVATIONS

I observed the facility secondary containment, pipes and valves, storage tanks, and separators/treaters; see Appendix 1 (Photographs Log), Photo No. 1. For additional GPS location and photo metadata, see Appendix 1.

I observed flowlines to and from the facility within a utility right of way and through wetlands adjacent to the facility, see Photos No. 2 through No. 6 and No. 9 and No. 10.

I observed the flowline collection dump system with an active leak of saltwater at one of the pipe joints, see Photos No. 5, and No. 7 and No. 8.

I observed one tank battery with four (4) storage tanks that appeared to be out of service, see Photo No. 11.

I observed the tank battery for the FWKO tank and an active release of crude oil/saltwater from a cut in the berm, see Photos No. 12 through No. 19.

I observed a small tank battery for a separator and some additional equipment outside secondary containment, see Photo No. 20.

I observed additional nearby wetlands that had been impacted from a crude oil/saltwater release from June 2024, per onsite personnel, see Photos No. 21 and No. 22 and No. 24.

I observed a flowline with an active leak outside secondary containment, see Photo No. 23.

I observed a tank battery with two (2) storage tanks and two (2) pumps with residual crude oil inside the secondary containment, see Photos No. 25 through No. 26, No. 28, and No. 30.

I observed the drainpipe for the secondary containment referenced above without a shutoff valve or cap, see Photos No. 27 through No. 29.

I observed four (4) tanks for refined product outside secondary containment that were actively leaking, see Photo No. 31.

I observed one of three nearby SWD injection wells associated with the facility, see Photo No. 32.

Section III – AREAS OF CONCERN

A closing conference was held with Mr. Micheal Pearson with C12: Arkansas Oil, LLC after the inspection. Areas of concern at the time of the inspection include the following:

- Historic and active crude oil and saltwater releases into nearby wetlands that have not been properly remediated (Photos No. 3 through No. 6, No. 9 and No. 10, No. 17 through No. 19, No. 21 and No. 22, and No. 24, and No. 29),

- An active saltwater leak from a pipe joint at the flowline collection system (Photos No. 7 and No. 8),
- Storage tanks not in use without proper labeling (Photo No. 11),
- A cut berm for the FWKO tank with loose crude oil and saltwater discharged onto the ground and into the surrounding area (Photos No. 12 through No. 19),
- The transfer line for the FWKO tank without a catchment bucket or control mechanism (Photo No. 14),
- An active leak from a flowline outside secondary containment (Photo No. 23),
- Loose crude oil and saltwater inside secondary containment for a tank battery onsite (Photos No. 25, No. 26, and No. 28),
- A drainpipe with no shutoff valve or cap for one of the tank batteries (Photos No. 27 through No. 29),
- A low area in the berm for one of the tank batteries (Photo No. 30), and
- Four (4) refined petroleum product tanks outside secondary containment with leaks to the ground (Photo No. 31).

Section IV – FOLLOW UP

Inspector will conduct follow-up phone calls with the company representative(s) over the coming weeks and months to ensure areas of concern are properly addressed.

Section V – LIST OF APPENDICES

Appendix 1 – Photograph Log – 32 photos taken 04/17/2025.

Appendix 1

Photograph Log 32 Photos



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 1

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.		
City: Lewisville	County/Parish: Lafayette	State: Arkansas



Photo File Name: 100-0788

Orientation: 320° NW

Date of Photo: 04/17/2025

Time of Photo: 0809

Latitude: 33.443267

Longitude: -93.533467

Photographer: Kerri McCabe

Description: Looking NW, this photo shows an overview of the C12: Arkansas Oil, LLC – Midway Smackover Unit Tract #3 Tank Battery ("facility").



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 2

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0789

Orientation: 345° NNW

Date of Photo: 04/17/2025

Time of Photo: 0810

Latitude: 33.443233

Longitude: -93.532883

Photographer: Kerri McCabe

Description: Looking NNW, this photo shows flowlines placed within a utility right of way and along a lease road.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 3

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0790

Orientation: 292° WNW

Date of Photo: 04/17/2025

Time of Photo: 0810

Latitude: 33.443217

Longitude: -93.533000

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows the flowlines from Photo No. 2 directed to the facility for storage and disposal.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 4

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0791

Orientation: 313° NW

Date of Photo: 04/17/2025

Time of Photo: 0810

Latitude: 33.443250

Longitude: -93.533117

Photographer: Kerri McCabe

Description: Looking NW, this photo shows flowlines and dead vegetation within a wetland adjacent to the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 5

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0792

Orientation: 354° N

Date of Photo: 04/17/2025

Time of Photo: 0811

Latitude: 33.443500

Longitude: -93.533517

Photographer: Kerri McCabe

Description: Looking N, this photo shows a distribution dump setup for flowlines adjacent to the wetland in Photo No. 4.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 6

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0793

Orientation: 69° ENE

Date of Photo: 04/17/2025

Time of Photo: 0812

Latitude: 33.443667

Longitude: -93.533517

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows the wetland adjacent to the flowline distribution setup from Photo No. 5.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 7

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0794

Orientation: 296° WNW

Date of Photo: 04/17/2025

Time of Photo: 0812

Latitude: 33.443698

Longitude: -93.533517

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows an active leak from one flowline connection with saltwater staining and crystals on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 8

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0795

Orientation: 276° W

Date of Photo: 04/17/2025

Time of Photo: 0812

Latitude: 33.443698

Longitude: -93.533517

Photographer: Kerri McCabe

Description: Looking W, this photo shows a closeup of the active leak from the flowline connection in Photo No. 7.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 9

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0796

Orientation: 32° NNE

Date of Photo: 04/17/2025

Time of Photo: 0812

Latitude: 33.443817

Longitude: -93.533500

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows an additional view of the flowlines and dead vegetation within a wetland adjacent to the distribution setup.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 10

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0797

Orientation: 74° ENE

Date of Photo: 04/17/2025

Time of Photo: 0813

Latitude: 33.443983

Longitude: -93.533483

Photographer: Kerri McCabe

Description: Looking ENE, this photo shows an additional view of the wetland area from Photo No. 9.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 11

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0798

Orientation: 315° NW

Date of Photo: 04/17/2025

Time of Photo: 0824

Latitude: 33.444283

Longitude: -93.533400

Photographer: Kerri McCabe

Description: Looking NW, this photo shows a tank battery with storage tanks that appeared to be out of service.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 12

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0799

Orientation: 265° W

Date of Photo: 04/17/2025

Time of Photo: 0824

Latitude: 33.444283

Longitude: -93.533400

Photographer: Kerri McCabe

Description: Looking W, this photo shows a free water knock-out (FWKO) tank inside secondary containment with loose crude oil.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 13

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0801

Orientation: 287° WNW

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444233

Longitude: -93.533467

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows loose crude oil and saltwater inside the secondary containment for the FWKO tank.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 14

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0802

Orientation: 305° NW

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444200

Longitude: -93.533617

Photographer: Kerri McCabe

Description: Looking NW, this photo shows a transfer pipe without a catchment bucket or cap at the FWKO tank battery.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 15

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0803

Orientation: 339° NNW

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444233

Longitude: -93.533650

Photographer: Kerri McCabe

Description: Looking NNW, this photo shows an additional view of the inside of the FWKO tank battery with loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 16

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0804

Orientation: 7° N

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444267

Longitude: -93.533683

Photographer: Kerri McCabe

Description: Looking N, this photo shows a cut in the berm of the FWKO secondary containment with loose crude oil and saltwater actively flowing from the structure.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 17

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0806

Orientation: 305° NW

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444267

Longitude: -93.533683

Photographer: Kerri McCabe

Description: Looking NW, this photo shows a closeup of the cut in the berm of the FWKO secondary containment from Photo No. 16.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 18

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0807

Orientation: 289° WNW

Date of Photo: 04/17/2025

Time of Photo: 0825

Latitude: 33.444267

Longitude: -93.533683

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows an overview of the active release from the FWKO tank battery with loose crude oil and saltwater on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 19

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0808

Orientation: 317° NW

Date of Photo: 04/17/2025

Time of Photo: 0826

Latitude: 33.444267

Longitude: -93.533733

Photographer: Kerri McCabe

Description: Looking NW, this photo shows an additional view of the release of loose crude oil and saltwater from Photo No. 18.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 20

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0809

Orientation: 281° W

Date of Photo: 04/17/2025

Time of Photo: 0826

Latitude: 33.444183

Longitude: -93.533800

Photographer: Kerri McCabe

Description: Looking W, this photo shows an overview of some miscellaneous equipment outside secondary containment.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 21

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0810

Orientation: 238° WSW

Date of Photo: 04/17/2025

Time of Photo: 0826

Latitude: 33.444183

Longitude: -93.533833

Photographer: Kerri McCabe

Description: Looking WSW, this photo shows an area adjacent to the facility that has been impacted by a release of loose crude oil and saltwater.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 22

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0812

Orientation: 293° WNW

Date of Photo: 04/17/2025

Time of Photo: 0827

Latitude: 33.443950

Longitude: -93.533667

Photographer: Kerri McCabe

Description: Looking WNW, this photo shows the extent of a release of loose crude oil and saltwater adjacent to the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 23

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0813

Orientation: 228° SW

Date of Photo: 04/17/2025

Time of Photo: 0827

Latitude: 33.443950

Longitude: -93.533683

Photographer: Kerri McCabe

Description: Looking SW, this photo shows an active leak from a flowline for another tank battery at the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 24

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0814

Orientation: 242° WSW

Date of Photo: 04/17/2025

Time of Photo: 0828

Latitude: 33.443917

Longitude: -93.533783

Photographer: Kerri McCabe

Description: Looking WSW, this photo shows an additional view of a release of loose crude oil and saltwater associated with the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 25

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0815

Orientation: 224° SW

Date of Photo: 04/17/2025

Time of Photo: 0828

Latitude: 33.443767

Longitude: -93.533867

Photographer: Kerri McCabe

Description: Looking SW, this photo shows the inside of an additional tank battery located at the facility with loose crude oil.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 26

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0816

Orientation: 171° S

Date of Photo: 04/17/2025

Time of Photo: 0828

Latitude: 33.443767

Longitude: -93.533867

Photographer: Kerri McCabe

Description: Looking S, this photo shows the inside of the tank battery from Photo No. 25 that appeared to be scraped to remove loose crude oil.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 27

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0819

Orientation: 160° SSE

Date of Photo: 04/17/2025

Time of Photo: 0829

Latitude: 33.443750

Longitude: -93.534017

Photographer: Kerri McCabe

Description: Looking SSE, this photo shows an open drainpipe for the tank battery in Photos No. 25 and 26 without a valve or cap.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 28

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0820

Orientation: 165° SSE

Date of Photo: 04/17/2025

Time of Photo: 0829

Latitude: 33.443767

Longitude: -93.534033

Photographer: Kerri McCabe

Description: Looking SSE, this photo shows an overview of the open drainpipe from Photo No. 27 and the associated tank battery.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 29

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0821

Orientation: 353° N

Date of Photo: 04/17/2025

Time of Photo: 0829

Latitude: 33.443700

Longitude: -93.534017

Photographer: Kerri McCabe

Description: Looking N, this photo shows an overview of the open drainpipe and the extent of a release that had occurred from the facility.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 30

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0822

Orientation: 33° NNE

Date of Photo: 04/17/2025

Time of Photo: 0830

Latitude: 33.443467

Longitude: -93.533917

Photographer: Kerri McCabe

Description: Looking NNE, this photo shows a low area in the berm for the tank battery in Photo No. 25 and No. 26.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 31

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0823

Orientation: 39° NE

Date of Photo: 04/17/2025

Time of Photo: 0831

Latitude: 33.443300

Longitude: -93.533767

Photographer: Kerri McCabe

Description: Looking NE, this photo shows tanks for refined petroleum products outside secondary containment with loose product on the ground.



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 32

Location: From Lewisville (Baker Community), at State Hwy 82 East, left on State Hwy 29, right on Lafayette CR 25, and then right onto an oilfield lease road at 33.443267, -93.533467.

City: Lewisville

County/Parish: Lafayette

State: Arkansas



Photo File Name: 100-0825

Orientation: 112° ESE

Date of Photo: 04/17/2025

Time of Photo: 0831

Latitude: 33.443300

Longitude: -93.533767

Photographer: Kerri McCabe

Description: Looking ESE, this photo shows one of several saltwater disposal (SWD) injection wells associated with the facility.