

Class I and II Well Inspection Form US Environmental Protection Agency – Region 4 Underground Injection Control Program 61 Forsyth Street SW, MC 9T25, Atlanta, Georgia, 30303 Phone: (404)562-9424					Inspection ID	EPA Well ID#: F L S 1 1 3 0 0 5 9 Year-Month-Day: 2 0 2 2 – 0 9 – 1 3 EPA Permit # (or RA): _____ Page 1 Of 2											
Inspector(s): Page Cirillo _____ (lead), Jason Rose _____ Start Time: 10:03 AM _____ _____ End Time: 10:10 AM _____																	
Facility Contact Information	Facility Name: <i>Blackjack Plant</i> _____ Street Address: <i>4940 Blackjack Plant Road</i> _____ City: <i>Jay</i> _____ County: <i>Santa Rosa</i> _____ State: <i>FL</i> _____ Zip: <i>32535</i> _____ Nature of Business: <i>Oil and gas production</i> _____ Facility Owner/Operator: <i>Black Creek Energy, LLC</i> _____ Phone: <i>(601) 431-5386</i> _____ Email: <i>harris.butler@butlerroyals.com</i> _____ Facility Contact (if different): <i>Michael Wetzel</i> _____ Phone: <i>(805) 324-6271</i> _____ O/O Mailing Address: <i>140 Virginia Street, Suite 402</i> _____ City: <i>Richmond</i> _____ County: <i>NA</i> _____ State: <i>VA</i> _____ Zip: <i>23209</i> _____																
	Well Data from File	Well Name & #: <i>Black Jack Creek SWDS 1-1 #24-1A</i> Well Type (see table): <i>Disposal</i> _____ State Permit: <i>API # 0911320060</i> _____ Latitude (°N): <i>30.846795°N</i> _____ Longitude (°W): <i>-87.094177°W</i> _____ Elevation (ft): <i>115.9'</i> _____ Injection Method (check applicable): ☐ Casing Injector; ☒ Tubing & Packer; ☐ Cemented Injection Tubing PBTB 7400' ☐ Other: _____ Total Depth (ft): <i>7480'</i> _____ Inner Casing Size (in): <i>7"</i> _____ Tubing Size (in): <i>2 – 7/8"</i> _____ Packer Depth (ft): <i>5695'</i> _____ Inj. Zone: ☐ Open Hole; ☒ Perforated; Top(ft): <i>6556'</i> _____ Bottom(ft): <i>6680'</i> _____ Max. Injection Pressure (psig): <i>1,800 psi</i>															
		Field Measurements and Observations	Latitude (°N): <i>30.846830°N</i> _____ Longitude (°W): <i>-87.094214°W</i> _____ Elevation (ft): <i>NA</i> _____ EPA GPS ID: <i>PG No. 3358766066</i> _____ Well Status (see table): <i>SI</i> If not Active, Reported Date Last Active: <i>Operator did not provide.</i> _____ Nature of Injected Fluid(s) if any: _____ General Condition of the Well Site: _____ Notes & Comments (include discrepancies from database values): <i>DEP indicated the disposal well is used as needed depending on when the plant is down. The operator confirmed this statement. The observed pressure was 250 psi. Disposal well did not appear to be operating at the time of the inspection. The site was clean and well-maintained. There was no evidence of leaks or excessive corrosion.</i> Perfs (see well schematics): 6556-6586' EL (6552-82' GR) 7/15/75 6610-6630' EL 4/21/98 6648-6680' EL (6644-76' GR) 7/15/75 6680-6695' EL 4/21/98 4spf 6695-6715' EL (6691-6711' GR) 8/06/72 See reverse for additional observations, comments and photo log														
	Owner/Operator Representative (Optional)								UIC Inspector								
	Name: <i>Cliff Emmons</i> _____ Signature & Date: <i>see attached field notes</i> _____								Name: <i>Page Cirillo</i> _____ Signature & Date: <i>Page Cirillo</i> 10/7/2022 _____								

Inspection ID	EPA Well ID#:	F	L	S	1	1	3	0	0	5	9
	Year-Month-Day:	2	0	2	2	-	0	9	-	1	3
	EPA Permit # (or RA):								5	5	5
		Page 2						Of	2		

(Cont)

Photographer: Jason Rose _____ EPA Camera ID: PG camera ID no. 14 S/N:31029537 _____

Photo ID:1 _____ Time: 10:01 AM ____ Lat (°N): NA _____ Long (°W) NA _____

Description: Looking south, Black Jack Creek SWDS #1-1 sign alongside access road. _____

Photo ID:2 _____ Time: 10:04 AM ____ Lat (°N): NA _____ Long (°W) NA _____

Description: Looking east, site overview, including well head, pressure gauges, valves, and access stairs. _____

Photo ID:3 _____ Time: 10:05 AM ____ Lat (°N): NA _____ Long (°W) NA _____

Description: Looking east, closeup view of surface casing pressure gauge reading 0 psi. _____

Photo ID:4 _____ Time: 10:05 AM ____ Lat (°N): NA _____ Long (°W) NA _____

Description: Looking east, closeup view of production casing pressure gauge reading 0 psi. _____

Photo ID:5 _____ Time: 10:07 AM ____ Lat (°N): NA _____ Long (°W) NA _____

Description: Looking southeast, closeup view of internal pressure gauge reading 250 psi. _____

UIC Inspector

Name: Page Cirillo _____

Signature & Date: *Page Cirillo* 10/7/2022 _____


Site Photographs
Blackjack Creek SWDS 1-1 #24-1A:
September 13, 2022



Photograph 1: Looking south, Blackjack Creek SWDS 1-1 #24-1A sign alongside access road.



Photograph 2: Looking east, site overview, including well head, pressure gauges, valves, and access stairs.

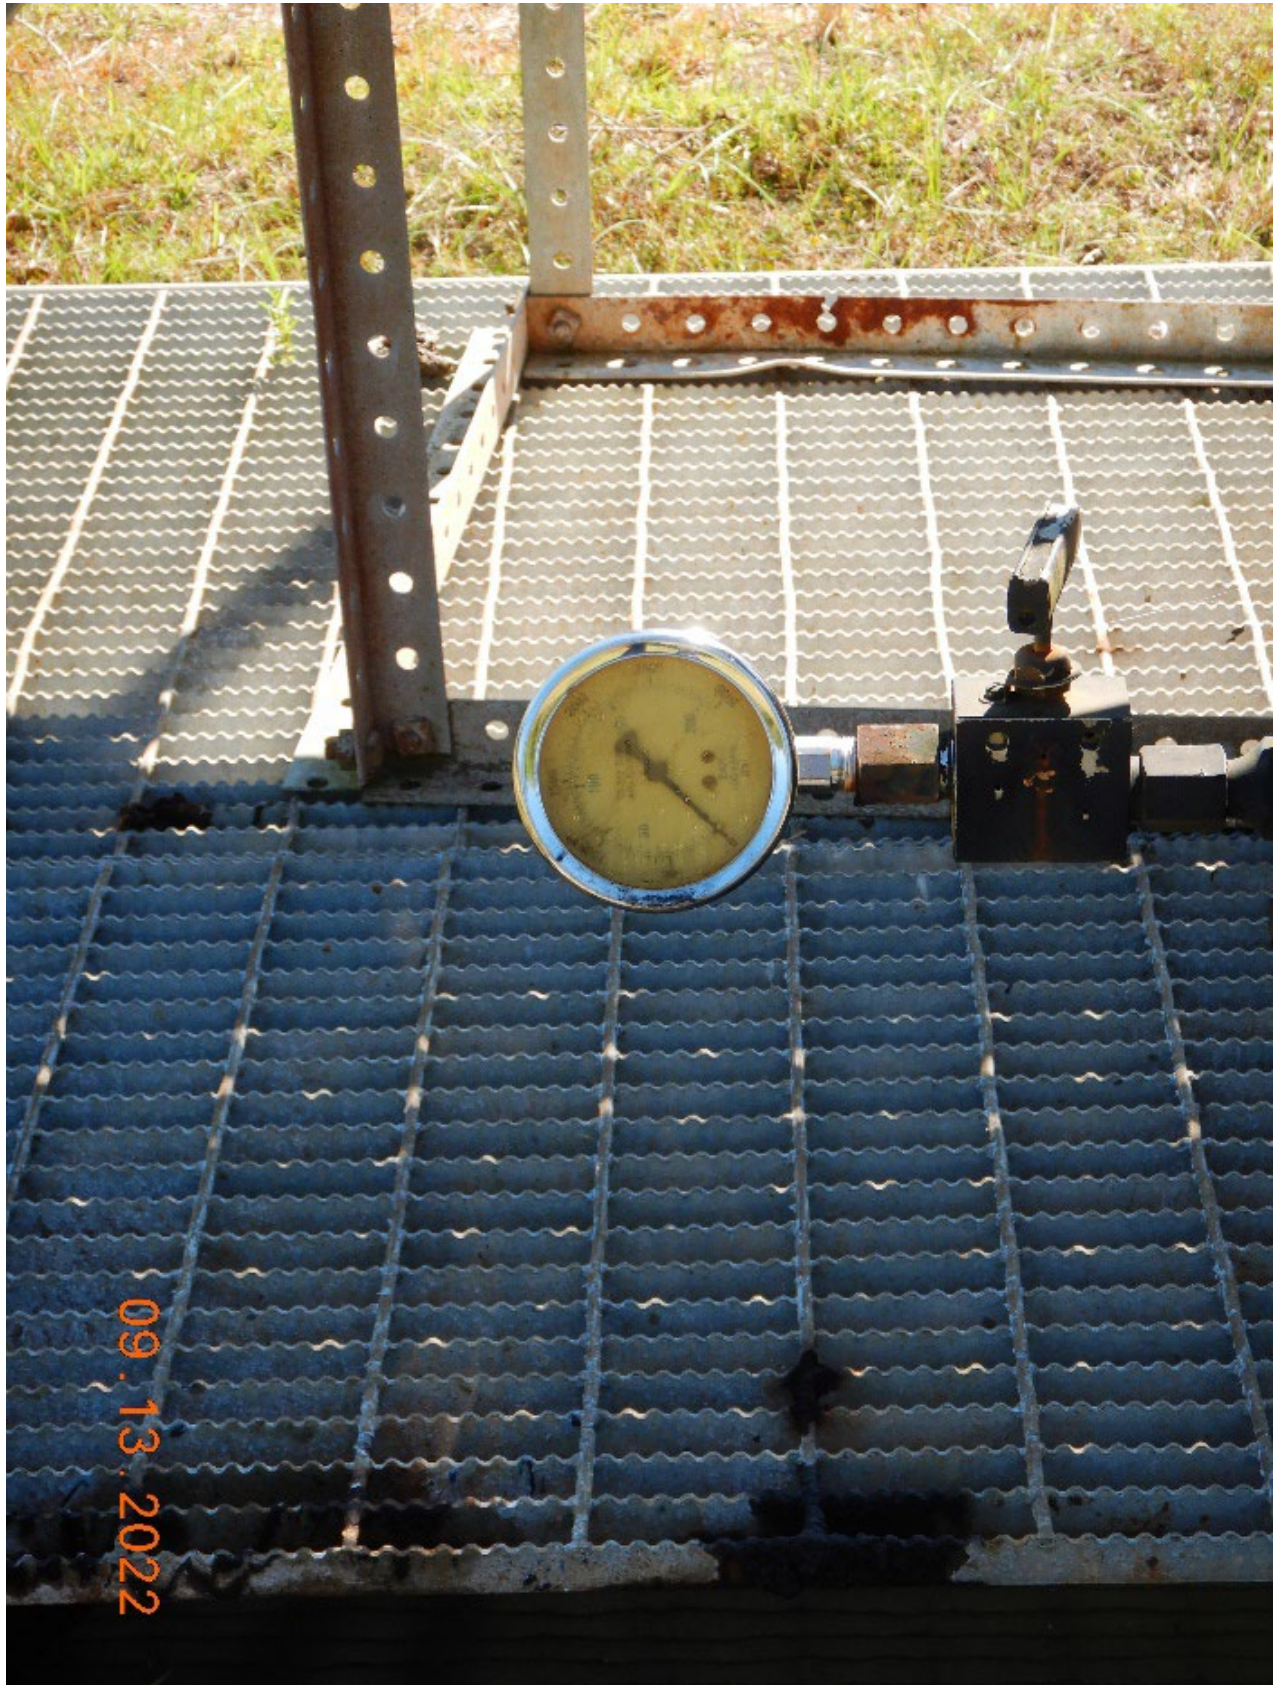

Photograph 3: Looking east, closeup view of surface casing pressure gauge reading 0 psi.



Photograph 4: Looking east, closeup view of internal pressure gauge reading 0 psi.



Photograph 5: Looking southeast, closeup view of internal pressure gauge reading 250 psi.