



## Clean Water Act Section 404: Site Visit/Case Development

For inspections authorized pursuant to Clean Water Act sections 308 and 404 (33 U.S.C. §§ 1318 and 1344)

This report includes only factual information gained by documentation, onsite observations, and/or onsite interviews.

|                                                   |                                                                            |                              |                                                                     |                                                                           |                   |
|---------------------------------------------------|----------------------------------------------------------------------------|------------------------------|---------------------------------------------------------------------|---------------------------------------------------------------------------|-------------------|
| Inspector Name(s)                                 | Chelsey Sherwood                                                           | Time In                      | 8:35 AM                                                             | Start Date                                                                | February 28, 2024 |
|                                                   |                                                                            | Time Out                     | 10:30 AM                                                            | End Date                                                                  | February 28, 2024 |
| Inspector's Organization                          | EPA Region 6, Enforcement and Compliance Division, Water Resources Section |                              |                                                                     |                                                                           |                   |
| Organization Requesting Inspection (if different) | N/A                                                                        |                              |                                                                     |                                                                           |                   |
| Inspection Type                                   | Evaluation                                                                 | Inspection Status            | Original                                                            |                                                                           |                   |
| Site Name                                         | Greenwood 950, LLC-Walden Ferry Road                                       |                              |                                                                     |                                                                           |                   |
| Site Address*                                     | Walden Ferry Road                                                          |                              |                                                                     |                                                                           |                   |
| City*                                             | Greenwood                                                                  | County*                      | Caddo                                                               | State*                                                                    | LA                |
|                                                   |                                                                            |                              |                                                                     | Zip Code*                                                                 | 71033             |
| Mailing Address*                                  | 1048 Adner Road                                                            |                              |                                                                     |                                                                           |                   |
| City*                                             | Haughton                                                                   | County*                      | Bossier                                                             | State*                                                                    | LA                |
|                                                   |                                                                            |                              |                                                                     | Zip Code*                                                                 | 71037             |
| Latitude*                                         | 32.448673                                                                  | Longitude*                   | -94.018924                                                          |                                                                           |                   |
| Estimated Size of Site (acres)                    | 105                                                                        | Is there a home on the site? | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |                                                                           |                   |
| Inspector Signature                               | CHELSEY SHERWOOD                                                           |                              |                                                                     | Digitally signed by CHELSEY SHERWOOD<br>Date: 2024.04.25 08:14:23 -05'00' |                   |
|                                                   |                                                                            |                              |                                                                     | Date                                                                      | 4/24/2024         |
| Supervisor Signature                              | Craig Young                                                                |                              |                                                                     | Date                                                                      | 04/25/2024        |

## Clean Water Act Section 404: Site Visit/Case Development

For inspections authorized pursuant to Clean Water Act sections 308 and 404 (33 U.S.C. §§ 1318 and 1344)

|                                                                                                                                                                                                                                                                                                                                                   |                                      |            |                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|------------|-------------------|
| Site Name                                                                                                                                                                                                                                                                                                                                         | Greenwood 950, LLC-Walden Ferry Road | Start Date | February 28, 2024 |
|                                                                                                                                                                                                                                                                                                                                                   |                                      | End Date   | February 28, 2024 |
| Inspection Purpose                                                                                                                                                                                                                                                                                                                                | Initial site visit                   |            |                   |
| <b>Opening Conference</b>                                                                                                                                                                                                                                                                                                                         |                                      |            |                   |
| <input checked="" type="checkbox"/> Presentation of Inspector Credentials                                                                                                                                                                                                                                                                         |                                      |            |                   |
| Name and Title (Use N/A if owner/operator not available to join the inspection)                                                                                                                                                                                                                                                                   |                                      |            |                   |
| Yes, I presented these to Mr. David Poston and explained why the EPA and USACE were there.                                                                                                                                                                                                                                                        |                                      |            |                   |
| <input checked="" type="checkbox"/> Opening Conference                                                                                                                                                                                                                                                                                            |                                      |            |                   |
| Name of person authorizing access if applicable                                                                                                                                                                                                                                                                                                   |                                      |            |                   |
| Mr. David Poston                                                                                                                                                                                                                                                                                                                                  |                                      |            |                   |
| Notes from Opening Conference                                                                                                                                                                                                                                                                                                                     |                                      |            |                   |
| We explained to Mr. Poston the reason for our site visit and concerns.                                                                                                                                                                                                                                                                            |                                      |            |                   |
| <input type="checkbox"/> Access Issues if Any                                                                                                                                                                                                                                                                                                     |                                      |            |                   |
| Describe                                                                                                                                                                                                                                                                                                                                          |                                      |            |                   |
| N/A                                                                                                                                                                                                                                                                                                                                               |                                      |            |                   |
| <b>Inspection Observations and Sample Collection</b>                                                                                                                                                                                                                                                                                              |                                      |            |                   |
| Site Owner/Site Operator/Responsible Party (Name, title and contact information)                                                                                                                                                                                                                                                                  |                                      |            |                   |
| Mr. David Poston. Email: davidposton59@gmail.com Phone number: 318-426-0528                                                                                                                                                                                                                                                                       |                                      |            |                   |
| Additional Persons Present at Inspection                                                                                                                                                                                                                                                                                                          |                                      |            |                   |
| Durham Norman and Bryton Hixson from Vicksburg District of U.S. Army Corps of Engineers (COE).                                                                                                                                                                                                                                                    |                                      |            |                   |
| General Site Characteristics (layout of property, etc.)                                                                                                                                                                                                                                                                                           |                                      |            |                   |
| The project is located north and south of Walden Ferry Road. There is a stream that flows south to north with several wetlands in the project area. The large wetland north of Walden Ferry Road was originally planted with pine for timber, but has since been flooded. Refer to map attachments for details.                                   |                                      |            |                   |
| Purpose and Need for Discharge of Dredged and/or Fill Material                                                                                                                                                                                                                                                                                    |                                      |            |                   |
| Mr. Poston said that the reason for the water control structures north of Walden Ferry Road was for selling water for fracking as he made more money doing that then using the land as timber. He said the work done south of the road, which consisted of digging out and channelizing a stream and building a large berm was for flood control. |                                      |            |                   |
| Site Overview (Past inspections, site description, permits, etc.)                                                                                                                                                                                                                                                                                 |                                      |            |                   |
| Vicksburg District COE has previously done inspections on this site.                                                                                                                                                                                                                                                                              |                                      |            |                   |
| Scope of Inspection (Areas inspected or not inspected)                                                                                                                                                                                                                                                                                            |                                      |            |                   |
| We inspected the work done south and north of Walden Ferry Road, which consisted of looking at the large berm created, channelized stream, filled wetlands, and water control structures. See photos and maps for details.                                                                                                                        |                                      |            |                   |

## Clean Water Act Section 404: Site Visit/Case Development

For inspections authorized pursuant to Clean Water Act sections 308 and 404 (33 U.S.C. §§ 1318 and 1344)

|                                                                                                                                                                                                                                                                                                                                                                     |                                      |            |                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|------------|-------------------|
| Site Name                                                                                                                                                                                                                                                                                                                                                           | Greenwood 950, LLC-Walden Ferry Road | Start Date | February 28, 2024 |
|                                                                                                                                                                                                                                                                                                                                                                     |                                      | End Date   | February 28, 2024 |
| Environmental Conditions (e.g., wind, rain, smoke, dust, temperature, snow)                                                                                                                                                                                                                                                                                         |                                      |            |                   |
| ~59 degrees F, cloudy                                                                                                                                                                                                                                                                                                                                               |                                      |            |                   |
| Field Work Conducted                                                                                                                                                                                                                                                                                                                                                |                                      |            |                   |
| We observed the stream, wetlands, berm, and water control structures in the project site and took photos for documentation.                                                                                                                                                                                                                                         |                                      |            |                   |
| <b>Closing Conference</b>                                                                                                                                                                                                                                                                                                                                           |                                      |            |                   |
| Documents Received and/or Requested During the Inspection                                                                                                                                                                                                                                                                                                           |                                      |            |                   |
| N/A                                                                                                                                                                                                                                                                                                                                                                 |                                      |            |                   |
| Compliance Assistance Provided (If any)                                                                                                                                                                                                                                                                                                                             |                                      |            |                   |
| We explained that a Section 404 permit was needed for the work conducted in Waters of the United States.                                                                                                                                                                                                                                                            |                                      |            |                   |
| Observations Relayed to Site Owner/Operator                                                                                                                                                                                                                                                                                                                         |                                      |            |                   |
| N/A                                                                                                                                                                                                                                                                                                                                                                 |                                      |            |                   |
| Actions Taken by Owner/Operator During the Inspection (If any)                                                                                                                                                                                                                                                                                                      |                                      |            |                   |
| N/A                                                                                                                                                                                                                                                                                                                                                                 |                                      |            |                   |
| Potential Issues of Concern Including Regulatory Citations                                                                                                                                                                                                                                                                                                          |                                      |            |                   |
| A Section 404 permit was not obtained for the discharge of fill material into streams and wetlands. There have been complaints regarding flooding over the road. There are also concerns with impacts to streams and wetland due to the water control structures and the large berm and stream being channelized potentially impeding flow. See photos for details. |                                      |            |                   |
| <b>Attachments*</b>                                                                                                                                                                                                                                                                                                                                                 |                                      |            |                   |
| <input checked="" type="checkbox"/> Maps and Sketches<br><input checked="" type="checkbox"/> Photographs (including location) and Photo Log<br><input type="checkbox"/> Other (SSIP, Wetlands Delineation Forms, etc.)                                                                                                                                              |                                      |            |                   |
| Appendix 1                                                                                                                                                                                                                                                                                                                                                          |                                      |            |                   |
| <b>Additional Notes</b>                                                                                                                                                                                                                                                                                                                                             |                                      |            |                   |
| This case has been referred to EPA.                                                                                                                                                                                                                                                                                                                                 |                                      |            |                   |

## Appendix 1

### Photograph Log



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 1

|                                 |                      |                  |
|---------------------------------|----------------------|------------------|
| Location: 32.442687, -94.017437 |                      |                  |
| City: Greenwood                 | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                               |
|-----------------|------------------------|------------------|---------------------------------------------------------------------------------------------------------------------------|
| DSCN6300.JPG    | 02/28/2024, 8:36 AM    | Chelsey Sherwood | Showing stream channel and wetland area. Note the standing dead timber. Picture taken from road facing downstream, north. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 2

|                                 |                      |                  |
|---------------------------------|----------------------|------------------|
| Location: 32.442653, -94.017408 |                      |                  |
| City: Greenwood                 | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                              |
|-----------------|------------------------|------------------|------------------------------------------------------------------------------------------|
| DSCN6301.JPG    | 02/28/2024, 8:36 AM    | Chelsey Sherwood | Showing stream channel and wetland area. Picture taken from road facing upstream, south. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 3

|                                 |                      |                  |
|---------------------------------|----------------------|------------------|
| Location: 32.442653, -94.017408 |                      |                  |
| City: Greenwood                 | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                          |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------------------|
| DSCN6302.JPG    | 02/28/2024, 8:37 AM    | Chelsey Sherwood | Showing the oil sheen in the stream. Picture taken from road facing upstream, south. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 4

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44257, -94.01779 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                  |
|-----------------|------------------------|------------------|------------------------------------------------------------------------------|
| DSCN6303.JPG    | 02/28/2024, 8:39 AM    | Chelsey Sherwood | Showing stressed vegetation in wetland area. Picture taken facing southeast. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 5

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44145, -94.0179 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                                                                      |
|-----------------|------------------------|------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| DSCN6304.JPG    | 02/28/2024, 9:03 AM    | Chelsey Sherwood | Showing excavated stream channel. Original channel is circled in red. Note the excessive sediment deposition. Picture taken from the berm that was built facing south, upstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 6

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44145, -94.0179 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                   |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------------------------------------------------------|
| DSCN6305.JPG    | 02/28/2024, 9:04 AM    | Chelsey Sherwood | Showing excavated channel through stream and wetland area. Note the excessive sediment deposition. Picture taken facing east. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 7

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44145, -94.0179 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                           |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------------------------------|
| DSCN6306.JPG    | 02/28/2024, 9:04 AM    | Chelsey Sherwood | Showing stream channel that has been excavated and culverted. Picture taken facing north, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 8

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44145, -94.0179 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                         |
|-----------------|------------------------|------------------|---------------------------------------------------------------------------------------------------------------------|
| DSCN6307.JPG    | 02/28/2024, 9:05 AM    | Chelsey Sherwood | Showing excavated channel through stream and wetland area from on top of the berm built. Picture taken facing west. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 9

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44145, -94.0179 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                              |
|-----------------|------------------------|------------------|------------------------------------------------------------------------------------------------------------------------------------------|
| DSCN6308.JPG    | 02/28/2024, 9:08 AM    | Chelsey Sherwood | Showing wetland area. Note the water marks and sediment on trees and <i>Juncus</i> . Picture taken facing northwest from on top of berm. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 10

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44149, -94.01871 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                      |
|-----------------|------------------------|------------------|----------------------------------------------------------------------------------------------------------------------------------|
| DSCN6309.JPG    | 02/28/2024, 9:11 AM    | Chelsey Sherwood | Showing wetland area. Note there originally was a stream channel in this area indicated by red arrow. Picture taken facing west. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 11

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44149, -94.01871 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                                       |
|-----------------|------------------------|------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|
| DSCN6310.JPG    | 02/28/2024, 9:12 AM    | Chelsey Sherwood | Showing wetland area and berm that was built (circled in red) through the wetland and stream severing connection. Picture taken facing southwest. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 12

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44149, -94.01871 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                                   |
|-----------------|------------------------|------------------|-----------------------------------------------------------------------------------------------------------------------------------------------|
| DSCN6311.JPG    | 02/28/2024, 9:12 AM    | Chelsey Sherwood | Showing wetland area and berm that was built (circled in red) through the wetland and stream severing connection. Picture taken facing south. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 13

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44149, -94.01871 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                              |
|-----------------|------------------------|------------------|----------------------------------------------------------------------------------------------------------|
| DSCN6312.JPG    | 02/28/2024, 9:12 AM    | Chelsey Sherwood | Showing wetland area. Note water lines on trees and sediment deposition. Picture taken facing northeast. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 14

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44149, -94.01871 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                               |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------------------|
| DSCN6313.JPG    | 02/28/2024, 9:13 AM    | Chelsey Sherwood | Showing wetland area and where originally there was a stream. Picture taken facing north. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 15

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44236, -94.01829 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                             |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------|
| DSCN6314.JPG    | 02/28/2024, 9:17 AM    | Chelsey Sherwood | Showing stream and wetland area. Picture taken facing east, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 16

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44236, -94.01829 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                    |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------------------------------------------------------------|
| DSCN6315.JPG    | 02/28/2024, 9:18 AM    | Chelsey Sherwood | Showing wetland area and where there appeared to have been a stream channel south of the road. Picture taken facing southwest. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 17

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44249, -94.01821 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                        |
|-----------------|------------------------|------------------|----------------------------------------------------------------------------------------------------|
| DSCN6316.JPG    | 02/28/2024, 9:19 AM    | Chelsey Sherwood | Showing wetland area and stream channel north of the road. Picture taken facing north, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 18

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44249, -94.01821 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                              |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------------------------------------------------------|
| DSCN6317.JPG    | 02/28/2024, 9:19 AM    | Chelsey Sherwood | Showing wetland area and channel that parallels road. Note the sediment deposition. Picture taken facing west, upstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 19

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44272, -94.01878 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                |
|-----------------|------------------------|------------------|----------------------------------------------------------------------------|
| DSCN6318.JPG    | 02/28/2024, 9:22 AM    | Chelsey Sherwood | Showing filamentous algae, orange-colored sediments, and sheen in wetland. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 20

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44272, -94.01878 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                              |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------|
| DSCN6319.JPG    | 02/28/2024, 9:24 AM    | Chelsey Sherwood | Showing stressed vegetation in wetland area. Picture taken facing north. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 21

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44286, -94.01709 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                   |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------|
| DSCN6320.JPG    | 02/28/2024, 9:31 AM    | Chelsey Sherwood | Showing wetland area and stressed vegetation. Picture taken facing northeast. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 22

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44869, -94.01882 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                               |
|-----------------|------------------------|------------------|---------------------------------------------------------------------------------------------------------------------------|
| DSCN6321.JPG    | 02/28/2024, 9:57 AM    | Chelsey Sherwood | Showing flood control structure gate and the stream and wetland complex. Note the dead trees. Picture taken facing south. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 23

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44869, -94.01882 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                              |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------------------------------------------------------|
| DSCN6322.JPG    | 02/28/2024, 9:57 AM    | Chelsey Sherwood | Showing flood control structure gate and the stream and wetland complex. Note the dead trees. Picture taken facing west. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 24

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44869, -94.01882 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                                                 |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|
| DSCN6323.JPG    | 02/28/2024, 9:57 AM    | Chelsey Sherwood | Showing stream and wetland complex. The red arrow shows approximate location of where stream channel flows. Note the dead trees. Picture taken facing east. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 25

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44869, -94.01882 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                   |
|-----------------|------------------------|------------------|-------------------------------------------------------------------------------|
| DSCN6324.JPG    | 02/28/2024, 10:00 AM   | Chelsey Sherwood | Showing flood control structure gate. Picture taken facing north, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 26

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44869, -94.01882 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                 |
|-----------------|------------------------|------------------|-----------------------------------------------------------------------------|
| DSCN6325.JPG    | 02/28/2024, 10:04 AM   | Chelsey Sherwood | Showing stream channel and wetland complex. Picture taken facing southeast. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 27

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44891, -94.01889 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                          |
|-----------------|------------------------|------------------|--------------------------------------------------------------------------------------|
| DSCN6326.JPG    | 02/28/2024, 10:07 AM   | Chelsey Sherwood | Showing stream channel outflow from culvert. Picture taken facing north, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 28

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44891, -94.01889 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                        |
|-----------------|------------------------|------------------|------------------------------------------------------------------------------------|
| DSCN6327.JPG    | 02/28/2024, 10:07 AM   | Chelsey Sherwood | Showing stream channel outflow from culvert. Picture taken facing south, upstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 29

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44882, -94.01975 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                       |
|-----------------|------------------------|------------------|-----------------------------------------------------------------------------------------------------------------------------------|
| DSCN6328.JPG    | 02/28/2024, 10:09 AM   | Chelsey Sherwood | Showing stream channel outflow from culvert. Note fill on river left and in stream channel. Picture taken facing north, upstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

## Photograph Log

Photo No. 30

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44882, -94.01975 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                       |
|-----------------|------------------------|------------------|-------------------------------------------------------------------|
| DSCN6329.JPG    | 02/28/2024, 10:10 AM   | Chelsey Sherwood | Showing flood control gate. Picture taken facing south, upstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 31

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44861, -94.01974 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                       |
|-----------------|------------------------|------------------|---------------------------------------------------------------------------------------------------|
| DSCN6330.JPG    | 02/28/2024, 10:11 AM   | Chelsey Sherwood | Showing flood control gate and culvert. Note fill material in channel. Picture taken facing east. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 32

|                               |                      |                  |
|-------------------------------|----------------------|------------------|
| Location: 32.44853, -94.01966 |                      |                  |
| City: Greenwood               | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                               |
|-----------------|------------------------|------------------|-----------------------------------------------------------------------------------------------------------|
| DSCN6331.JPG    | 02/28/2024, 10:12 AM   | Chelsey Sherwood | Showing flood control gate. Note debris piled around and on top of gate. Picture taken south, downstream. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 33

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44862, -94.0192 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |



| Photo File Name | Date and Time of Photo | Photographer     | Description                                                                                                                  |
|-----------------|------------------------|------------------|------------------------------------------------------------------------------------------------------------------------------|
| DSCN6332.JPG    | 02/28/2024, 10:13 AM   | Chelsey Sherwood | Showing broken concrete and asphalt placed along and in the channel between the two flood control gates. Picture taken east. |



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Photograph Log

Photo No. 34

|                              |                      |                  |
|------------------------------|----------------------|------------------|
| Location: 32.44862, -94.0192 |                      |                  |
| City: Greenwood              | County/Parish: Caddo | State: Louisiana |




| Photo File Name | Date and Time of Photo | Photographer     | Description                                             |
|-----------------|------------------------|------------------|---------------------------------------------------------|
| DSCN6333.JPG    | 02/28/2024, 10:14 AM   | Chelsey Sherwood | Showing flood control gate. Picture taken facing south. |

# Greenwood 950, LLC Walden Ferry Road



4/24/2024, 10:11:58 AM

● PhotoLocationsGreenwood950LLCWalendFerryRoad1

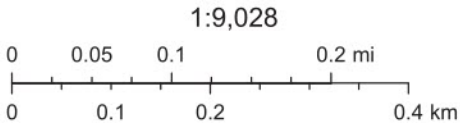


© 2024 Microsoft Corporation © 2024 Maxar ©CNES (2024) Distribution  
Airbus DS © 2024 TomTom

# Greenwood 950, LLC Walden Ferry Road



4/24/2024, 10:04:21 AM

● PhotoLocationsGreenwood950LLCWalendFerryRoad1

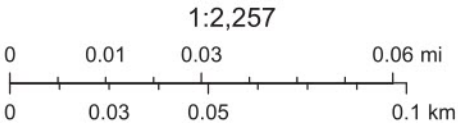


© 2024 Microsoft Corporation © 2024 Maxar ©CNES (2024) Distribution  
Airbus DS © 2024 TomTom

Greenwood 950, LLC Walden Ferry Road




4/24/2024, 10:07:55 AM

● PhotoLocationsGreenwood950LLCWalendFerryRoad1

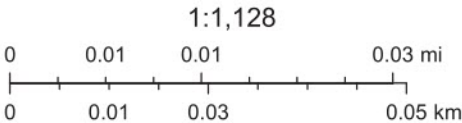

© 2024 Microsoft Corporation © 2024 Maxar ©CNES (2024) Distribution  
Airbus DS © 2024 TomTom

Downstream Analysis Greenwood 950, LLC Walden Ferry Road

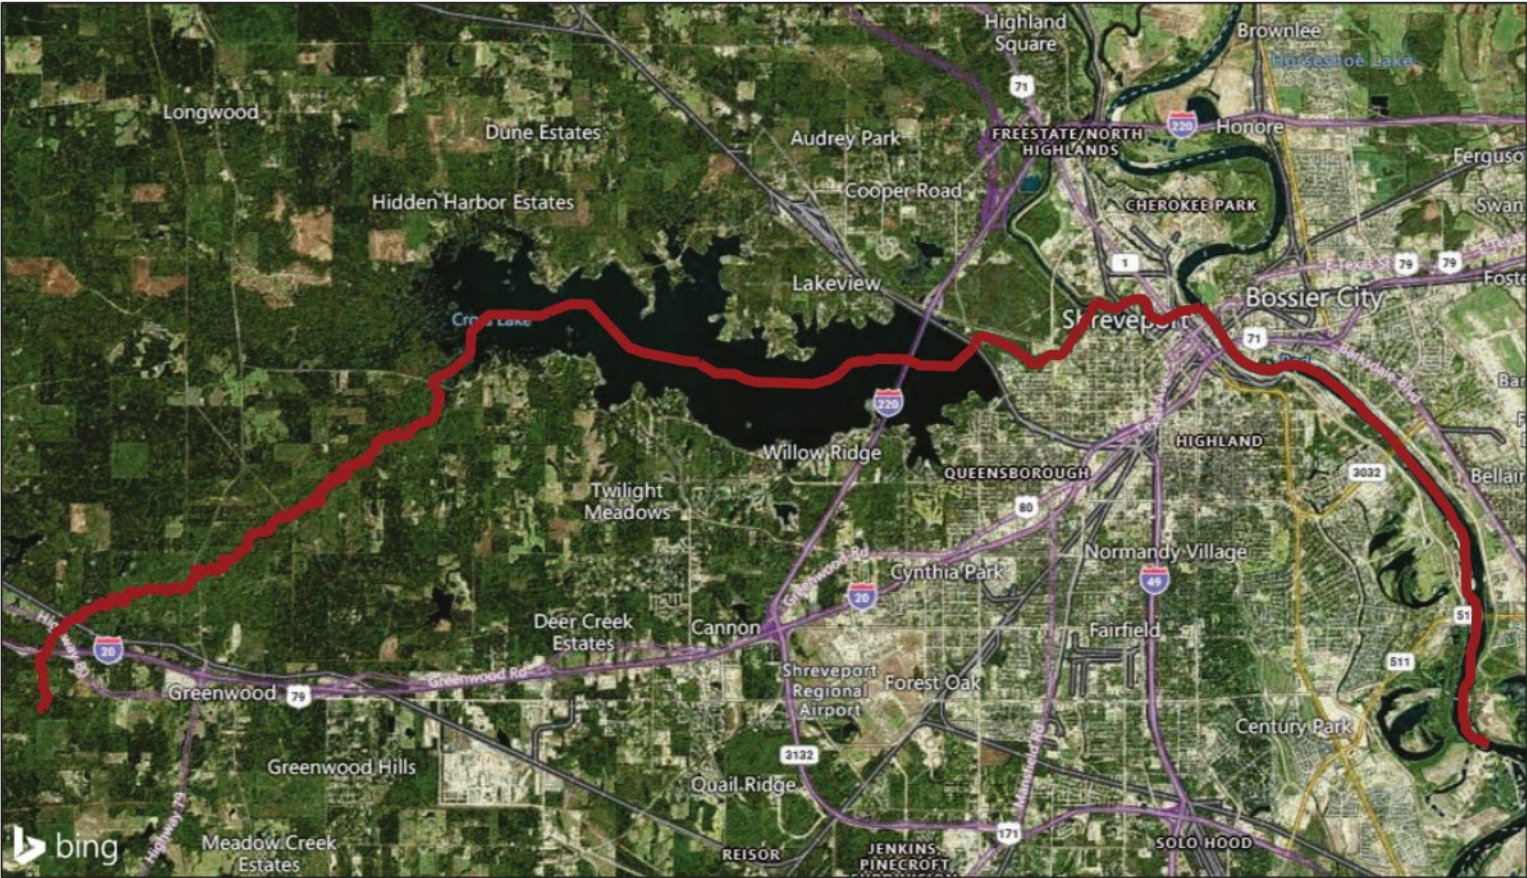

4/24/2024, 10:15:51 AM

- ResultLinkPath
- ResultStreamsSelected

