

AR226-1509

SAMPLING INVESTIGATION RESULTS LITTLE HOCKING WATER ASSOCIATION WELL FIELD WASHINGTON COUNTY, OHIO

Date: April 2003

Project No.: 7482
18983762.00010



CORPORATE REMEDIATION GROUP
*An Alliance between
DuPont and URS Diamond*

Barley Mill Plaza, Building 27
Wilmington, Delaware 19805

000438

CONTAIN NO CBI

WVDEP 17571

TABLE OF CONTENTS

Executive Summary	iii
1.0 Introduction.....	1
2.0 Environmental Setting	3
2.1 Geology.....	3
2.2 Hydrogeology.....	4
3.0 Sampling Approach	5
4.0 Groundwater Sample Results.....	6
4.1 C-8 in Groundwater from Temporary Borings	6
4.2 C-8 in Groundwater from Production and Test Wells.....	6
4.3 Groundwater Elevations in Production and Test Wells and Ohio River Stage.....	8
5.0 Soil Sample Results	9
6.0 Site Conceptual Model.....	10
6.1 Geology.....	10
6.2 Hydrogeology.....	10
6.3 C-8 Transport Mechanisms and Migration Pathways.....	11
7.0 Conclusions and Recommendations	13
8.0 References.....	15

TABLES

Table 1	C-8 in Groundwater from Temporary Borings
Table 2	C-8 in Production and Test Wells
Table 3	Groundwater Elevation Data for Production and Test Wells August 21, 2002
Table 4	C-8 in Soil from Temporary Borings

000439

FIGURES

Figure 1	Site Location Map
Figure 2	Production and Test Well Locations
Figure 3	C-8 in Groundwater - January 2002
Figure 4	Idealized Ohio River Valley Cross-Section and Block Diagram
Figure 5	Generalized Geologic Cross-Section at River Mile 190
Figure 6	Temporary Boring Locations
Figure 7	C-8 Concentration Ranges in Groundwater
Figure 8	Groundwater Elevation Contour Map – August 2002
Figure 9	C-8 Concentration Ranges in Soil
Figure 10	Cross-section Location Map
Figure 11	Cross-section A-A'
Figure 12	Cross-section B-B'
Figure 13	Cross-section C-C'

APPENDICES

Appendix A	C-8 Analytical Reporting
Appendix B	Geologic Logs for Little Hocking Water Association Well Field Temporary Borings
Appendix C	Geologic Logs for Production and Test Wells (Provided by Little Hocking)

000440

EXECUTIVE SUMMARY

DuPont conducted a field investigation of the Little Hocking Water Association well field in August 2002 in order to delineate ammonium perfluorooctanoate (C-8) concentrations in soil and groundwater near a test well, TW-4. Groundwater sampled from TW-4 in 2002 showed a C-8 concentration range of 12.3 to 37.1 ug/L. This report summarizes the work performed, presents results, and provides conclusions and recommendations.

Recently, pursuant to a multi-media consent order issued by the West Virginia Departments of Environmental Protection and Health and Human Resources to DuPont on November 15, 2001 (Order No. GWR-2001-019; Consent Order), DuPont had submitted summary reports to the Ohio Environmental Protection Agency detailing the off-site investigation activities near the Washington Works facility. These reports assessed media-specific C-8 transport from the facility and concluded that migration of air emissions is the only probable transport mechanism for C-8 found in the Little Hocking Water Association well field.

The field investigation of the Little Hocking Water Association well field focused on delineating depth-specific C-8 concentrations in soil and groundwater near TW-4. Concurrently, additional geoprobe borings, test wells and production wells were sampled in order to develop a site conceptual model for deposition and migration of C-8 in soil and groundwater at the Little Hocking Water Association well field. The following conclusions are drawn from the investigation results and other available data:

- ❑ All groundwater results are below the C-8 Assessment of Toxicity Team (CATT) established human health protective screening criteria for water (water C-8 SL; WVDEP 2002) of 150 ug/L.
- ❑ The C-8 concentrations in groundwater decreased with depth within the aquifer. The C-8 concentrations in groundwater at the top of the aquifer, within the silty clay, ranged from ND (<0.01 ug/L) to 78 ug/L, while C-8 concentrations at the bottom of the aquifer, within the sand and gravel, ranged from ND (<0.01 ug/L) to 8.58 ug/L (excluding results for TW-4).
- ❑ Consistently high pH values measured in TW-4 and other field observations indicate that this test well's construction is likely compromised, possibly due to a failed grout seal or to a failed well casing. Higher concentrations of C-8 measured in this well (ranging from 12.3 to 37.1 ug/L) are likely attributed to shallow groundwater that contains higher C-8 concentrations migrating downward into the deeper monitoring zone or into the well itself, which could happen if the grout seal or the well casing were to have failed. C-8 concentrations measured in this well are not likely to be truly representative of the deep aquifer.
- ❑ Drinking water is pumped from the bottom of the sand and gravel aquifer through the four production wells. The highest C-8 concentration measured in the four production wells was 8.58 ug/L, significantly lower than the human health protective water C-8 SL. The C-8 results for finished water, a combination of

waters from the production wells that is distributed to Little Hocking customers, ranged from 1.69 to 4.29 ug/L, also significantly lower than the water C-8 SL.

- ❑ All soil results are below the CATT-established human health protective screening criteria for soil (soil C-8 SL) of 240 mg/kg (WVDEP 2002). The highest soil C-8 concentration measured is 170 ug/kg (0.170 mg/kg). Most results for soil sampled below the water table are nondetectable.
- ❑ Overall, the very low concentrations of C-8 measured in the soils indicate that C-8 does not readily adsorb to soil, especially soils below the water table.
- ❑ C-8 results for soil and groundwater sampled immediately adjacent to TW-4 do not distinguish this test well as a source for higher C-8 concentrations in soil and groundwater.
- ❑ Overall, this investigation as completed, combined with the air emission modeling and groundwater modeling results and the available physiochemical data for C-8, are sufficient to understand the migration pathways of C-8 from the Washington Works facility and within the Little Hocking Water Association well field.
- ❑ Revised groundwater modeling by DuPont supports the previous conclusion that no potential groundwater migration pathway exists beneath the Ohio River to the Little Hocking Well field.
- ❑ Based on the current data available, DuPont believes the following pathway does exist. C-8 from the DuPont facility is transported via air emissions by wind and is deposited on the Little Hocking well field surface soils. Precipitation then leaches the C-8 downward through the unsaturated zone to the aquifer. Dissolved C-8 then migrates with groundwater within the aquifer. Groundwater containing low levels of C-8 is then pumped from the aquifer through the four production wells. Water from the production wells is mixed and the finished water, containing even lower levels of C-8, then enters the Little Hocking Water Association distribution system.
- ❑ This investigation as completed, combined with the overall understanding of C-8 migration pathways within the Little Hocking well field, is also sufficient to understand the distribution of C-8 in the test wells, including TW-4, in the production wells and in the finished water that enters the Little Hocking distribution system.
- ❑ In order to assess the impact of recent C-8 air emission reductions at the Washington Works facility, DuPont recommends continuing quarterly monitoring of C-8 in the four Little Hocking Water Association production wells and finished water for a period of two years.

1.0 INTRODUCTION

Pursuant to the multi-media consent order issued to DuPont on November 15, 2001 (Order No. GWR-2001-019; Consent Order), groundwater was sampled at public water supplies (PWS) along the Ohio River in West Virginia and Ohio. Groundwater was sampled to determine if releases of C-8 from the DuPont Washington Works facility (located in Washington, West Virginia) have impacted groundwater in the PWS. The PWS sampling was performed under the direction of the Groundwater Investigation Steering Team (GIST) which was established under the Consent Order. The Little Hocking Water Association well field, located across the Ohio River from the Washington Works facility in Washington County, Ohio, was included in this sampling. The locations of the Little Hocking Water Association well field and the DuPont Washington Works facility are shown in Figure 1.

Four production wells at the Little Hocking Water Association well field (LHPSD1 through 4) were sampled in December 2001. The C-8 concentrations measured in the production wells ranged from 0.844 to 7.66 ug/L. To better understand the distribution of C-8 in the Little Hocking well field, a more extensive sampling event was conducted in January 2002, that included the sampling of finished water (the water distributed to customers) and booster station sampling points, and groundwater from all production and test wells in the well field. The locations of the production and test wells sampled in the Little Hocking well field are shown in Figure 2.

A total of 19 groundwater samples, including one duplicate, were collected and analyzed from Little Hocking during the January 2002 sampling event. The concentrations of C-8 in finished water and booster station sampling points ranged from 1.69 to 1.94 ug/L. The C-8 concentrations measured for the production wells ranged from 0.744 to 6.22 ug/L. The C-8 results for nine of the ten test wells ranged from 0.364 to 4.48 ug/L. In test well 4 (TW-4), the concentration measured was 37.1 ug/L. Figure 3 shows the January 2002 distribution of C-8 results in the production and test wells. Based on the elevated result at TW-4 compared to the surrounding wells, the Ohio Environmental Protection Agency (OEPA) requested that DuPont conduct a focused field investigation to delineate C-8 concentrations in soil and groundwater near TW-4.

In August 2002, DuPont conducted the field investigation at the Little Hocking Water Association well field. During this investigation, the following activities were performed:

- ☐ Advanced ten temporary soil borings
- ☐ Continuously monitored geologic information during the advancement of the ten temporary borings
- ☐ Sampled soil and groundwater and monitored groundwater parameters at various depths within the temporary borings

- ☐ Sampled groundwater in all production and test wells and recorded groundwater elevations
- ☐ Measured Ohio River stage

The C-8 Assessment of Toxicity Team (CATT), was assembled as required by the Consent Order to establish human health protective screening criteria for water (water C-8 SL) and for soil (soil C-8 SL). In August 2002, while the field investigation was being conducted at Little Hocking, the CATT issued its final report and established the water C-8 SL at 150 ug/L and the soil C-8 SL at 240 mg/kg (WVDEP, 2002).

Following the completion of the field activities at Little Hocking, groundwater samples were analyzed to measure C-8 concentrations. C-8 analytical results for groundwater were then compared to the CATT-established water C-8 SL. In August 2002, an analytical method for measuring C-8 in soils was still under development; therefore, soils sampled during the investigation were placed on-hold in a secure manner. The method development was completed in February 2003. C-8 analytical results for soils were finalized in March 2003. C-8 analytical results for soil were then compared to the CATT-established soil C-8 SL. The analytical results were then evaluated in conjunction with geologic data available from Little Hocking Water Association and with geological data obtained from the temporary borings. A site conceptual model was then developed.

This report documents the field investigation activities and the results of the investigation. In this report, the following sections are discussed:

- ☐ Environmental Setting (Section 2)
- ☐ Sampling Approach (Section 3)
- ☐ Groundwater Results (Section 4)
- ☐ Soil Sample Results (Section 5)
- ☐ The Little Hocking Site Conceptual Model (Section 6)
- ☐ Conclusions and Recommendations (Section 7)
- ☐ References (Section 8)

000444

2.0 ENVIRONMENTAL SETTING

2.1 Geology

The Little Hocking well field is located in the Ohio River Valley and consists of Quaternary alluvial sediments that overlie the Permian-aged Dunkard Group. The two predominant facies of the Ohio River alluvium that have been identified in this area include coarse-grained Ohio River Alluvium (Pleistocene-aged glacial outwash deposits) and fine-grained Ohio River Alluvium [Holocene overbank deposits (Simard, 1989)]. The Pleistocene deposits consist primarily of coarse-grained sand and gravel while the Holocene deposits consist primarily of interbedded and laminated silt, clay and fine-grained sand. The Dunkard Group (bedrock) consists primarily of red and varicolored sandy shale; gray, green and brown sandstone; gray and light-gray siltstone; and minor beds of coal, claystone, black carbonaceous shale and limestone.

The facies of the Ohio River Alluvium formed in response to the glacial advances and retreats of the pre-, early- and late-Wisconsinan and were deposited as successive phases of aggradation and degradation of river valley alluvial materials. The coarse-grained Pleistocene alluvium was deposited as glacial outwash during the primary valley aggradation event following the glacial scouring of the valley into the bedrock floor. During the subsequent degradation and aggradation cycles of the Pleistocene, the glacial outwash sediments were partially removed, re-worked and then redeposited to a lower elevation than the previous cycle, thus forming a terrace. This process formed a series of Pleistocene-aged terrace surfaces within the Ohio River Valley. These surfaces were designated (youngest to oldest) as S4, S5, and S6 by Simard. With each subsequent degradation/aggradation cycle, additional fines were incorporated into the Pleistocene deposits due to continual influx of finer-grained fluvial sediments from tributaries of the Ohio River. As a result, the Pleistocene deposits become more highly re-worked and progressively finer-grained toward the center of the river valley, particularly in locations downstream of significant tributaries (Simard, 1989). The total thickness of Pleistocene sediments at Washington Bottom (located immediately south across the Ohio River from Little Hocking in West Virginia) ranges from about 80 feet beneath the highest Pleistocene terrace surfaces to about 15 feet beneath the current channel of the Ohio River.

The Pleistocene alluvial deposits are overlain by the finer-grained Holocene sediments. The silts, clays, and fine sands were deposited on the surface of the Pleistocene terraces as well as on a series of more recent floodplains, which formed in the center of the Ohio River Valley during the Holocene. The thickness of the Holocene sediments typically ranges from 5 to 15 feet over the Pleistocene terrace surfaces and 25 to 35 feet over the Holocene floodplains. Simard designated the Holocene floodplain surfaces as S1 through S3 and the modern floodplain of the Ohio River as S0. Figure 4, modified from Simard (1989), is a block diagram and idealized cross-section through the Ohio River valley depicting the complex set of Pleistocene terraces and Holocene floodplains which have formed in the valley.

A generalized north-south cross-section from the Little Hocking Water Association well field in Ohio, through the Ohio River and across the Washington Works facility, is presented in Figure 5. This cross-section shows the floodplain and terrace surfaces, the Holocene silt and clay overbank deposits overlying the Pleistocene sand and gravel outwash deposits and the re-worked Pleistocene alluvium in the center of the river valley. The alluvial terrace deposits are underlain by a flat, river-scoured bedrock surface of the Dunkard Group that rises steeply and forms the valley walls to the North of Little Hocking Water Association and to the south of the Washington Works facility (Figure 1).

2.2 Hydrogeology

Groundwater supplies in the region are obtained from the Dunkard Group bedrock and Ohio River alluvial terrace deposits. However, the saturated portion of the Ohio River alluvial terrace deposits comprise the principal regional aquifer used for water supply purposes. Production wells completed in this aquifer have been known to yield up to 500 gallons per minute (Schultz, 1984). Based on these high yields, numerous industrial and commercial water supply companies obtain water from the alluvial aquifer.

The Ohio River Alluvial Aquifer is the primary water-table aquifer in the area. This aquifer occurs at a depth of 15 to 30 feet below ground surface in the Little Hocking well field. The saturated zone is approximately 30 to 40 feet thick, extending approximately to the surface of the underlying Dunkard Group bedrock. Numerous pumping tests have been completed in the alluvial aquifer in the Washington Bottom area as part of water supply investigations. The hydraulic conductivity of the alluvial aquifer in the area typically ranges from 100 to 300 ft./d (Legggette, Brashears & Graham, Inc., 1986; Burgess & Niple Ltd., 1988). In contrast, the hydraulic conductivity of the underlying Dunkard Group bedrock aquifer is typically between 0.05 and 5 ft./d (Kozar and Mathes, 2001).

Natural recharge to the alluvial aquifer comes from various sources, including:

- ☐ Infiltration of precipitation falling directly on the alluvium
- ☐ Lateral movement of the river water through the alluvium
- ☐ Seepage from stream tributaries that discharge to the Ohio River
- ☐ Surface run-off from the outcrop areas of the Dunkard Group, which form steep slopes adjacent to the uppermost Pleistocene terrace.

3.0 SAMPLING APPROACH

In order to evaluate the elevated C-8 concentrations in TW-4, DuPont implemented a focused sampling approach that delineated horizontally and vertically the C-8 concentrations in groundwater near this test well. This sampling plan was developed with assistance from the OEPA and was submitted to and approved by the OEPA in early August 2002 (DuPont, 2002a). The locations of temporary borings advanced are shown in Figure 5. TW-4 was used as the center point, and six radial sampling segments were established north, northeast, southeast, south, west, and northwest. Along each segment, soil and groundwater or only groundwater were sampled from the temporary borings. Figure 5 shows the locations of the two borings where soil and groundwater were sampled and the locations of the eight borings where only groundwater was sampled. In two borings where soil and groundwater were sampled, sampling was planned at the following depths from ground surface.

❑ Soil

- at the surface
- at 5-foot intervals below ground surface to the top of the sand and gravel aquifer (approximately 30 feet below grade)
- at 5-foot intervals from the top of the sand and gravel aquifer to the bottom of the aquifer (estimated at 50 to 55 feet below grade)
- at the geologic interfaces

❑ Groundwater

- at first encountered water (approximately 17 to 20 feet below grade)
- at 5-foot intervals from first encountered groundwater to the bottom of the sand and gravel aquifer (estimated at 50 to 55 feet below grade).
- at the geologic interfaces

At all other temporary boring locations, groundwater sampling was planned at two depths, at first encountered water (approximately 17 to 20 feet below grade) and at the bottom of the sand and gravel aquifer (estimated at 50 to 55 feet below grade).

In addition, DuPont scheduled the Consent Order-required 3Q02 PWS sampling event, which includes sampling the four production wells and TW-4 at Little Hocking, to coincide with the field investigation. The Little Hocking test wells, that are not required sampling points in the quarterly PWS sampling, were sampled as part of the field investigation, including TW-1 through TW-6 and TW-9 through TW-12 (Figure 2). Groundwater elevations were measured in the test and production wells prior to sampling the wells. Ohio River stage was also measured using the datum located on the Kraton Polymers property, located immediately east of the Little Hocking well field, with the assistance of a Senior Environmental Engineer from Kraton.

4.0 GROUNDWATER SAMPLE RESULTS

For groundwater sampled from production wells, test wells and the temporary borings, sampling was conducted as described in the Quality Assurance Project Plan (DuPont 2002b) and in the Sampling Investigation Plan for Little Hocking Water Association Well Field (DuPont, 2002a). Appendix A provides information on C-8 analytical reporting.

4.1 C-8 in Groundwater from Temporary Borings

Groundwater sampled at various depths from the ten temporary borings was analyzed for C-8. Table 1 presents the C-8 results for the groundwater samples. The first part of the sample name indicates the investigation and the sample type (WWO-G; Washington Works, Ohio, groundwater). The second part of the sample name indicates from which temporary boring the sample was collected (i.e. LHWAN1 is boring LHWAN-1; see Figure 6 for temporary boring locations). The third part of the sample name indicates the depth below ground surface from which the groundwater was sampled. Figure 7 shows the range in C-8 concentrations measured in each of the temporary borings.

In total, 18 samples (including one duplicate sample) were collected from the ten temporary borings (Table 1). Samples of first water encountered were collected from all ten borings. Samples from greater depths were collected from three borings. At the boring closest to TW-4, LHWASW-1, samples were collected every five feet from the first water encountered to the bottom of the sand and gravel aquifer. Note, not all planned sampling was completed. The field investigation proceeded slower than expected due to changing field conditions (stabilization of field parameters, particularly turbidity, took much longer than anticipated) and interruptions by the oversight consultant. As a consequence, not all groundwater and soils targeted in the work plan were sampled.

The C-8 concentrations measured in the groundwater sampled from temporary borings ranged from non-detectable (<0.01 ug/L; ND) to 78 ug/L and do not exceed the CATT-established human health protective water C-8 SL of 150 ug/L. In general, C-8 concentrations are higher at the first water encountered than at greater depths within the aquifer or at the bottom of the aquifer. The distribution of C-8 vertically and horizontally within the well field is discussed in detail in Section 6 which presents the site conceptual model for C-8 in soil and groundwater at Little Hocking.

4.2 C-8 in Groundwater from Production and Test Wells

Table 2 presents the PWS sampling C-8 results for the Little Hocking Water Association. The data for the well field investigation conducted in August 2002, including the data from the four production wells and all ten test wells are highlighted in blue. At the bottom of Table 2 are data from finished water and booster station sampling points. These are samples of the water that is being distributed to Little Hocking Water Association customers. Finished water was inadvertently not sampled during the well

field sampling. Table 2 also provides data from the 4Q02 and the 1Q03 PWS sampling events in which the four production wells, TW-4 and finished water were sampled. During the well sampling and PWS sampling, all of the C-8 concentrations measured in the production and test wells and in the finished water were well below the water C-8 SL of 150 ug/L that was established by the CATT (WVDEP, 2002).

Figure 7 shows the range of C-8 measured at each production and test well using all the data for each well summarized in Table 2. The highest concentration of C-8 measured in a production or test well, excluding TW-4, was 8.58 ug/L.

C-8 concentrations measured in TW-4, which was the focus of this investigation, have been variable. The C-8 concentration in this test well has ranged from 12.3 to 37.1 ug/L. These levels are higher than in any other test or production well in the Little Hocking well field. However, field and laboratory measurements and field observations, discussed below, suggest that the integrity of this test well is compromised.

Table 2 provides the pH data for the groundwater sampled collected from the production and test wells. The pH measured for all production and test wells, except for TW-4, has ranged from 6.72 to 7.94. However, the pH values measured in TW-4 are much higher, and have ranged from 9.22 to 12.61. High pH values are commonly associated with cement-bentonite grout (Colangelo et al. 1986).

Bentonite, which is commonly used as grouting material in well construction, is a clay mineral containing calcium, aluminum and iron. A comparison of groundwater analytical results between TW-4 and Well #2, one of the four production wells, also shows that TW-4 has approximately twice as much calcium and three times as much iron and aluminum than Well #2 (OEPA, 2002).

Field activities show that a three-inch pump that fits in the upper portion of the below-surface PVC pipe of TW-4, gets stuck in the PVC pipe at depth. The one and one half-inch pump, on the other hand, can be lowered to the bottom of the well. This observation indicates that the PVC pipe is not completely straight. A bent PVC pipe may indicate a problem with the joint between lengths of PVC pipe that could allow grout contamination into the well. Furthermore, particles of a crusty, white material, which may be grout, are frequently found on the pump when it is removed from the well. In addition, water from TW-4 also is frequently a milky to grayish color.

The consistently high pH values, water chemistry, and other field observations from this well likely indicate the integrity of the well is compromised, most likely by a failed grout seal or a failed well casing related to the bend in the PVC pipe. A failed grout seal or a failed well casing would allow shallow groundwater, which contains higher concentrations of C-8, to migrate into the deeper monitoring zone and would result in unusually high C-8 concentrations in the test well compared to C-8 concentrations measured in other production and test wells. Because of the compromised integrity of TW-4, it is likely that samples of groundwater from this well are not representative of typical conditions within the deeper portions of the sand and gravel aquifer.

The distribution of C-8 in the production and test wells in the Little Hocking well field is discussed in detail in Section 6, which presents the site conceptual model for C-8 in soil and groundwater in the Little Hocking Water Association well field.

4.3 Groundwater Elevations in Production and Test Wells and Ohio River Stage

Groundwater elevations were measured in all production and test wells sampled in the Little Hocking well field. In addition, the Ohio River stage was measured. Table 3 provides the surveyed measuring point elevations of the production and test wells, the depths to water measured and the calculated groundwater elevations. The Ohio River stage is also presented in this table.

Figure 8 presents the groundwater elevation contour map of the Little Hocking well field for August 21, 2002. The pumping of the production wells results in the development of a cone of depression surrounding the production wells with groundwater flowing towards the production wells from all directions. Because the four production wells are cycled on and off, the cone of depression shifts its position depending on which production wells that are pumping at the time. Groundwater elevations and flow directions within the Little Hocking well field aquifer are discussed in more detail in Section 6, which presents the site conceptual model for C-8 in soil and groundwater at the Little Hocking well field.

5.0 SOIL SAMPLE RESULTS

For soil sampled from the temporary borings, sampling was conducted as described in the Sampling Investigation Plan (DuPont, 2002b). In total, 22 soil samples, including one duplicate sample, were collected from two temporary borings, LHWASW-1 and LHWANW-1. Table 4 provides the sample names, sample dates, the C-8 concentration measured and comments. The sample nomenclature is similar to that employed for the groundwater samples. The first part of the sample name indicates the investigation and the sample type (WWO-S; Washington Works, Ohio, soil). The second part of the sample name indicates from which temporary boring the sample was collected (i.e. LHWASW1 is boring LHWASW-1). The third part of the sample name indicates the depth below ground surface where the sample was collected. The Comments column, on the far right, provides a brief description of the sample.

The C-8 concentrations measured from the two borings ranged from ND (<2 ug/kg) to 170 ug/kg in LHWASW-1 and from ND to 110 ug/kg in LHWANW-1 (Figure 9). In general, the concentrations of C-8 measured decreases with sampling depth in both of the temporary borings. The C-8 concentrations measured in soil from the temporary borings are significantly lower than the human health protective soil C-8 SL (240 mg/kg or 240,000 ug/kg) that was established by the CATT (WVDEP, 2002).

C-8 concentrations measured in soils from the Little Hocking well field are discussed in detail in Section 6, which presents the site conceptual model for C-8 in soil and groundwater at the Little Hocking Water Association well field.

6.0 SITE CONCEPTUAL MODEL

6.1 Geology

Using the geologic data available from the temporary borings and the production and test wells, three cross-sections (A-A', B-B', and C-C') were generated for the Little Hocking well field. Appendix B provides the geologic logs for the temporary borings. Geological logs for the production and test wells (made available to DuPont by the Little Hocking Water Association) are provided in Appendix C. The cross-section location map is provided in Figure 10. Cross-sections A-A' and B-B' generally run north to south and C-C' runs west to east. Cross-sections A-A', B-B', and C-C' are presented in Figures 11, 12, and 13, respectively. These cross-sections show that the stratigraphy of the Little Hocking well field is comprised of three lithological units (from ground surface downward):

- ❑ Holocene overbank deposits (approximately 25-40 feet of a low permeable silty clay or sandy clay or sand and clay)
- ❑ Pleistocene glacial outwash deposits (approximately 20-35 feet of sand and gravel which is the site aquifer)
- ❑ Dunkard Group bedrock (shale)

The composition of the Holocene overbank deposits is variable. In the western part of the well field, silty clay and clay are observed, while in the eastern portion sand and clay and/or sandy clay is found. The contact between the upper silty clay and the underlying sand and gravel is an erosional surface, characterized in some locations by channels cut into the sand and gravel (Figure 13). The composition of the sand and gravel unit is also variable, consisting of sand, sand and gravel, silty sand, and clayey sand. Where encountered in the temporary borings, the underlying bedrock is a micaceous, greenish gray siltstone. The logs for the production and temporary wells indicate that bedrock consists of red and blue shale, red clay and sandstone.

6.2 Hydrogeology

Cross-sections A-A', B-B' and C-C' also show the groundwater elevation for August 21, 2002 based on data measured at the production and test wells. At the time water levels were measured, Well #1, Well #2 and Well #3 were being pumped and Well #5 was not being used. The cone of depression around these three wells can be seen most obviously on cross-section C-C' (Figure 13), but can also be observed on B-B' (Figure 12). The groundwater contour map, which also shows the drawdown from the pumping wells, is provided in Figure 8. The hydraulic conductivity of the alluvial aquifer in the area typically ranges from 100 to 300 ft./day. Because of the high hydraulic conductivity, it is likely that the cone of depression shifts its position rapidly with the cycling on and off of the four production wells. Ohio River stage, 582.24 ft mean sea level, is higher than in

the test production and test wells. Therefore, water from the river flows into the site aquifer. Precipitation also is a minor recharge source for the Little Hocking well field.

6.3 C-8 Transport Mechanisms and Migration Pathways

Based on our current knowledge, the following paragraphs describe the transport mechanisms and migration pathways for C-8 from the Washington Works facility.

A groundwater model was developed for the Washington Works facility as part of the RFI report for Washington Works (DuPont, 1999). The Consent Order required refinement of the groundwater model for the facility to re-evaluate the extent of groundwater captured by the pumping wells at the site and to confirm that off-site migration of C-8 impacted groundwater is not occurring. To meet these requirements, refinement of the groundwater modeling work was completed with input, guidance, and critical review from the United States Geological Survey, the USACOE, the West Virginia Department of Health and Human Resources, and GIST members during the model development, calibration, and finalization process. The report of final findings for the revised groundwater model for the facility and the surrounding area was submitted to the GIST in January 2003 (DuPont, 2003). The revised groundwater model supports DuPont's previous conclusions that no off-site migration of groundwater is known to be occurring and that no potential groundwater migration pathway exists beneath the Ohio River to the Little Hocking well field.

However, DuPont had released, and continues to release, C-8 in air emissions from the Washington Works facility. C-8 is emitted to the atmosphere in two phases, a vapor phase, and a particulate phase. In May 2002, additional control equipment was installed at the facility to reduce C-8 emissions. There has been approximately a 65 percent decrease in total C-8 air emissions since the installation of this equipment compared to levels measured for 1999, when C-8 emission levels were at their highest. Continued reductions in C-8 emissions from the facility are anticipated during the next few years as abatement efficiency improvement projects are completed.

The Little Hocking well field is located directly north of the Washington Works facility across the Ohio River into Ohio. Wind direction data show that the Little Hocking well field is downwind of the facility and the predominant wind flow. Air emissions modeling by DuPont indicates that some C-8 in emissions from the Washington Works facility migrate over the Little Hocking well field.

Some C-8 in the vapor and particulate phases, emitted from the facility and transported by wind, is deposited on the surface soil at the Little Hocking well field. The concentrations of C-8 measured in surface soils (i.e. 0-1 foot depth) sampled during this investigation were 110 ug/kg and 170 ug/kg (Figure 11). C-8 is then leached by the precipitation from surface soils to surface-water bodies and/or infiltration into surface soils.

Dissolved C-8 continues migrating downward in the unsaturated zone with the infiltrating precipitation. The C-8 concentration in the soils below the surface, in the unsaturated zone, ranged from 3.4 to 13 ug/kg, almost an order of magnitude lower than the concentrations of C-8 measured at the surface (see LHWAN-1 and LHWASW-1 in

Figure 11). The low permeability of the upper silty clay likely slows the rate of downward migration of precipitation. In addition, the rate and direction of migration of precipitation likely changes with the different lithologies encountered in the Holocene overbank deposits. For example, precipitation might migrate slowly downward through the silty clay and then migrate laterally in a sand lens at a much faster rate. Soil-type differences may also be responsible for the highly variable C-8 concentrations measured within the groundwater in silty clay unit (compare LHWAS-1 with C-8 concentration of nondetectable to LHWAS-2 having C-8 at 78 ug/L). In addition, the rate of precipitation and the level of the water table likely have some control over the rate of migration of dissolved C-8. However, because C-8 is highly soluble (Fluoropolymers Manufacturers Group, 2001), it does not tend to precipitate or sorb to particles in the soil but it remains in solution and migrates with groundwater.

The concentrations of C-8 in groundwater at the top of the water table are higher than the concentration of C-8 just below at the lithologic contact between the silty clay and the sand and gravel (Figure 11). These data indicate that the overall the concentration of C-8 decreases with depth in the water table within the silty clay. Alternatively, these data also may reflect the increased permeability in the sand and gravel compared to the silty clay.

The C-8 concentration measured in a single boring at various depths show that the concentration of C-8 in groundwater and soil decreases with depth within the aquifer (Figure 11) as the dissolved C-8 migrates within the sand and gravel aquifer. However, the C-8 concentration at the base of the sand and gravel aquifer (i.e. position of the well screens) is somewhat variable and does not seem to show a trend with groundwater flow direction towards the pumping wells. Table 2 shows that C-8 concentrations are consistent within a single production well but that the concentrations are different between the production wells. Well #3 consistently has the lowest C-8 concentration (less than 1ug/L) whereas Well #5 consistently has the highest C-8 concentration (ranging from 5.69 to 8.59 ug/L). Because the four production wells are cycled on and off and the C-8 concentrations measured in the wells are not the same, the C-8 concentration in the finished water is variable. Table 2 shows the concentration of C-8 in finished water has ranged from 1.69 to 4.29 ug/L.

Briefly summarized, DuPont currently believes that C-8 from the DuPont facility is transported via air emissions by wind and is deposited on the Little Hocking well field surface soils. Precipitation leaches the C-8 downward through the unsaturated zone to the aquifer. Dissolved C-8 then migrates with groundwater within the aquifer. Groundwater containing low levels of C-8 is then pumped from the aquifer through the production wells. Water from the four production wells is mixed and water containing even lower levels of C-8 (the finished water) then enters the Little Hocking Water Association distribution system. C-8 concentrations in finished water from Little Hocking are significantly below the human health protective water C-8 SL of 150 ug/L (WVDEP 2002).

7.0 CONCLUSIONS AND RECOMMENDATIONS

Based on the investigation at the Little Hocking Water Association well field and other data available, the following conclusions can be made:

- ❑ All groundwater results are below the C-8 Assessment of Toxicity Team (CATT) established human health protective screening criteria for water (water C-8 SL; WVDEP 2002) of 150 ug/L.
- ❑ The C-8 concentrations in groundwater decreased with depth within the aquifer. The C-8 concentrations in groundwater at the top of the aquifer, within the silty clay, ranged from ND (<0.01 ug/L) to 78 ug/L, while C-8 concentrations at the bottom of the aquifer, within the sand and gravel, ranged from ND (<0.01 ug/L) to 8.58 ug/L (excluding results for TW-4).
- ❑ Consistently high pH values measured in TW-4 and other field observations indicate that this test well's construction is likely compromised, possibly due to a failed grout seal or to a failed well casing. Higher concentrations of C-8 measured in this well (ranging from 12.3 to 37.1 ug/L) are likely attributed to shallow groundwater that contains higher C-8 concentrations migrating downward into the deeper monitoring zone or into the well itself, which could happen if the grout seal or the well casing were to have failed. C-8 concentrations measured in this well are not likely to be truly representative of the deep aquifer.
- ❑ Drinking water is pumped from the bottom of the sand and gravel aquifer through the four production wells. The highest C-8 concentration measured in the four production wells was 8.58 ug/L, significantly lower than the human health protective water C-8 SL. The C-8 results for finished water, a combination of waters from the production wells that is distributed to Little Hocking customers, ranged from 1.69 to 4.29 ug/L, also significantly lower than the water C-8 SL.
- ❑ All soil results are below the CATT-established human health protective screening criteria for soil (soil C-8 SL) of 240 mg/kg (WVDEP 2002). The highest soil C-8 concentration measured is 170 ug/kg (0.170 mg/kg). Most results for soil sampled below the water table are nondetectable.
- ❑ Overall, the very low concentrations of C-8 measured in the soils indicate that C-8 does not readily adsorb to soil, especially soils below the water table.
- ❑ C-8 results for soil and groundwater sampled immediately adjacent to TW-4 do not distinguish this test well as a source for higher C-8 concentrations in soil and groundwater.
- ❑ Overall, this investigation as completed, combined with the air emission modeling and groundwater modeling results and the available physiochemical data for C-8, are sufficient to understand the migration pathways of C-8 from the Washington Works facility and within the Little Hocking Water Association well field.

- ❑ Revised groundwater modeling by DuPont supports the previous conclusion that no potential groundwater migration pathway exists beneath the Ohio River to the Little Hocking Well field.
- ❑ Based on the current data available, DuPont believes the following pathway does exist. C-8 from the DuPont facility is transported via air emissions by wind and is deposited on the Little Hocking well field surface soils. Precipitation then leaches the C-8 downward through the unsaturated zone to the aquifer. Dissolved C-8 then migrates with groundwater within the aquifer. Groundwater containing low levels of C-8 is then pumped from the aquifer through the four production wells. Water from the production wells is mixed and the finished water, containing even lower levels of C-8, then enters the Little Hocking Water Association distribution system.
- ❑ This investigation as completed, combined with the overall understanding of C-8 migration pathways within the Little Hocking well field, is also sufficient to understand the distribution of C-8 in the test wells, including TW-4, in the production wells and in the finished water that enters the Little Hocking distribution system.
- ❑ In order to assess the impact of recent C-8 air emission reductions at the Washington Works facility, DuPont recommends continuing quarterly monitoring of C-8 in the four Little Hocking Water Association production wells and finished water for a period of two years.

8.0 REFERENCES

- Burgess & Niple, Ltd. 1988. *Blennerhassett Island Water Supply Well Drilling and Test Pumping*, unpublished report.
- Colangelo, R. V., Canestra, R. B., and Morehouse, J. T. 1986. *The Effects of Water Quality Data Due to Annular Space Material and Monitoring Well Specifications*, Proceedings of the Ninth Annual Madison Waste Conference on Municipal and Industrial Waste, Madison, WI, pp. 100-120.
- DuPont 2003. *Revised Groundwater Flow Model, DuPont Washington Works, Washington, WV* January 2003. DuPont Corporate Remediation Group and URS Diamond.
- _____. 2002a. *Sampling Investigation Plan for Little Hocking Water Association Well Field, Washington County, Ohio* August 2002. DuPont Corporate Remediation Group and URS Diamond.
- _____. 2002b. *Groundwater Investigation Quality Assurance Project Plan for Washington Works Plant, Washington Works, West Virginia* January 2002. DuPont Corporate Remediation Group and URS Diamond.
- _____. 2001. *Project-Specific Waste Management Procedures for Letart Landfill, Local Landfill, Dry Run Landfill, Washington Works Plant and Designated Off-Site Areas* November 2001. DuPont Corporate Remediation Group and URS Diamond.
- _____. 1999. *RCRA Facility Investigation Report, DuPont Washington Works*, June 30, 1999. DuPont Corporate Remediation Group and URS Diamond. 1999. *RCRA Facility Investigation Report, DuPont Washington Works* June 30, 1999. DuPont Corporate Remediation Group and URS Diamond.
- Fluoropolymer Manufacturers Group 2001. *Guide to the safe Handling of Fluoropolymer Dispersions* October 2001. The Society of the Plastics Industry, Inc.
- Leggette, Brashears & Graham, Inc. 1986. *Hydrogeologic Evaluation for Additional Water Supply from Blennerhassett Island*, unpublished report.
- Kozar, M.D. and M.V. Mathes, 2001. *Aquifer-Characteristics Data for West Virginia*. Water-Resources Investigations Report 01-4036, United States Geological Survey, 74 p.

Ohio Environmental Protection Agency, 2002. Fax dated May 28, 2002, from Steve Williams (OEPA) to Andrew Hartten (DuPont) providing sampling results from Little Hocking TW-4 and Well #2 conducted on April 23, 2002.

Simard, C. M. 1989 *Geological History of the Lower Terraces and Floodplains of the Upper Ohio River Valley*, Open File Report, West Virginia Geological Survey. 160 P.

Schultz, R.A. 1984. *Groundwater Hydrology of the Minor Tributary Basins of the Ohio River*, West Virginia.

WVDEP, 2002 *Final Ammonium Perfluorooctanone (C8) Assessment of Toxicity Team (CATT) Report* August 2002. West Virginia Department of Environmental Protection.

Table 1
C-8 in Groundwater from Temporary Borings
Little Hocking Water Association
Washington County, Ohio

Sample Name	Sample Date	C-8 ug/L	Comments
WVO-G-LHWAN1 (17-22)	8/29/02	50.8	first water encountered
WVO-G-LHWANE1 (21-27)*	8/20/02	5.58	first water encountered
WVO-G-LHWANE1 (56-58)	8/22/02	0.662	bottom of sand and gravel
WVO-G-LHWANE2 (20.7-25.7)	8/30/02	1.28	first water encountered
WVO-G-LHWAE1 (21-26)	8/30/02	0.416	first water encountered
WVO-G-LHWAS1 (25-30)	8/28/02	ND (<0.01)	first water encountered
WVO-G-LHWAS2 (25-30)	8/27/02	78	first water encountered
WVO-G-LHWASW1 (28.5-33)	8/23/02	0.0912	first water encountered
WVO-G-LHWASW1 (35-40)*	8/26/02	1.32	every 5 ft groundwater sample
WVO-G-LHWASW1 (40-45)	8/26/02	1.02	every 5 ft groundwater sample
WVO-G-LHWASW1 (45-50)	8/28/02	0.376	every 5 ft groundwater sample
WVO-G-LHWASW1 (50-55)	8/28/02	0.166	every 5 ft groundwater sample
WVO-G-LHWASW1 (55-56)*	8/28/02	0.254	bottom of sand and gravel
WVO-G-LHWA1 (29-34)	8/29/02	ND (<0.01)	first water encountered
WVO-G-LHWA2 (33-38)	8/29/02	3.35	first water encountered
WVO-G-LHWANW1 (19-25)	8/29/02	34.6	first water encountered
WVO-G-LHWANW1 (24-29)	8/29/02	5.9	top of sand and gravel
WVO-G-LHWANW1 (24-29)-2(DUP)	8/29/02	6.22	top of sand and gravel

* Sample split with the Ohio EPA.

000460

Table 2
C-8 in Production and Test Wells
Little Hocking Water Association
Washington County, Ohio

Well	Sample Name	Sample Date	C-8 ug/l	Comments	pH
Well #1	LHPSD1	12/20/01	1.82	Production Well	7.19
	LHPSD1	1/21/02	1.72	Production Well	7.68
	LHPSD1	2/22/02	2.37	Production Well	6.97
	LHPSD1	3/26/02	2.99	Production Well	7.30
	LHPSD1	4/23/02	2.02	Production Well	8.03
	LHPSD1	8/21/02	3.65	Production Well	6.79
	LHPSD1	10/16/02	3.41	Production Well	6.97
	LHPSD1	2/26/03	3.38	Production Well	6.72
Well #2	LHPSD2	12/20/01	3.72	Production Well	7.08
	LHPSD2	12/20/01	3.52	duplicate	---
	LHPSD2	1/21/02	2.97	Production Well	7.74
	LHPSD2	2/22/02	2.03	Production Well	7.61
	LHPSD2	2/22/02	2.07	duplicate	---
	LHPSD2	3/26/02	3.31	Production Well	7.56
	LHPSD2	4/23/02	3.4	Production Well	7.76
	LHPSD2	8/21/02	4.26	Production Well	7.39
	LHPSD2	10/16/02	3.98	Production Well	7.5
	LHPSD2	2/26/03	3.62	Production Well	7.2
Well #3	LHPSD3	12/20/01	0.844	Production Well	7.25
	LHPSD3	1/21/02	0.744	Production Well	7.83
	LHPSD3	2/22/02	0.42	Production Well	7.65
	LHPSD3	3/26/02	0.827	Production Well	7.73
	LHPSD3	4/23/02	0.783	Production Well	7.94
	LHPSD3	8/21/02	0.952	Production Well	7.69
	LHPSD3	10/16/02	0.495	Production Well	7.77
	LHPSD3	10/16/02	0.434	duplicate	---
	LHPSD3	2/26/03	0.733	Production Well	7.44
	LHPSD3				
Well #5	LHPSD5	12/20/01	7.66	Production Well	7.04
	LHPSD5	1/21/02	6.22	Production Well	7.4
	LHPSD5	1/21/02	6.14	duplicate	7.39
	LHPSD5	2/22/02	5.69	Production Well	7.26
	LHPSD5	3/26/02	6.57	Production Well	7.40
	LHPSD5	4/23/02	6.11	Production Well	7.52
	LHPSD5	8/21/02	8.09	Production Well	7.2
	LHPSD5	10/16/02	8.58	Production Well	7.41
	LHPSD5	2/26/03	6.93	Production Well	7.16
	LHPSD5	2/26/03	7.16	duplicate	---
TW-1	LHPSDTW1	1/22/02	2.16	Test well	7.87
	LHPSDTW1	8/21/02	0.81	Test well	7.41
TW-2	LHPSDTW2	1/22/02	0.103	Test well	7.62
	LHPSDTW2	8/21/02	0.081	Test well	7.03
TW-3	LHPSDTW3	1/22/02	4.48	Test well	7.42
	LHPSDTW3	8/21/02	4.17	Test well	7.13

Table 2
C-8 in Production and Test Wells
Little Hocking Water Association
Washington County, Ohio

Sample Name	Sample Name	Sample Date	C-8 ug/l	Comments	pH
TW-4	LHPSDTW4	1/22/02	37.1	Test well	12.61
	LHPSDTW4	3/26/02	33.3	Test well	12.26
	LHPSDTW4	4/23/02	28.7	Test well	12.35
	LHPSDTW4	8/21/02	12.3	Test well	11.32
	LHPSDTW4	10/16/02	14.5	Test well	9.22
	LHPSDTW4	2/26/03	22.5	Test well	10.54
TW-5	LHPSDTW5	8/21/02	6.26	Test well	6.7
TW-6	LHPSDTW6	1/22/02	1.79	Test well	7.03
	LHPSDTW6	8/21/02	1.15	Test well	6.81
	LHPSDTW6	8/21/02	1.23	duplicate	6.81
TW-9	LHPSDTW9	1/22/02	0.364	Test well	7.33
	LHPSDTW9	8/21/02	0.812	Test well	7.09
TW-10	LHPSDTW10	1/21/02	1.9	Test well	7.43
	LHPSDTW10	8/21/02	1.1	Test well	6.85
TW-11	LHPSDTW11	1/21/02	1.41	Test well	7.38
	LHPSDTW11	8/21/02	1.73	Test well	7.07
TW-12	LHPSDTW12	1/21/02	0.758	Test well	7.39
	LHPSDTW12	8/21/02	0.824	Test well	6.9
LHPSDEP001	LHPSDEP001	1/22/02	1.69	Finished Water	
LHPSDEP001	LHPSDEP001	3/26/02	2.62	Finished Water	
LHPSDEP001	LHPSDEP001	4/23/02	1.93	Finished Water	
LHPSDEP001	LHPSDEP001	10/16/02	4.29	Finished Water	
LHPSDEP001	LHPSDEP001	2/26/03	2.33	Finished Water	
LHTORCHBS	LHTORCHBS	1/22/02	1.85	Booster Station Sample	
BARTLETTCC	BARTLETTCC	1/22/02	1.94	Booster Station Sample	
339B STA	339B STA	1/22/02	1.81	Booster Station Sample	

Shaded cells indicate groundwater sampled for the Little Hocking Sampling Investigation in August 2002.

000462

Table 3
Groundwater Elevation Data for Production and Test Wells August 2002
Little Hocking Water Association
Washington County, Ohio

Well ID	Surveyed Elevation*	Depth to Water (8/21/02)	Groundwater Elevation (feet MSL)
Well #1	613.47	56.88	556.59
Well #2	613.71	42.88	570.83
Well #3	613.54	39.68	573.86
Well #5	613.18	35.62	577.56
TW-1	598.13	17.38	580.75
TW-2	599.92	18.63	581.29
TW-3	599.75	22.78	576.97
TW-4	598.52	18.16	580.36
TW-5	608.28	30.63	577.65
TW-6	598.7	19.03	579.67
TW-9	598.53	21.44	577.09
TW-10	595.83	17.77	578.06
TW-11	603.79	26.57	577.22
TW-12	602.22	23.95	578.27
Ohio River	584.7	2.46	582.24

*Elevations were surveyed by Bob Griffin of LHWA on 8/23/02 using 610.0 as reference assumption for PW-1 well house top of floor slab.

000463

Table 4
C-8 in Soil from Temporary Borings
Little Hocking Water Association
Washington County, Ohio

Sample Name	Sample Date	C-8 ug/kg	Comments
WWO-S- LHWASW1 (3-9)	8/23/02	170	surface soil
WWO-S- LHWASW1 (5.0-5.6)	8/23/02	13	every 5 ft soil sample
WWO-S- LHWASW1 (11.2-11.7)	8/23/02	3.4	every 5 ft soil sample
WWO-S- LHWASW1 (15.5-16.0)	8/23/02	3.3	every 5 ft soil sample
WWO-S- LHWASW1 (22.1-22.6)	8/23/02	NQ	every 5 ft soil sample
WWO-S- LHWASW1 (26.5-27.0)	8/23/02	ND(0.18)	every 5 ft soil sample
WWO-S- LHWASW1 (30.0-30.5)	8/23/02	ND(0.18)	geologic interface
WWO-S- LHWASW1 (30.5-31.0)	8/23/02	ND(0.19)	geologic interface
WWO-S- LHWASW1 (37.0-37.5)	8/26/02	NQ	lithology change
WWO-S- LHWASW1 (37.5-38.0)	8/26/02	ND(0.19)	lithology change
WWO-S- LHWASW1 (44.3-44.5)	8/26/02	NQ	every 5 ft soil sample, charcoal layer
WWO-S- LHWASW1 (47.5-48.0)	8/26/02	ND(0.18)	every 5 ft soil sample
WWO-S- LHWASW1 (53.5-54.0)	8/28/02	ND(0.18)	every 5 ft soil sample
WWO-S- LHWASW1 (53.5-54.0)-2	8/28/02	ND(0.17)	every 5 ft soil sample, duplicate
WWO-S- LHWASW1 (55.5-56.0)	8/28/02	ND(0.17)	every 5 ft soil sample
WWO-S- LHWANW1 (0.1-0.5)	8/29/02	110	surface soil
WWO-S- LHWANW1 (5.0-5.5)	8/29/02	6.1	every 5 ft soil sample
WWO-S- LHWANW1 (10.0-10.5)	8/29/02	7.5	every 5 ft soil sample
WWO-S- LHWANW1 (15.0-15.5)	8/29/02	6.9	every 5 ft soil sample
WWO-S- LHWANW1 (20.0-20.5)	8/29/02	17	geologic interface
WWO-S- LHWANW1 (21.0-21.5)	8/29/02	18	geologic interface
WWO-S- LHWANW1 (25.0-25.5)	8/29/02	8.4	every 5 ft soil sample


ND = not detected at the listed method detection limit (MDL).

NQ = detected at a level between the MDL and the reporting limit (RL); result is not quantifiable.

ND<MDL<NQ<RL


RL = limit of quantitation (LOQ) adjusted for actual sample weight and % moisture.
nominal LOQ = 2 ug/kg.

000464

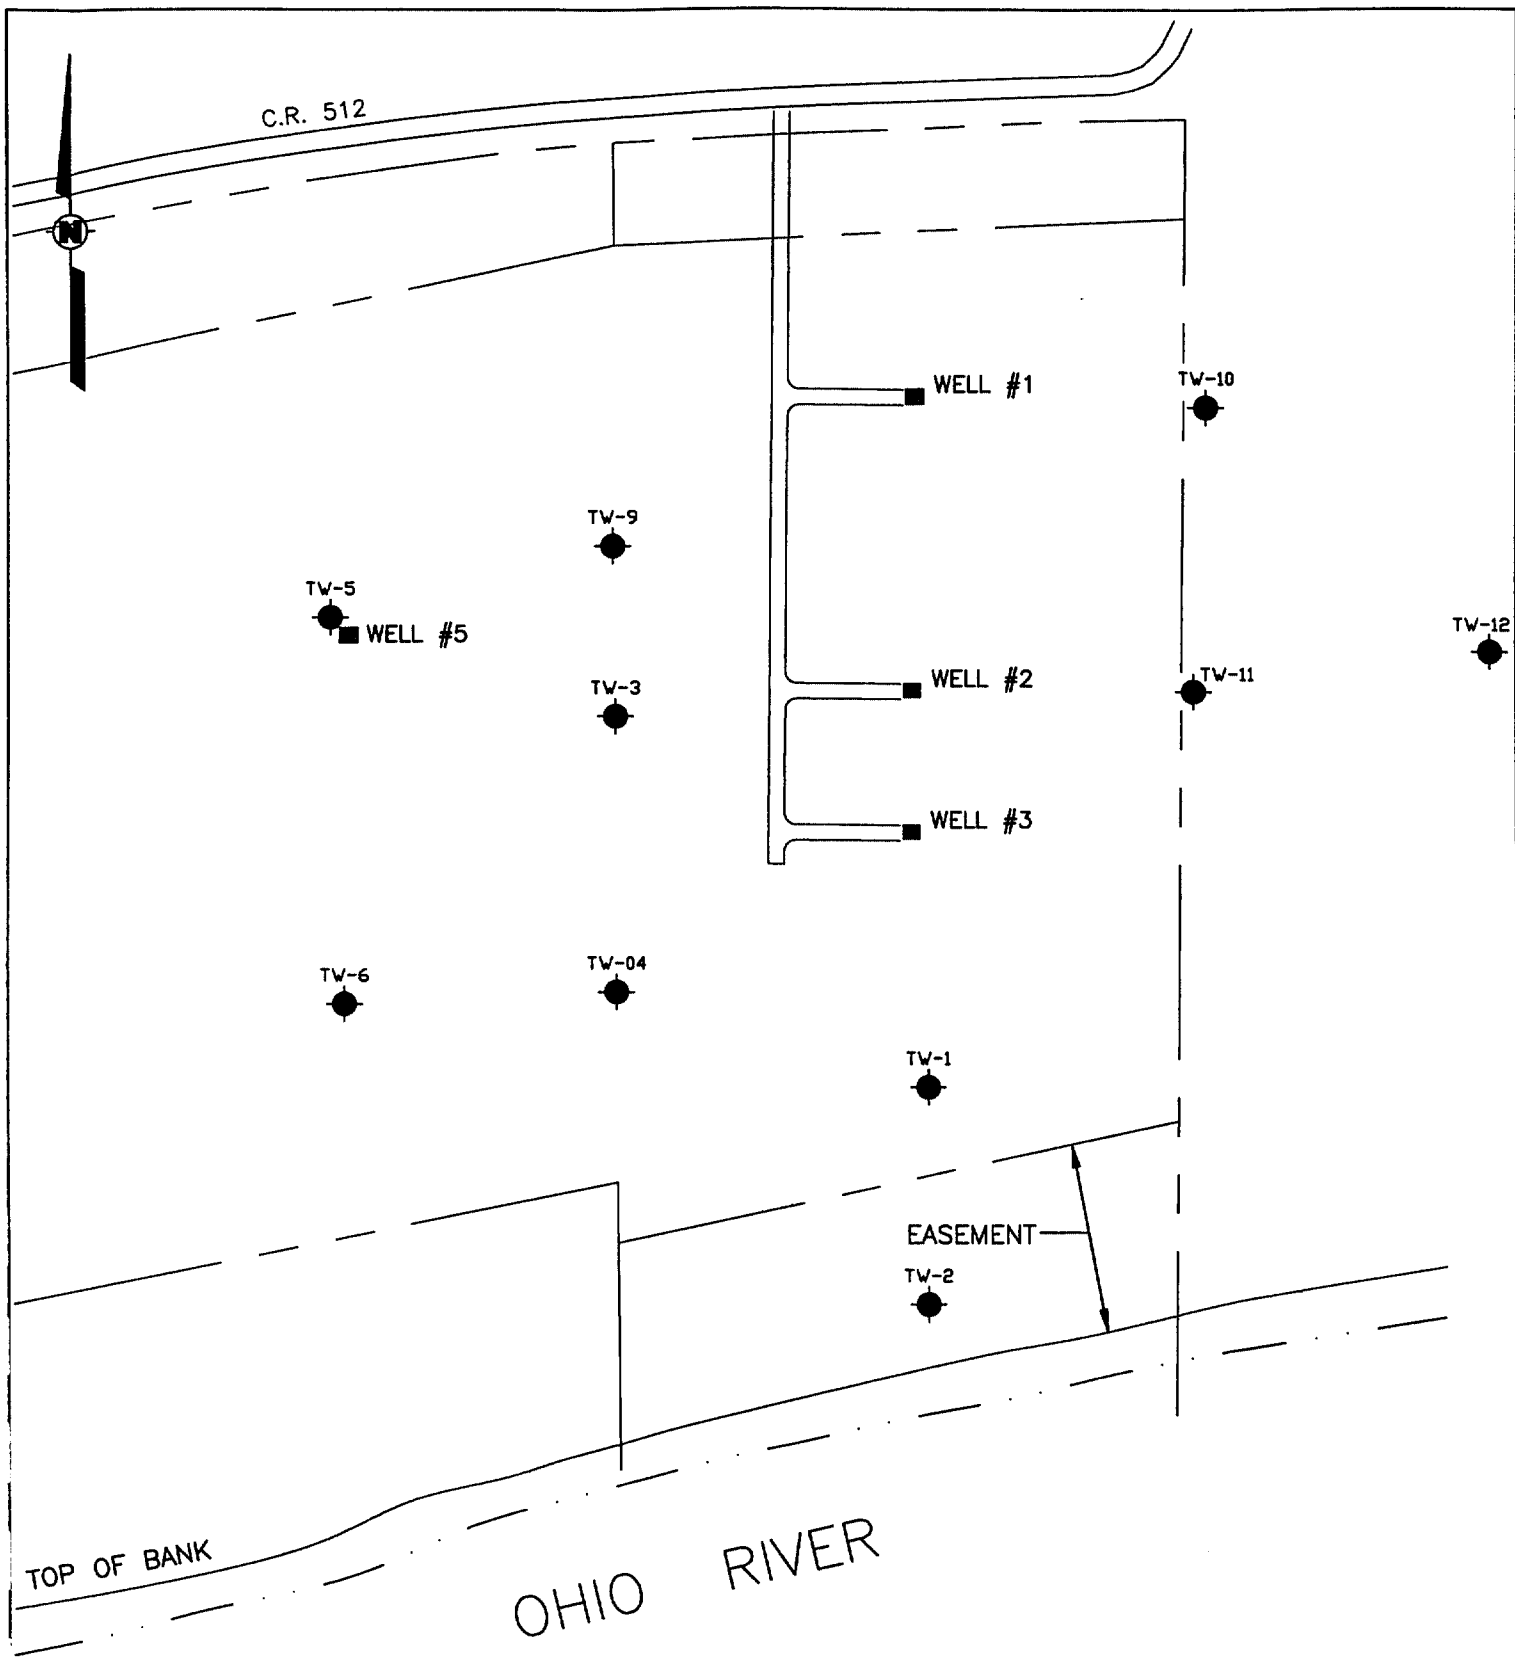

000467

LEGEND:
 ■ WATER SUPPLY WELL
 ● TEST WELL







Corporate Remediation Group
*An Alliance between
 DuPont and URS Diamond*

Barley Mill Plaza, Building 27
 Wilmington, Delaware 19805


PRODUCTION AND TEST WELL LOCATIONS			
Little Hocking Water Association Little Hocking, Ohio			
SCALE As Shown	DESIGNED	DRAWN DEL	CAD FILE NO. 7423A007
DATE 2/25/03	CHECKED TDL	APPROVED	FIGURE 2

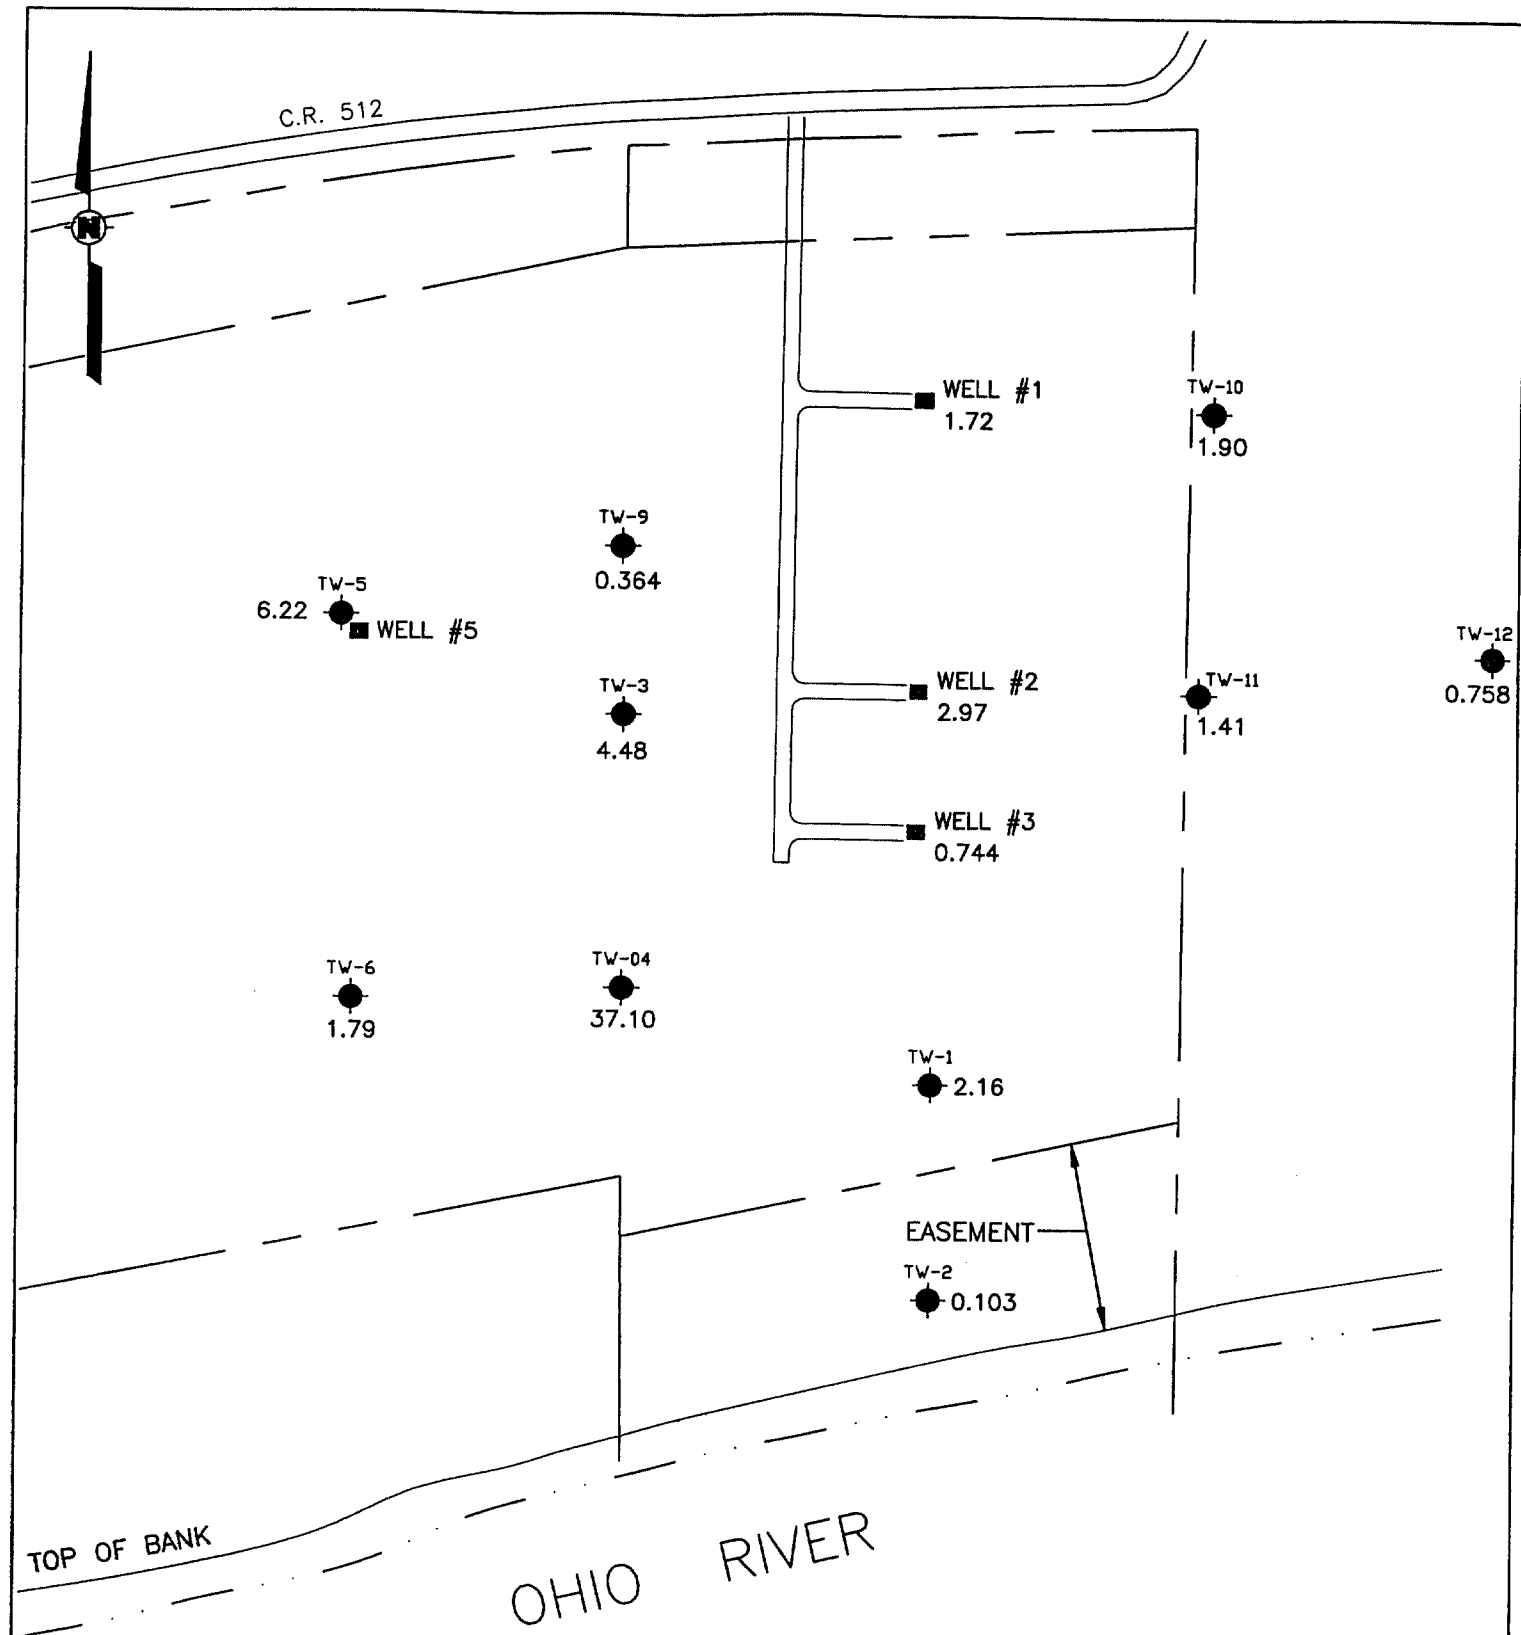

LEGEND:

- WATER SUPPLY WELL
- TEST WELL
- 1.79 C-8 RESULTS IN UG/L

SCALE



000468



Corporate Remediation Group



*An Alliance between
DuPont and URS Diamond*

Barley Mill Plaza, Building 27
Wilmington, Delaware 19805

C-8 IN GROUNDWATER
JANUARY, 2002

Little Hocking Water Association
Little Hocking, Ohio


SCALE	DESIGNED	DRAWN	DEL.	CAD FILE NO.
As Shown				7423A002
DATE	CHECKED	APPROVED	FIGURE	
4/12/02	TDL		3	

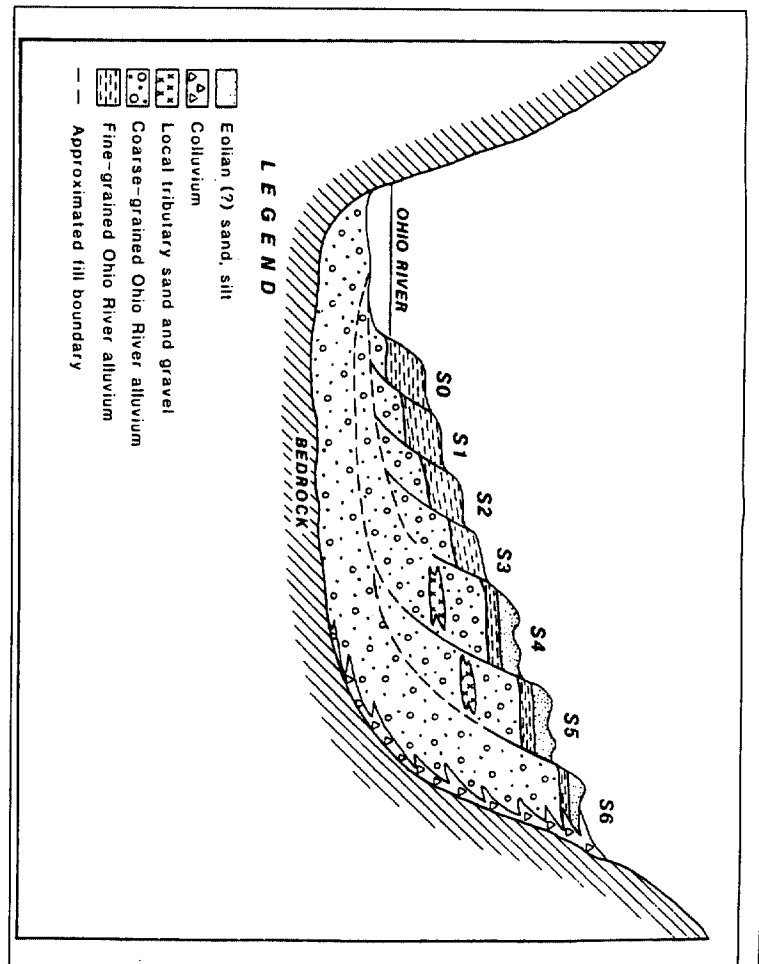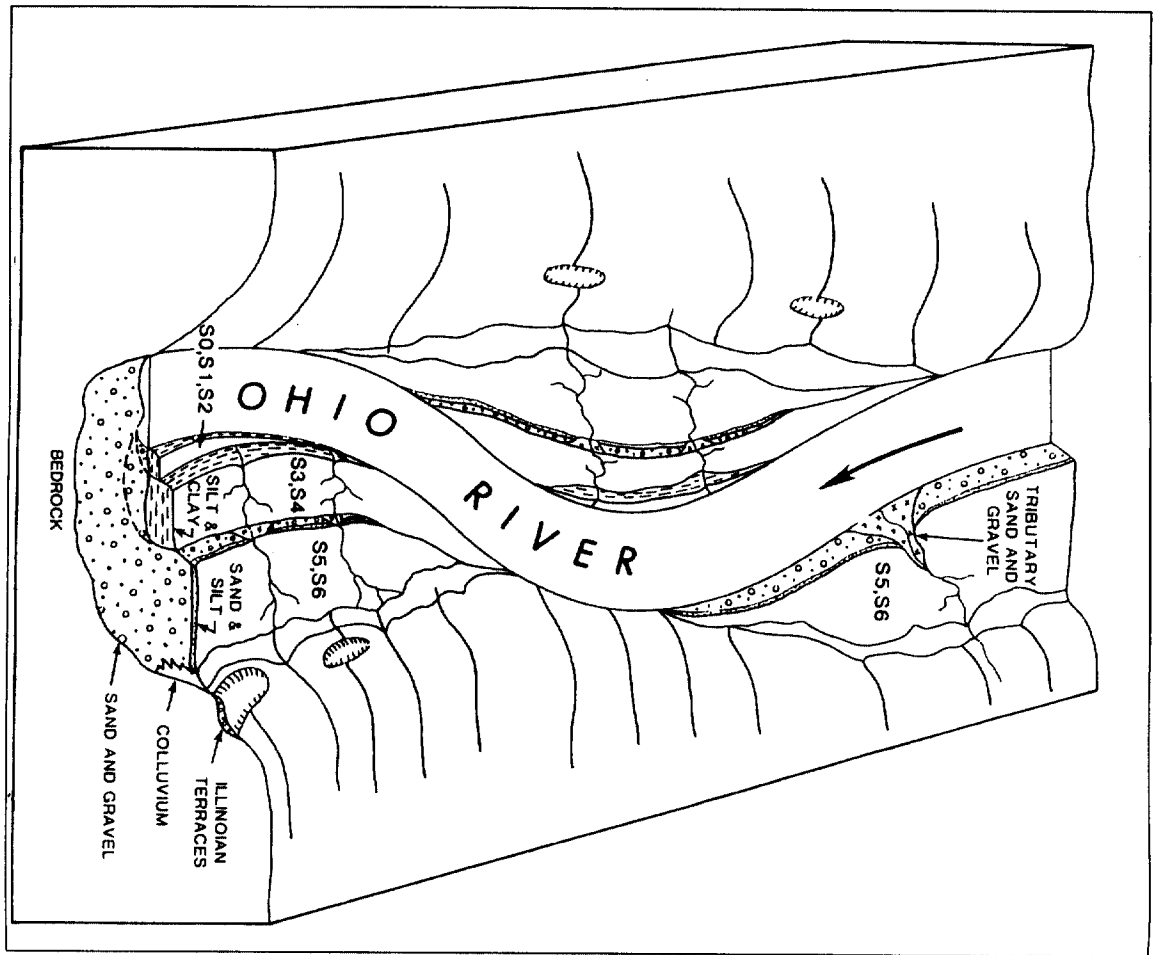


ILLUSTRATIONS TAKEN FROM SIMARD, 1989.

DESIGNED	DATE	BY	REVIEWED	DATE	BY
DRAWN					
CHECKED					
APP. BY					
APPROVED					
Corporate Remediation Group <i>An Alliance between</i> <i>DuPont and OHS Diamond</i> Barley Mill Plaza, Building 27 Wilmington, Delaware 19805					
IDEALIZED OHIO RIVER VALLEY CROSS-SECTION AND BLOCK DIAGRAM			DuPont Washington Works Washington, West Virginia		
SCALE	DATE	BY	DATE	BY	DATE
1" = 100'	12/4/89	Page 4			

000469




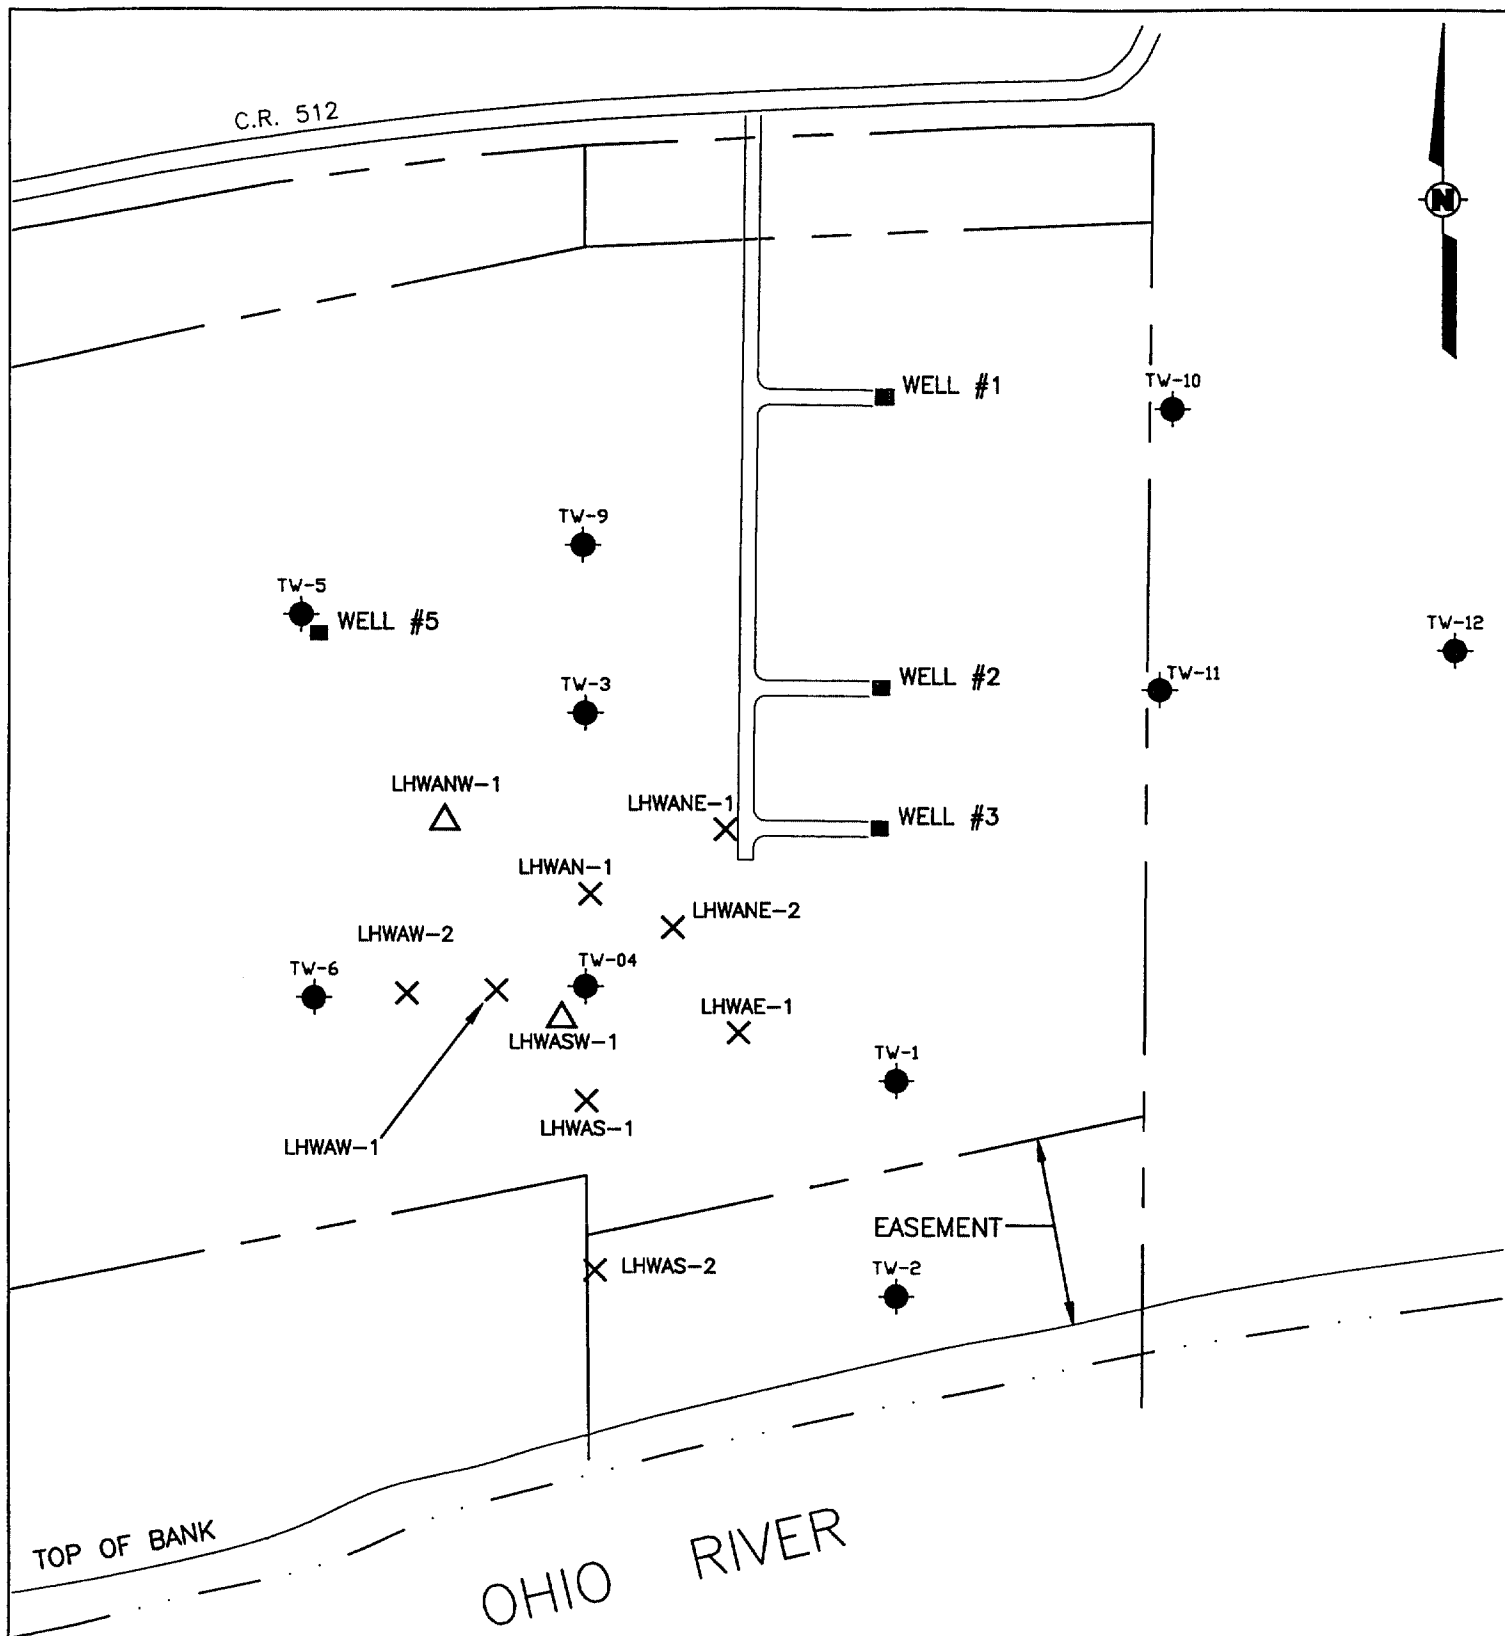

LEGEND:

- WATER SUPPLY WELL
- TEST WELL
- △ BORING - SOIL & GROUNDWATER SAMPLES
- × BORING - GROUNDWATER SAMPLES

SCALE



NOTE:

LOCATIONS OF WELLS AND BORINGS ARE APPROXIMATE.

000471



Corporate Remediation Group

*An Alliance between
DuPont and URS Diamond*


Barley Mill Plaza, Building 27
Wilmington, Delaware 19805



TEMPORARY BORING LOCATIONS

Little Hocking Water Association
Little Hocking, Ohio


SCALE As Shown	DESIGNED	DRAWN DEL	CAD FILE NO. 3835A005
DATE 9/28/02	CHECKED KLD	APPROVED	FIGURE 6

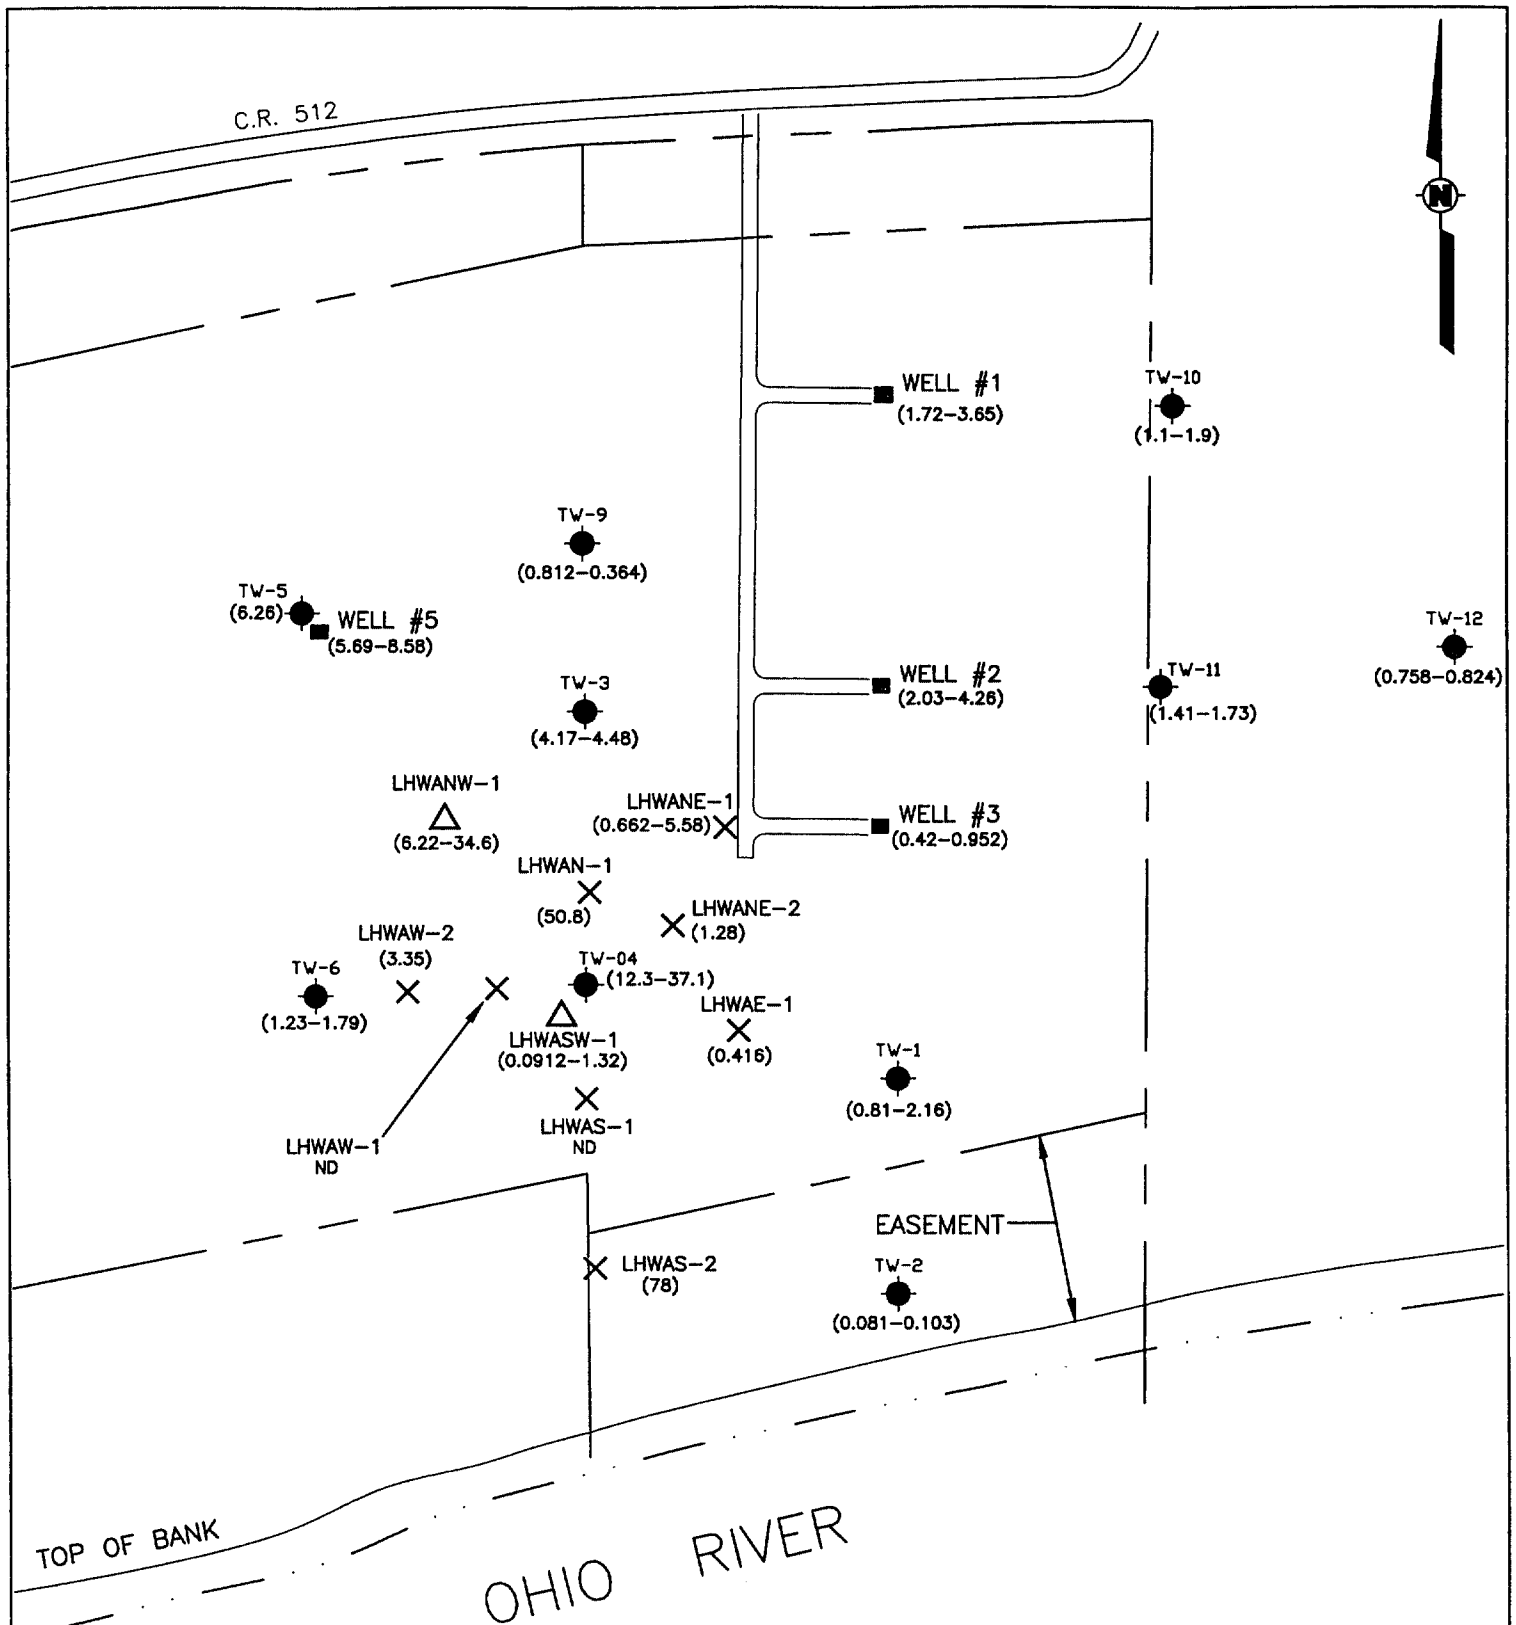

LEGEND:

- WATER SUPPLY WELL
- TEST WELL
- △ BORING - SOIL & GROUNDWATER SAMPLES
- × BORING - GROUNDWATER SAMPLES

SCALE



NOTE:

LOCATIONS OF WELLS AND BORINGS ARE APPROXIMATE.
ND = <0.01 ug/L

000472



Corporate Remediation Group


*An Alliance between
DuPont and URS Diamond*

Barley Mill Plaza, Building 27
Wilmington, Delaware 19805

C-8 CONCENTRATION RANGES
IN GROUNDWATER

Little Hocking Water Association
Little Hocking, Ohio

SCALE As Shown	DESIGNED	DRAWN DEL	CAD FILE NO. 7423A008
DATE 4/12/02	CHECKED TDL	APPROVED	FIGURE 7

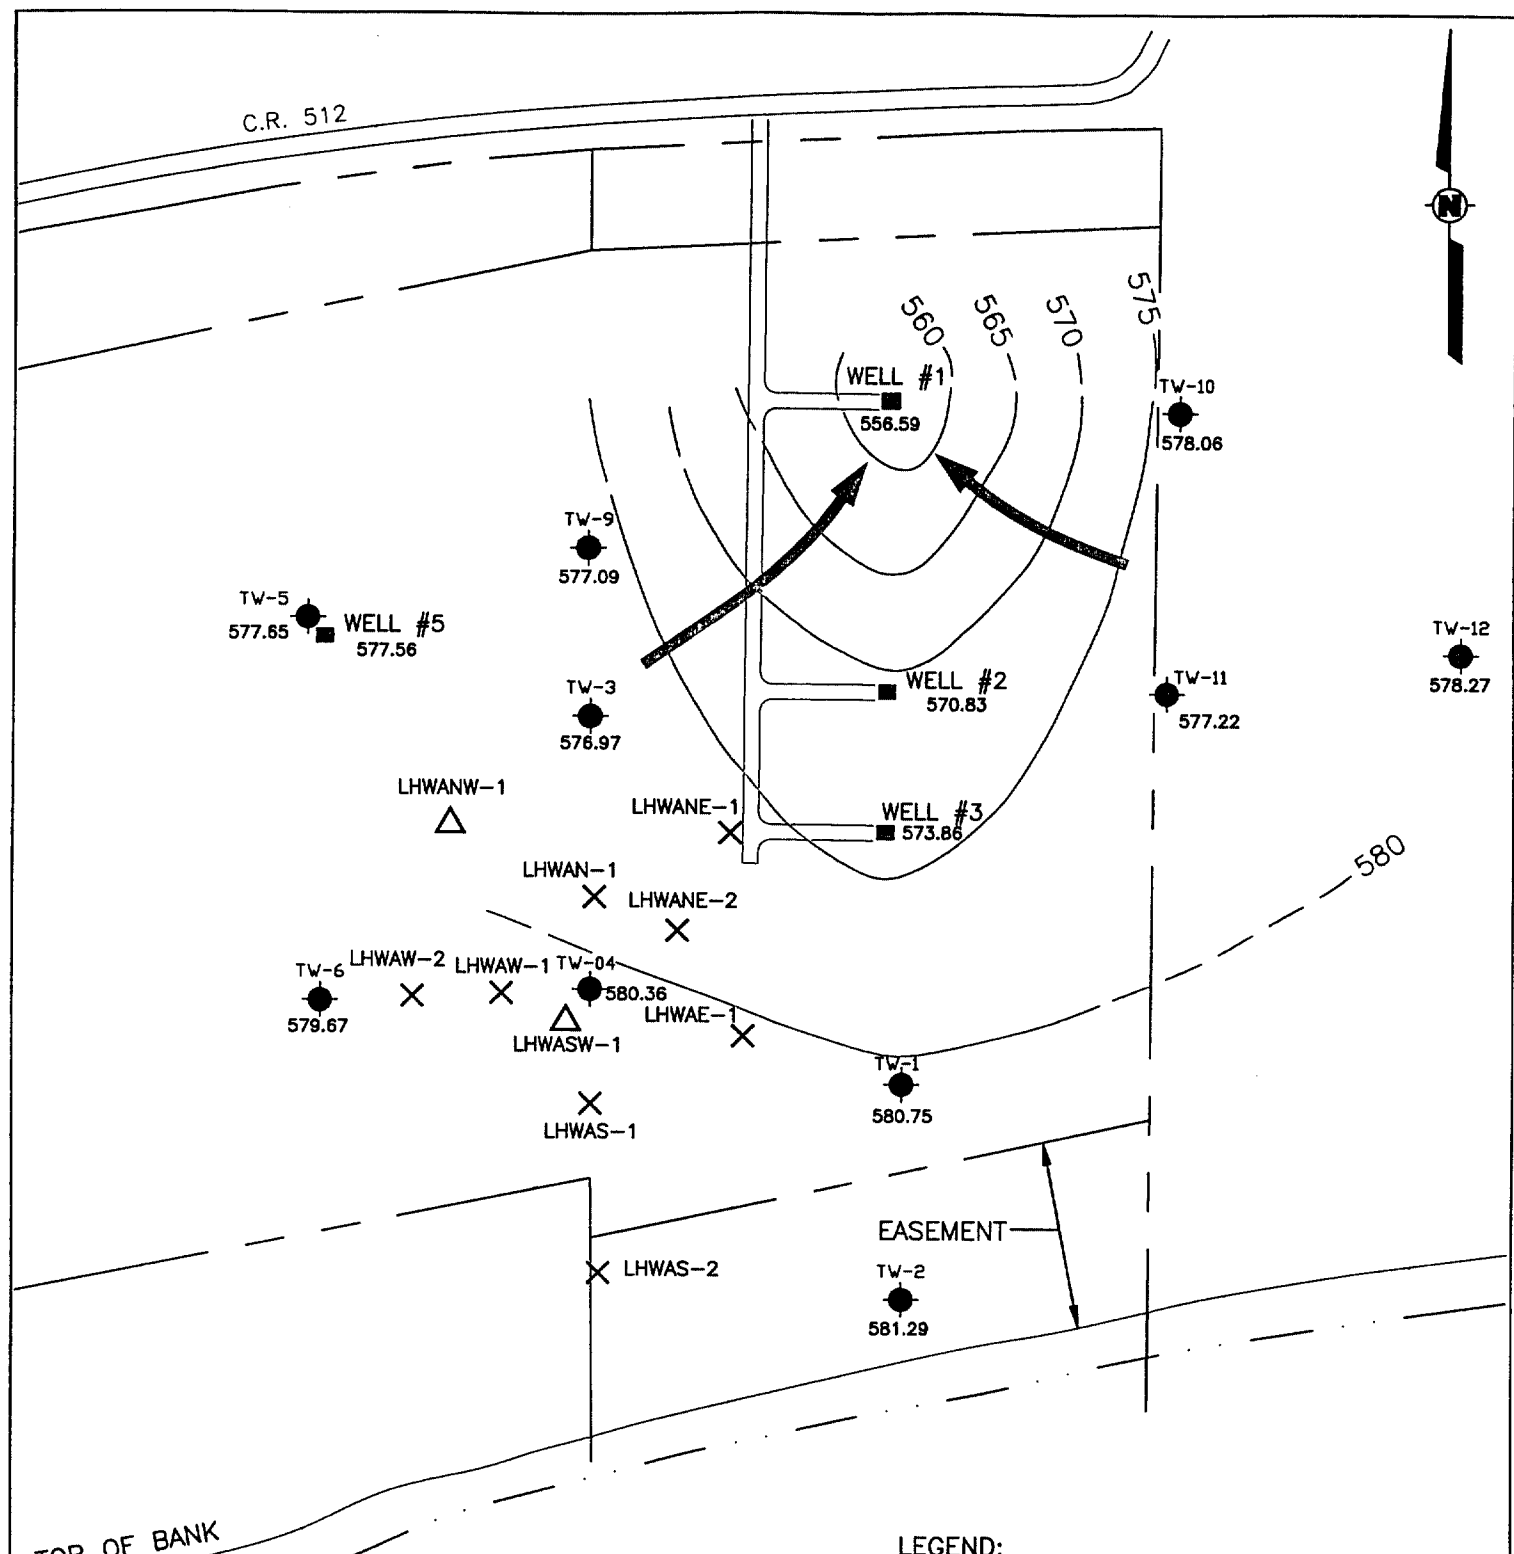

LEGEND:


- WATER SUPPLY WELL
- TEST WELL
- △ BORING - SOIL & GROUNDWATER SAMPLES
- × BORING - GROUNDWATER SAMPLES

- 565 — DIRECTION OF GROUND-WATER FLOW
- ← GROUNDWATER CONTOUR WITH ELEVATION
- 581.29 WATER LEVEL ELEVATIONS IN FEET MSL

NOTE:

LOCATIONS OF WELLS AND BORINGS ARE APPROXIMATE.

SCALE



000473



Corporate Remediation Group


*An Alliance between
DuPont and URS*

Barley Mill Plaza, Building 27
Wilmington, Delaware 19805

GROUNDWATER ELEVATION CONTOUR MAP
AUGUST, 2002

Little Hocking Water Association
Little Hocking, Ohio

SCALE	DESIGNED	DRAWN	CAD FILE NO.
As Shown		DEL	3635A002
DATE	CHECKED	APPROVED	FIGURE
4/12/02	TDL		8

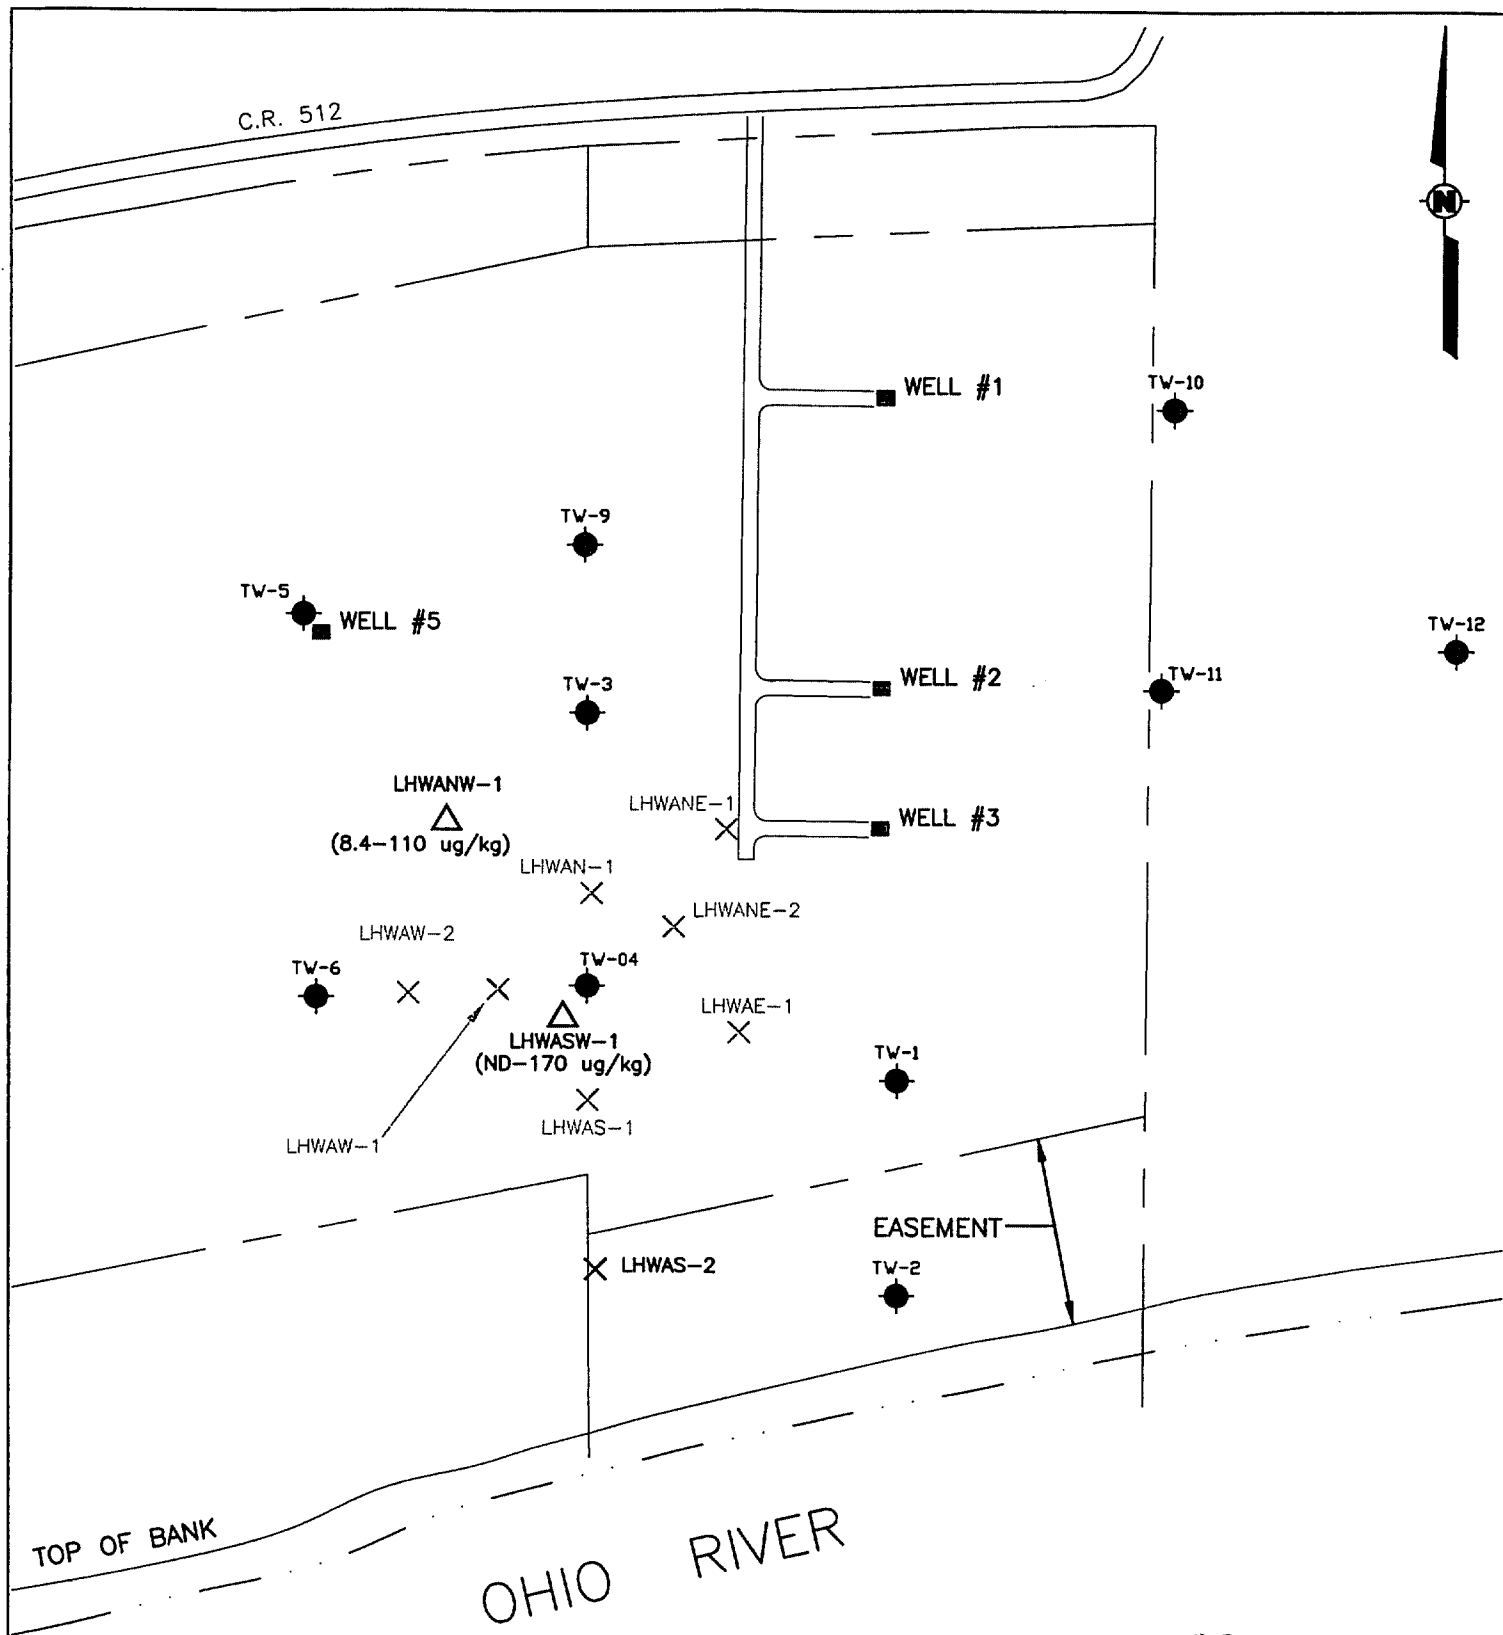


000474

LEGEND:

- WATER SUPPLY WELL
- TEST WELL
- △ BORING - SOIL & GROUNDWATER SAMPLES
- × BORING - GROUNDWATER SAMPLES

SCALE



NOTE:

LOCATIONS OF WELLS AND BORINGS ARE APPROXIMATE.
ND = NON DETECT AT STATED REPORTING LIMIT



Corporate Remediation Group

*An Alliance between
DuPont and URS | Diamond*


Barley Mill Plaza, Building 27
Wilmington, Delaware 19805



C-8 CONCENTRATION
RANGES IN SOIL (ug/l)

Little Hocking Water Association
Little Hocking, Ohio


SCALE As Shown	DESIGNED	DRAWN DHE	CAD FILE NO. 7423A009
DATE 02/28/2003	CHECKED TDL	APPROVED	FIGURE 9

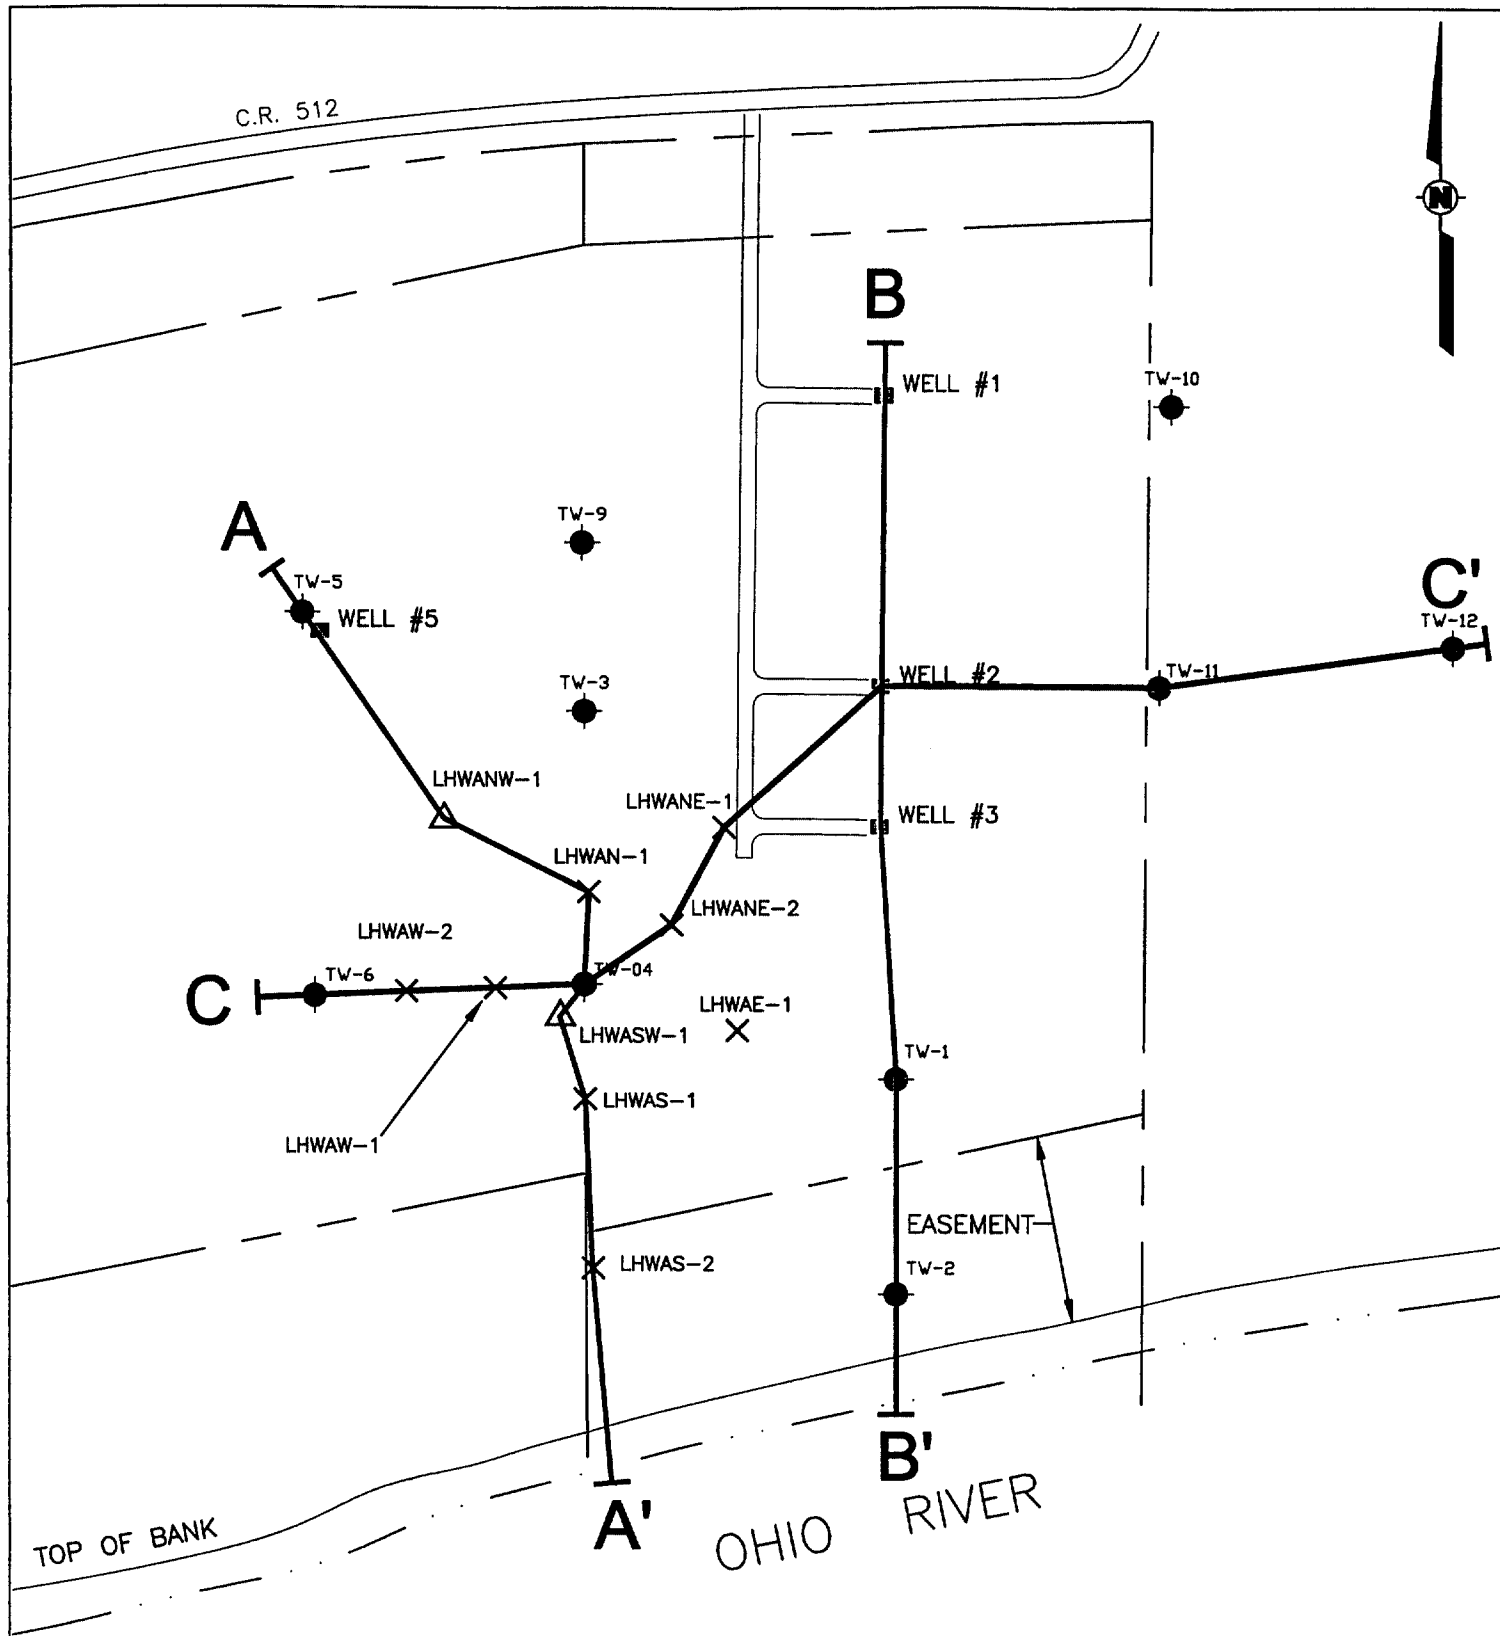

LEGEND:

- WATER SUPPLY WELL
- TEST WELL
- △ BORING - SOIL & GROUNDWATER SAMPLES
- × BORING - GROUNDWATER SAMPLES

SCALE



NOTE:

LOCATIONS OF WELLS AND BORINGS ARE APPROXIMATE.

000475



Corporate Remediation Group

*An Alliance between
DuPont and URS Diamond*

Barley Mill Plaza, Building 27
Wilmington, Delaware 19805




CROSS-SECTION LOCATION MAP

Little Hocking Water Association
Little Hocking, Ohio

SCALE As Shown	DESIGNED	DRAWN DHE	CAD FILE NO. 3636A006
DATE 03/28/02	CHECKED KLD	APPROVED	FIGURE 10


SOUTH A'

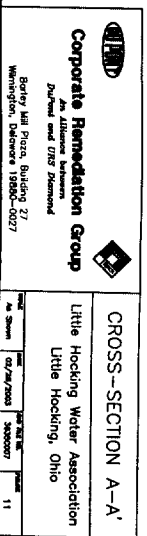

NORTH
B

SOUTH
B'

000477

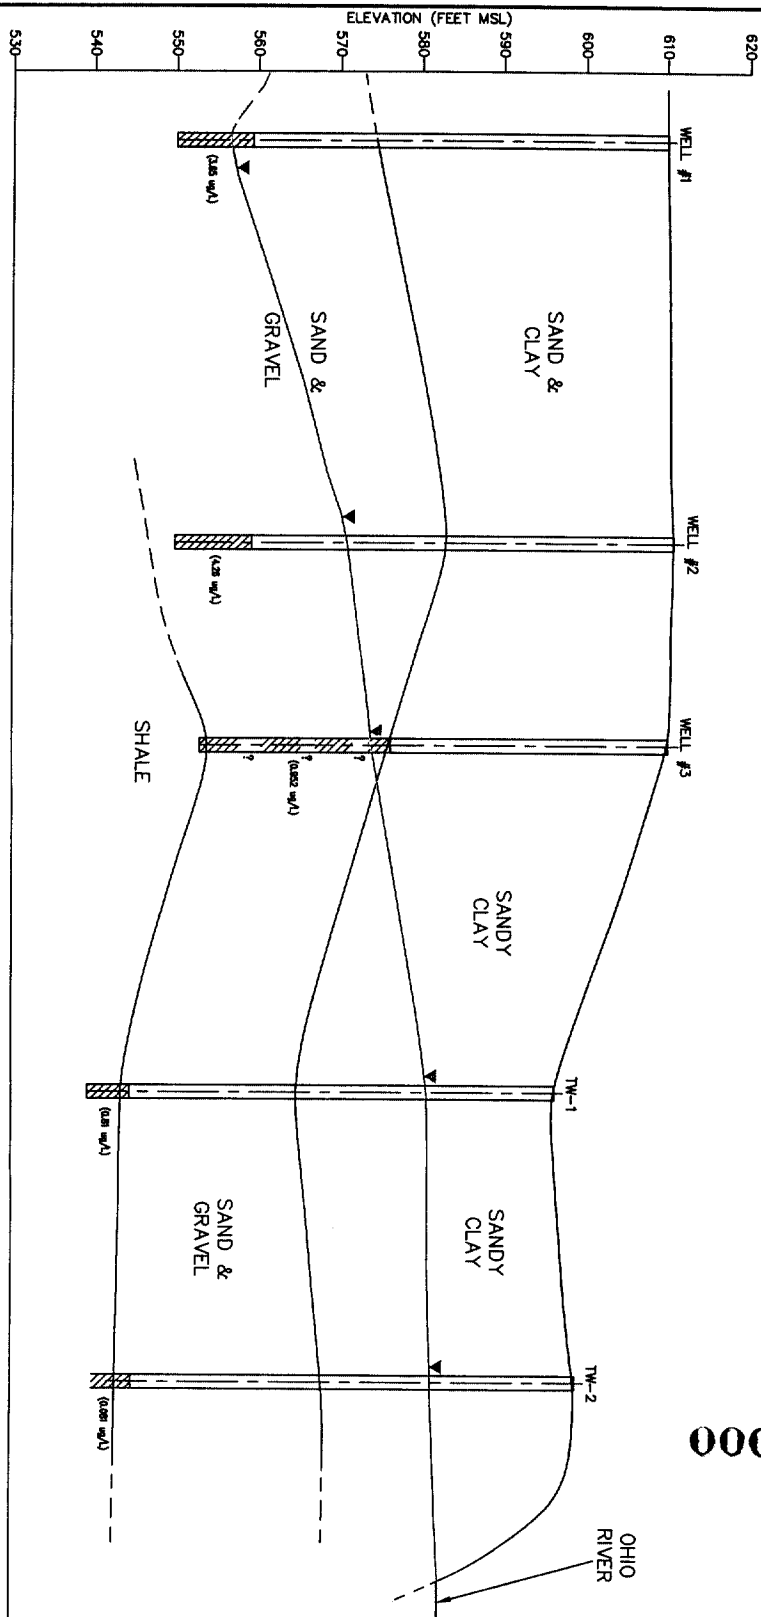

LEGEND:

SCREENED INTERVAL IN TEST WELL OR PRODUCTION WELL AND C-8 CONCENTRATION IN GROUNDWATER (ND-CLOI ug/L)

ESTIMATED SCREENED INTERVAL IN TEST WELL OR PRODUCTION WELL AND C-8 CONCENTRATION IN GROUNDWATER (ND-CLOI ug/L)

GROUNDWATER ELEVATION

Horizontal Scale: 1" = 60'
Vertical Scale: 1" = 10'



Corporate Remediation Group
An Alliance between
DuPont and URS | DuPont



CROSS-SECTION B-B'
Little Hocking Water Association
Little Hocking, Ohio

50' 0" 10' 0" 5' 0" 0' 0"

Scale: 1" = 60'


12

West

C

East

C'

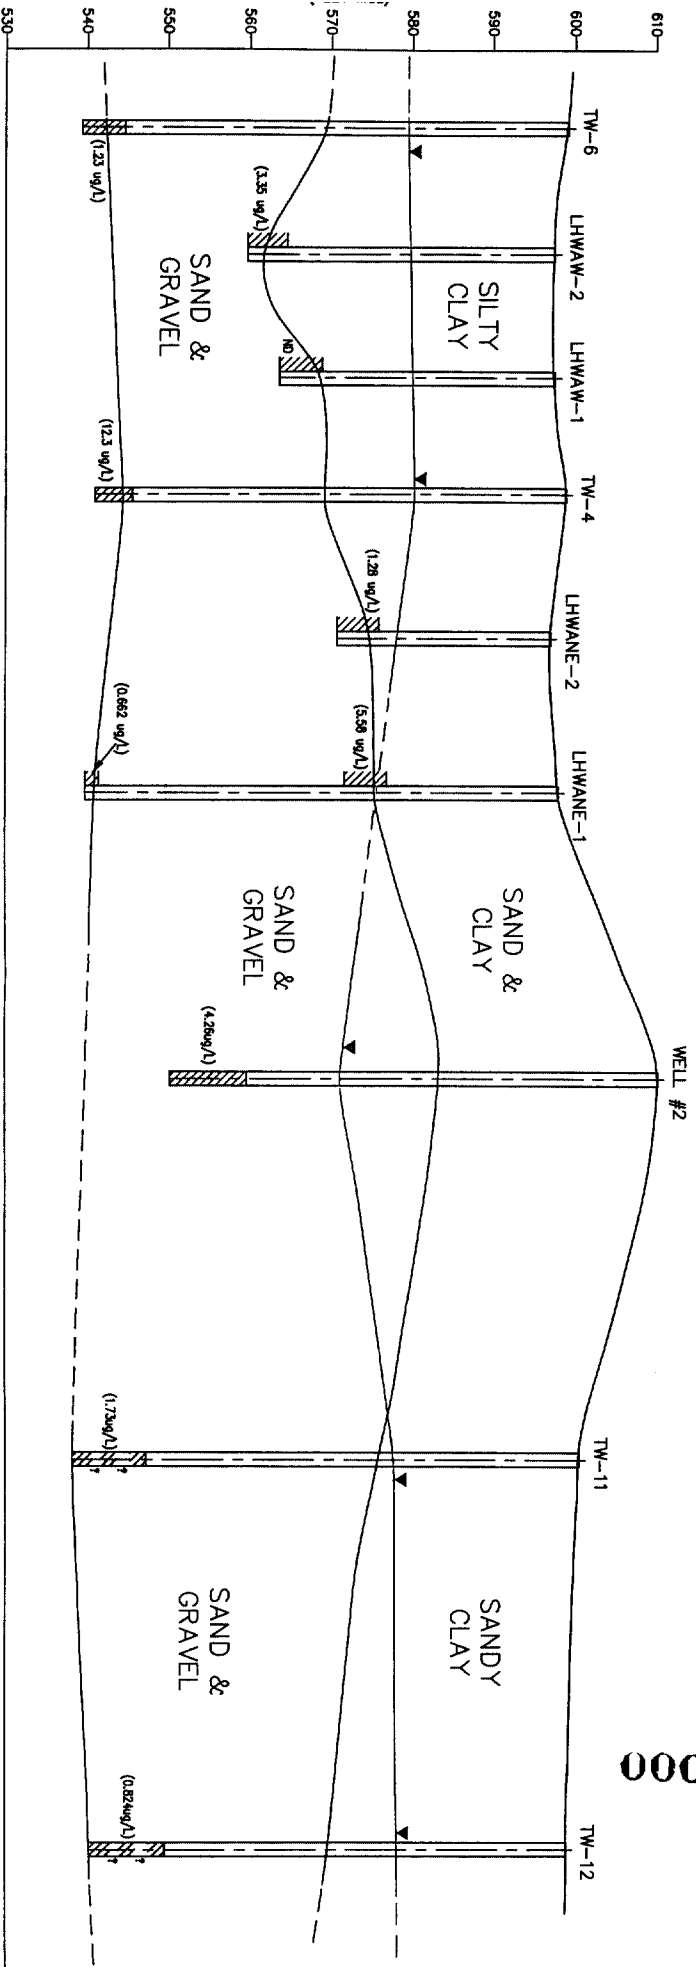

000478

LEGEND:

SCREENED INTERVAL IN TEST WELL OR
PRODUCTION WELL AND C-8 CONCENTRATION
IN GROUNDWATER (ND=0.01 ug/L)

ESTIMATED SCREENED INTERVAL IN TEST WELL
OR PRODUCTION WELL AND C-8 CONCENTRATION
IN GROUNDWATER (ND=0.01 ug/L)

GROUND WATER SAMPLE LOCATION IN GEOPROBE
OR ROTISONIC BORING AND C-8 CONCENTRATION
IN GROUNDWATER (ND=0.01 ug/L)

GROUNDWATER ELEVATION

Horizontal Scale: 1" = 60'
Vertical Scale: 1" = 10'

Corporate Remediation Group
An Affiliation Between
Pulte and D&B Companies

CROSS-SECTION C-C'
Little Hooking Water Association
Little Hooking, Ohio

As Shown

12/27/2023

15

Barry Hill Plaza, Building 27
Wilmington, Delaware 19805-0027

15

APPENDIX A
C-8 ANALYTICAL REPORTING

000480

C-8 Analysis of Water

In October 2001, a new analytical method for analysis of C-8 in water was developed and tested by Exygen Research, Inc. (Exygen; located in State College, PA). This laboratory utilizes Liquid Chromatography/Tandem Mass Spectrometry (LC/MS/MS). DuPont adopted the regular use of LC/MS/MS for C-8 analysis in water in November 2001 and Exygen continues to perform the water analyses for DuPont.

Exygen reports C-8 results for the laboratory replicate of each field sample. These results are evaluated for precision by comparing the field sample result to the corresponding laboratory replicate result.

- ❑ If both results are less than the practical quantitation limit (PQL), the replicate sample for that analyte is considered to have passed the precision criteria.
- ❑ If one or both results are between one and five times the PQL, the replicate is considered to have met the precision criteria if the two results differ by less than the PQL.
- ❑ If one result is less than the PQL and the other is not, and if the two results differed by a value less than the PQL, the replicate is said to have met the acceptance criteria.
- ❑ If both results are at least five times the PQL, the replicate is considered to have met the criteria if the relative percent difference (RPD) between the two results is less than or equal to 20%. The RPD is the absolute value of the difference of two measurements divided by their average.

When the precision criteria outlined above are met, Exygen reports the average of the field sample and laboratory replicate results reported by the laboratory. If criteria for precision are exceeded, Exygen reports the higher of the sample and lab replicate results. Finally, when one result (from the sample/lab replicate pair) is above the PQL and one below, the result that is above the PQLs is reported. C-8 results are recorded in the Corporate Environmental Database (CED) and are reported as FC-143 for consistency with historical results.

An aliquot of each field sample is also analyzed as a matrix spike (MS). Results of the MS analysis are used to assess accuracy. The MS recovery value must fall between 70 to 130%, unless the sample concentration is at least four times the amount spiked. The maximum amount used to spike field samples is 500 ug/L.

All data packages generated by Exygen are reviewed in-house for compliance with the laboratory Standard Operating Procedures (SOP) and data usability, using the checklist provided in the Quality Assurance Project Plan (DuPont 2002a). Results of the in-house review indicate that data reported by Exygen have been generated in compliance with the laboratory SOP, with few exceptions as noted in the individual review summaries. All data reported by Exygen have been judged usable for the purposes of the project. A subset of the data packages generated by Exygen have been submitted to Environmental Standards, Inc (ESI) in Valley Forge, Pennsylvania, for an independent (i.e., third-party) quality assurance review. Results of the quality assurance review will be provided when available.

000481

C-8 Analysis of Soil

The laboratory performing analysis of soil samples and associated field blanks is Severn-Trent Laboratories, Inc., Arvada, Colorado (STL-Denver).

STL-Denver analyzes samples for C-8 according to a laboratory standard operating procedure (SOP), DEN-LC-0012A. Each sample is tested unspiked, in duplicate (lab replicate), and spiked with C-8, using LC/MS/MS.

STL-Denver reports C-8 results for the laboratory replicate of each sample. These results are evaluated for precision by comparing the sample result to the corresponding laboratory replicate result.

- ☐ If both results are less than the practical quantitation limit (PQL), the replicate sample for that analyte is considered to have passed the precision criteria.
- ☐ If one or both results are between one and five times the PQL, the replicate is considered to have met the precision criteria if the two results differ by less than the PQL.
- ☐ If one result is less than the PQL and the other is not, and if the two results differed by a value less than the PQL, the replicate is said to have met the acceptance criteria.
- ☐ If both results are at least five times the PQL, the replicate is considered to have met the criteria if the relative percent difference (RPD) between the two results is less than or equal to 20%. The RPD is the absolute value of the difference of two measurements divided by their average.

When the precision criteria outlined above are met, STL-Denver reports the average of the sample and lab replicate results. If criteria for precision are exceeded, STL-Denver reports the higher of the sample and lab replicate results. Finally, when one result (from the sample/lab replicate pair) is above the PQL and one below, the result that is above the PQL is reported. C-8 results are currently recorded in DuPont's Corporate Environmental Database (CED) and are reported as FC-143 for consistency with historical results.

An aliquot of each field sample is also analyzed as a matrix spike (MS). Results of the MS analysis are used to assess accuracy. The MS recovery value should fall between 70 to 130%, unless the sample concentration is significantly higher than the amount spiked.

All data packages generated by STL-Denver are reviewed in-house for compliance with the laboratory Standard Operating Procedures (SOP) and data usability. Results of the in-house review indicate that data reported by STL-Denver have been generated in compliance with the laboratory SOP. All data reported by STL-Denver have been judged usable for the purposes of the project. A subset of the data packages generated by STL-Denver have been submitted to Environmental Standards, Inc (ESI) in Valley Forge, Pennsylvania, for an independent (i.e., third-party) quality assurance review. Results of the quality assurance review will be provided when available.

000482

APPENDIX B

GEOLOGIC LOGS FOR LITTLE HOCKING WATER ASSOCIATION WELL FIELD TEMPORARY BORINGS



LHWA-N1

(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 29, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 597.69'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.69	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	597	T T T T T		Brown silty TOPSOIL.		
		T T T T T		SILTY CLAY, top few inches is gray w/o mottles. Becomes brown with lots of orange, gray and dark brown mottles. Dry and crumbly.	85%	
5	592			Light brown SILTY CLAY, with gray mottles (fracture surfaces?) and some rare orange mottles, hard, semi-plastic	100%	
				No mottles, few pebbles.		
				2" very dark brown SILTY CLAY, mottles are BLACK after which there are no mottles.		
10	587			Brown SILTY CLAY, rare fine to very fine sand, sticky. Rolls into coarse logs.	100%	
				Like above, soft.	121%	
				Rare sand and pebbles, Sandstone clasts at 15.2 and 15.9'. Moist, not mottles.	154%	
15	582			Brown SANDY/SILTY CLAY to CLAYEY SILTY SAND, very moist at 17', Pebbles at 17.3'.	200%	
				Brown fine SAND, minor silt and clay, wet. Interbedded with moist SILTY CLAY to 20'.	133%	
20	577			WL measured 1 hour after setting well point.		
				Clayey SILTY SAND, wet to moist, brown, few pebbles, cobble at 18". Bottom is fine sand with little silt and no clay (21.6-22').	146%	
				TD at 22'.		
25	572					
30						

000485



LHWA-NE1

(page 1 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 20, 2002
Date Completed : August 20, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Mornier
Logged By : Steve Opp

Northing (WV St Pl)* :
Easting Coord.** :
Surface Elevation** : 597.85'
Sample prefix : LHWA NE

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.85	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	597			Brown silty TOPSOIL, some organics, dry. By .2' have tannish brown CLAYEY SILT, micaceous, little organics, some orange mottling, dry.	90%	
5	592			Reddish brown SILTY CLAY, dry, micaceous, orange and gray mottling. Moisture in sample by ~7.5'. Increased clay with depth.	122%	
10	587			Brown SILTY CLAY, micaceous, some fine to medium sand, moist to wet, trace fine to medium gravel to ~10.5' depth, well rounded.	118%	
15	582			Continued Brown SILTY CLAY with some sand, moist to wet, micaceous.	126%	
20	577			Trace fine gravel to ~19.5'. ~0.5' thick zone of SILTY SAND w/ little fine to medium gravel. Moist to wet. Below is ~2.5' brown SILTY CLAY with some fine to medium SAND, moist to wet, micaceous.	100%	
				GW elevation when GW sample collected (21-27).		GW SAMP
25	572			Brown fine to medium SAND with little clay and little silt, becomes wet, dark brown to black stained zones at 22.7 and 23.1'. Zones are ~1" thick		
				Brown fine to medium SAND, with trace fine gravel, little silt and clay, micaceous, wet.		
30				Grades to a brownish to tannish brown fine to coarse SAND, with some fine to medium well rounded gravel at base of sample [~30'], wet micaceous.	114%	

000486



LHWA-NE1



(page 2 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 20, 2002
Date Completed : August 20, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : Steve Opp

Northing (WV St Pl)* :
Easting Coord.** :
Surface Elevation** : 597.85'
Sample prefix : LHWANE

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.85	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
30	567			Tannish brown silty fine to coarse SAND with some fine to medium well rounded gravel, wet, micaceous. Poor recovery 30-40' interval.		
35	562				50%	
40	557			Same as above with angular gravel		
45	552				73%	
50	547			Brown to dark brown silty fine to coarse SAND w/ some fine to coarse gravel, micaceous, wet.		
55	542			Greenish gray competent SILTSTONE breccia, micaceous, dry. (Depth estimated based on measured thickness of overlying seds, not versus total recovery). TD@60'.	29%	
60						

000487



LHWA-NE2

(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 29, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Mornier
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 596.64'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 596.64	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	596			Brown, silty clay TOPSOIL, dry, crumbly.		
				Gray SILTY CLAY, hard, dry, crumbly, few mottles.	83%	
				Heavy orange mottles, some reds, few black. Gray/brown overall color.		
5	591			Mottles and fracture coating are black, red and orange. Lighter oranges with depth.	100%	
				8" long parting with orange coating.		
10	586			Brown SILTY CLAY turning to olive brown clay and SILTY CLAY. Semi- plastic, moderately stiff to plastic.	100%	
				Brown SILTY/SANDY CLAY, dark brown mottles, semi-plastic to plastic, moist. Rare pebbles, sand is fine to very fine, some dark brown to black mottles, plastic, moist.	117%	
15	581			GW level measured ~12 hours after well installation.	113%	
				Brown SILTY/SANDY CLAY- increased sand, few pebbles + cobbles of sandstone at 19'. Moist.	121%	
20	576				79%	
25	571			Medium SAND, few pebbles, wet. (Poor recovery-depth estimated).	61%	GW SAMP
TD at 25.7'. Well set (3/4" PVC).						
30						

000488



LHWA-E1

(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 29, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 596.39'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 596.39	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	596			Light brown silty TOPSOIL. Dry.		
				Gray SILTY CLAY, Top 10" has few mottles (C horizon), Hard, dry. Below is brown/gray SILTY CLAY with lots of orange mottles, few brown mottles, dry, crumbly.	81%	
5	591			Light brown SILTY CLAY with strong red and orange mottles and coatings on fracture surfaces. Some black mottles, semi-plastic to crumbly.	100%	
10	586			Olive brown SILTY CLAY with gray mottles and gray-coated fractures. No moist fractures. Semi-plastic	94%	
15	581				100%	
					154%	
20	576			SILTY TO SANDY CLAY. plastic, sticky, soft, brown with green tinge, some gray mottles, sandy zones more moist.	200%	
				6" Silty fine SAND, brown, wet, sloppy.	133%	
				Brown SANDY/SILTY CLAY, gray and orange mottles, plastic. sticky.	150%	
				Brown gray SILTY/ANDY CLAY. plastic, moist.		
				SANDY CLAY, sticky, wet.		
25	571			Thinly interbedded (~2-5") FINE SAND +/- silt and SILTY/SANDY CLAY. SAND is wet. Bottom 1/3 is SANDY BROWN CLAY, sticky, plastic.	146%	
TD @ 26'. Well set (3/4" PVC)						
30						

000489



LHWA-S1

(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 27, 2002
Date Completed : August 27, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 596.46'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 596.46	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	596			Brown silty TOPSOIL, dry, minor roots, crumbly.		
				Brown/gray SILTY CLAY, hard, stiff, competent, orange mottles. Becomes light brown with depth. Mixed orange and gray mottles.	29%	
5	591				60%	
10	586			Gray mottles have moisture inside (old rootlettes?) Clay is stiff but semi-plastic. Very hard drilling, light brown SILTY CLAY, same as above.	100%	
			▼	Water level measured 1.5 hours after drilling ceased.	108%	
15	581			Brown SILTY CLAY, gray mottles, rare dark brown mottles, moist, very plastic, can roll into ropes. Mica is present, not noted above.	138%	
				SANDY/SILTY CLAY, Brown, moist, fine to very fine sand grains, clay is becoming sticky.	138%	
				SANDY CLAY are soft, and very moist (not wet). Few dark brown/black mottles.	142%	
20	576			Sandy zone zone in SANDY CLAY, 5" thick. very moist, no odors.	142%	
				Light brown SILTY CLAY, minor fine sand, moist, sticky, wet sand stringer at ~24'.	146%	
25	571			Clay becomes interbedded (.5-1' thick) SILTY CLAYS AND SANDY CLAYS. Silty clay is light brown and soft, Sandy clays are very moist and light brown.	158%	
				REDRILL- Interbedded brown CLAY and fine SANDS (dropped sample)	100%	GW sample
30				Red/orange CLAY, layered, w/ gray clay (?). Moist, stiff.		

000490



LHWA-S2

(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 26, 2002
Date Completed : August 26, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 598.76'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 598.76	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	598			Brown SILTY CLAY w/ lesser CLAYEY SILT. 0-3' - Dry, Sandstone fragments at 23", roots, crumbly.	88%	
				Brown SILTY CLAY with gray, moist, semi-plastic, roots, rare orange mottles.		
				SILTY CLAY, rare dk brn and gray mottles. Semi-plastic to crumbly, more clayey and semi plastic at base, stiff. Top 12' dry.	100%	
5	593					
				Brown SILTY CLAY (more clay). Semi-plastic to plastic, more moist at base, rolls to string in hand at base, minor mica, gray and rare dk brown mottles- gray appear to be old root sections and moister.	100%	
10	588					
				Brown SILTY CLAY like above. Wet spots in gray mottles. Not as stiff. Slightly soft.	100%	
				Water level measured next morning.	100%	
15	583					
				Brown SILTY/SANDY CLAY, moist, sticky, soft, minor mica and coal(?) fragments, some gray mottling, moister or wet along mottles. Sand is fine to very fine grained.	122%	
				Brown SANDY CLAY. very moist but not wet. Some black spots of High organic(?) content, no odor, very soft and plastic.	133%	
20	578					
				Brown SILTY CLAY -4" at ~22', soft, moist.		
				Brown SANDY CLAY, dark brown mottles, very soft, same as above.	128%	
				Brown VERY SANDY CLAY, WET w/ lesser moist, SILTY CLAY.		
25	573			Brown SILTY SAND with minor clay, wet, minor mica.	122%	
				SILTY SANDY CLAY, moist not wet, brown.		
				Drilled to 30' to try to get water sample. Problems collecting sample. Water level ~24.3' BGS after drilling to 30' (it dropped). No recovery in this run.		
30						

000491



LHWA-SW1

(page 1 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 23, 2002
Date Completed : August 28, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : Steve Opp

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 596.87'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 596.87	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	596			Dark brown TOPSOIL, dry. By .2' have tannish brown CLAYEY SILT, some organics, dry. Tannish brown SILTY CLAY, with little organics, orange and grey mottling, dry.	68%	(3-.9)
5	591			Tannish brown SILTY CLAY with orange and gray mottling, dry.	117%	(5-5.6)
10	586			Brown SILTY CLAY with some gray mottling, dry to moist.	128%	(11.2-11.7)
15	581			Tannish brown, same as above, dry to moist.	118%	(15.5-16)
20	576			Tannish brown to brown SILTY CLAY, micaceous, becomes moist, gray mottling.	108%	
25	571			Thin black-stained zone at 24.5'.	114%	(26.5-27)
30				Brown CLAYEY SILT, gray mottling, moist to wet, micaceous. Thin (2"), fine SANDY zone, wet at 29' followed by brown CLAYEY SILT, micaceous, variably wet.		

000492



LHWA-SW1

(page 2 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 23, 2002
Date Completed : August 28, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : Steve Opp

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 596.87'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 596.87	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
30	566			Brown CLAYEY SILT, some fine sand, wet, micaceous, orange and gray mottling, fine sandy lens from 30.5-31'.	210%	(30-30.5) (30.5-31) GW SAMP
35	561			Brown to gray SILTY CLAY with little fine sand, wet. Grades to silt with some fine sand.	75%	
40	556			Tannish brown SILTY fine to medium SAND with some fine to medium gravel, little clay, WET.	44%	(37-37.5) (37.5-38)
45	551			Tannish brown fine to coarse SAND with some fine gravel, little silt, wet, charcoal seam at 0.7' from base of sample.	74%	GW SAMP (44.3-44.5)
50	546			Tannish brown fine to medium SILTY SAND with little fine to medium gravel, wet, charcoal seam near bottom of interval.	104%	(47.5-48)
55	541			Fine to medium gravel (0.5') followed by tannish brown fine to coarse SILTY SAND = with some fine to coarse gravel, wet.	50%	GW SAMP (53.5-54)
60				Tannish brown fine to coarse grained SILTY SAND with some fine to coarse gravel, wet. Yellowish brown to greenish gray weathered SH + ST bedrock, dry.	135%	(55.5-56)
				TD A@~57'.		

000493



LHWA-W1

(page 1 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 28, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 597.17'

* See figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.17	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	597			Brown silty day TOPSOIL. Dry, crumbly.		
				Gray/Brown SILTY CLAY, few orange mottles, hard and dry, Increased mottling below 1', including orange and dark brown mottles, somewhat crumbly.	85%	
5	592			Light brown SILTY CLAY with gray mottles, semi-plastic, stiff, crumbles into small balls when rolled.	100%	
				Some orange mottled, continued semi-plastic, gray mottles appear to be rootlets.		
10	587			Few gray mottle cracks appear moist vs the dry clay, semi-plastic.	100%	
				No moisture in mottles. Very stiff, hard to break.	121%	
15	582				77%	
				Brown SILTY CLAY, plastic, sticky, rare sand grains, fine to very fine sand, Gray and dark brown mottles. Possible desiccation crack in this interval. Increased mica content.	200%	
20	577				133%	
				~.8' of SANDY SILTY CLAY, f-vf sand, moist, not wet.	146%	
				GW level measured 1 hour after drilling.		
25	572			SILTY/CLAYEY SAND, wet to moist, light brown	154%	
				SILTY/SANDY CLAY, light brown, moist, increased sand with depth. to ~26.3'. Wet, sloppy SILT with CLAY (2").	154%	
				Brown SILTY CLAY, rare sand, few mottles.		
				SANDY SILTY CLAY, Plastic, gray and orange mottles, some mica. Small piece of coa.		
30				Brown fine SANDY SILT, clayey, wet, sloppy	100%	

000494



LHWA-W1


(page 2 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 28, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 597.17'

* See figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.17	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
30	567			SANDY/SILTY CLAY, brown, moist, plastic. Muddy SILT in bottom 2". Very fine to medium-fine SAND, minor silt and clay, wet. SILTY CLAY, minor sand, stiff, moist. Fine SILT, muddy, wet, brown, underlain by 5" of moist, SILTY SANDY CLAY, moist. TD @ 34'. Well point set here.	100% 133%	
35	562					
40	557					
45	552					
50	547					
55	542					
60						

000495



LHWA-W2

(page 1 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 28, 2002
Date Completed : August 28, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 597.20'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.20	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
0	597			Brown silty TOPSOIL, dry, minor roots, crumbly. Light brown silty clay TOPSOIL, dry, crumbly. Gray SILTY CLAY, dry, crumbly, no mottles in upper .5'. Becomes Brow/gray with orange mottles below this, stiff, hard.	81%	
5	592			Crumbles to small balls when rolled. Light brown SILTY CLAY, gray mottles, semi-plastic, Dry, minor dark brown mottles.	98%	
10	587			Still no moisture noted.	100%	
15	582			SILTY CLAY is a little softer, little more moisture, dry.	100%	
20	577			Measured GW 15 minutes after drilling, elevation not stable (rising)	175%	
				Gray mottles show some moisture, few dark brown mottles, clay is now able to be rolled into thin ropes between hands, Some mica below this point.	150%	
				Rare sand, moist, plastic, sand is fine to very fine. Sediments are soft.	125%	
25	572			SANDY CLAY/CLAYEY SAND, very moist, light brown color, minor mica. Brown SILTY CLAY, minor SAND. Brown SANDY SILTY CLAY LAYER (6" thick)	179%	
				Very pronounced gray rootey channel ~10" long, wet inside, very soft and plastic clay. Rolls very thin.	163%	
				SANDY CLAY to CLAYEY SAND, light brown, fine sand, wet seams at ~27.5' and 29.2' (<= 3")	200%	
30					150%	

000496



LHWA-W2



(page 2 of 2)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 28, 2002
Date Completed : August 28, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : John Ristow

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 597.20'

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 597.20	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample
30	567			Brown SILTY CLAYEY SAND, very sloppy, wet. Some gray coloring. Sticky, mica.	125%	GW SAMP
				Brown and Gray SILTY CLAY, increased sand content with depth, moist.	179%	
35	562			Gray SANDY CLAY to CLAYEY sand with a few small pebbles, wet, for .8' becoming Gray sand and small gravel, clean, wet, Bottom 1' SILTY SAND and GRAVEL mix. TD @38'.	163%	
					200%	
40	557					
45	552					
50	547					
55	542					
60						

000497



LHWA-NW1



(page 1 of 1)

DuPont Corporate Remediation Group
Washington Works Consent Order
Little Hocking Investigation
Project # 18983762

Date Started : August 28, 2002
Date Completed : August 29, 2002
Drilling Method : Geoprobe
Sampling Method : Continuous
Company : Bowser Morner
Logged By : Steve Opp

Northing (WV St Pl)* :
Easting Coord.* :
Surface Elevation** : 598.01
Sample prefix : LHWANW1

* See Figure 6 for approximate location
** Elevation assumes top of Well House #1
Floor Slab = 610.00' :

Depth in Feet	Surf. Elev. 598.01	GRAPHIC	Water Level	DESCRIPTION	Recovery	Sample	
0	598			Stiff, tannish brown topsoil. Some organics, dry. Grades quickly into tannish brown CLAYEY SILT with some organics, dry, orange and gray mottling.	88%	(0.1-0.5)	
5	593			Brown CLAYEY SILT/SILTY CLAY, micaceous, orange and gray mottles, dry.	114%	(5-5.5)	
10	588			Brown SILTY CLAY w/ little fine to medium gravel and little fine sand, becomes moist, micaceous.	126%	(10-10.5)	
15	583			Brown SILTY CLAY with trace fine to medium gravel and some fine to medium sand. Increasing sand content and coarsening toward base of sample (19').	94%	(15-15.5)	
20	578			Same as above with silt lens at 21'.	92%	(20-20.5)	
25	573			Brown fine SILTY SAND with some clay, wet, grades to tannish brown fine to medium SAND with some silt, and trace clay, wet.	92%	GW SAMP (25-25.5)	
				Tannish brown fine to medium SILTY SAND, wet.	92%	GW SAMP	
30		TD @ 29'.					

000498

APPENDIX C

GEOLOGIC LOGS FOR PRODUCTION AND TEST WELLS (PROVIDED BY LITTLE HOCKING)

WELL # 1

Water Well Log and Drilling Report
Ohio Department of Natural Resources
Division of Water
Phone: 614-265-6740
email: cleve.brown@dnr.state.oh.us
Water Home: <http://www.dnr.state.oh.us/water>

WELL LOG AND DRILLING REPORT

Well Log Number: 389539

ORIGINAL OWNER AND LOCATION

Original Owner Name: *LITTLE HOCKING WATER* Lot Number:
County: *WASHINGTON* Township: *BELPRE* Section Number:
Address:
State: *OH* Zip Code:
Location Map Year: *1981* Location Area:
Location Number: *42*

CONSTRUCTION DETAILS

Wellbore Diameter:
Casing Diameter: *10 in.*
Well Use:
Wellbore Type:
Total Depth: *50 ft.*
Casing Thickness:
Screen Length:
Driller's Name: *G.M. BAKER & SON*
Depth to Bedrock:
Casing Length: *51 ft.*
Date of Completion: *11/28/70*

WELL TEST DETAILS

Static Water Level: *10 ft.*
Drawdown: *25 ft.*
Test Rate: *250 gpm*
Test Duration: *40 hrs.*
Associated Reports
NONE

WELL LOG

Formations	From	To
SAND & CLAY	0	- 22
SAND & CLAY	22	- 36
GRAVEL/SAND/CLAY	36	- 40
SAND & GRAVEL	40	- 50

000501

WELL #2

Water Well Log and Drilling Report
Ohio Department of Natural Resources
Division of Water
Phone: 614-265-6740

email: cleve.brown@dnr.state.oh.usWater Home: <http://www.dnr.state.oh.us/water>**WELL LOG AND DRILLING REPORT**

Well Log Number: 389538

ORIGINAL OWNER AND LOCATIONOriginal Owner Name: *LITTLE HOCKING WATER* Lot Number:County: *WASHINGTON*Township: *BELPRE*

Section Number:

Address:

City:

State: *OH*

Zip Code:

Location Number: 42

Location Map Year: *1981* Location Area:**CONSTRUCTION DETAILS**

Borehole Diameter:

Total Depth: *60 ft.*

Depth to Bedrock:

Casing Diameter: *12 in.*

Casing Thickness:

Casing Length: *51 ft.*

Well Use:

Screen Length:

Date of Completion: *11/28/70*

Aquifer Type:

Driller's Name: *G.M. BAKER & SON***WELL TEST DETAILS**Static Water Level: *16 ft.*Test Rate: *400 gpm***Associated Reports**.wdown: *20 ft.*Test Duration: *24 hrs.*

NONE

WELL LOG**Formations****From To**

SAND & CLAY

0 - 27

SAND

27 - 31

SAND & GRAVEL

31 - 60

000502

WELL #3

Water Well Log and Drilling Report
Ohio Department of Natural Resources
Division of Water
Phone: 614-265-6740

email: cleve.brown@dnr.state.oh.us
Water Home: <http://www.dnr.state.oh.us/water>

WELL LOG AND DRILLING REPORT

Well Log Number: 450860

ORIGINAL OWNER AND LOCATIONOriginal Owner Name: *LITTLE HOCKING WATER* Lot Number:County: *WASHINGTON*Township: *BELPRE*

Section Number:

Address: *CO RD 721*

City:

State: *OH*

Zip Code:

Location Number: *42*Location Map Year: *1981* Location Area:**CONSTRUCTION DETAILS**

Borehole Diameter:

Total Depth: *57 ft.*

Depth to Bedrock:

Casing Diameter: *12 in.*

Casing Thickness:

Casing Length: *34 ft.*

Well Use:

Screen Length:

Date of Completion: *4/29/76*

Aquifer Type:

Driller's Name: *LAYNE-OHIO, COLS***WELL TEST DETAILS**Static Water Level: *16 ft.*Test Rate: *503 gpm*Associated Reports.wdown: *8 ft.*Test Duration: *2 hrs.*

NONE

WELL LOGFormationsFrom To

BRN CLAY

0 - 14

BRN SANDY CLAY

14 - 34

SANDY GRAVEL

34 - 56

RED SHALE

56 - 57

000503



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of

LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Water & Sewer Date 12-20-85
City or Village Little Hocking State Ohio
Well No.: P.W. 5 Drillers: F. Webb & D. Colburn Rig: 45
Well Location: _____ ft. (____) and _____ ft. (____) of the _____ cor
Section _____, Twp. _____ (____), Range _____ (____) _____ Co
Otherwise located as Adjacent to T.H. 5 and T.W. 5A

Work Began: 12-3-85 Work Completed: 12-12-85 Well Depth to Plug: 56'
All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>43</u>	<u>24"</u>	<u>.375</u>	<u>steel</u> with <u>welded</u> joints from _____ to _____
<u>43</u>	<u>12"</u>	<u>.375</u>	<u>steel</u> with <u>welded</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Cook

Amount	Dia.	Opening	Material
<u>15'</u>	<u>.375</u>	_____	<u>S.S.</u> with <u>welded</u> joints from <u>5</u> to <u>15</u>
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom S.S. Plate

Hole Record:

24" inch from 0 to 56'
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>4 ton</u>	<u>1/2"x1/8"</u>	<u>Parry Gravel</u>	<u>56'</u>	<u>21</u>

000504

WELL LOG

Feet		Feet	Description
0	to	20	Brown clay
20	to	27	Brown sandy clay
27	to	37	Brown clay with coarse to fine sand
37	to	45	Medium to coarse sand and gravel with sand fine sand
45	to	57	Medium to coarse sand and gravel
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level 18' 8"; pumping level 31' $\pm$ after 24 hours pumping at 402 g.p.m.

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000505



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of
LAYNE-WESTERN COMPANY, INC.WATER SUPPLY SERVICES
WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue Columbus, Ohio 43228 (614) 876-1195

Name of Job Little Hocking Date 8/31/84
City or Village Little Hocking State Ohio
Well No.: TW-1 Drillers: D. Havens Rig: SR
Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner
Section _____, Twp. _____ (____), Range _____ (____) Cour
Otherwise located as 300'
150' south of PW #3

Work Began: 8/30/84 Work Completed: 8/30/84 Well Depth to Plug: 55'
All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>50'</u>	<u>3"</u>	<u>Sch. 40</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Slot .010

Amount	Dia.	Opening	Material
<u>5'</u>	<u>3"</u>	<u>.010</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC

Hole Record:

_____ inch from _____ to _____
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1100#</u>	<u>#4</u>	<u>Parry Gravel</u>	<u>58'</u>	<u>30'</u>

000506

SEE OTHER SIDE

WELL LOG

Feet		Feet	Description
0	to	5	Brown clay
5	to	10	Brown sandy clay
10	to	15	Brown sandy clay, traces of gray clay
15	to	32	Brown sandy clay, layers of sand
32	to	53	Sand and gravel
53	to	57	Red shale, blue shale
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level 17.7'; pumping level _____ after _____ hours pumping at _____ g.p.
1-8-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000507



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of
LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Date 8/31/84City or Village Little Hocking State OhioWell No.: TW-2 Drillers: D. Havens Rig: SR

Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner

Section _____, Twp. _____ (____), Range _____ (____) _____ Cou

Otherwise located as 500'
-300' south of PW 3Work Began: 8/30/84 Work Completed: 8/30/84 Well Depth to Plug: 55'

All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>50</u>	<u>3</u>	<u>Sch. 40</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Slot .010

Amount	Dia.	Opening	Material
<u>5'</u>	<u>3"</u>	<u>.010</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC

Hole Record:

_____ inch from _____ to _____

_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1300#</u>	<u>#4</u>	<u>Parry Gravel</u>	<u>58'</u>	<u>30'</u>

000508

WELL LOG

Feet		Feet	Description
0	to	5	Brown clay
5	to	30	Brown sandy clay, layers of sand
30	to	55	Sand and gravel
55	to	58	Red shale and blue shale
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level 18.3'; pumping level _____ after _____ hours pumping at _____ g.p.
 1-8-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000509



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of

LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Date 8/31/84
City or Village Little Hocking State Ohio
Well No.: TW-3 Drillers: D. Havens Rig: SR
Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner
Section _____, Twp. _____ (____), Range _____ (____) Cour
Otherwise located as 300' west of existing wells. Along edge of right-away

Work Began: 8/28/84 Work Completed: 8/28/84 Well Depth to Plug: 55'

All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material	
<u>50'</u>	<u>3"</u>	<u>Sch. 40</u>	<u>PVC</u>	with <u>screw</u> joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Slot #.010

Amount	Dia.	Opening	Material	
<u>5'</u>	<u>3"</u>	<u>#010</u>	<u>PVC</u>	with _____ joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC

Hole Record:

_____ inch from _____ to _____
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1100#</u>	<u>#4</u>	<u>Parry Gravel</u>	<u>58'</u>	<u>30'</u>

000510

WELL LOG

Description

Feet

Feet

• 0

to

5

Brown clay

5

to

30

Brown sand clay, traces of gray clay 10' - 15'

30

10

55

Sand and gravel

55

14

58

Blue shale

to

10

14

1

1

1

1

1

1

•

Well Test Data: Static Level 20.1'; pumping level _____ after _____ hours pumping at _____ g.p.m.

1-B-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000511



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of
LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Date 8/31/84
City or Village Little Hocking State Ohio
Well No.: TW-4 Drillers: D. Havens Rig: SR
Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner of
Section _____, Twp. _____ (____), Range _____ (____) _____ County.
Otherwise located as 300' west of existing wells along edge of right-away
south of Well No. 3

Work Began: 8/29/84 Work Completed: 8/29/84 Well Depth to Plug: 54'
All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>54'</u>	<u>3"</u>	<u>Sch. 40</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Slot #010 PVC

Amount	Dia.	Opening	Material
<u>5'</u>	<u>3"</u>	<u>.010</u>	<u>PVC</u> with <u>screw</u> joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC

Hole Record:

_____ inch from _____ to _____
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1100#</u>	<u>#4</u>	<u>Parry Gravel</u>	<u>58</u>	<u>30</u>

000512

WELL LOG

Feet		Feet	Description
0	to	5	Brown Clay
5	to	10	Brown sandy clay
10	to	15	Brown sandy clay, traces of gray clay
15	to	30	Brown sandy clay, trace of sand
30	to	54	Sand and gravel
54	to	58	Blue shale
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level 18.6'; pumping level _____ after _____ hours pumping at _____ g.p.m.
1-8-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of

LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Sewer & Water Date 11/2/84
City or Village Little Hocking State Ohio
Well No.: TW-5 Drillers: D. Havens Rig: Rotary
Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner of
Section _____, Twp. _____ (____), Range _____ (____) County.
Otherwise located as 300' west of T.H. #3

Work Began: 10/30/84 Work Completed: 10/30/84 Well Depth to Plug: 56'
All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material	
<u>51'</u>	<u>4"</u>	<u>40</u>	<u>PVC</u>	with _____ joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Diedrich

Amount	Dia.	Opening	Material	
<u>5'</u>	<u>4"</u>	<u>.010</u>	<u>PVC</u>	with _____ joints from _____ to _____
_____	_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC plug

Hole Record:

7 7/8 inch from 0 to 50'
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1500#</u>	<u>1/8x1/4</u>	<u>Smith Concrete</u>	<u>30'</u>	<u>56'</u>

000514

WELL LOG

Feet		Feet	Washed Samples	Description
0	to	28	Brown clay, stiff	
28	to	32	Brown Sandy clay	
32	to	38	Brown sandy clay, soft	
38	to	41	Gray sand, traces of clay (more clay)	
41	to	56	Sand and gravel, fine sand	
56	to	60	Gray shale	
	to		Spoons	
32	to	34	Sand, traces of clay, brown	
37	to	38	Brown sand, traces of clay	
38	to	39	Gray sand, traces of clay	
39	to	42	Washed	
42	to	44	Sand and gravel	
42	to	47	Washed	
47	to	49	Sand and gravel	
47	to	52	Washed	
52	to	54	Sand and gravel	
54	to	56	Washed	

Well Test Data: Static Level 18.8'; pumping level _____ after _____ hours pumping at _____ g.p.m.
1-8-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000515



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of
LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job Little Hocking Sewer & Water Date 11/2/84
City or Village Little Hocking State Ohio
Well No.: TW-6 Drillers: D. Havens Rig: Rotary
Well Location: _____ ft. () and _____ ft. () of the _____ corner of
Section _____, Twp. _____ (), Range _____ () _____ County.
Otherwise located as 300' west of T.H. #4

Work Began: 10/31/84 Work Completed: 10/31/84 Well Depth to Plug: 56'

All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>51'</u>	<u>4"</u>	<u>40</u>	<u>PVC</u>
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Diedrich

Amount	Dia.	Opening	Material
<u>5'</u>	<u>4"</u>	<u>.010</u>	<u>PVC</u>
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom PVC plug

Hole Record:

7 7/8 inch from 0 to 60'
_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>1500</u>	<u>1/8x1/4</u>	<u>Smith Concrete</u>	<u>30'</u>	<u>56'</u>

000516

WELL LOG

Feet		Feet	Description
0	to	16	Brown clay, stiff
16	to	36	Brown sandy clay with traces of gray clay
36	to	42	Sand and gravel (small)
42	to	56	Sand, some small gravel (mostly sand)
56	to	60	Gray shale
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level 18' 3"; pumping level _____ after _____ hours pumping at _____ g.p.m.
1-29-85

Length of test _____ hrs. See Well Test Data Sheet Dated _____

REMARKS:

000517



WELL INFORMATION - DRIFT WELLS

The Layne Ohio Company

A Division of
LAYNE-WESTERN COMPANY, INC.

WATER SUPPLY SERVICES

WATER WELLS • LAYNE PUMPS • TEST DRILLING • WATER TREATMENT EQUIPMENT

4921 Vulcan Avenue • Columbus, Ohio 43228 • (614) 876-1195

Name of Job: Little Hocking Water & Sewer Date: 11-25-85City or Village: Little Hocking State: OhioWell No.: 9 Drillers: D. L. Havens Rig: Rotary

Well Location: _____ ft. (____) and _____ ft. (____) of the _____ corner of

Section _____, Twp. _____ (____), Range _____ (____) County.

Otherwise located as 200-300' northwest of PW 1Work Began: 11-19-85 Work Completed: 11-19-85 Well Depth to Plug: 56'

All measurements made from existing ground level at time well was drilled.

Casing Record:

Amount	Dia.	Wt. or Thickness	Material
<u>53'</u>	<u>6"</u>	<u>40</u>	<u>P.V.C.</u> with <u>glue</u> joints from <u>51'</u> to <u>11'</u>
_____	_____	_____	with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Screen Record: Type Cook

Amount	Dia.	Opening	Material
<u>5'</u>	<u>6"</u>	<u>010</u>	<u>P.V.C.</u> with _____ joints from _____ to _____
_____	_____	_____	with _____ joints from _____ to _____

Type of Seal at Bottom P.V.C. cap

Hole Record:

8½ inch from 0 to 56'

_____ inch from _____ to _____

Gravel Pack Record:

Amount	Size	Source	From	To
<u>600 lbs.</u>	<u>#4</u>	<u>Perry</u>	<u>56'</u>	<u>18'</u>

000518

WELL LOG

Feet		Feet	Description
<u>0</u>	to	<u>8</u>	<u>Hard brown clay, 5000 lbs. P.D.</u>
<u>8</u>	to	<u>18</u>	<u>Med. to hard brown sandy clay, 0-1000 P.D.</u>
<u>18</u>	to	<u>28</u>	<u>Soft sandy brown clay, 0 P.D.</u>
<u>28</u>	to	<u>38</u>	<u>Sandy silt and soft brown clay, 0 P.D.</u>
<u>38</u>	to	<u>56</u>	<u>Sand and gravel, 0 P.D.</u>
<u>56</u>	to		<u>Gray shale</u>
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		
	to		

Well Test Data: Static Level _____; pumping level _____ after _____ hours pumping at _____ g.p.m.

Length of test _____ hrs. See Well Test Data Sheet Dated _____


REMARKS:

B&N collected water samples and water static levels

P.D. = Pull Down on drill bit



Draw Down



Owner LITTLE HOCKING WATER DISTRICT Location

000522